



PHASE I ENVIRONMENTAL SITE ASSESSMENT REPORT

Safe Harbor Self-Storage

103 Cemetery Road
Angleton, Texas 77515

Report Date: June 23, 2020
Partner Project No. 20-284099.1



Prepared for:

Texas Dow Federal Credit Union

1001 FM 2004
Lake Jackson, Texas 77566

June 23, 2020

Ms. Melissa Hadley
Texas Dow Federal Credit Union
1001 FM 2004
Lake Jackson, Texas 77566

Subject: Phase I Environmental Site Assessment
Safe Harbor Self-Storage
103 Cemetery Road
Angleton, Texas 77515
Partner Project No. 20-284099.1

Dear Ms. Hadley:

Partner Engineering and Science, Inc. (Partner) is pleased to provide the results of the *Phase I Environmental Site Assessment* (Phase I ESA) report of the abovementioned address (the "subject property"). This assessment was performed in conformance with the scope and limitations as detailed in the ASTM Practice E1527-13 Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process.

This assessment included a site reconnaissance as well as research and interviews with representatives of the public, property ownership, site manager, and regulatory agencies. An assessment was made, conclusions stated, and recommendations outlined.

We appreciate the opportunity to provide environmental services to you. If you have any questions concerning this report, or if we can assist you in any other matter, please contact me at (713) 929-3547.

Sincerely,



Jeff Polasek
Relationship Manager

EXECUTIVE SUMMARY

Partner Engineering and Science, Inc. (Partner) has performed a Phase I Environmental Site Assessment (ESA) in accordance with the scope of work and limitations of ASTM Standard Practice E1527-13, the Environmental Protection Agency Standards and Practices for All Appropriate Inquiries (AAI) (40 CFR Part 312) and set forth by Texas Dow Federal Credit Union for the property located at 103 Cemetery Road in Angleton, Brazoria County, Texas (the "subject property"). The Phase I Environmental Site Assessment is designed to provide Texas Dow Federal Credit Union with an assessment concerning environmental conditions (limited to those issues identified in the report) as they exist at the subject property.

Property Description

The subject property is located on the north side of Cemetery Road and approximately 150-feet west side of South Velasco Street within a mixed residential and commercial area of Brazoria County. Please refer to the table below for further description of the subject property:

Subject Property Data

Address:	103 Cemetery Road, Angleton, Texas
Property Use:	Vacant, Commercial
Land Acreage (Ac):	0.29 Ac
Number of Buildings:	Two
Number of Floors:	One
Gross Building Area (SF):	3,595 SF (Total)
Date of Construction:	1980
Assessor's Parcel Number (APN):	253585
Type of Construction:	Concrete slab-on-grade, steel framed, corrugated metal siding, pitched corrugated metal roof
Current Tenants:	Vacant – Formerly occupied by Safe Harbor Self-Storage
Site Assessment Performed By:	Hannah Kelley of Partner
Site Assessment Conducted On:	June 19, 2020

The subject property is currently a vacant storage facility formerly occupied by Safe Harbor Self-Storage for commercial use. Due to the vacant nature of the subject property, there are no current on-site operations. Former onsite operations consist of typical storage activities and routine property maintenance. In addition to the current structures, the subject property is also improved with concrete paved parking areas and associated landscaping.

According to available historical sources, the subject property was formerly undeveloped or farmland as early as 1943; developed with a trailer structure between 1963 and circa 1965; and developed with the current structures in 1980. Tenants on the subject property include Angleton Mini Warehouse (1995-2017); and Safe Harbor Self-Storage (2019-Present).

The immediately surrounding properties consist of a single-family residence (1035 South Velasco Street) to the north; vacant land (1101 South Velasco Street) and a vacant commercial building (1111 South Velasco Street) to the south across Cemetery Road; a multi-family residential complex (105 Cemetery Road) to the east; and a vacant filling station, T&M Grocery (1039 South Velasco Street) to the west.

According to local well logs from the Texas Water Development Board, the depth to groundwater in the vicinity of the subject property is inferred to be approximately 15 to 20 feet below ground surface (bgs) and groundwater flow is inferred to be toward the general south.

Findings

A *REC* refers to the presence or likely presence of any hazardous substances or petroleum products in, on, or at a property: due to release to the environment; under conditions indicative of a release to the environment; or under conditions that pose a material threat of a future release to the environment.

- Partner did not identify any RECs during the course of this assessment.

A *CREC* refers to a REC resulting from a past release of hazardous substances or petroleum products that has been addressed to the satisfaction of the applicable regulatory authority, with hazardous substances or petroleum products allowed to remain in place subject to the implementation of required controls.

- Partner did not identify any CRECs during the course of this assessment.

A *HREC* refers to a past release of any hazardous substances or petroleum products that has occurred in connection with the property and has been addressed to the satisfaction of the applicable regulatory authority or meeting unrestricted use criteria established by a regulatory authority, without subjecting the property to any required controls.

- Partner did not identify any HRECs during the course of this assessment.

An *environmental issue* refers to environmental concerns identified by Partner, which do not qualify as RECs; however, warrant further discussion.

- Partner did not identify any environmental issues during the course of this assessment.

Conclusions, Opinions and Recommendations

Partner has performed a Phase I Environmental Site Assessment in conformance with the scope and limitations of ASTM Practice E1527-13 of 103 Cemetery Road in Angleton, Brazoria County, Texas (the "subject property"). Any exceptions to, or deletions from, this practice are described in Section 1.5 of this report.

This assessment has revealed no evidence of recognized environmental conditions or environmental issues in connection with the subject property. Based on the conclusions of this assessment, Partner recommends no further investigation of the subject property at this time.

TABLE OF CONTENTS

1.0	INTRODUCTION	1
1.1	Purpose	1
1.2	Scope of Work	1
1.3	Limitations	2
1.4	User Reliance	2
1.5	Limiting Conditions	3
2.0	SITE DESCRIPTION	4
2.1	Site Location and Legal Description	4
2.2	Current Property Use	4
2.3	Current Use of Adjacent Properties	4
2.4	Physical Setting Sources	5
2.4.1	Topography	5
2.4.2	Hydrology	5
2.4.3	Geology/Soils	5
2.4.4	Flood Zone Information	6
3.0	HISTORICAL INFORMATION	7
3.1	Aerial Photograph Review	7
3.2	Fire Insurance Maps	8
3.3	City Directories	8
3.4	Historical Topographic Maps	10
4.0	REGULATORY RECORDS REVIEW	11
4.1	Regulatory Agencies	11
4.1.1	State Department	11
4.1.2	Health Department	11
4.1.3	Fire Department	11
4.1.4	Building Department	11
4.1.5	Oil & Gas Exploration	12
4.1.6	Assessor's Office	12
4.2	Mapped Database Records Search	12
4.2.1	Regulatory Database Summary	13
4.2.2	Subject Property Listings	13
4.2.3	Adjacent Property Listings	13
4.2.4	Sites of Concern Listings	14
4.2.5	Orphan Listings	15
5.0	USER PROVIDED INFORMATION AND INTERVIEWS	16
5.1	Interviews	16
5.1.1	Interview with Owner	16
5.1.2	Interview with Report User	17
5.1.3	Interview with Key Site Manager	17
5.1.4	Interviews with Past Owners, Operators and Occupants	17
5.1.5	Interview with Others	17
5.2	User Provided Information	17
5.2.1	Title Records, Environmental Liens, and AULs	17
5.2.2	Specialized Knowledge	17

5.2.3	Actual Knowledge of the User	17
5.2.4	Valuation Reduction for Environmental Issues	17
5.2.5	Commonly Known or Reasonably Ascertainable Information	18
5.2.6	Previous Reports and Other Provided Documentation	18
6.0	SITE RECONNAISSANCE	19
6.1	General Site Characteristics.....	19
6.2	Potential Environmental Hazards.....	20
6.3	Non-ASTM Services.....	21
6.3.1	Asbestos-Containing Materials (ACMs)	21
6.3.2	Lead-Based Paint (LBP)	21
6.3.3	Radon	22
6.3.4	Lead in Drinking Water.....	22
6.3.5	Mold.....	22
6.4	Adjacent Property Reconnaissance.....	23
7.0	FINDINGS AND CONCLUSIONS.....	24
8.0	SIGNATURES OF ENVIRONMENTAL PROFESSIONALS	25
9.0	REFERENCES.....	26

Figures

Figure 1	Site Location Map
Figure 2	Site Plan
Figure 3	Topographic Map

Appendices

Appendix A	Site Photographs
Appendix B	Historical/Regulatory Documentation
Appendix C	Regulatory Database Report
Appendix D	Qualifications

1.0 INTRODUCTION

Partner Engineering and Science, Inc. (Partner) has performed a Phase I Environmental Site Assessment (ESA) in conformance with the scope and limitations of ASTM Standard Practice E1527-13 and the Environmental Protection Agency Standards and Practices for All Appropriate Inquiries (AAI) (40 CFR Part 312) for the property located at 103 Cemetery Road in Angleton, Brazoria County, Texas (the "subject property"). Any exceptions to, or deletions from, this scope of work are described in the report.

1.1 Purpose

The purpose of this ESA is to identify existing or potential Recognized Environmental Conditions (as defined by ASTM Standard E1527-13) affecting the subject property that: 1) constitute or result in a material violation or a potential material violation of any applicable environmental law; 2) impose any material constraints on the operation of the subject property or require a material change in the use thereof; 3) require clean-up, remedial action or other response with respect to Hazardous Substances or Petroleum Products on or affecting the subject property under any applicable environmental law; 4) may affect the value of the subject property; and 5) may require specific actions to be performed with regard to such conditions and circumstances. The information contained in the ESA Report will be used by Client to: 1) evaluate its legal and financial liabilities for transactions related to foreclosure, purchase, sale, loan origination, loan workout or seller financing; 2) evaluate the subject property's overall development potential, the associated market value and the impact of applicable laws that restrict financial and other types of assistance for the future development of the subject property; and/or 3) determine whether specific actions are required to be performed prior to the foreclosure, purchase, sale, loan origination, loan workout or seller financing of the subject property.

This ESA was performed to permit the *User* to satisfy one of the requirements to qualify for the innocent landowner, contiguous property owner, or bona fide prospective purchaser limitations on scope of Comprehensive Environmental Response, Compensation and Liability Act (CERCLA) (42 U.S.C. §9601) liability (hereinafter, the "*landowner liability protections*," or "*LLPs*"). ASTM Standard E1527-13 constitutes "*all appropriate inquiry* into the previous ownership and uses of the *property* consistent with good commercial or customary practice" as defined at 42 U.S.C. §9601(35)(B).

1.2 Scope of Work

The scope of work for this ESA is in accordance with the requirements of ASTM Standard E1527-13. This assessment included: 1) a property and adjacent site reconnaissance; 2) interviews with key personnel; 3) a review of historical sources; 4) a review of regulatory agency records; and 5) a review of a regulatory database report provided by a third-party vendor. Partner contacted local agencies, such as environmental health departments, fire departments and building departments in order to determine any current and/or former hazardous substances usage, storage and/or releases of hazardous substances on the subject property. Additionally, Partner researched information on the presence of activity and use limitations (AULs) at these agencies. As defined by ASTM E1527-13, AULs are the legal or physical restrictions or limitations on the use of, or access to, a site or facility: 1) to reduce or eliminate potential exposure to hazardous substances or petroleum products in the soil or groundwater on the subject property; or 2) to prevent activities that could interfere with the effectiveness of a response action, in

order to ensure maintenance of a condition of no significant risk to public health or the environment. These legal or physical restrictions, which may include institutional and/or engineering controls (IC/ECs), are intended to prevent adverse impacts to individuals or populations that may be exposed to hazardous substances and petroleum products in the soil or groundwater on the property.

If requested by Client, this report may also include the identification, discussion of, and/or limited sampling of asbestos-containing materials (ACMs), lead-based paint (LBP), mold, and/or radon.

1.3 Limitations

Partner warrants that the findings and conclusions contained herein were accomplished in accordance with the methodologies set forth in the Scope of Work. These methodologies are described as representing good commercial and customary practice for conducting an ESA of a property for the purpose of identifying recognized environmental conditions. There is a possibility that even with the proper application of these methodologies there may exist on the subject property conditions that could not be identified within the scope of the assessment or which were not reasonably identifiable from the available information. Partner believes that the information obtained from the record review and the interviews concerning the subject property is reliable. However, Partner cannot and does not warrant or guarantee that the information provided by these other sources is accurate or complete. The conclusions and findings set forth in this report are strictly limited in time and scope to the date of the evaluations. The conclusions presented in the report are based solely on the services described therein, and not on scientific tasks or procedures beyond the scope of agreed-upon services or the time and budgeting restraints imposed by the Client. No other warranties are implied or expressed.

Some of the information provided in this report is based upon personal interviews, and research of available documents, records, and maps held by the appropriate government and private agencies. This report is subject to the limitations of historical documentation, availability, and accuracy of pertinent records, and the personal recollections of those persons contacted.

This practice does not address requirements of any state or local laws or of any federal laws other than the all appropriate inquiry provisions of the LLPs. Further, this report does not intend to address all of the safety concerns, if any, associated with the subject property.

Environmental concerns, which are beyond the scope of a Phase I ESA as defined by ASTM include the following: ACMs, LBP, radon, and lead in drinking water. These issues may affect environmental risk at the subject property and may warrant discussion and/or assessment; however, are considered non-scope issues. If specifically requested by the Client, these non-scope issues are discussed in Section 6.3.

1.4 User Reliance

Texas Dow Federal Credit Union engaged Partner to perform this assessment in accordance with an agreement governing the nature, scope and purpose of the work as well as other matters critical to the engagement. All reports, both verbal and written, are for the sole use and benefit of Texas Dow Federal Credit Union. Either verbally or in writing, third parties may come into possession of this report or all or part of the information generated as a result of this work. In the absence of a written agreement with Partner granting such rights, no third parties shall have rights of recourse or recovery whatsoever under any course of action against Partner, its officers, employees, vendors, successors or assigns. Any such

unauthorized user shall be responsible to protect, indemnify and hold Partner, Client and their respective officers, employees, vendors, successors and assigns harmless from any and all claims, damages, losses, liabilities, expenses (including reasonable attorneys' fees) and costs attributable to such Use. Unauthorized use of this report shall constitute acceptance of and commitment to these responsibilities, which shall be irrevocable and shall apply regardless of the cause of action or legal theory pled or asserted. Additional legal penalties may apply.

1.5 Limiting Conditions

The findings and conclusions contain all of the limitations inherent in these methodologies that are referred to in ASTM E1527-13.

- Interviews with past or current owners, operators and occupants were not reasonably ascertainable and thus constitute a data gap. Based on information obtained from other historical sources (as discussed in Section 3.0), this data gap is not expected to alter the findings of this assessment.
- Partner requested information relative to deed restrictions and environmental liens and a title search from the Report User. This information was not provided at the time of the assessment.
- Partner submitted Freedom of Information Act (FOIA) requests to the fire, health, and building departments via the City Secretary for information pertaining to hazardous substances, underground storage tanks, releases, inspection records, etc. for the subject property and/or adjacent properties. As of this writing, these agencies have not responded to Partner's request. Based on information obtained from other historical sources, this limitation is not expected to alter the overall findings of this assessment.

2.0 SITE DESCRIPTION

2.1 Site Location and Legal Description

The subject property at 103 Cemetery Road in Angleton, Texas is located on the north side of Cemetery Road and approximately 150-feet west of South Velasco Street. According to the Brazoria County Assessor, the subject property is legally described as *F K STEVENS (A0375 I T TINSLEY) (ANGLETON) LOT 9C2 ACRES .29*, and ownership is currently vested in Teer Dennie since 2015.

Please refer to Figure 1: Site Location Map, Figure 2: Site Plan, Figure 3: Topographic Map, and Appendix A: Site Photographs for the location and site characteristics of the subject property.

2.2 Current Property Use

The subject property is currently a vacant storage facility formerly occupied by Safe Harbor Self-Storage for commercial use. Due to the vacant nature of the subject property, there are no current on-site operations. Former onsite operations consist of typical storage activities and routine property maintenance. The subject property consists of two one-story buildings located on the eastern and western sides of the property. In addition to the current structures, the subject property is also improved with concrete paved parking areas and associated landscaping.

According to available information, the subject property is located within the jurisdiction of the City of Angleton. There are no zoning ordinances within the jurisdictional limits of the Angleton; however, the subject property is listed as Real Commercial development by the Brazoria County Appraisal District and is considered a legal use in its current configuration.

The subject property was not identified in the regulatory database report of Section 4.2.

2.3 Current Use of Adjacent Properties

The subject property is located within a mixed commercial and residential area of Brazoria County. During the vicinity reconnaissance, Partner observed the following land use on properties in the immediate vicinity of the subject property:

Immediately Surrounding Properties

North: A single-family residence (1035 South Velasco Street)

South: Cemetery Road beyond which is vacant land (1101 South Velasco Street) and a vacant commercial building (1111 South Velasco Street)

East: A multi-family residential complex (105 Cemetery Road)

West: A vacant filling station, T&M Grocery (1039 South Velasco Street)

The adjacent property to the south was identified as a Leaking Petroleum Storage Tank (LPST), Underground Storage Tank (UST), Resource Conservation Recovery Act (RCRA) Non Generator / No Longer Regulated (NLR), United States (US) Aerometric Information Retrieval System (AIRS), Facility Index System (FINDS), and Industrial Hazardous Waste (IHW) site; and the adjacent property to the west was identified as a UST, Financial Assurance, Groundwater Contamination Case (GCC), Petroleum Storage Tank (PST) Stage 2, and LPST site in the regulatory database report of Section 4.2.

2.4 Physical Setting Sources

2.4.1 Topography

The United States Geological Survey (USGS) *Angleton, Texas* Quadrangle 7.5-minute series topographic map was reviewed for this ESA. According to the contour lines on the topographic map, the subject property is located at approximately 26 feet above mean sea level (MSL). The contour lines in the area of the subject property indicate the area is sloping gently toward the general south. The subject property is depicted on the 2013 map as unshaded to represent urban development and bound by a road to the south; however, no additional site-specific features are depicted.

A copy of the most recent topographic map is included as Figure 3 of this report.

2.4.2 Hydrology

According to topographic map interpretation, the direction of groundwater flow in the vicinity of the subject property is inferred to be toward the general south. The nearest surface water in the vicinity of the subject property is an unnamed surface pond located approximately 1,900-feet west of the subject property. No settling ponds, lagoons, surface impoundments, wetlands or natural catch basins were observed at the subject property during this assessment.

According to available information, a public water system operated by the Angleton Department of Public Works and Engineering serves the subject property vicinity. The sources of public water for Angleton are surface water from the Brazos River.

Information specific to the subject property regarding the depth to groundwater and direction of groundwater flow was not available for the subject area. However, according to information obtained from local well logs from the Texas Water Development Board, depth to the high water table is anticipated between 15 and 20 feet below ground surface (bgs).

2.4.3 Geology/Soils

The subject property is situated within the gulf coastal plains of the Coastal Prairies physiographic province of the State of Texas. The uppermost geologic formation underlying the soils at the subject property is the Pleistocene Age Beaumont formation. The Beaumont formation comprises the underlying stratigraphy and consists mostly of clay, silt and sand deposited in stream channel, point bar, and fluvial environments. The thickness of the Beaumont formation is estimated to be over 200 feet. The Beaumont formation is underlain by the Lissie and Willis formations, which are estimated to be a total of approximately 300 feet thick.

Based on information obtained from the USDA Natural Resources Conservation Service Web Soil Survey online database, the subject property is mapped as Bernard-Edna complex. The Bernard series consists of very deep, somewhat poorly drained, very slowly permeable soils that formed in thick clayey sediments on marine terraces of Pleistocene age. These soils are on broad Coastal Prairies. Slopes range from 0 to 1 percent. The Edna series consists of very deep, somewhat poorly drained soils that formed in loamy fluviomarine deposits derived from the Beaumont Formation of Pleistocene age. These nearly level to gently sloping soils are on ancient meander ridges. Slope ranges from 0 to 5 percent but most less than 1 percent.

2.4.4 Flood Zone Information

Partner performed a review of the Flood Insurance Rate Map, published by the Federal Emergency Management Agency. According to Community Panel Number 48039C0445H, dated June 5, 1989, the subject property appears to be located in Zone X, an area located outside of the 100-year and 500-year flood plains.

3.0 HISTORICAL INFORMATION

Partner obtained historical use information about the subject property from a variety of sources. A chronological listing of the historical data found is summarized in the table below:

Historical Use Information

Period/Date	Source	Description/Use
1943-1963	Aerial Photographs, Topographic Maps	Farmland or undeveloped land
1965-1974	Aerial Photographs	Commercial, Residential
1980-present	Aerial Photographs, Topographic Maps	Commercial; Storage

Tenants on the subject property include Angleton Mini Warehouse (1995-2017); and Safe Harbor Self-Storage (2019-Present). No potential environmental concerns were identified in association with the current or former use of the subject property.

3.1 Aerial Photograph Review

Partner obtained available aerial photographs of the subject property and surrounding area from Environmental Data Resources (EDR) on June 9, 2020. The following was observed on the subject property and adjacent properties during the aerial photograph review:

Date:	1944	Scale:	1"=500'
Subject Property:	Appears to be developed as farmland		
North:	Appears to be developed as farmland and with a residential structure		
South:	Appears to be developed as farmland across a road		
East:	Appears to be developed as farmland		
West:	Appears to be developed as farmland		

Date:	1961	Scale:	1"=500'
Subject Property:	Appears to be vacant land		
North:	Appears to be developed with a residential structure		
South:	Appears to be developed with a parking lot for a commercial warehouse across a road		
East:	No significant changes across a driveway		
West:	Appears to be developed with the existing commercial structure and filling station		

Date:	1965, 1974	Scale:	1"=500'
Subject Property:	Appears to be developed with a trailer and shed structure		
North:	No significant changes visible		
South:	Appears to be developed with a filling station and a parking lot across a road		
East:	No significant changes visible		
West:	No significant changes visible		

Date:	1983, 1987	Scale:	1"=500'
Subject Property:	Appears to be developed with the existing storage structures		
North:	No significant changes visible		
South:	Appears to be developed with a filling station and the existing commercial structure across a road		
East:	Appears to be developed with the existing multi-family complex		
West:	No significant changes visible		

Date:	1995, 2005, 2008, 2012, 2016	Scale:	1"=500'
Subject Property:	No significant changes visible		
North:	No significant changes visible		
South:	Appears to be vacant land and developed with the existing commercial structure across a road		
East:	No significant changes visible		
West:	No significant changes visible		

Copies of select aerial photographs are included in Appendix B of this report.

3.2 Fire Insurance Maps

Sanborn map coverage was not available for the subject property.

3.3 City Directories

Partner reviewed historical city directories obtained from EDR on June 12, 2020 for past names and businesses that were listed for the subject property and adjacent properties. The findings are presented in the following table:

City Directory Search for 103 Cemetery Road (Subject Property)	
Year(s)	Occupant Listed
1964,	No listings
1967,	
1970,	
1974,	
1978,	
1986,	
1992	
1995,	Angleton Mini Warehouse
2000,	
2005,	
2010,	
2014,	
2017	

According to the city directory review, the subject property has been occupied by a storage facility. Based on the city directory review, no environmentally sensitive listings were identified for the subject property address.

City Directory Search for Adjacent Properties	
Year(s)	Occupant Listed
1964,	No listings (105 Cemetery Road)

City Directory Search for Adjacent Properties

Year(s)	Occupant Listed
1967,	No listings (1035 South Velasco Street)
1970	No listings (1039 South Velasco Street) No listings (1101 South Velasco Street) No listings (1111 South Velasco Street)
1974	No listings (105 Cemetery Road) No listings (1035 South Velasco Street) No listings (1039 South Velasco Street) US Marine Corp Recruiting Station (1101 South Velasco Street) Perez Shoe Shop (1111 South Velasco Street)
1978	Quail Manor Apartments, residential listings (105 Cemetery Road) Vivian Farrer (1035 South Velasco Street) No listings (1039 South Velasco Street) Beachway Shopping Center, National Oceanic & Atmosphere Administration (1101 South Velasco Street) No listings (1111 South Velasco Street)
1986	Quail Manor Apartments, residential listings (105 Cemetery Road) Mrs. Vivian Farrer (1035 South Velasco Street) No listings (1039 South Velasco Street) Beachway Shopping Center, South Texas Transit (1101 South Velasco Street) Mallinckrodt Incorporated Clinic (1111 South Velasco Street)
1992	No listings (105 Cemetery Road) Residential listings (1035 South Velasco Street) No listings (1039 South Velasco Street) Bingo Rainbow (1101 South Velasco Street) No listings (1111 South Velasco Street)
1995	Quail Manor Apartments, residential listings (105 Cemetery Road) Cory Jackson (1035 South Velasco Street) Glass Center, T&M Grocery Texaco (1039 South Velasco Street) No listings (1101 South Velasco Street) Mallinckrodt Inc. (1111 South Velasco Street)
2000	Las Palmas Apartments, Quail Manor Apartments (105 Cemetery Road) John Taylor (1035 South Velasco Street) T & M Grocery (1039 South Velasco Street) No listings (1101 South Velasco Street) Alva Medical (1111 South Velasco Street)
2005,	Las Brisas Apartments (105 Cemetery Road)
2010	John Taylor (1035 South Velasco Street) T & M Grocery (1039 South Velasco Street) No listings (1101 South Velasco Street) Merit Medical (1111 South Velasco Street)
2014,	Las Brisas Apartments (105 Cemetery Road)
2017	John Taylor (1035 South Velasco Street) No listings (1039 South Velasco Street) No listings (1101 South Velasco Street) Merit Medical (1111 South Velasco Street)

According to the city directory review, the adjacent properties have been occupied by residential tenants, a multi-family apartment complex, a shopping center, and a filling station. Environmentally sensitive listings identified for the adjacent property addresses are further discussed in Section 4.2.3.

Copies of reviewed city directories are included in Appendix B of this report.

3.4 Historical Topographic Maps

Partner reviewed historical topographic maps obtained from EDR on June 8, 2020. The following was observed on the subject property and adjacent properties during the topographic map review:

Date: 1943	
Subject Property:	Depicted as undeveloped land
North:	Depicted developed with a residential structure
South:	Depicted as undeveloped land across a road
East:	Depicted as undeveloped land
West:	Depicted as undeveloped land
Date: 1963	
Subject Property:	No significant changes depicted
North:	Depicted developed with a residential structure and two farm structures
South:	Depicted as undeveloped land across a road
East:	No significant changes depicted
West:	Depicted developed with a structure
Date: 1974	
Subject Property:	No significant changes depicted
North:	No significant changes depicted
South:	Depicted developed with a structure across a road
East:	No significant changes depicted across a road
West:	No significant changes depicted

Copies of reviewed topographic maps are included in Appendix B of this report.

4.0 REGULATORY RECORDS REVIEW

4.1 Regulatory Agencies

4.1.1 State Department

Regulatory Agency Data

Name of Agency: Texas Commission on Environmental Quality (TCEQ)
Point of Contact: <https://www15.tceq.texas.gov>
Agency Address: 12100 Park 35 Circle, Austin, Texas
Agency Phone Number: (512) 239-1000
Date of Contact: June 2020
Method of Communication: Online, Email
Summary of Communication: No records regarding hazardous substance use, storage or releases, or the presence of USTs and AULs on the subject property were on file with the TCEQ.

4.1.2 Health Department

Regulatory Agency Data

Name of Agency: Angleton Environmental Health Department (AEHD)
Point of Contact: Frances Aguilar, City Secretary
Agency Address: 121 South Velasco Street, Angleton, Texas
Agency Phone Number: (979) 849-4634
Date of Contact: June 2020
Method of Communication: Email
Summary of Communication: As of the date of this report, Partner has not received a response from the City Secretary for inclusion in this report.

4.1.3 Fire Department

Regulatory Agency Data

Name of Agency: Angleton Fire Marshal's Office (AFMO)
Point of Contact: Frances Aguilar, City Secretary
Agency Address: 121 South Velasco Street, Angleton, Texas
Agency Phone Number: (979) 849-4634
Date of Contact: June 2020
Method of Communication: Email
Summary of Communication: As of the date of this report, Partner has not received a response from the City Secretary for inclusion in this report.

4.1.4 Building Department

Regulatory Agency Data

Name of Agency: Angleton Building Department (ABD)
Point of Contact: Frances Aguilar, City Secretary

Regulatory Agency Data

Agency Address: 121 South Velasco Street, Angleton, Texas
Agency Phone Number: (979) 849-4634
Date of Contact: June 2020
Method of Communication: Email
Summary of Communication: As of the date of this report, Partner has not received a response from the City Secretary for inclusion in this report.

4.1.5 Oil & Gas Exploration

Regulatory Agency Data

Name of Agency: Rail Road Commission of Texas (RRC)
Point of Contact: <http://www.gisp.rrc.texas.gov/GISViewer2/>
Agency Address: 1701 North Congress Avenue, Austin, Texas
Agency Phone Number: (512) 463-7158
Date of Contact: June 14, 2020
Method of Communication: Online
Summary of Communication: According to RRC, no oil or gas wells are located on or adjacent to the subject property.

4.1.6 Assessor's Office

Regulatory Agency Data

Name of Agency: Brazoria County Appraisal District (BCAD)
Point of Contact: <https://www.brazoriacad.org/>
Agency Address: 500 North Chenango Street, Angleton, Texas
Agency Phone Number: (979) 849-7792
Date of Contact: June 2020
Method of Communication: Online
Summary of Communication: According to records reviewed, the subject property is identified by Assessor Parcel Number (APN) 253585 and is currently owned by Teer Dennie since 2015. The current buildings were constructed in 1980 and total approximately 3,595 square feet on a 0.29 acre lot.

4.2 Mapped Database Records Search

Information from standard federal, state, county, and city environmental record sources was provided by Environmental Data Resources, Inc. (EDR). Data from governmental agency lists are updated and integrated into one database, which is updated as these data are released. The information contained in this report was compiled from publicly available sources and the locations of the sites are plotted utilizing a geographic information system, which geocodes the site addresses. The accuracy of the geocoded locations is approximately +/-300 feet.

Using the ASTM definition of migration, Partner considers the migration of hazardous substances or petroleum products in any form onto the subject property during the evaluation of each site listed on the radius report, which includes solid, liquid, and vapor.

4.2.1 Regulatory Database Summary

Radius Report Data				
Database	Search Radius (mile)	Subject Property	Adjacent Properties	Sites of Concern
Federal NPL or Delisted NPL Site	1.00	N	N	N
Federal CERCLIS Site	0.50	N	N	N
Federal CERCLIS-NFRAP Site	0.50	N	N	N
Federal RCRA CORRACTS Facility	1.00	N	N	N
Federal RCRA TSDF Facility	0.50	N	N	N
Federal RCRA Generators Site (LQG, SQG, CESQG)	0.25	N	Y	N
Federal IC/EC Registries	0.50	N	N	N
Federal ERNS Site	Subject Property	N	-	-
State/Tribal Equivalent NPL	1.00	N	N	N
State/Tribal Equivalent CERCLIS	1.00	N	N	N
State/Tribal Landfill/Solid Waste Disposal Site	0.50	N	N	N
State/Tribal Leaking Storage Tank Site	0.50	N	Y	N
State/Tribal Registered Storage Tank Sites (UST/AST)	0.25	N	Y	N
State/Tribal Voluntary Cleanup Sites (VCP)	0.50	N	N	N
State/Tribal Spills	0.50	N	N	N
Federal Brownfield Sites	0.50	N	N	N
State Brownfield Sites	0.50	N	N	N
EDR MGP	Varies	N	N	N
EDR US Hist Auto Station	Varies	N	N	N
EDR US Hist Cleaners	Varies	N	N	N
FINDS	Subject Property	N	Y	N
US AIRS	0.25	N	Y	N
IHW	0.25	N	Y	N

4.2.2 Subject Property Listings

The subject property is not identified in the regulatory database report.

4.2.3 Adjacent Property Listings

The adjacent property to the south is identified as a UST, LPST, RCRA NonGen / NLR, US AIRS, FINDS, and IHW site in the regulatory database report, as discussed below:

- The property, identified as Beachway Center at 1101 South Velasco Street, is located adjacent to the south of the subject property. This facility reportedly contained two USTs with unreported capacity, construction, and contents that were installed in January 1969 and were removed from the ground on May 10, 1990. According to information on file with the TCEQ, this facility reported a release (LPST ID: 106071) to the TCEQ on February 12, 1993, and a secondary release (LPST ID: 108820) on December 12, 1994 that reportedly affected soil and groundwater. According to available information, the release is presumed to have been discovered following tank removal and the collection of subsurface data. Additionally, according to the TCEQ, the responsible party

was identified as Phil Buetel and regulatory closure was granted on February 20, 2007 and June 27, 1995, respectively. Based on the regulatory closure, inferred direction of groundwater flow, and removal of the USTs and impacted soils only, these listings do not appear to represent a significant environmental concern to the subject property at this time.

- The property, identified as Mallinckrodt Medical at 1111 South Velasco Street, is located adjacent to the south of the subject property. This facility is identified as a RCRA NonGen / NLR as of July 8, 2013. Historically, this facility operated as a non-generator as early as February 15, 2001, and a Small Quantity Generator (SQG) beginning on June 12, 1987. This site was a registered Texas IHW facility from August 28, 1987 until July 8, 2013. Wastes listed as being generated include ignitable waste, corrosive waste, benzene, tetrachloroethylene, and spent halogenated solvents. According to the database, this facility has received violations for records/reporting and manifests on May 29, 1998 and have since reached compliance. The US AIRS listing is regarding air permits at the facility with no reported violations. The FINDS listing is in relation to the RCRA and AIRS listings. Based on the nature of these listings, lack of reported releases, these listings do not appear to represent a significant environmental concern at this time.

The adjacent property to the west is identified as a UST, Financial Assurance, GCC, and LPST site in the regulatory database report, as discussed below:

- The property, identified as T & M Grocery at 1039 South Velasco Street, is located adjacent to the west of the subject property. According to the database and available information from the TCEQ, this facility reportedly contains one 12,000-gallon gasoline UST, and one 12,000-gallon gasoline and diesel UST installed on February 5, 2001 and are currently in use. This site formerly contained one 4,000-gallon gasoline UST, one 4,000-gallon diesel UST, two 3,000-gallon gasoline USTs, and one 500-gallon used oil UST reportedly installed in January 1960 and were removed from the ground on February 5, 2001. This facility additionally reported a release (LPST ID: 113399) to the TCEQ on August 19, 1998 that reportedly affected groundwater and soil. Information regarding discovery and remedial activities were not available at the time of this assessment. The responsible party was identified as T & M Grocery and Akbar Momin and regulatory closure was granted on May 23, 2008. Financial Assurance listing is merely an indication that the financially responsible parties have been identified and measures have been taken to ensure that financial resources will be available for post-closure and corrective measure cases. Additionally, during the adjacent property reconnaissance, this facility appeared to be undergoing building demolition and tank removal processes; however, associated information was not available at the time of this assessment. Based on regulatory closure, inferred direction of groundwater flow, and financial assurance, these listings do not appear to represent a significant environmental concern to the subject property.

Based on the findings, vapor migration is not expected to represent a significant environmental concern at this time.

4.2.4 Sites of Concern Listings

No sites of concern are identified in the regulatory database report.

4.2.5 Orphan Listings

No orphan listings of concern are identified in the regulatory database report.

A copy of the regulatory database report is included in Appendix C of this report.

5.0 USER PROVIDED INFORMATION AND INTERVIEWS

In order to qualify for one of the *Landowner Liability Protections (LLPs)* offered by the Small Business Liability Relief and Brownfields Revitalization Act of 2001 (the *Brownfields Amendments*), the *User* must conduct the following inquiries required by 40 CFR 312.25, 312.28, 312.29, 312.30, and 312.31. The *User* should provide the following information to the *environmental professional*. Failure to provide this information could result in a determination that *all appropriate inquiries* is not complete. The *User* is asked to provide information or knowledge of the following:

- Review Title and Judicial Records for Environmental Liens and AULs
- Specialized Knowledge or Experience of the User
- Actual Knowledge of the User
- Reason for Significantly Lower Purchase Price
- Commonly Known or *Reasonably Ascertainable* information
- Degree of Obviousness
- Reason for Preparation of this Phase I ESA

Fulfillment of these user responsibilities is key to qualification for the identified defenses to CERCLA liability. Partner requested our Client to provide information to satisfy User Responsibilities as identified in Section 6 of the ASTM guidance.

Pursuant to ASTM E1527-13, Partner requested the following site information from Texas Dow Federal Credit Union (User of this report).

User Responsibilities				
Item	Provided By User	Not Provided By User	Discussed Below	Does Not Apply
AAI User Questionnaire	X		X	
Title Records, Environmental Liens, and AULs		X		
Specialized Knowledge			X	
Actual Knowledge			X	
Valuation Reduction for Environmental Issues			X	
Identification of Key Site Manager	Section 5.1.3			
Reason for Performing Phase I ESA	Section 1.1			
Prior Environmental Reports		X		
Other				X

5.1 Interviews

5.1.1 Interview with Owner

Mr. Dennie Teer, subject property owner, was not aware of any pending, threatened, or past litigation relevant to hazardous substances or petroleum products in, on, or from the subject property; any pending, threatened, or past administrative proceedings relevant to hazardous substances or petroleum

products in, on, or from the subject property; or any notices from a governmental entity regarding any possible violation of environmental laws or possible liability relating to hazardous substances or petroleum products.

According to Mr. Teer, the subject property was developed in 1980 for commercial use. Prior to that, the subject property was undeveloped. Mr. Teer further stated that there are no USTs, ASTs, clarifiers, oil/water separators, groundwater monitoring wells, or hazardous substance use/storage/generation on the subject property to the best of his knowledge.

5.1.2 Interview with Report User

Please refer to Section 5.2 below for information requested from the Report User. The information requested was not received prior to the issuance of this report. Because the Report User (Client) is a lender, it is understood that the Report User would not have knowledge of the property that would significantly impact our ability to satisfy the objectives of this assessment. The lack of this information is not considered to represent a significant data gap.

5.1.3 Interview with Key Site Manager

A key site manager was not provided to be interviewed at the time of this assessment.

5.1.4 Interviews with Past Owners, Operators and Occupants

Interviews with past owners, operators and occupants were not reasonably ascertainable and thus constitute a data gap.

5.1.5 Interview with Others

As the subject property is not an abandoned property as defined in ASTM 1527-13, interview with others were not performed.

5.2 User Provided Information

5.2.1 Title Records, Environmental Liens, and AULs

Partner was not provided with title records or environmental lien and AUL information for review as part of this assessment.

5.2.2 Specialized Knowledge

No specialized knowledge of environmental conditions associated with the subject property was provided by the User at the time of the assessment.

5.2.3 Actual Knowledge of the User

No actual knowledge of any environmental lien or AULs encumbering the subject property or in connection with the subject property was provided by the User at the time of the assessment.

5.2.4 Valuation Reduction for Environmental Issues

No knowledge of valuation reductions associated with the subject property was provided by the User at the time of the assessment.

5.2.5 Commonly Known or Reasonably Ascertainable Information

The User did not provide information that is commonly known or *reasonably ascertainable* within the local community about the subject property at the time of the assessment.

5.2.6 Previous Reports and Other Provided Documentation

No previous reports or other pertinent documentation was provided to Partner for review during the course of this assessment.

6.0 SITE RECONNAISSANCE

The weather at the time of the site visit was overcast. Refer to Section 1.5 for limitations encountered during the field reconnaissance and Sections 2.1 and 2.2 for subject property operations. The table below provides the site assessment details:

Site Assessment Data

Site Assessment Performed By: Hannah Kelley
Site Assessment Conducted On: June 19, 2020

The table below provides the subject property personnel interviewed during the field reconnaissance:

Site Visit Personnel for 103 Cemetery Road (Subject Property)

Name	Title/Role	Contact Number	Site Walk* Yes/No
Justin Paden	Key Site Manager	(281) 690-5900	No

* Accompanied Partner during the field reconnaissance activities and provided information pertaining to the current operations and maintenance of the subject property

No potential environmental concerns were identified during the onsite reconnaissance.

6.1 General Site Characteristics

6.1.1 Solid Waste Disposal

Based on the vacant nature, solid waste is not currently generated at the subject property.

6.1.2 Sewage Discharge and Disposal

Based on the vacant and former storage operations, there are no sanitary discharges at the subject property. No wastewater treatment facilities or septic systems were observed or reported on the subject property.

6.1.3 Surface Water Drainage

Storm water is removed from the subject property primarily by sheet flow action across the paved surfaces towards the public right of way. Site storm water from roofs, landscaped areas, and paved areas is directed to on-site concrete swales, which drain to the public right of way. The subject property is connected to a municipal owned and maintained sewer system.

The subject property does not appear to be a designated wetland area, based on information obtained from the United States Fish & Wildlife Service; however, a comprehensive wetlands survey would be required in order to formally determine actual wetlands on the subject property. No surface impoundments, wetlands, natural catch basins, settling ponds, or lagoons are located on the subject property. No drywells were identified on the subject property.

6.1.4 Source of Heating and Cooling

The subject property is developed with two non-climate-controlled storage structures; as such, no heating and cooling systems or domestic hot water equipment were observed on the subject property.

6.1.5 Wells and Cisterns

No aboveground evidence of wells or cisterns was observed during the site reconnaissance.

6.1.6 Wastewater

Due to the vacant nature of the subject property, domestic wastewater is not currently generated onsite.

6.1.7 Septic Systems

No septic systems were observed or reported on the subject property.

6.1.8 Additional Site Observations

No additional general site characteristics were observed during the site reconnaissance.

6.2 Potential Environmental Hazards

6.2.1 Hazardous Substances and Petroleum Products Used or Stored at the Site

No hazardous substances or petroleum products were observed on the subject property during the site reconnaissance.

6.2.2 Aboveground & Underground Hazardous Substance or Petroleum Product Storage Tanks (ASTs/USTs)

No evidence of current or former ASTs or USTs was observed during the site reconnaissance.

6.2.3 Evidence of Releases

No spills, stains or other indications that a surficial release has occurred at the subject property were observed.

6.2.4 Polychlorinated Biphenyls (PCBs)

Older transformers and other electrical equipment could contain PCBs at a level that subjects them to regulation by the U.S. EPA. PCBs in electrical equipment are controlled by United States Environmental Protection Agency regulations 40 CFR, Part 761. Under the regulations, there are three categories into which electrical equipment can be classified: 1) Less than 50 parts per million (ppm) of PCBs – “Non-PCB;” 2) 50 ppm-500 ppm – “PCB-Contaminated;” and, 3) Greater than 500 ppm – “PCB-Containing.” The manufacture, process, or distribution in commerce or use of any PCB in any manner other than in a totally enclosed manner was prohibited after July 2, 1979.

The on-site reconnaissance addressed indoor and outdoor transformers that may contain PCBs. Two pole-mounted transformers were observed on the subject property. The transformers are labeled indicating no PCB content. No staining or leakage was observed in the vicinity of the transformers. Based on the good condition of the equipment and lack of PCBs, the transformers are not expected to represent a significant environmental concern.

Additionally, no other potential PCB-containing equipment (interior transformers, oil-filled switches, hoists, lifts, dock levelers, hydraulic elevators, balers, etc.) was observed on the subject property during Partner’s reconnaissance.

6.2.5 Strong, Pungent or Noxious Odors

No strong, pungent or noxious odors were evident during the site reconnaissance.

6.2.6 Pools of Liquid

No pools of liquid were observed on the subject property during the site reconnaissance.

6.2.7 Drains, Sumps and Clarifiers

No drains, sumps, or clarifiers, other than those associated with storm water removal, were observed on the subject property during the site reconnaissance.

6.2.8 Pits, Ponds and Lagoons

No pits, ponds or lagoons were observed on the subject property.

6.2.9 Stressed Vegetation

No stressed vegetation was observed on the subject property.

6.2.10 Additional Potential Environmental Hazards

No additional environmental hazards, including landfill activities or radiological hazards, were observed.

6.3 Non-ASTM Services

6.3.1 Asbestos-Containing Materials (ACMs)

Asbestos is the name given to a number of naturally occurring, fibrous silicate minerals mined for their useful properties such as thermal insulation, chemical and thermal stability, and high tensile strength. The Occupational Safety and Health Administration (OSHA) regulation 29 CFR 1926.1101 requires certain construction materials to be presumed to contain asbestos, for purposes of this regulation. All thermal system insulation (TSI), surfacing material, and asphalt/vinyl flooring that are present in a building that have not been appropriately tested are "presumed asbestos-containing material" (PACM).

The subject property buildings were constructed in 1980. As such, an asbestos evaluation was not required by the Client's scope of services; however, please refer to the table below for observed materials that would be considered suspect ACMs in the event of a thorough survey:

6.3.2 Lead-Based Paint (LBP)

Lead is a highly toxic metal that affects virtually every system of the body. LBP is defined as any paint, varnish, stain, or other applied coating that has 1 mg/cm² (or 5,000 ug/g or 0.5% by weight) or more of lead. Congress passed the Residential Lead-Based Paint Hazard Reduction Act of 1992, also known as "Title X", to protect families from exposure to lead from paint, dust, and soil. Under Section 1017 of Title X, intact LBP on most walls and ceilings is not considered a "hazard," although the condition of the paint should be monitored and maintained to ensure that it does not become deteriorated. Further, Section 1018 of this law directed the Housing and Urban Development (HUD) and the US EPA to require the disclosure of known information on LBP and LBP hazards before the sale or lease of most housing built before 1978.

It is unlikely that LBP is present in buildings constructed after 1977. Therefore, due to the age of the subject property buildings, it is unlikely that LBP is present.

6.3.3 Radon

Radon is a colorless, odorless, naturally occurring, radioactive, inert, gaseous element formed by radioactive decay of radium (Ra) atoms. The US EPA has prepared a map to assist National, State, and local organizations to target their resources and to implement radon-resistant building codes. The map divides the country into three Radon Zones, according to the table below:

EPA Radon Zones		
EPA Zones	Average Predicted Radon Levels	Potential
Zone 1	Exceed 4.0 pCi/L	Highest
Zone 2	Between 2.0 and 4.0 pCi/L	Moderate
Zone 3	Less than 2.0 pCi/L	Low

It is important to note that the EPA has found homes with elevated levels of radon in all three zones, and the US EPA recommends site-specific testing in order to determine radon levels at a specific location. However, the map does give a valuable indication of the propensity of radon gas accumulation in structures.

Radon sampling was not conducted as part of this assessment. Review of the US EPA Map of Radon Zones places the subject property in Zone 3. Based upon the radon zone classification, radon is not considered to be a significant environmental concern.

6.3.4 Lead in Drinking Water

According to available information, a public water system operated by the Angleton Department of Public Works and Engineering serves the subject property vicinity. The sources of public water for the City of Angleton are surface water from the Brazos River. According to the Angleton and the 2019 Annual Water Quality Report, water supplied to the subject property is in compliance with all State and Federal regulations pertaining to drinking water standards, including lead and copper. Water sampling was not conducted to verify water quality.

6.3.5 Mold

Molds are microscopic organisms found virtually everywhere, indoors and outdoors. Mold will grow and multiply under the right conditions, needing only sufficient moisture (e.g. in the form of very high humidity, condensation, or water from a leaking pipe, etc.) and organic material (e.g., ceiling tile, drywall, paper, or natural fiber carpet padding).

Partner observed accessible, interior areas for the subject property buildings for significant evidence of mold growth with the exceptions detailed in Section 1.5 of this report; however, this ESA should not be used as a mold survey or inspection. Additionally, this limited assessment was not designed to assess all areas of potential mold growth that may be affected by mold growth on the subject property. Rather, it is intended to give the client an indication as to whether or not conspicuous (based on observed areas) mold growth is present at the subject property. This evaluation did not include a review of pipe chases, mechanical systems, or areas behind enclosed walls and ceilings.

No obvious indications of water damage or mold growth were observed during Partner's visual assessment.

6.4 Adjacent Property Reconnaissance

The adjacent property reconnaissance consisted of observing the adjacent properties from the subject property premises. No items of environmental concern were identified on the adjacent properties during the site assessment, including hazardous substances, petroleum products, ASTs, evidence of releases, PCBs, strong or noxious odors, pools of liquids, sumps or clarifiers, pits or lagoons, stressed vegetation, or any other potential environmental hazards.

6.4.1 Hazardous Substances and Petroleum Products Used or Stored at the Site

Partner observed hazardous substances and petroleum product storage during the adjacent site reconnaissance and is further discussed above in Section 4.2.3.

6.4.2 ASTs/USTs for Hazardous Substances or Petroleum Products

Partner observed USTs containing hazardous substances and petroleum product storage during the adjacent site reconnaissance and is further discussed above in Section 4.2.3.

7.0 FINDINGS AND CONCLUSIONS

Findings

A *REC* refers to the presence or likely presence of any hazardous substances or petroleum products in, on, or at a property: due to release to the environment; under conditions indicative of a release to the environment; or under conditions that pose a material threat of a future release to the environment.

- Partner did not identify any RECs during the course of this assessment.

A *CREC* refers to a REC resulting from a past release of hazardous substances or petroleum products that has been addressed to the satisfaction of the applicable regulatory authority, with hazardous substances or petroleum products allowed to remain in place subject to the implementation of required controls.

- Partner did not identify any CRECs during the course of this assessment.

A *HREC* refers to a past release of any hazardous substances or petroleum products that has occurred in connection with the property and has been addressed to the satisfaction of the applicable regulatory authority or meeting unrestricted use criteria established by a regulatory authority, without subjecting the property to any required controls.

- Partner did not identify any HRECs during the course of this assessment.

An *environmental issue* refers to environmental concerns identified by Partner, which do not qualify as RECs; however, warrant further discussion.

- Partner did not identify any environmental issues during the course of this assessment.

Conclusions, Opinions and Recommendations

Partner has performed a Phase I Environmental Site Assessment in conformance with the scope and limitations of ASTM Practice E1527-13 of 103 Cemetery Road in Angleton, Brazoria County, Texas (the "subject property"). Any exceptions to, or deletions from, this practice are described in Section 1.5 of this report.

This assessment has revealed no evidence of recognized environmental conditions or environmental issues in connection with the subject property. Based on the conclusions of this assessment, Partner recommends no further investigation of the subject property at this time.

8.0 SIGNATURES OF ENVIRONMENTAL PROFESSIONALS

Partner has performed a Phase I Environmental Site Assessment of the property located at 103 Cemetery Road in Angleton, Brazoria County, Texas in conformance with the scope and limitations of the protocol and the limitations stated earlier in this report. Exceptions to or deletions from this protocol are discussed earlier in this report.

By signing below, Partner declares that, to the best of our professional knowledge and belief, we meet the definition of *Environmental Professional* as defined in §312.10 of 40 CFR §312. Partner has the specific qualifications based on education, training, and experience to assess a *property* of the nature, history, and setting of the subject *property*. Partner has developed and performed the all appropriate inquiries in conformance with the standards and practices set forth in 40 CFR Part 312.

Prepared By:



Hannah Kelley
Environmental Scientist

Reviewed By:



Gordon Little
Senior Author

9.0 REFERENCES

Reference Documents

American Society for Testing and Materials, Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process, ASTM Designation: E1527-13.

Environmental Data Resources (EDR), Radius Report, June 2020

Federal Emergency Management Agency, Federal Insurance Administration, National Flood Insurance Program, Flood Insurance Map, accessed via internet, June 2020

United States Department of Agriculture, Natural Resources Conservation Service, accessed via internet, June 2020

United States Department of Agriculture, Natural Resources Conservation Service, Web Soil Survey, accessed via the internet, June 2020


United States Environmental Protection Agency, EPA Map of Radon Zones (Document EPA-402-R-93-071), accessed via the internet, June 2020

United States Geological Survey, accessed via the Internet, June 2020

United States Geological Survey Topographic Map 1995, 7.5 minute series, accessed via internet, June 2020

FIGURES

- 1 SITE LOCATION MAP**
- 2 SITE PLAN**
- 3 TOPOGRAPHIC MAP**

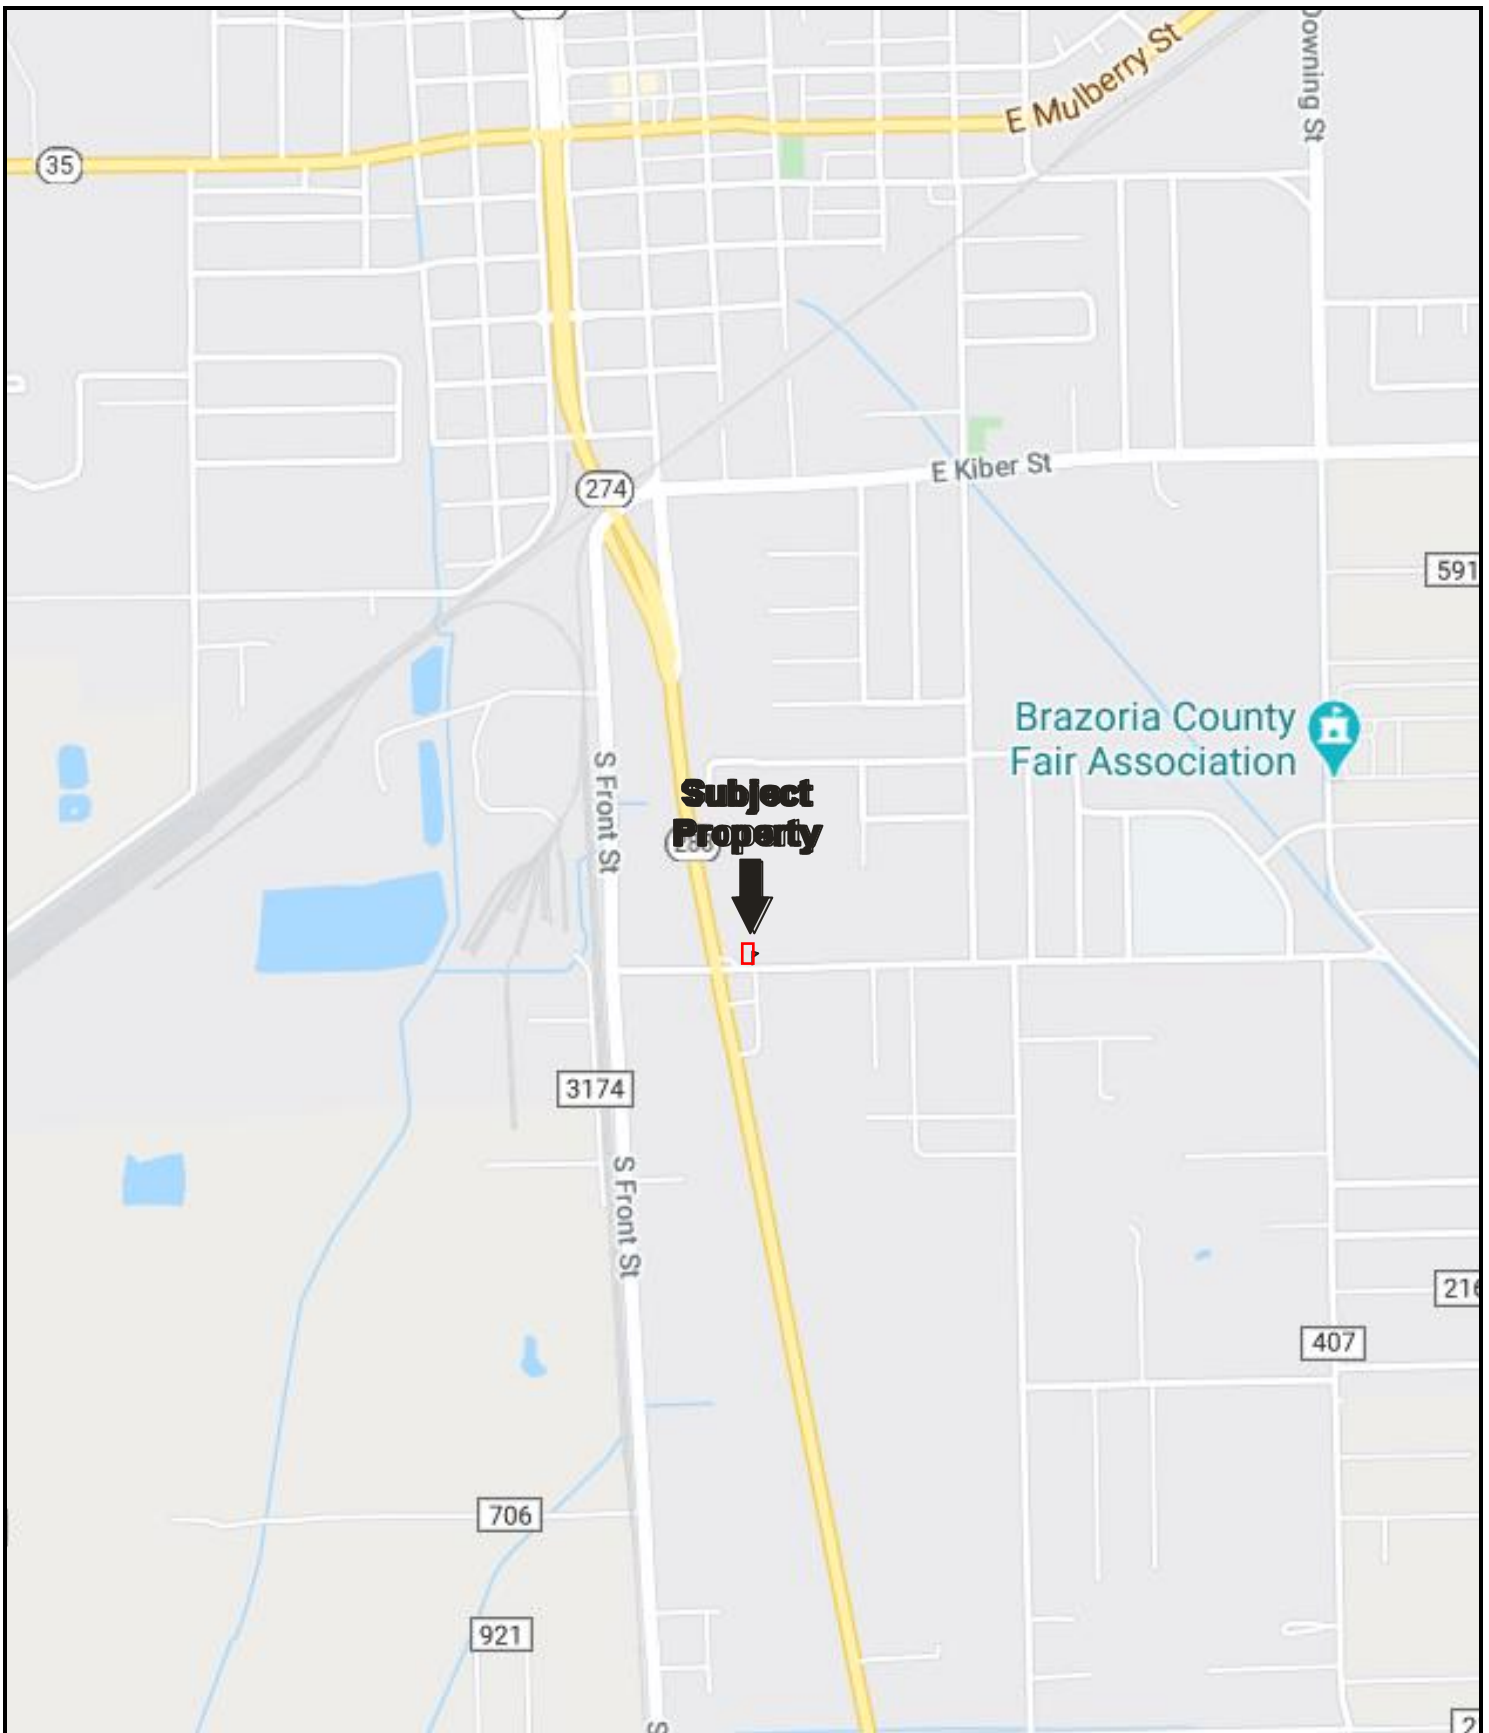

Drawing Not To Scale

KEY:
Subject Property 

FIGURE 1: SITE LOCATION MAP
Project No. 20-284099.1



**GROUNDWATER
FLOW**



KEY:
Subject Property 

FIGURE 2: SITE PLAN
Project No. 20-284099.1



USGS 7.5 Minute Angleton, Texas Quadrangle
Created: 2013

KEY:
Subject Property 

FIGURE 3: TOPOGRAPHIC MAP
Project No. 20-284099.1

PARTNER

APPENDIX A: SITE PHOTOGRAPHS



1. View of the subject property.



2. View of eastern perimeter, facing north.



3. View of northern perimeter, facing west.



4. View of western perimeter, facing south.



5. View of southern perimeter, facing east.



6. View of subject property building.



7. View of subject property building.



8. View of typical unit.



9. View of the eastern adjacent property.



10. View of northern perimeter beyond which is the northern adjacent residence.




11. View of the western adjacent property.



12. View of Cemetery Road beyond which are the southern adjacent properties.

APPENDIX B: HISTORICAL/REGULATORY DOCUMENTATION




500

1000

2000



Key: Subject Property 

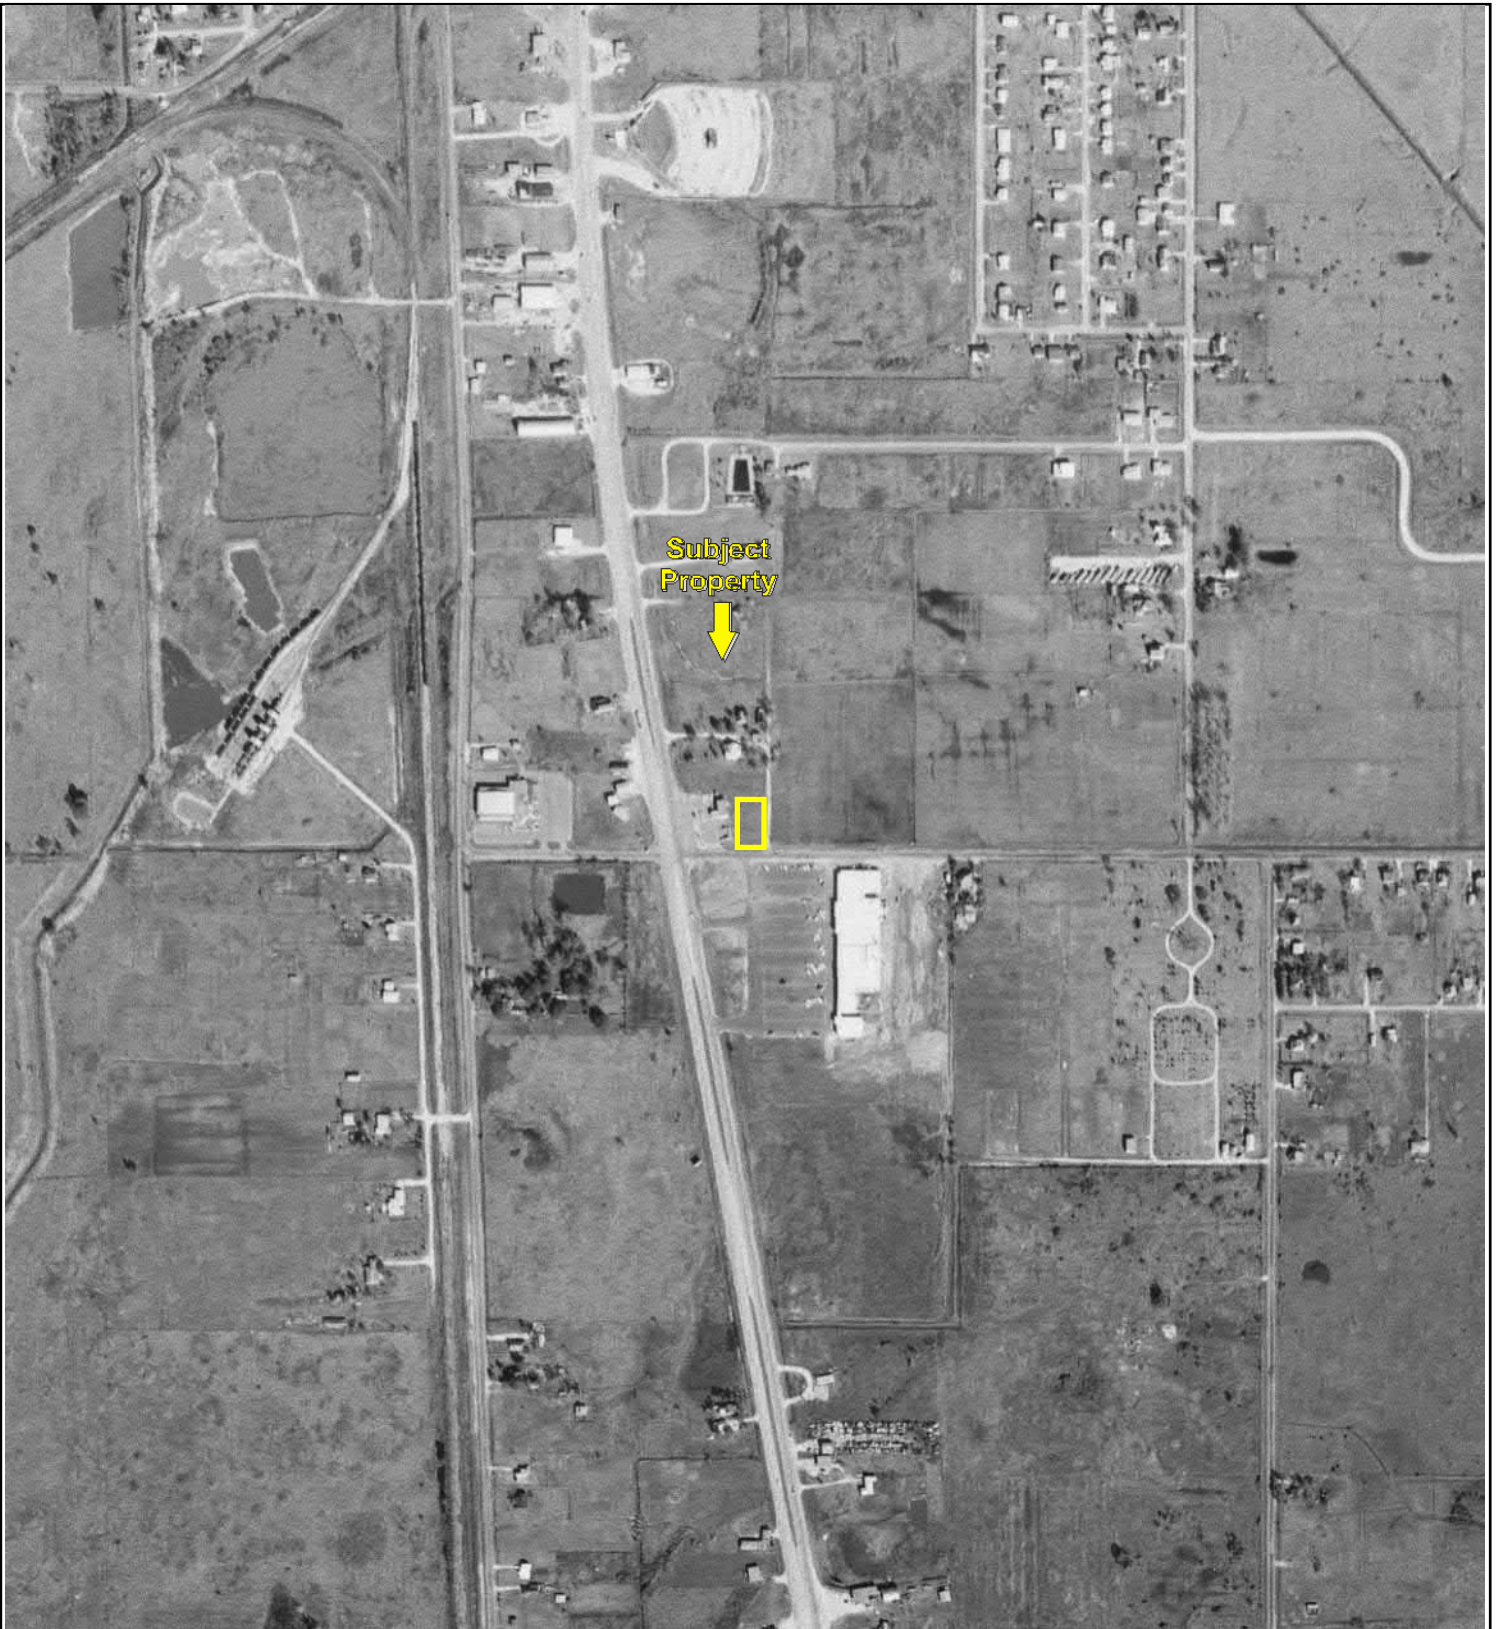

Key: Subject Property 



500

1000

2000

Key: Subject Property 




500

1000


2000



Key: Subject Property 



Key: Subject Property 




500

1000


2000




Key: Subject Property 



Key: Subject Property 



Key: Subject Property 




500

1000

2000



Key: Subject Property 



500

1000

2000



Key: Subject Property 



500

1000

2000



Key: Subject Property 



Safe Harbor Self Storage

103 Cemetery Road

ANGLETON, TX 77515

Inquiry Number: 6085945.3

June 08, 2020

Certified Sanborn® Map Report



6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

Certified Sanborn® Map Report

06/08/20

Site Name:

Safe Harbor Self Storage
103 Cemetery Road
ANGLETON, TX 77515
EDR Inquiry # 6085945.3

Client Name:

Partner Engineering and Science, Inc.
2154 Torrance Blvd, Suite 200
Torrance, CA 90501-0000
Contact: Larissa Lopez



The Sanborn Library has been searched by EDR and maps covering the target property location as provided by Partner Engineering and Science, Inc. were identified for the years listed below. The Sanborn Library is the largest, most complete collection of fire insurance maps. The collection includes maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow, and others. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by the Sanborn Library LLC, the copyright holder for the collection. Results can be authenticated by visiting www.edrnet.com/sanborn.

The Sanborn Library is continually enhanced with newly identified map archives. This report accesses all maps in the collection as of the day this report was generated.

Certified Sanborn Results:

Certification # 8A08-40AF-A8F4

PO # 20-284099.1

Project 20-284099.1

UNMAAPPED PROPERTY

This report certifies that the complete holdings of the Sanborn Library, LLC collection have been searched based on client supplied target property information, and fire insurance maps covering the target property were not found.



Sanborn® Library search results

Certification #: 8A08-40AF-A8F4

The Sanborn Library includes more than 1.2 million fire insurance maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow and others which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

- ☒ Library of Congress
- ☒ University Publications of America
- ☒ EDR Private Collection

The Sanborn Library LLC Since 1866™

Limited Permission To Make Copies

Partner Engineering and Science, Inc. (the client) is permitted to make up to FIVE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice. Copyright 2020 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Safe Harbor Self Storage

103 Cemetery Road
ANGLETON, TX 77515

Inquiry Number: 6085945.5
June 12, 2020

The EDR-City Directory Image Report



Environmental Data Resources Inc

6 Armstrong Road
Shelton, CT 06484
800.352.0050
www.edrnet.com

TABLE OF CONTENTS

SECTION

Executive Summary

Findings

City Directory Images

Thank you for your business.

Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OR DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2020 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc. or its affiliates is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

DESCRIPTION

Environmental Data Resources, Inc.'s (EDR) City Directory Report is a screening tool designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's City Directory Report includes a search of available city directory data at 5 year intervals.

RECORD SOURCES

EDR's Digital Archive combines historical directory listings from sources such as Cole Information and Dun & Bradstreet. These standard sources of property information complement and enhance each other to provide a more comprehensive report.

EDR is licensed to reproduce certain City Directory works by the copyright holders of those works. The purchaser of this EDR City Directory Report may include it in report(s) delivered to a customer. Reproduction of City Directories without permission of the publisher or licensed vendor may be a violation of copyright.

Data by

infoUSA[®]

Copyright©2008
All Rights Reserved

RESEARCH SUMMARY

The following research sources were consulted in the preparation of this report. A check mark indicates where information was identified in the source and provided in this report.

<u>Year</u>	<u>Target Street</u>	<u>Cross Street</u>	<u>Source</u>
2017	☑	☑	EDR Digital Archive
2014	☑	☑	EDR Digital Archive
2010	☑	☑	EDR Digital Archive
2005	☑	☑	EDR Digital Archive
2000	☑	☑	EDR Digital Archive
1995	☑	☑	EDR Digital Archive
1992	☑	☑	EDR Digital Archive
1986	☑	☑	Polk's City Directory
1978	☑	☑	Polk's City Directory
1974	☑	☑	Polk's City Directory
1970	☑	☑	Polk's City Directory
1967	☑	☑	Polk's City Directory
1964	☑	☑	Polk's City Directory

FINDINGS

TARGET PROPERTY STREET

103 Cemetery Road
ANGLETON, TX 77515

<u>Year</u>	<u>CD Image</u>	<u>Source</u>

CEMETARY RD

2017	pg A2	EDR Digital Archive
2014	pg A5	EDR Digital Archive
2010	pg A7	EDR Digital Archive
2005	pg A9	EDR Digital Archive
2000	pg A11	EDR Digital Archive
1995	pg A13	EDR Digital Archive
1992	pg A15	EDR Digital Archive
1986	pg A17	Polk's City Directory
1986	pg A18	Polk's City Directory
1978	pg A21	Polk's City Directory
1978	pg A22	Polk's City Directory
1974	pg A24	Polk's City Directory
1974	pg A25	Polk's City Directory
1970	pg A28	Polk's City Directory
1967	pg A31	Polk's City Directory
1964	pg A33	Polk's City Directory

FINDINGS

CROSS STREETS

<u>Year</u>	<u>CD Image</u>	<u>Source</u>

S VELASCO ST

2017	pg. A4	EDR Digital Archive
2014	pg. A6	EDR Digital Archive
2010	pg. A8	EDR Digital Archive
2005	pg. A10	EDR Digital Archive
2000	pg. A12	EDR Digital Archive
1995	pg. A14	EDR Digital Archive
1992	pg. A16	EDR Digital Archive
1986	pg. A19	Polk's City Directory
1986	pg. A20	Polk's City Directory
1978	pg. A23	Polk's City Directory
1974	pg. A26	Polk's City Directory
1974	pg. A27	Polk's City Directory
1970	pg. A29	Polk's City Directory
1970	pg. A30	Polk's City Directory
1967	pg. A32	Polk's City Directory
1964	pg. A34	Polk's City Directory
1964	pg. A35	Polk's City Directory

City Directory Images

CEMETARY RD 2017

103	ANGLETON MINI WAREHOUSE
105	ATKINSON, ERIN
	BRADSHAW, MELVIN G
	BROOKS, OLIVIA
	CANO, FRANCES D
	CORTEZ, MIKE P
	DICKINSON, BERNADETTE O
	DICKSON, CHRISTOPHER
	EDWARDS, ZELMA
	ESTAY, COY
	FILLMORE, CYNTHIA
	FLORES, EVA
	FOREMAN, AMBER M
	FURR, FLESHIA M
	GASAWAY, DEBORAH
	GONZALES, CRISTAL
	GRICE, FREDDIE
	HARRIS, VIOLET E
	LAS BRISAS APARTMENTS
	LE, NAM V
	LOERA, SIGIFREDO
	MACK, MARSHALL T
	MASON, JORDAN A
	MCKNIGHT, MARY
	MUNOZ, RICARDO
	RECTOR, SHANE
	RITTLINGER, PATRICIA P
	RODRIGUEZ, RUBEN G
	ROGERS, CEDRIC
	SANCHEZ, SHERYL
	STEPHENS, WILL
	SULIVERAS, WILFREDO O
	TOLBERT, JACK F
	WEAVER, JERRIE E
	WEAVER, PEGGY
	WILSON, SAMUEL J
324	AGNEW, GENE A
	ARNING, TRESSIE E
	BLEDSON, LILLIE H
	CHILDERS, VIRGINIA L
	CORNEJO, FERNANDO R
	CORTES-GARCIA, ERICELDA
	CORTEZ, MARIA D
	EPERLEY, LORETTA J
	FOX, NORMA L
	HAMILTON, SUSAN E
	HOLMES, STACEY M
	MACKEY, JESSICA L
	MENDEZ, GUADALUPE
	MUNOZ, JOSE A

CEMETARY RD 2017 (Cont'd)

324	NICHOLS, ROBERT L OCHOA, MICHAEL PARKER, TAWNIA M PRODOEHL, DONALD L RIVERA, JUAN TERRY, DAVID B TRIBBLE, SANDRA S VILLALOBOS, MARTHA WHITE, CRICIA M WILLIAMS, JOSEPH L
328	ANGLETON CEMETERY ASSOCIATION INC

S VELASCO ST 2017

1012	ACTION MINI STORAGE
1021	THE AMERICAN LEGION
1024	GARCIA'S WRECKER SERVICE
1025	DOLLAR GENERAL STORE
1026	GARCIA'S WRECKER SERVICE
1029	BILLY'S DONUTS
1034	BRYSON MEMORIALS
1035	TAYLOR, JOHN R
1040	ANGLETON LANES
	ANGLETON LANES AMEN BILLIARDS
1100	ELYONS MUFFLERS & BRAKES
1128	TILSON CUSTOM HOMES
1212	CHASTANG CHRYSLER DODGE JEEP RAM
	CHASTANG FORD
	RAGLAND DODGE CHRYSLER JEEP
	RAGLAND MOTOR COMPANY
1300	DIAMOND MOTORS OF ANGLETON

CEMETARY RD 2014

105	LAS BRISAS APARTMENTS
324	AGNEW, GENE A
	BAILEY, STANLEY E
	BLEDSON, LILLIE H
	BRANCH, MONIQUE A
	CORNEJO, FERNANDO R
	CORTES-GARCIA, ERICELDA
	CORTEZ, MARIA D
	FOX, NORMA
	GARCIA, DAGOBERTO
	GOMEZ, LUTIVINA
	HOLMES, STACEY M
	HORN, MICHAEL C
	KING, JAMES A
	LEWIS, GARY A
	LOPEZ, AVIS R
	MACKEY, JESSICA L
	MENDEZ, MARIA G
	MORROW, FLOYD
	NICHOLS, ROBERT L
	OCHOA, MICHAEL
	PRODOEHL, DONALD L
	ROMO, JOSE A
	SCIORTINO, SALVATORE S
	TERRY, DAVID B
	TRIBBLE, SANDRA S
	VILLALOBOS, MARTHA
	WHITE, CRICIA M
328	ANGLETON CEMETERY ASSOCIATION INC

S VELASCO ST 2014

1012	ACTION MINI STORAGE
1021	THE AMERICAN LEGION
1024	GARCIA'S WRECKER SERVICE
1028	DAVIDS DETAILING
1029	BILLYS DONUTS
1034	BRYSON MEMORIALS
1035	TAYLOR, JOHN R
1040	ANGLETON LANES
1101	CLAIRE'S PLACE
1111	MERIT MEDICAL SYSTEMS INC
1128	TILSON CUSTOM HOMES
1212	RAGLAND DODGE CHRYSLER JEEP
	RAGLAND MOTOR COMPANY
1300	DIAMOND MOTORS OF ANGLETON

CEMETARY RD 2010

105	LAS BRISAS APARTMENTS
211	OCCUPANT UNKNOWN,
324	AGNEW, GENE A
	BLEDSON, LILLIE H
	CORTEZ, ABRAHAM
	CORTEZ, ERISLDA
	CRUZ, ESTELA
	GALLARZO, CRISTINA
	GARCIA, DAGOBERTO
	HAMILTON, B
	LINDSLEY, RICHARD
	LOPEZ, AVIS R
	NICHOLS, ROBERT L
	PAYNE, CAROLYN K
	PRODOEHL, DONALD L
	REYES, TERRY
	ROBLES, NORMA E
	SALDANA, MARIA
	SEMPREVIVO, ALBERT
	SOUTHSIDE MOBILE HOME PARK
	STRATTON, JEFFREY L
	TERRY, DAVID B
	TRIBBLE, SANDRA S
	VELASQUEZ, MARIA
	WHITE, CRICIA M
	WILLIAMS, JOSEPH L
	YATES, DENNIS
328	ANGLETON CEMETERY ASSN INC

S VELASCO ST**2010**

1012	ACTION MINI STORAGE
1024	READ, PHYLLIS
1026	GARCIA'S WRECKER SVC
1028	DAVIDS DETAILING
1034	BRYSON MEMORIALS
1035	TAYLOR, JOHN R
1039	T & M GROCERY
	WESTERN UNION
1040	ANGLETON BOWL
	SPARE TIME RECREATIONS INC
1100	JUST TIRES WHEEL
	MARDI GRAS AMUSEMENT
1111	MERIT MEDICAL SYSTEMS INC
1128	TILSON CUSTOM HOMES
1212	JOE RAGLAND CHRYSLER JEEP
	RAGLAND DODGE CHRYSLER JEEP
1300	DIAMOND MOTORS
	MILLER AUTO SALES

CEMETARY RD 2005

103	ANGLETON MINI WAREHO
105	LAS BRISAS
324	ADAMS, CURTIS E
	AGNEW, GENE A
	BAILEY, STANLEY E
	BLEDSON, LILLIE H
	BONDS, S
	CHILDS, RITA J
	COLLINS, A
	DELANEY, JOHN
	EPERLEY, STEVEN J
	FORD, THERESA
	GOLDEN, CRAIG
	HARRIS, SHYVONNE
	HOLLINGSWORTH, LESLEE
	HOLMES, STACEY
	INGLE, DELMER
	LOPEZ, FRED D
	MACKEY, JESSICA L
	MATA, ARISTEO
	MCCOWN, ROBERT R
	MENDEZ, IDELFONSO
	MILLS, JAMES E
	MIRELES, KAREN
	MURO, BETTY L
	NEFF, BRIAN
	ORTIZ, DIANE
	PENA, JONATHAN P
	PIERCE, ARICK K
	PRODOEHL, DONALD L
	SALDANA, HUGO G
	SEAT, JOSEPH
	SEMPREVIVO, ALBERT
	STARK, TABITHA G
	STUBBS, DAWN S
	THOMPSON, LINDA
	TOBER, DORA
	TORRES, STEVEN D
	TRIBBLE, SANDRA F
	WILLIAMS, JOSEPH L

S VELASCO ST**2005**

1012	ACTION MINI STORAGE
1024	READ, PHYLLIS
1027	TAYLOR JOHN
1034	BRYSON MEMORIALS
1035	TAYLOR, JOHN R
1039	T & M GROCERY
1100	GRAPEVINE GIFTS
	JW ENTERPRISES
1109	MERIT MEDICAL SYSTEMS INC
1111	MERIT MEDICAL
1128	TILSON HOME CORP
1212	RAGLAND CHRYSLER CENTER
	RAGLAND MOTOR CO INC
1300	DIAMOND MOTORS

CEMETARY RD 2000

105	LAS PALMAS APARTMENTS
	QUAIL MANOR APARTMENTS
234	RAY, HENRY K
324	AGNEW, GENE
	BLEDSON, LILLIE K
	EPERLEY, BILLY J
	HYNUM, JAMES
	JOHNSON, T
	MATHENY, STEVE
	NELSON, LOURENE
	PARKER, CHERYL
	PENA, BRANDY
	PERSHEN, JOHN
	PERSHERN, JOHN
	PIERCE, ARICK K
	POSEY, KENNETH
	PRODOEHL, DONALD L
	RODRIGUEZ, D R
	SALDANA, HUGO
	SCOTT, CYNTHIA
	SHARP, K S
	SYARK, RICHARD
	THOMPSON, LINDA
	TRIBBLE, SANDRA
	WHIPPLE, CHARLES T
	WHITE, JIM H
	WILLIAMS, CHERYL L
	YEAGER, LEON
328	ANGLETON CEMETERY ASSOCIATION INCORPORATED

S VELASCO ST 2000

1022	CASTILLO, ELVIRA
1027	TEXAS STAT OFBOARD OF PARDONS & PAROLESFIELD SERVICE
1034	BRYSON MEMORIALS
1035	TAYLOR, JOHN R
1039	T & M GROCERY
1100	FIRST CHOICE AUTO SALES
	FIRST CREDIT MOTOR COMPANY
1111	ALVA MEDICAL
1128	TILSON CUSTOM HOMES
1212	RAGLAND CHRYSLER CENTER
	RAGLAND CHRYSLR CENTER CHRYSLR PLYMOUTH DDG JEEP EGL
1300	DIAMOND MOTORS

CEMETARY RD 1995

103	ANGLETON MINI WAREHOUSE
105	QUAIL MANOR APARTMENTS
324	APPLEGATE, DOUG
	BARNETT, ROBERT
	BLEDSON, L K
	BYNUM, RODNEY
	EPPERLEY, B J
	GARRETT, LARRY
	GILLESPIE, ALFRED
	HENRY, ERIC
	HUGHES, MATTHEW
	JOHNSON, DALE
	KING, WILLIAM
	LOWERY, HENRY
	MURPHY, ELLEN M
	POSEY, KENNETH
	RAY, EDWARD W
	SELBY, HOWARD S
	SOLOMON, G
	STOUT, JEFF J
	TRIBBLE, SANDRA
	WHIPPLE, KELLY
	WHITE, JIM H
328	ANGLETON CEMETERY ASSN INC

S VELASCO ST**1995**

1024	OCCUPANT UNKNOWNN
1027	OCCUPANT UNKNOWNN WORKERS COMPENSATION COMM
1028	GRAHAM SUPPLY CO
1034	BRYSON MEMORIALS OCCUPANT UNKNOWNN
1035	JACKSON, CORY
1039	GLASS CENTER T & M GROCERY TEXACO
1040	FIESTA BALLROOM
1100	FIRST CHOICE AUTO SALES
1111	MALLINCKRODT INC
1128	TILSON CUSTOM HOMES
1130	BROADWAY REAL ESTATE BROADWAY RL ESTATE BROADWAY, MIKE
1212	RAGLAND, JOE A

CEMETARY RD 1992

324 BARNETT, ROBERT
 BLEDSOE, L K
 COUEY, LLOYD S
 GONZALES, F
 PEE, JOHNNIE
 SOLOMON, G
 YATES, BILLY

S VELASCO ST**1992**

1034	BRYSON, LESLIE
1035	FRENCH, MINDY S
	MAJORS, TANYA
1101	RAINBOW, BINGO
1130	BROADWAY, MIKE

CEMETARY RD 1986

22

13

CEMETERY RD —FROM END
OF S VELASCO EAST TO
DOWNING RD 1 SOUTH OF
DWYER

ZIP CODE 77515

40a No Return

105 Quail Manor Apartments
849-9771

1a★Walker Judy 848-0320

2a Vacant

3a★Crowder Roger

4a Vacant

5a★Perry Sheilah

6a★Hung Nguyen

7a★Binh Truong

8a★Laws Andrew

9a★Williams Sandra

10 Vacant

11★Dickinson Bernadette

12 Vacant

13 Vacant

14★Wood Mike

15★Ruefenacht Pauline

16★Villareal Mary

17★Ramirez Guadalupe

18 Vacant

19 Vacant

20★Smith Vernon D

21a★Edwards Vicky

22a★Davis Walter

23★Mercado Veronica

24a Vacant

25a★Garza Renaldo

26a Vacant

27a Vacant

28a★Pettus Preston

29a Vacant

30★Austin Clara

31★Adame Arcellia

32★Anderson Roy

33★Pereda Tineo

34 Vacant

35 Vacant

36 Vacant

37★Woodard Jimmy

38★Thompson James

39 Vacant

40a★Labeth Charles

205★Graham Joseph 849-1580

208★Veit Jay

209★Alexander Debra

210★Vanda Richard

214★Scifres Larry

213★Lueong Pham

214★Tinker Marvin 849-5059

215★Manning Earl

216★Nelson Jeanetta

218★Charles Virginia 848-1620

219★Keys A Y 849-2245

221★Gear Audrey L

227★Griggs Carl W

CEMETARY RD 1986

24-Hour Wrecker Service

MAYNARD'S PAINT & BODY SHOP

J. B. MAYNARD

700 S. Velasco St. (77515)

Telephones Day 849-4081 Night 849-6665

23

CEMETERY RD—Contd

229★Smith Roy
231★Newberry Bob
233★Hollingsworth June
236★Mata Robt 848-0353
300 Angleton Volunteer Fire Dept
Station No 2
324 Southside Mobile Home Park
849-4268
1★Thomas Charles B Jr
848-1314
2★Mackey Sandra G 849-1460
3★Copeland Terry L 849-3034
4★Mc Entire Ronnie D
849-4958
5★Jensen Van L 849-9673
6 Vacant
7 Vacant
8★Oakes Bryan L 849-0506
9★Bartosh Loraine 848-1464
10 Vacant
11★Ray Edw W 849-6077
12 Artman Helen 849-8607
13 No Return
16 Broadway Jack 849-9605
17 Vacant
18 No Return
18 Colbert Bruce 848-0668
19 No Return
20 No Return
21★Sprague Ken 848-0551
22 Vacant
23★Evans Jimmy 848-0421
24 Follett Wm 849-6853
25★Gibbs Dan 849-8804
26★Rhea Jim
27 Martinez
28★Lewis Jerry L 849-2067
29★Tribble A D
30★Strong Steve D 848-1462
31★Gibbs John 849-8804
32★Henderson Keith
33★Bledsoe Lillie Mrs 849-0268
34★Gillispie Alfred 849-9487
35★Vasquez Carlos 848-1111
36 Vacant
37 Julian Terry D 849-1351
328 Angleton Cemetery Assn Inc
849-8491
702 Rowell James Jr 849-3490
SHANKS RD INTERSECTS
604 Vacant
704 Cochran Henry A © 849-5244
708★Page Becky © 848-0746
720 Rolf Enith M © 849-7690
720a★Lantrip Ronnie L 849-4800

724 Meason Mary F
802 Rives R L 849-5022
824★Warrick Curtis
928 Perry Mary Mrs © 849-7223
1000 Perry Leslie V © 849-5520
GIFFORD RD BEGINS
1003 Mc Knight Clair R ©
849-7250
1100 Circle A Convenience Store
849-4553
1102 Car Wash 849-5115
1124 Kunkel Paul © 849-7330
SOUTHSIDE DR BEGINS

1

CHENANGO ST N —FROM 200 E MULBERRY NORTH TO SWIFT

ZIP CODE 77515
MYRTLE INTERSECTS
201 Arnold Alton C lwyr 849-4346
205 State Rehabilitation
Commission 849-8521
220 Mallard Jay A lwyr 849-4394
221 City Fire Dept 849-4751
City Police Department
849-4361
MAGNOLIA INTERSECTS
223 City Municipal Court 849-2471
LOCUST INTERSECTS
LIVE OAK INTERSECTS
500 Snow Building The
713 Vacant
500 County Appraisal Dist
849-7792
Suites
200 Dept Of Agrl (Agrl
Stabilization-
Conservation) 849-7451
205 Farmers Home
Administration 849-5251
206 Psychological Service
Group 849-1000
301 Snow & Whitworth
848-0116
301 Snow & Brooks Properties
real est 849-4096
302 Jones Edward D & Co
849-2309
312 Ou S Congressman (Dist
Ofc) 849-4446
353 Letter Perfect Ofc Servs
848-0116
357 Family Physician Serv

S VELASCO ST 1986

108

N VELASCO ST—Contd

D Angleton Mortgage Brokers
Inc 849-7782

2802 No Return

2805 Tigner J H Jr © 849-5006

LARIAT LA BEGINS

TRACY ST BEGINS

SHANNON ST BEGINS

PINEWAY BEGINS

BRONCO BEND INTERSECTS

SILVER SADDLE BEGINS

LARIAT LA BEGINS

HENDERSON RD INTERSECTS

3

VELASCO ST S —FROM 100

MULBERRY SOUTH

**(DIVIDING LINE FOR EAST
AND WEST STREETS)**

ZIP CODE 77515

100 Stevens & Rice Law Office
849-9375

101 Thomas Texaco 849-9030

116 Allied First National Bk Of
Angleton 849-6404

121 City Hall 849-4364

Boyd Lawrence lwyr

Mayor 849-4361

Judge 849-4361

Secretary 849-4361

Treasurer

Clerk 849-4361

Tax Assessor & Collr

Councilmen 849-4361

Street & Sanitation Dept

849-4361

Water & Sewer Dept 849-4361

City Public Works

Department

Councilwoman

Parks Supervisor

Building Inspector

STREET CONTINUED

E ORANGE INTERSECTS

200 Baby World furn 849-8352

222 Ideal Cleaners 849-5041

230 Gold Room The 849-7679

E PEACH INTERSECTS

304 Vacant

305 Holcombe Motors 849-2980

321 Holcombe Motors Inc auto
dlrs 849-7766

324★Tankersley Don

E PLUM INTERSECTS

403 Sam's Television Service
849-4452

404 Vacant

E MURRAY INTERSECTS

500 Angie's Train Stop Restr
849-3004

501 Department Of Public Safety
849-5706

E MUNSON INTERSECTS

600 Angleton Lumber Co 849-7771

601 Climate Heating & Air
Conditioning Co 849-5726

MO PAC RR INTERSECTS

13

E KIBER INTERSECTS

700 Maynard's Paint & Body Shop
849-4081

701 Apple Chevrolet-Oldsmobile
Inc 849-2454

702 Colemans Auto Parts Inc
849-1256

705 Vacant

720 Across The Tracts Drive-In
849-6310

808 Charter Food Store gas sta
849-1620

816 Repo City Mobile Home Sales
849-3066

825 Kotis Eddie Wheels Of
Angleton Inc used autos
849-0611

840 Vacant

900 Eileen's 849-9873

901 Angleton Ford-Mercury Inc
849-2351

908 K & L Welding & Fabricating
Co 849-6290

921 State Farm Ins 849-8211

925 Water For The Futrue
849-2162

929 Cooksey's Gun Shop 849-7511

930 Clayton Mechanical Services
849-0564

1000 Brazosport Plastics Inc
849-5422

1001 Angleton Municipal Pool
849-0860

Furniture Bargain Center
849-8493

1004 Angleton Material Yard Inc
849-2400

1013 Coastal Mobile Homes
849-3448

DWYER ST BEGINS

1021 American Legion Post No
241 post home 849-9060

1026 Ward Animal Hospital
849-5754

1027 M & M Builders Inc
849-9338

Mc Donald Realty 849-9338

First General Of Gulf Coast
849-9338

1028 Graham Supply Co 849-7735

1029 Laverne's Texaco 849-1332

1034 Vacant

1035★Farrer Vivian Mrs 849-6733

1036★Smith Grover © 849-1691

1040 Angleton Bowling Center
849-5764

Information on a person or firm.

E

S VELASCO ST 1986

109

S VELASCO ST—Contd

- 1101 Beachway Shopping Center
South Texas Transit 849-2768
- 1103 Gulf Coast Legal Foundation
849-6464
- 1105 March Of Dimes (Lone Star
Div Ofc) 849-7752
- 1107 Overrun Mallinckrodt Inc
- 1111 Mallinckrodt Incorporated
clinic 848-5000
- 1114 Angleton Mobile Homes
849-2376
- 1128 Tilson Custom Homes
849-5748
- 1300★Sanchez Rickey
- 2532 Peters' Cut Rate Liquor No
5 849-5961

4

**VANCE DR —FROM CR 199
WEST****ZIP CODE 77515**

Vance Mobile Home Park

CEMETARY RD 1978

ALBERT PARTEN, Owner
CARPETING — WALLPAPER — NAPKO PAINT — RESILIENT TILES
SHEET FLOORING — LAMINATED PLASTICS — DECORATOR CONSULTANT
932 E. MULBERRY ST., ANGLETON, TEXAS TEL. 849-6372

17

W CEDAR ST—Contd

127★Rose Wm
136★Howell Robt 849-9467
N FRONT ST INTERSECTS
N HANCOCK ST INTERSECTS
201 Bible Roy M © 849-6185
259★Cannon David Lee
301 Alexander Arth © 849-5376
302 Matthews Nannie Mrs ©
849-6704
305 Thomas Juanita Mrs ©
849-6720
309 Ford Lee © 849-7465
N CANNON INTERSECTS
407 No Return
417★George Nathaniel 849-5433
421★Ramos Josephine
424 Vacant
N PARRISH INTERSECTS
515 Turner Florence Mrs ©
849-8937
519 Vacant
523★Corona Chas
W COLUMBIA INTERSECTS
608 Vacant
609 Wright Ruby Mrs ©
612★Tubbs Roland
617★Diggs Gylum 849-3563
621 Vacant
N WALKER INTERSECTS
906 Nelson John © 849-7780

3

CEMETERY RD —FROM END OF S VELASCO EAST TO DOWNING RD 1 SOUTH OF DWYER

ZIP CODE 77515

105 Quail Manor Apts 849-9771
1a★Russell Raymond 849-0646
2a Vacant
3a★Carethers Bill
4a★Mc Cullen E J
5a★Smith Leon 849-0849
6a No Return
7a★Poole M
8a★Quiller
9a★Mc Veay Ron
10★Hoelewyh J H
11 Vacant
12★Hartshorn Jackie
13 No Return
14★Besch Pearl Mrs
15★Henline Marie
16★Harris Eliz Mrs

17 No Return
18 Vacant
19★Nesmith Lucy 849-8723
21a★Gomez Gerald O
22a★Fain Charles
23★Stoltenberg Mark
23a★Salazar Rudy 849-5254
24a★Dupotey Arnold
25a★Moore Glenn 849-3849
26a★Glick James D
27a★Noel Brad
28a★Garateix Edwardo
29a★Martinez Efrain
30★Rogriguez Adalberto
31★Valenzuelas A P
32 Vacant
33 Vacant
34★Hicks James
35★King J D
36★Cacres Juan 849-3349
37★Russell Chas L
38★Bertino Michael 849-8845
39★Cobb Hazel
40a★Riley Rick L 849-0839
110 Hendricks James G 849-8241
Department Health Education
& Welfare
Social Security Administration
(Ofc) 849-8241
300 Angleton Volunteer Fire Dept
Station No 2
324★Gillespie Alfred
★Mc Gee Terry
Southside Mobile Home Park
849-8744
O★Crowell Rich
1 Broussard Harold
2 Hendricks V A
3★Wesselski F W
4 Payne Monty
5★Westbrook Joe A
6 Ray Edw 849-4296
7★Hill Sharon Mrs
8 Vacant
9★Nesmith Mitchell
10★Hollingsworth R H
11★Hynum Raymond
12★Artman Helen 849-8607
13★Cox Michl
14★Silva Benj
15★Wilcox Jim 849-7884
16★Broadway Jack
17★Els Glen
17 Vacant
18 Brown T A
19 Vacant

21
Associates
Free V.I.P. Referral Service
Angleton, Texas (77515)
REALTOR
MLS

CEMETARY RD 1978

Mina's

113 N. VELASCO ST. (77515)

DRESS SHOP



CRON

YOUR "ONE STOP" F
BOYS' SIZES AGES 3 TO 18
(SHORTS, REGULAR, LONG)

113 N. PARKING PL., LAKE JACKSON

18

CEMETERY RD—Contd

- 20★Bradford John
- 21★Wagner Jimmy
- 22★Beto K E
- 23★Parnell Wayne 849-9696
- 24 Follett Wm
- 25★Gillice Mike 849-6280
- 26 Hancock John 849-8236
- 27★Winberg G W
- 28★Everett B A
- 29★Svetlik Jerry
- 30★Sellers Larry
- 31★Weltz Brian
- 32★Howard Pat

336★Rowell James 849-3490

SHANKS RD INTERSECTS

- 604★Whitten Carnel 849-4832
- 704 Cochran Henry A © 849-5244
- 708★Ivy L A ©
- 720 Roff Enith M © 849-7690
- 724★Topping Ronald
- 824★Rangel Louis T 849-4584
- 928 Perry Ralph © 849-7223
- 1000 Perry Leslie V © 849-5520

GIFFORD RD BEGINS

- 1003 Mc Knight Clair R ©
849-7250
- 1124 Kunkel Paul E © 849-7330

1

**CHENANGO ST N —FROM 200
E MULBERRY NORTH TO
SWIFT**

ZIP CODE 77515

S VELASCO ST 1978

80

CITY HALL—Contd

Treasurer 849-4361
 Clerks 849-4361
 Tax Assessor & Collr
 Councilmen 849-4361
 Street & Sanitation Dept
 849-4361
 Water & Sewer Dept 849-4361

STREET CONTINUED**E ORANGE INTERSECTS**

200 Sears Roebuck & Co 849-5703
 222 Ideal Cleaners 849-5041
 230 Vacant

E PEACH INTERSECTS

304 Brooks Association For
 Architecture & Planning
 archts
 305 L & M Exxon Service Station
 849-7026

321 Holcombe Motors Inc auto
 dlrs 849-7766

324 Gayle James R Jr © 849-7295
E PLUM INTERSECTS

403 Sam's Television Serv
 849-4452

404 No Return

E MURRAY INTERSECTS

500 Rodney's Restaurant TI9-5291

E MUNSON INTERSECTS

600 Angleton Lumber Co 849-7771

601 Climate Heating & Air
 Conditioning Co 849-5726

MO PAC RR INTERSECTS**E KIBER INTERSECTS**

700 Maynard's Paint & Body Shop
 849-4081

701 Scott Chester Chevrolet-
 Oldsmobile Inc autos
 849-6462

702 Hi-Lo Auto Supply 849-8587

720 Wells Across The Tracks
 849-6310

808 Billups Number Three gas sta

825 Piper Vol Motor Co 849-4822

832 Angleton Ice House 849-3221

833 Vacant

840 Carol's Lounge 849-9983

920 K & L Welding Co 849-6290
 Brazoria Supply Co wldrs sup
 849-5061

921 Personality Plus beauty salon
 849-7609

925 Cooksey's Gun Shop 849-7511

1000 Brazosport Plastic 849-5422

1001 Willy's Upholstery Shop
 849-7183

1013 Continental Housing Inc
 849-9571

DWYER ST BEGINS

1019 Brief Encounters bar &
 lounge 849-9940

1020 Economy Sales plmb sup
 849-6945

1026 Patterson L Drilling water
 well dreg 849-5736

1027 Commercial Bookkeeping
 Serv 849-7781

1029 Laverne's Texaco

1030 Ward Animal Hospital
 849-5754

Ward Floyd M

1034 Help-Ur-Self Gas Sta
 849-8006

★Estes Anna Mrs

Clark Nursery & Garden
 Center nurseryman 849-5440
 Clark James R 849-5476

1035★Farrer Vivian 849-6733

1040 Angleton Bowlanes 849-5764
 Angleton Snack Bar 849-5764

1101 Beachway Shopping Center
 National Oceanic &
 Atmospheric Admn

1103 Vacant

1105 Discount Liquor Store
 849-0972

1109 Vacant (1109-1113)

1114 Eddie's Mobile Homes Broker
 849-9382

★Sorensen J R

1115 Graham Electromatics equip
 repr 849-9521

1117 Vacant

1119 Lafieta Lounge 849-7381

1300★Elizando Celes © 849-9718
 Beachway Gulf Service
 Station 849-7020

3

**VINE DR —FROM 700
 SOUTHSIDE SOUTH TO
 CEMETERY RD**

ZIP CODE 77515

1004 Gerick Louis © 849-5425

1008★Charrier Curley 849-3119

1012★Follett Dorothy L 849-7456

1016 No Return

1020 Slaughter Johnny L ©
 849-7626

1021 Berry Henry C Jr 849-4472

1024 Vacant

1025 Duncan John H Jr ©
 849-7420

1028 Johnson Herman W Jr ©
 849-5057

1029★Brod Frank

1032 Rogers Wm R © 849-7291

1033 Lewis James M 849-5808

1036 Kadera Edwin R © 849-3176

1037★Gifford Curtis L 849-3351

1040 Adkins Wm E © 849-7125

1041★Brown Melvin 849-4555

1044 Collins Robt L © 849-7151

1045 Holley Robt E © 849-8779

1048 Bonneau Donald R 849-7484

CEMETARY RD 1974**621 Vacant****623 Vacant****N WALKER INTERSECTS****706 Nelson John © 849-7780**

3**CEMETERY RD —FROM END
OF S VELASCO EAST TO
DOWNING RD 1 SOUTH OF
DWYER****ZIP CODE 77515****★ Rwell James****110 ★ Hendricks James G 849-8241**

CEMETARY RD 1974**12**

CEMETERY RD—Contd**324 Southside Mobile Home Park****849-5365****Hattaway H A © 849-5365****★ Pugh Lloyd****★ Goodman Charles B ©****849-4490****604 No Return****708 ★ David Carl****802 Rives R L © 849-5022****824 ★ Ramos Jesse 849-4447**

**(THE FOLLOWING ARE NOT
NUMBERED OCCUPANTS ARE
LISTED**

IN ALPHABETICAL ORDER)

Cochran Henry A © 849-5244**Kunkel Paul E © TI9-7330****Mc Knight Clair R ©****TI9-7250****Perry Ralph © 849-7223****Perry Leslie V © 849-5520****Rowell James R ©****Roff Enith M © TI9-7690**

1

**CHENANGO ST N —FROM 200
E MULBERRY NORTH TO
SWIFT**

ZIP CODE 77515

S VELASCO ST 1974

500 E & M Exxon Service Station
849-7026
321 Holcombe Motors Inc auto
dlrs 849-7766
324 Gayle James R Jr © 849-7295
5 E PLUM INTERSECTS
403 Barrow Woodrow W 849-5555
404 Burkhart Lillie M Mrs ©
849-6355
E MURRAY INTERSECTS
500 Rodney's Restaurant TI9-5291
& E MUNSON INTERSECTS
600 Angleton Lumber Co 849-7771
601 Climate Heating & Air
ce Conditioning Co 849-5726
MO PAC RR INTERSECTS
E KIBER INTERSECTS
700 Angleton Tire Co 849-5302
701 Scott Chester Chevrolet-
Oldsmobile Inc autos
849-6462
702 Hi-Lo Auto Parts 849-8587
720 Dairy Land Of Angleton restr
849-6310
808 Vacant
832 Garcia Fruit Market
3 833 Lehmann-Neal Insurance
Agency 849-5779
840 Roy's Cafe & Drive Inn
849-7080
843 Tinney's Auto Parts 849-5381
845 Tinney's Conoco Service
Station 849-5381
920 K & L Welding Co 849-6290
Brazoria Supply Co wldrs sup
849-5061
921 Cooksey Real Estate 849-6712
General Insurance Agency
849-6712
925 Cooksey's Gun Shop 849-7511
1000 Vacant
1001 Willie Upholstery Shop
849-7183
1013 Vacant
1019 American Legion Post No
241
1020 Economy Sales plmb sup
849-6945

S VELASCO ST 1974**58****S VELASCO ST—Contd**

- 1026 Patterson L Incorporated
water well dreg 849-5736
- 1027 Liberty Loan Corporation Of
Angleton 849-5794
- 1029 Kelley's Texaco Service Sta
No 2 849-7225
- 1030 Ward Animal Hospital
849-5754
★ Ward Floyd M
- 1036 Vacant
- 1100 Beachway Shopping Center
- 1101 U S Marine Corp Recruiting
Station 849-6261
- 1103 Gaylon's Beauty Salon
849-6671
- 1105 Three Brothers Supermarket
849-7381
- 1109 Morgan & Lindsey variety
849-7172
- 1111 Perez Shoe Shop
- 1113 Big Top Dollar variety
849-7102
- 1114 Eddie's Mobile Homes
849-8801
- 1115 Vacant
- 1117 Stanley's Card & Gift Shop
849-3271
- 1119 Jack's Restaurant 849-7195
(THE FOLLOWING ARE NOT
NUMBERED OCCUPANTS ARE
LISTED IN ALPHABETICAL
ORDER)
- Beachway Gulf Service
Station 849-7020
- Memorial Park
Municipal Swimming Pool
849-5909

3

**VINE DR —FROM 700
SOUTHSIDE SOUTH TO
CEMETERY RD**

ZIP CODE 77515

CEMETARY RD 1970

TEL. 849-7197

SERVICE

E. MULBERRY ST. - HWY. 35



S

ered
e
ified
esss
tory

12

W CEDAR ST—Contd

114 Curley Sarah V Mrs
TI9-6691

116 Harris Eliz Mrs TI9-6691

120 Ankele Willie L Mrs ©
TI9-6596

125 Vacant

127 Vacant

136 Foreman Lloyd A Jr
TI9-6746

N FRONT INTERSECTS

(NOT OPEN FROM N FRONT
TO N HANCOCK)

N HANCOCK

201 Bible Roy M © TI9-6185
Holmes Vera ©301 Alexander Arthur ©
TI9-5376302 Matthews Nannie Mrs ©
849-6704

305 Thomas Willie © TI9-6720

309 Ford Lee © TI9-7465

N CANNON INTERSECTS

407 Thomas Burell E ©
TI9-7146

417 Vacant

424 Vacant

N PARRISH INTERSECTS

503 Brown Tommy 849-6660

515 Turner Florence Mrs ©
849-8937

519 Vacant

523 Vacant

W COLUMBIA INTERSECTS

608 Toombs Daniel 849-4649

609 Wright Thos J © 849-6525

612 Branch Everett

617 Diggs Marie Mrs

621 Vacant

623 Vacant

N WALKER INTERSECTS

706 Nelson John © 849-7780

3

CEMETERY RD —FROM END
OF S VELASCO EAST TO
DOWNING RD, 1 SOUTH
OF DWYER

ZIP CODE 77515

324 Southside Trailer Park
849-5365

Hattaway H A © 849-5365

Albers Elvis 849-8868

Stuksa Eleanor Mrs ©
849-4490

604 Mills Roy © 849-8155

708 Beaird Sue © 849-7428

802 Rives R L © 849-5022

(THE FOLLOWING ARE NOT
NUMBERED OCCUPANTS
ARE LISTED

IN ALPHABETICAL ORDER)

Cochran Henry A ©
849-5244

Giles Michl © 849-8476

Hailewyn F H 849-7276

Kunkel Paul E © TI9-7330

Mc Knight Clair R ©
TI9-7250

Perry Ralph © 849-7223

Perry Leslie V © 849-5520

Rowell J R ©

Roff Enith M © TI9-7690

1

CHENANGO ST N —FROM
200 E MULBERRY NORTH
TO SWIFT

ZIP CODE 77515

115 Vacant

117 Vacant

MYRTLE INTERSECTS

201 Credit Bureau Of Greater
Angleton 849-6431US Farmers Home
Administration

O'Neil Tim real est 849-8897

205 State Rehabilitation

Commission 849-8521

221 City Fire Dept 849-7701

City Police Department
849-7701

MAGNOLIA INTERSECTS

LOCUST INTERSECTS

LIVE OAK INTERSECTS

CEDAR INTERSECTS

611 Mc Lure Sammy R

628 Ford Johnnie C Mrs ©
849-5123

ASH INTERSECTS

MILLER INTERSECTS

801 Under Constn

808 Herrin David C Rev ©
849-8897809 Jewell's Beauty Shop
849-5043

Sykes Phillip 849-5043

812 Mc Whorter Wayne 849-6186

813 Keith Charles 849-8865

815 Under Constn

816 Reaf Herman C © 849-8772

817 Clifton Thos © 849-7580

818 Downing T L 849-8420

820 Garcia Bibi © 849-8060

822 Duncan Ernest W bldg contr

828 Pruitt Luther A © 849-5534

908 Martindale D W © 849-5001

909 Newman John L © 849-5325

913 Powell Jerry L © 849-5102

916 Weber Larry © 849-5098

917 Taylor Paul G 849-7422

Taylor Refrigeration
849-7422920 Stark Bernice B Mrs ©
849-6936

921 Jacob Wm B 849-4632

924 Thomas Clarence A Rev ©
849-7230

5

WILKINS INTERSECTS

1006 Cox Donald E © TI9-6577

1007 Leatherwood Gerald P Rev
TI9-6703

S VELASCO ST 1970**55****S VELASCO ST—Contd**

Gaylon's Beauty Salon

TI9-6671

Kelley's Texaco Serv

Station 849-7225

Morgan & Lindsey Inc

variety store TI9-7172

Three Brothers

Supermarket 849-7381

STREET CONTINUED

Brazoria Supply Co wldrs

supplies TI9-5061

Cooksey's Gun Shop

849-7511

Economy Sales plumb sups

TI9-6945

K & L Welding Co

849-6290

Memorial Park

Municipal Swimming Pool

TI9-5909

Patterson L Inc water well

dreg TI9-5736

Pinney's Conoco Service

Station 849-5381

Smith E Jessie Mrs ©

849-5440

Tinney's Auto Parts

TI9-5381

Ward Animal Hospital

TI9-5754

Ward Floyd M

3**VINE DR —FROM 700
SOUTHSIDE SOUTH TO
CEMETERY RD****ZIP CODE 77515**

1004 Gerick Louis © 849-5425

1008 Johnson Fred 849-5628

CEMETARY RD 1967

823 VACANT
---N WALKER INTERSECTS
704 UNDER CONSTN

3
CEMETERY RD -FROM END OF
S VELASCO EAST TO
DOWNING RD. 1 SOUTH OF
DWYER

---ZIP CODE 77515

924 VACANT

928 PERRY'S PLUMBING
CONTRS TI9-7223

PERRY RALPH •
TI9-7223

940 PERRY LESLIE V •
TI9-5520

COCHRAN HENRY A •
TI9-5244

GILES MICHAEL

KUNKEL PAUL E • TI9-7330

LEE M J

MAYFIELD EPWIN A •
TI9-7164

MC KNIGHT CLAIR R •
TI9-7250

PHILLIPS BERT G JR •
TI9-8885

PHILLIPS CHARLIE F •
TI9-6547

PHILLIPS GEO • TI9-6547

RIVES LEONA H MRS •

TI9-5022

ROFF ENITH M • TI9-7690

SOUTH SIDE ELEMENTARY

SCHOOL • TI9-5245

WELCH NOEL E • TI9-7123

1
CHENANGO ST N -FROM 200 E
MULBERRY NORTH TO SWIFT

S VELASCO ST 1967

59

VELASCO ST S-CONTD

321 FOSTER-HOLCOMBE CO
AUTO DLRS TI9-7578

324 GAYLE JAMES R JR •
TI9-7295

---E PLUM INTERSECTS

403 BARROW WOODROW W
TI9-5555
GULF CITIES LIFE
INSURANCE CO
TI9-5555

404 BURKHART LILLIE M MRS

437 PHELPS MITCHELL

---E MURRAY INTERSECTS

501 RODNEY'S RESTAURANT
TI9-5291

537 ANGLETON FOOD LOCKERS
TI9-7525

---E MUNSON INTERSECTS

600 ANGLETON LUMBER CO
TI9-7771

601 CLIMATE ENGINEERING
CO AIR CONDNG & HTG
TI9-5726

---MO PAC RD INTERSECTS

---E KIBER INTERSECTS

700 ANGLETON TIRE CO
TI9-5302

720 DAIRY LAND OF
ANGLETON RESTR
TI9-6310

808 HANCOCK SERVICE
STATION NO 757
TI9-7060

832 GARCIA FRUIT MARKET

833 LEHMANN NEAL
INSURANCE AGENCY
TI9-5779

840 ROY'S CAFE & DRIVE
INN TI9-7080

921 COOKSEY PEAL ESTATE
TI9-6712
GENERAL INSURANCE
AGENCY TI9-6712

1000 COASTAL MOTOR CO INC
AUTOS TI9-5757

1001 HADELER'S WILLIE
UPHOLSTERY SHOP
TI9-7183

---(THE FOLLOWING ARE NOT
NUMBERED

---OCCUPANTS ARE LISTED
IN ALPHABETICAL

---ORDER 00

ALL-FAB CO PIPE
FABRICATING TI9-6612

AMERICAN LEGION POST NO
241

ANGLETON AUTO SALES
TI9-7622

ANGLETON BOWLING LANES
TI9-5764

BAR-B-Q PALACE TI9-7622

BEACHWAY SHOPPING CENTER

BEACHWAY BARBER SHOP

BEACHWAY GULF SERVICE
STATION

GAYLON'S BEAUTY SALON
TI9-6671

LIBERTY LOANS TI9-5794

MONTGOMERY WARD & CO
DEPT STORE TI9-8221

MORGAN & LINDSEY INC
VARIETY STORE TI9-7172

SHADDOCK'S RAINBOW SUPER
MARKET TI9-7381

---STREET CONTINUED

BRAZOLPIA SUPPLY CO WLDRS
SUPPLIES TI9-5061

COOKSEY'S GUN SHOP
TI9-5415

ECONOMY SALES PLUMB SUPS
TI9-6945

JUNGLE LOUNGE TI9-7098

VACANT

LOWE JODIE • TI9-7622

MEMORIAL PARK

MUNICIPAL SWIMMING POOL
TI9-5909

PATTERSON L INC WATER
WELL DREG TI9-5736

PERRY'S OUTBOARD SALES &
SERVICE TI9-7332

PERRY'S TEXACO STATION
TI9-7332

SMITH'S STOP & SHOP
STORE GENL MDSE

SMITH WYLIE H • TI9-5440

SWOPE LESLIE R

TINNEY'S AUTO PARTS
TI9-5381

WARD ANIMAL HOSPITAL
TI9-5754

3

VINE DR -FROM 700
SOUTHSIDE SOUTH TO
CEMETERY RD

---ZIP CODE 77515

1004 GERICK LOUIS •

1008 PEACOCK CHARLES E
TI9-6129

1012 SMITH JOHN W •
TI9-6057

1016 DAVIS LEONARD C •
TI9-8348

1020 SLAUGHTER JOHNNY L •
TI9-7626

1021 MATTHEWS A B
TI9-8255

1024 MALATEK KENNETH A •
TI9-6882

1025 DUCAN JOHN H JR •
TI9-7420

1028 ATKINS H C •

1029 SMITH GENE E •
TI9-7965

1032 ROGERS WM R •
TI9-7291

1033 LEWIS J M

1036 HURT JAMES T •

1037 DURRITT JAMES T •
TI9-7955

1040 AOKINS WM E •
TI9-7125

1041 CHESSER W G TI9-8456

CEMETARY RD 1964

617 Wright Rogers ©
 621 McKinney Pete
 623 Vacant
 N Walker intersects

3

**CEMETERY ROAD — From end of
 S Velasco east to Downing rd, 1
 south of Dwyer**

924 Oglesby J R © TI9-5084
 928 Perry's Plmb contrs TI9-7223
 Perry Ralph © TI9-7223
 940 Perry Leslie V © TI9-5520
 (The following are not numbered,
 occupants are listed in alphabeti-
 cal order)

Cochran Henry A © TI9-5244
 Kunkel Paul E © TI9-7330
 Mayfield Erwin A © TI9-7164
 McKnight Clair R © TI9-7250
 Phillips Bert G jr © TI9-8085
 Phillips Charlie F © TI9-6547
 Rives Leona H Mrs ©

TI9-5022

Roff Enith M © TI9-7690
 Southside Elem Sch TI9-5245
 Welch Noel E © TI9-7123

1

**CHENANGO N — From 200 E Mul-
 berry north to Swift**

115 Henry M Doyle
 117 Anderson Don

COMPANY

S VELASCO ST 1964

Barrow Woodrow TI9-5555
 Gulf Cities Life Ins Co
 TI9-5555

404 Burkhart lillie M Mrs ©
 TI9-6355

437 Phelps Mitchell
 Murray intersects

501 Rodney's Restr TI9-5291
 537 Angleton Food Lockers
 TI9-7525

Munson intersects, s side
 600 Angleton Lbr Co TI9-7771
 601 Climate Eng Co air condtnng
 & htg TI9-5726

MoPacRR intersects

Kiber intersects

700 Angleton Tire Co TI9-5302
 720 Dairy Land of Angleton restr
 TI9-6310

808 Hancock Serv Sta No 757
 TI9-7060

rear Essterling Billy
 832 Farmer's Mkt Jr fruit stand
 833 Lehmann-Neal Ins Agcy
 TI9-5779

840 Roy's Cafe & Drive Inn
 TI9-7080

921 General Ins Agcy TI9-6712
 Cooksey Real Est TI9-6712
 1000 Coastal Mtr Co Inc autos
 TI9-5757

1001 Hadelers Willie Upholstery
 Shop TI9-7183

(The following are not numbered,
 occupants are listed in alphabet-
 ical order)

All-Fab Co pipe fabricators
 TI9-6612

Am Legion Post No 241
 Angleton Auto Sls TI9-7622
 Angleton Bowling Lanes
 TI9-5764

Bar-B-Q Palace restr
 TI9-7622

Beachway Shopping Center
 Beachway Barber Shop
 Beachway Cowboy Corral
 western wear TI9-5321

Fregia H E Drug TI9-6487
 Garrett's Pharmacies Inc
 TI9-6487

Gaylon's Beauty Salon
 TI9-6671

Henderson's Restr TI9-7014
 Montgomery Ward & Co dept
 store TI9-8221

Morgan & Lindsey Inc varie-
 ty store TI9-7172

Shaddock's Rainbow Super
 Mkt TI9-7381

S VELASCO ST 1964**35****VELASCO S—Contd****Beachway Shopping Center—Contd**

Time Plan Finance Co

TI9-5794

White's Auto Stores

TI9-8441

Street continued

Brazoria Sup Co wldrs sup

TI9-5061

No return

Cooksey's Gun Shop

TI9-5415

Economy Sls whol plmb
sup TI9-6945

Jungle Lounge TI9-7098

K & L Welding Co TI9-6290

Lowe Jodie © TI9-7622

Memorial Park

Municipal Swimming Pool

TI9-5909

Patterson L Inc water well
drilling TI9-5736Perry's Outboard Sls & Serv
mtrs TI9-7332

Perry's Texaco Sta TI9-7332

Smith Wiley H © TI9-5440

Smith Stop & Shop Store
genl mdse

Swope Leslie R

Tinney's Auto Parts

TI9-5381

Ward Animal Hosp TI9-5754

3**VINE DRIVE — From 700 South-
side south to Cemetery rd**


1004 Gerrick Louis J ©

1008 Peacock Chas E TI9-6129


1012 Smith John W © TI9-6057

S VELASCO ST 1970


324 Gayle James R Jr ©
TI9-7295
E PLUM INTERSECTS
403 Barrow Woodrow W
TI9-5555
404 Burkhart Lillie M Mrs ©
849-6355
E MURRAY INTERSECTS
501 Rodney's Restaurant
TI9-5291
537 Vacant
E MUNSON INTERSECTS
600 Angleton Lumber Co
TI9-7771
601 Climate Heating & Air
Conditioning Co 849-5726
MO PAC RR INTERSECTS
E KIBER INTERSECTS
700 Angleton Tire Co 849-5302
701 Chester Scott Chevrolet-
Oldsmobile Inc autos
849-6461
702 Hi-Lo Auto Parts 849-8587
720 Dairy Land Of Angleton
restr TI9-6310
808 Hancock Service Station
849-7060
Slaughter Lavalie
832 Garcia Fruit Market
833 Lehmann-Neal Insurance
Agency 849-5779
840 Roy's Cafe & Drive Inn
TI9-7080
921 Cooksey Real Estate
TI9-6712
General Insurance Agency
TI9-6712
1000 Brazosport Plastics Inc
849-5422
1001 Willie Upholstery Shop
849-7183
1013 Angleton Mobile Homes
Sales 849-4373
1114 Royal Homes Inc trailers
849-8801
Carlin Robt Jr
(THE FOLLOWING ARE NOT
NUMBERED
OCCUPANTS ARE LISTED IN
ALPHABETICAL
ORDER- 00
Post No 241 (Am Legion)
Angleton Bowling Lanes
TI9-5764
Angleton Snack Bar
849-7622
Beachway Shopping Center
Beachway Gulf Service
Station 849-7020
Bradshaw's Discount
Garden Center 849-8901
Ezelle Auto Service
849-6689

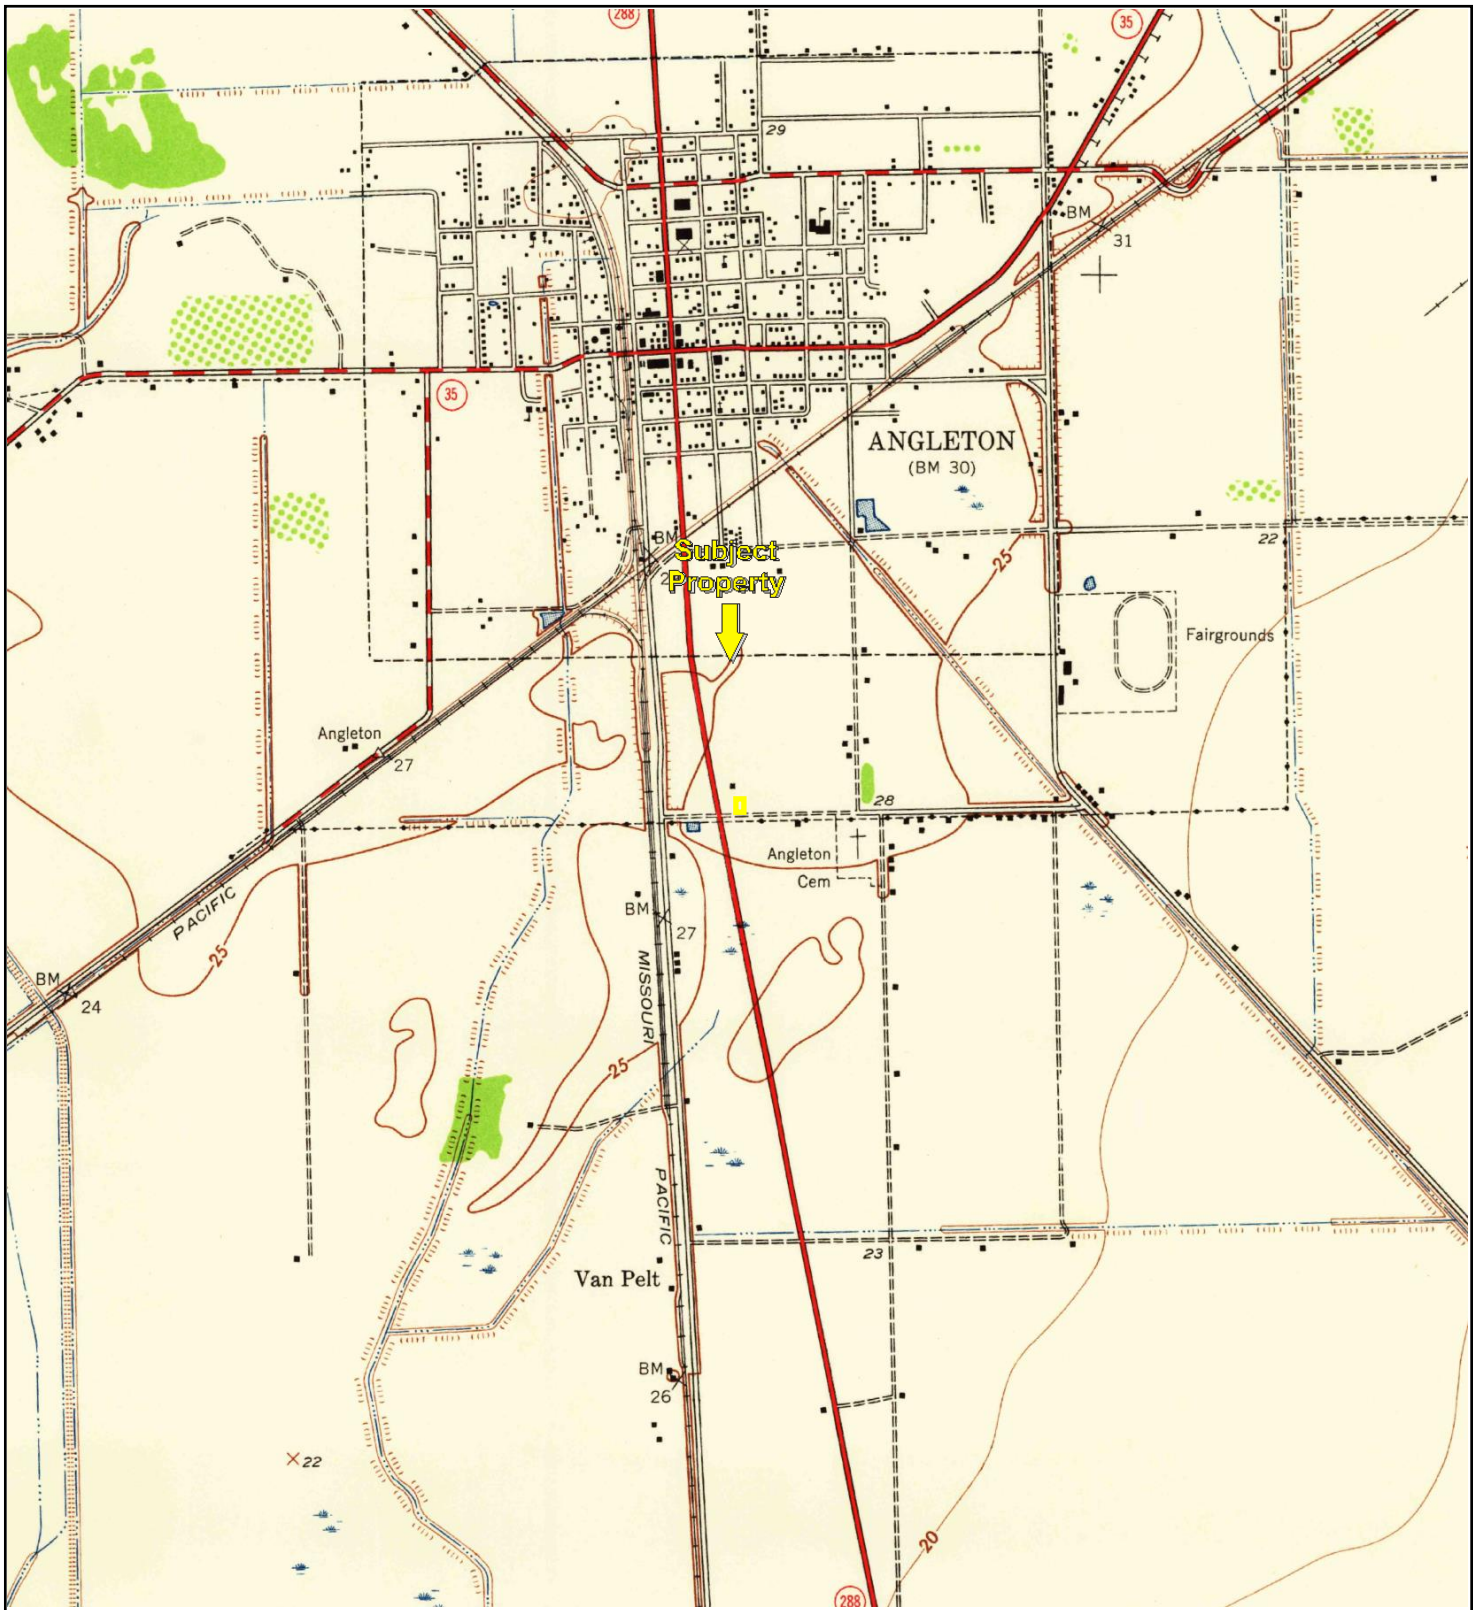


TP, Angleton, 1943, 7.5-minute




Key: Subject Property 

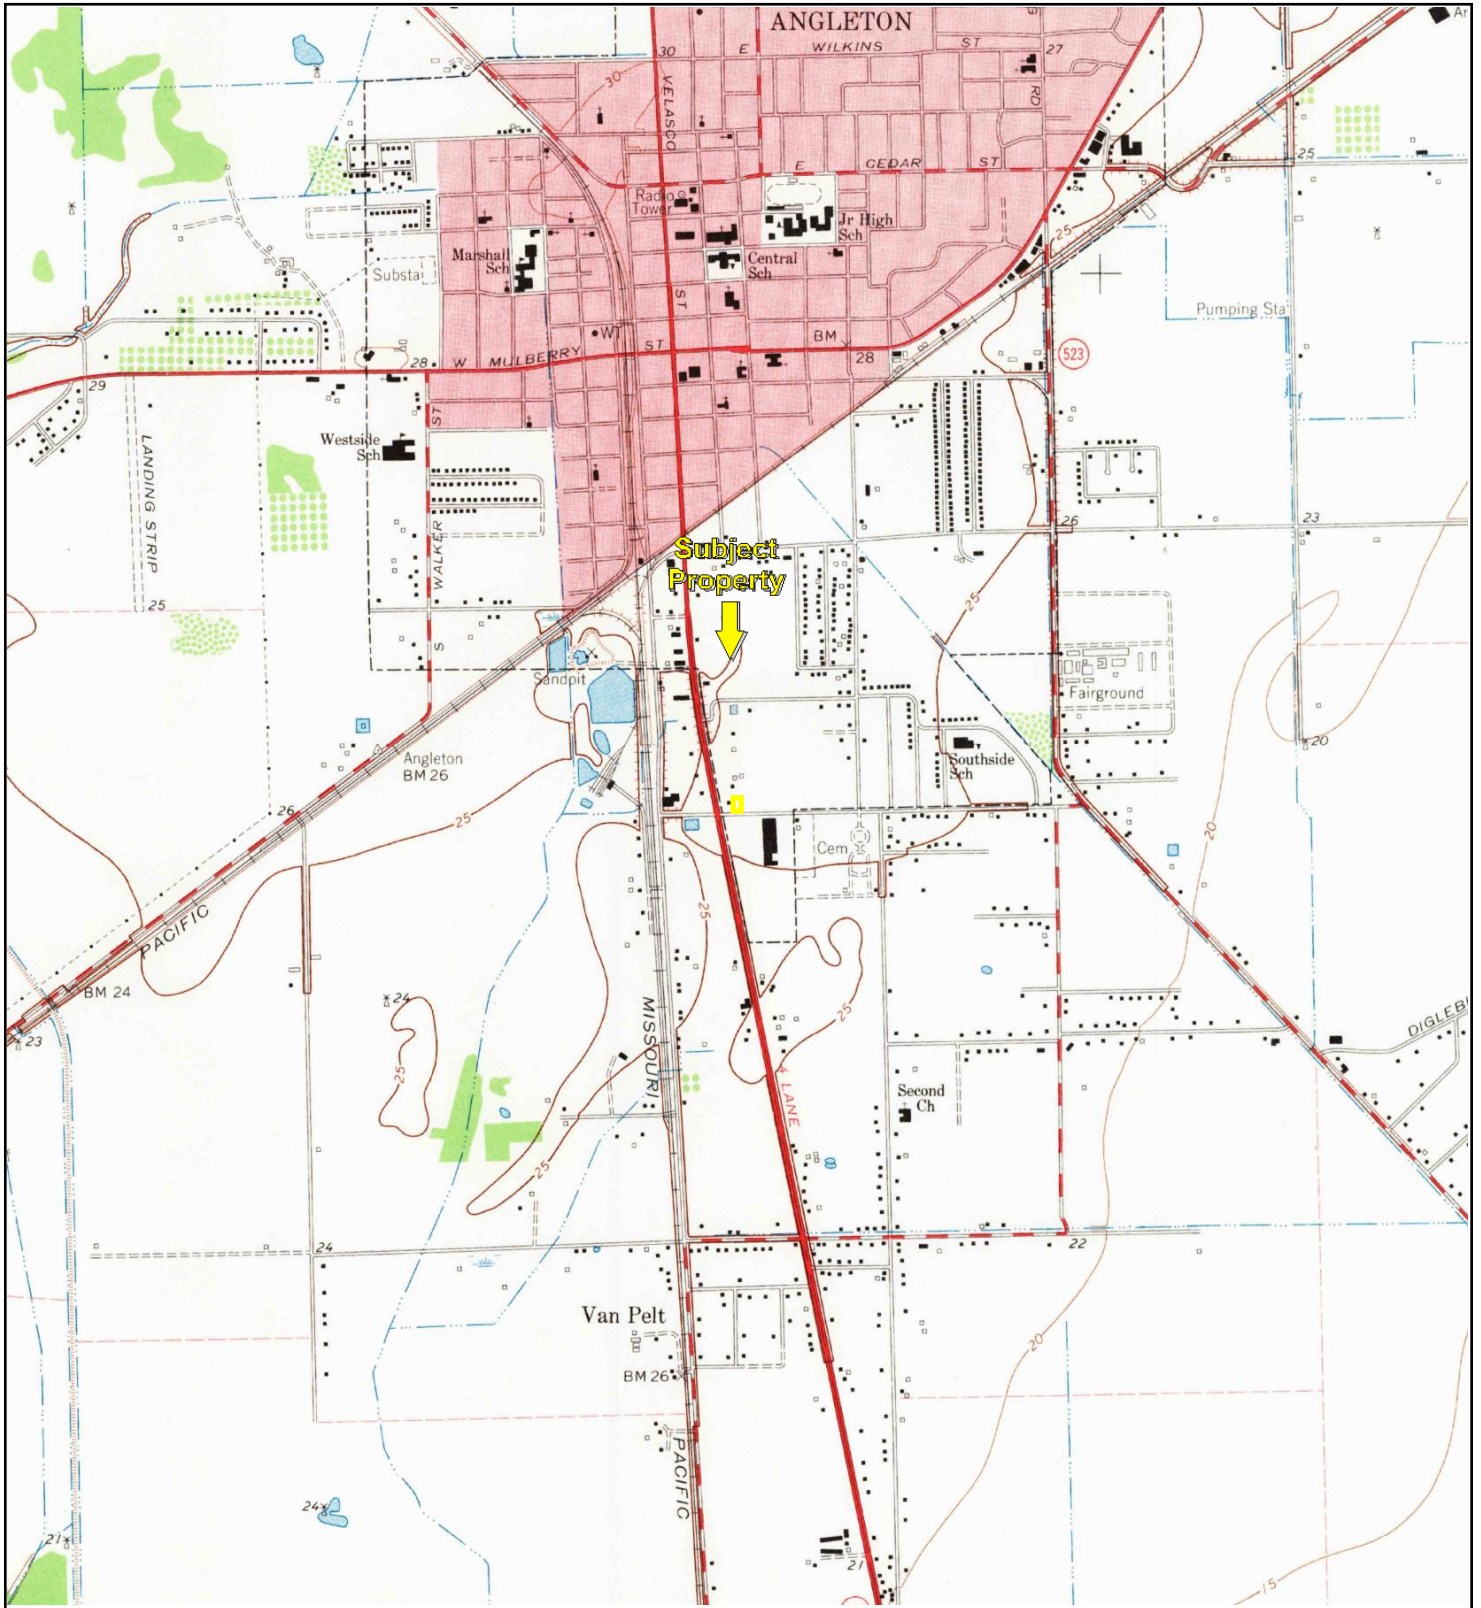


TP, Angleton, 1963, 7.5-minute



Key: Subject Property 

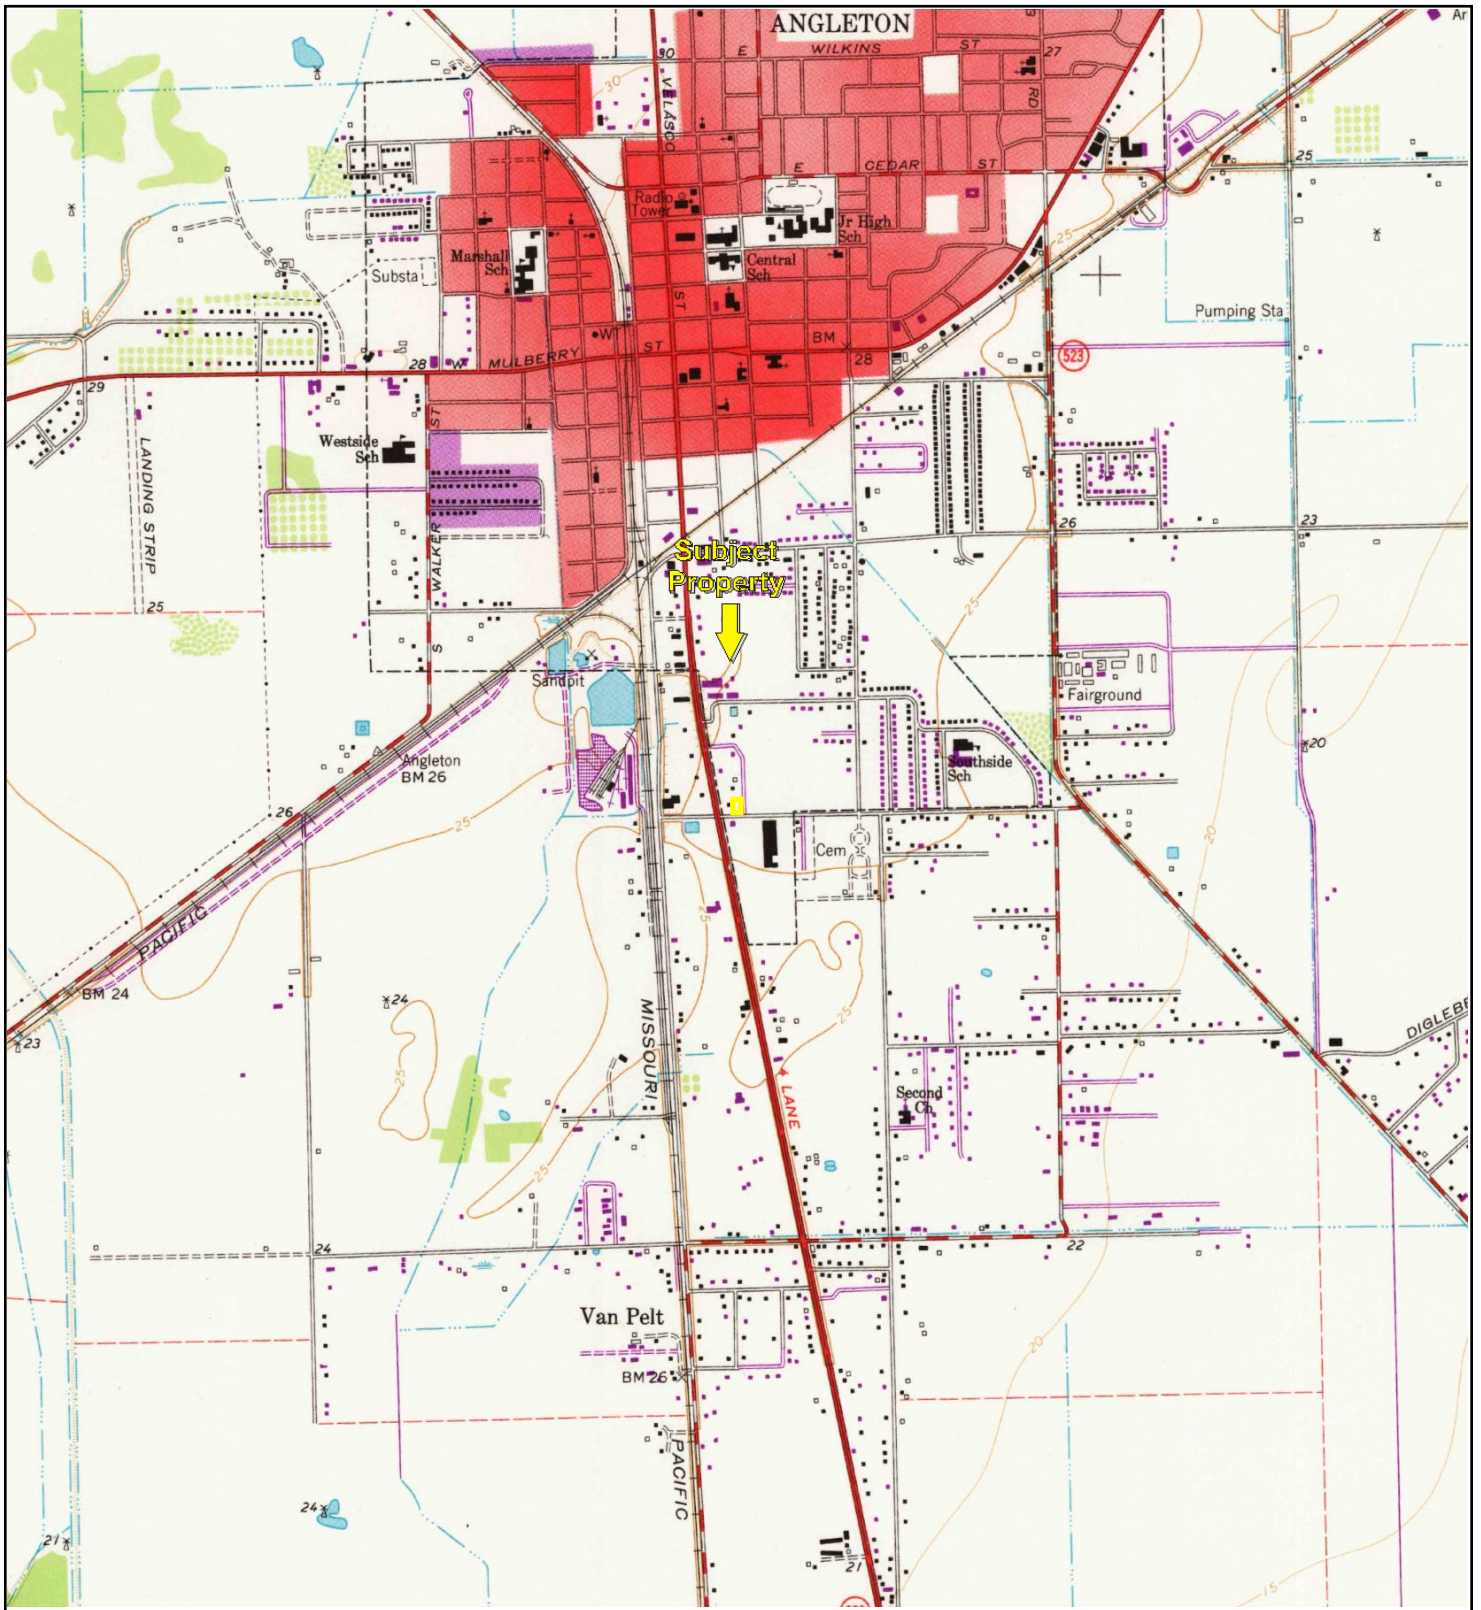

TP, Angleton, 1974, 7.5-minute



Key: Subject Property 



Key: Subject Property 

Little, Gordon

From: Kelley, Hannah
Sent: Monday, June 22, 2020 12:34 PM
To: citysecretary@angleton.tx.us
Subject: Public Records Request - 103 Cemetery Road

Good morning,

Could you check for records for building permits, violations, zoning permits, activity use limitations, hazardous material spills, fires, USTs, and environmental concerns for a property located at:

Safe Harbor Self-Storage
103 Cemetery Road, Angleton, Texas
APN: 253585

Thanks!


Hannah Kelley
Staff Assessor

PARTNER ENGINEERING AND SCIENCE, INC.

12012 Wickchester Lane, Suite 320, Houston, Texas 77079
C: 713-504-8499 | O: 713-892-5517 | F: 713-758-0139



June 14, 2020

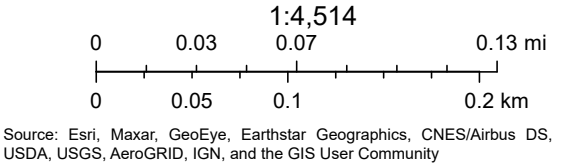

Property

Account			
Property ID:	253585	Legal Description:	F K STEVENS (A0375 I T TINSLEY) (ANGLETON) LOT 9C2 ACRES .29
Geographic ID:	7798-0012-110	Zoning:	3-18-14 AMS/CJC
Type:	Real	Agent Code:	
Property Use Code:			
Property Use Description:			
Location			
Address:	103 CEMETERY RD ANGLETON, TX	Mapsco:	COMMSAN
Neighborhood:	COMM ACCTS	Map ID:	
Neighborhood CD:	COMM		
Owner			
Name:	TEER DENNIE	Owner ID:	1111641
Mailing Address:	926 PLANTATION ST LEAGUE CITY, TX 77573-2821	% Ownership:	100.0000000000%
		Exemptions:	

Values

(+) Improvement Homesite Value:	+	\$0	
(+) Improvement Non-Homesite Value:	+	\$69,210	
(+) Land Homesite Value:	+	\$0	
(+) Land Non-Homesite Value:	+	\$16,420	Ag / Timber Use Value
(+) Agricultural Market Valuation:	+	\$0	\$0
(+) Timber Market Valuation:	+	\$0	\$0

(=) Market Value:	=	\$85,630	
(-) Ag or Timber Use Value Reduction:	-	\$0	

(=) Appraised Value:	=	\$85,630	
(-) HS Cap:	-	\$0	

(=) Assessed Value:	=	\$85,630	

Taxing Jurisdiction

Owner:	TEER DENNIE
% Ownership:	100.0000000000%
Total Value:	\$85,630

Entity	Description	Tax Rate	Appraised Value	Taxable Value	Estimated Tax		
CAD	BRAZORIA COUNTY APPRAISAL DISTRICT	0.000000	\$85,630	\$85,630	\$0.00		
CAN	CITY OF ANGLETON	0.697580	\$85,630	\$85,630	\$597.34		
DR1	ANGLETON DRAINAGE DISTRICT	0.130352	\$85,630	\$85,630	\$111.62		

GBC	BRAZORIA COUNTY	0.365233	\$85,630	\$85,630	\$312.75
HAD	ANGLETON-DANBURY HOSPITAL DISTRICT	0.242259	\$85,630	\$85,630	\$207.45
NAV	PORT FREEPORT	0.040100	\$85,630	\$85,630	\$34.34
RDB	ROAD & BRIDGE FUND	0.050000	\$85,630	\$85,630	\$42.82
SAN	ANGLETON INDEPENDENT SCHOOL DISTRICT	1.385200	\$85,630	\$85,630	\$1,186.15
Total Tax Rate:		2.910724			
				Taxes w/Current Exemptions:	\$2,492.47
				Taxes w/o Exemptions:	\$2,492.45

Improvement / Building

All improvements valued at income

Improvement #1:	Commercial	State Code:	F1	Living Area:	1600.0 sqft	Value:	N/A
Type	Description	Class CD	Exterior Wall	Year Built	SQFT		
386	MINI- WAREHOUSE	D - 2		1980	1600.0		

Improvement #2:	Commercial	State Code:	F1	Living Area:	1995.0 sqft	Value:	N/A
Type	Description	Class CD	Exterior Wall	Year Built	SQFT		
386	MINI- WAREHOUSE	D - 2		1980	1995.0		

Improvement #3:	Misc Imp	State Code:	F1	Living Area:	sqft	Value:	N/A
Type	Description	Class CD	Exterior Wall	Year Built	SQFT		
YPC1	CONCRETE PAVING AVERAGE	C		1980	5982.0		

Land

#	Type	Description	Acres	Sqft	Eff Front	Eff Depth	Market Value	Prod. Value
1	S1	PRIMARY SITE	0.2900	12632.00	0.00	0.00	\$0	\$0

Roll Value History

Year	Improvements	Land Market	Ag Valuation	Appraised	HS Cap	Assessed
2020	\$69,210	\$16,420	0	85,630	\$0	\$85,630
2019	\$52,580	\$16,420	0	69,000	\$0	\$69,000
2018	\$69,790	\$16,420	0	86,210	\$0	\$86,210
2017	\$60,480	\$16,420	0	76,900	\$0	\$76,900
2016	\$57,210	\$16,420	0	73,630	\$0	\$73,630
2015	\$26,590	\$15,160	0	41,750	\$0	\$41,750
2014	\$26,590	\$15,160	0	41,750	\$0	\$41,750
2013	\$22,800	\$18,950	0	41,750	\$0	\$41,750
2012	\$21,410	\$18,950	0	40,360	\$0	\$40,360
2011	\$36,350	\$18,950	0	55,300	\$0	\$55,300
2010	\$42,600	\$18,950	0	61,550	\$0	\$61,550
2009	\$41,580	\$18,950	0	60,530	\$0	\$60,530
2008	\$40,590	\$18,950	0	59,540	\$0	\$59,540
2007	\$40,590	\$18,950	0	59,540	\$0	\$59,540
2006	\$46,910	\$12,630	0	59,540	\$0	\$59,540

Deed History - (Last 3 Deed Transactions)

#	Deed Date	Type	Description	Grantor	Grantee	Volume	Page	Deed Number
1	2/20/2015	WD	WARRANTY DEED	RICE REAL ESTATE PARTNERSHIP LTD	TEER DENNIE	15	007468	
2	12/8/2005	WD	WARRANTY DEED	MILLS MIKE & CHERYL	RICE REAL ESTATE PARTNERSHIP LTD	06	060109	
3	9/15/2004	CS	CONTRACT OF SALE	MILLS MIKE & CHERYL	MILLS MIKE & CHERYL	05	060608	0

Tax Due

Property Tax Information as of 06/14/2020

Amount Due if Paid on:  ↓

Year	Taxing Jurisdiction	Taxable Value	Base Tax	Base Taxes Paid	Base Tax Due	Discount / Penalty & Interest	Attorney Fees	Amount Due

NOTE: Penalty & Interest accrues every month on the unpaid tax and is added to the balance. Attorney fees may also increase your tax liability if not paid by July 1. If you plan to submit payment on a future date, make sure you enter the date and RECALCULATE to obtain the correct total amount due.

Questions Please Call (979) 849-7792


ENVIRONMENTAL SITE ASSESSMENT QUESTIONNAIRE

Please complete to the best of your knowledge. For those questions that are not applicable, please respond with an "N/A". For those questions that are unknown, please respond with "unknown".

1. PROPERTY INFORMATION:

Property Name: <u>SAFE HARBOR SELF STORAGE</u>		
Property Address: <u>103 CEMETERY RD.</u>		
City <u>ANGLTON</u>	State <u>TX</u>	Zip <u>77575</u>
Assessor's Parcel Number		
Property Owner & Contact Information: <u>DENNIETEE 281-802-5366</u>		
Date Property Owner Purchased: <u>2015</u>		
Key Site Manager & Contact Information:		

2. COMPLETED BY

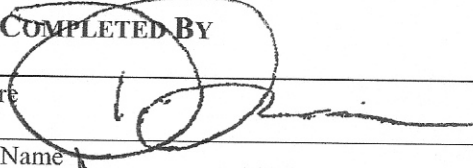Signature 	Date <u>6/8/2020</u>
Printed Name <u>DENNIETEE</u>	Relation to Subject Property

3. PREVIOUS INVESTIGATIONS

Have any previous environmental investigations been performed at the property, including Phase I ESAs, Phase II Subsurface Investigations, Remediation, Asbestos or Lead-Based Paint surveys? NONE

(If yes, please provide copies)

4. PROPERTY DESCRIPTION

Property Size: _____ Number of Building(s): 2

Size of Building(s): _____

Date of Construction: _____

Property Type: (please circle)

Multi-Family Hotel Mobile Home Park Retail/Commercial Industrial Office

Other: STORAGE

Please provide Rent Roll if Applicable.

Historical Use of Property: STORAGE

5. SURROUNDING PROPERTY USES

4. Relationship of the purchase price to the fair market value of the property if it were not contaminated (40 CFR 312.29)

Does the purchase price being paid for this property reasonably reflect the fair market value of the property? If you conclude that there is a difference, have you considered whether the lower purchase price is because contamination is known or believed to be present at the property?

☐ YES ☒ NO

5. Commonly known or reasonably ascertainable information about the Property (40 CFR 312.30)

Are you aware of commonly known or reasonably ascertainable information about the property that would help the environmental professional to identify conditions indicative of releases or threatened releases?

☐ YES ☒ NO

a. Do you know the past uses of the property? *STORAGE*

☒ YES ☐ NO

b. Do you know of specific chemicals that are present or once were present at the property?

☐ YES ☒ NO

c. Do you know of spills or other chemical releases that have taken place at the property?

☐ YES ☒ NO

d. Do you know of any environmental cleanups that have taken place at the property?

☐ YES ☒ NO

e. Do you have any prior knowledge that the property was developed as a gas station, dry cleaner, manufacturing/industrial facility in the past?

☐ YES ☒ NO

f. Are you aware of historical use of hazardous materials or petroleum products used or present on the property?

☐ YES ☒ NO

g. Do you know if the property is currently or was formerly equipped with underground storage tanks (USTs) or septic tanks?

☐ YES ☒ NO


h. Do you know of any past, threatened or pending lawsuits or administrative proceedings concerning a release or threatened release of any hazardous substance or petroleum products involving the property by any owner or occupant of the property?

☐ YES ☒ NO

6. The degree of obviousness of the presence or likely presence of contamination at the property, and the ability to detect the contamination by appropriate investigation (40 CFR 312.31)

Based on your knowledge and experience related to the property are there any obvious indicators that point to the presence or likely presence of releases at the property?

☐ YES ☒ NO

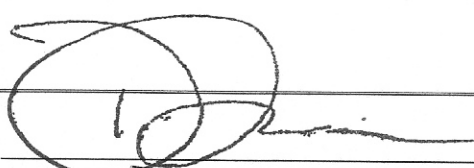Signature of User/Person Interviewed: 

Name of User/Person Interviewed: DENNIE TEER

Title/Relationship to Property: OWNER

Phone Number/Email: 281-802-5366 / OFFICE@DETCO.NET

Date: 6/8/2020

Contact for additional information:

Name: _____

Relationship to Property: _____

Phone Number/Email: _____

PHASE I ENVIRONMENTAL SITE ASSESSMENT QUESTIONNAIRE

The following questionnaire is required by the ASTM Standard E 1527-13, which adheres to the All Appropriate Inquiries (AAI) Rule (United States Environmental Protection Agency) (40 CFR 312).

As defined by ASTM, the User of the report is the "party seeking to use Practice E 1527 to complete an environmental site assessment of the property. A user may include, without limitation, a potential purchaser of property, a potential tenant of property, an owner of property, a lender, or a property manager. The user has specific obligations for completing a successful application of this practice."

PROPERTY ADDRESS:	103 CEMETERY RD.
PROPERTY CITY, STATE ZIP:	ANGLETON, TX 77515

1. Environmental liens that are filed or recorded against the property (40 CFR 312.25)

Did a search of recorded land title records (or judicial records) identify any environmental liens filed or recorded against the property under federal, tribal, state or local law?

☐ YES ☒ NO

2. Activity and use limitations (AULs) that are in place on the property or that have been filed or records against the property (40 CFR 312.26(a)(1)(v) and (vi))

Did a search of recorded land title records (or judicial records) identify any AULs, such as engineering controls, land use restrictions or institutional controls that are in place at the property and/or have been filed or recorded against the property under federal, tribal, state or local law?

☐ YES ☒ NO

3. Specialized knowledge or experience of the person seeking to qualify for the LLP (40 CFR 312.28)

Do you have any specialized knowledge or experience related to the property or nearby properties? For example, are you involved in the same line of business as the current or former occupants of the property or an adjoining property so that you would have specialized knowledge of the chemicals and processes used by this type of business?

☐ YES ☒ NO

DIRECTION	USE
North	
South	
East	
West	

Are you aware of any potential environmental concerns associated with surrounding properties?
 _____ YES ☒ NO

If yes, please describe: _____

6. UTILITIES & SERVICES

Please provide the name of the utility or contractor providing the following:

Electric	_____	Bio-hazardous Waste	_____
Gas	_____	Elevator Maintenance	_____
Potable Water	_____	Used Grease	_____
Sanitary Sewer	_____	Hazardous Waste	_____

7. ON SITE OPERATIONS

Are you aware of any of the following conditions, either past or present, on the property?		
Condition	Response	If yes, please describe
1. Stored Chemicals	☐ Yes ☒ No	
2. Underground Storage Tanks	☐ Yes ☒ No	
3. Aboveground Storage Tanks	☐ Yes ☒ No	
4. Spills or Releases	☐ Yes ☒ No	
5. Dump Areas/Landfills	☐ Yes ☒ No	
6. Waste Treatment Systems	☐ Yes ☒ No	
7. Clarifiers/Separators	☐ Yes ☒ No	
8. Vents/Odors	☐ Yes ☒ No	
9. Floor Drains/Sumps	☐ Yes ☒ No	
10. Stained Soil	☐ Yes ☒ No	
11. Electrical Transformers	☐ Yes ☒ No	
12. Hydraulic Lifts/Elevators	☐ Yes ☒ No	
13. Dry Cleaning Operations	☐ Yes ☒ No	
14. Oil/Gas/Water/Monitoring Wells	☐ Yes ☒ No	
15. Environmental Permits	☐ Yes ☒ No	

APPENDIX C: REGULATORY DATABASE REPORT

Safe Harbor Self Storage

103 Cemetery Road
ANGLETON, TX 77515

Inquiry Number: 6085945.2s
June 08, 2020

The EDR Radius Map™ Report with GeoCheck®



6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

TABLE OF CONTENTS

<u>SECTION</u>	<u>PAGE</u>
Executive Summary	ES1
Overview Map	2
Detail Map	3
Map Findings Summary	4
Map Findings	8
Orphan Summary	158
Government Records Searched/Data Currency Tracking	GR-1
 <u>GEOCHECK ADDENDUM</u>	
Physical Setting Source Addendum	A-1
Physical Setting Source Summary	A-2
Physical Setting SSURGO Soil Map	A-5
Physical Setting Source Map	A-14
Physical Setting Source Map Findings	A-16
Physical Setting Source Records Searched	PSGR-1

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2020 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

A search of available environmental records was conducted by Environmental Data Resources, Inc (EDR). The report was designed to assist parties seeking to meet the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E 1527-13), the ASTM Standard Practice for Environmental Site Assessments for Forestland or Rural Property (E 2247-16), the ASTM Standard Practice for Limited Environmental Due Diligence: Transaction Screen Process (E 1528-14) or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

TARGET PROPERTY INFORMATION

ADDRESS

103 CEMETERY ROAD
ANGLETON, TX 77515

COORDINATES

Latitude (North):	29.1507150 - 29° 9' 2.57"
Longitude (West):	95.4294860 - 95° 25' 46.14"
Universal Tranverse Mercator:	Zone 15
UTM X (Meters):	263670.2
UTM Y (Meters):	3226948.8
Elevation:	26 ft. above sea level

USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property Map:	5937069 ANGLETON, TX
Version Date:	2013

AERIAL PHOTOGRAPHY IN THIS REPORT

Portions of Photo from:	20141021, 20141014
Source:	USDA

MAPPED SITES SUMMARY

Target Property Address:
103 CEMETERY ROAD
ANGLETON, TX 77515

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
A1	T & M GROCERY	1039 S VELASCO ST	UST, Financial Assurance, GCC, PST STAGE 2,...	Higher	56, 0.011, West
A2	T M GROCERY	1039 S VELASCO ST	LPST	Higher	56, 0.011, West
A3	BEACHWAY CENTER	1101 S VELASCO ST	LPST, UST, CENTRAL REGISTRY	Higher	145, 0.027, South
A4	MALLINCKRODT MEDICAL	1111 S VELASCO ST	RCRA NonGen / NLR, US AIRS, FINDS	Higher	173, 0.033, SW
A5	MALLINCKRODT MEDICAL	1111 S VELASCO ST	Ind. Haz Waste	Higher	173, 0.033, SW
B6	WAGNER RAY DAEWOO	1100 S VELASCO ST	EDR Hist Auto	Lower	364, 0.069, SW
7	CHRISTOPHERSON TEXAC	1029 S VELASCO	EDR Hist Auto	Higher	409, 0.077, NW
B8	UNITED PARCEL SERVIC	113 CEMETARY RD	UST	Lower	632, 0.120, SW
B9	UNITED PARCEL SERVIC	113 CEMETARY RD	Ind. Haz Waste, CENTRAL REGISTRY	Lower	632, 0.120, SW
B10	UNITED PARCEL SERVIC	113 CEMETERY RD	RCRA-VSQG, FINDS, ECHO	Lower	632, 0.120, SW
11	HURTA SITE	ACROSS FROM BOWLING	CLI	Lower	790, 0.150, South
12	RICHMOND INDUSTRIES	1021 S FRONT ST	UST	Higher	811, 0.154, WNW
C13	BW SERVICES ANGLETON	1100 WAYNE DR	Ind. Haz Waste	Higher	1027, 0.195, WSW
C14	BW SERVICES ANGLETON	1100 WAYNE DR	SEMS-ARCHIVE, CORRACTS, RCRA-TSDF, RCRA-LQG, 2020	Higher	1027, 0.195, WSW

EXECUTIVE SUMMARY

TARGET PROPERTY SEARCH RESULTS

The target property was not listed in any of the databases searched by EDR.

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable ") government records either on the target property or within the search radius around the target property for the following databases:

STANDARD ENVIRONMENTAL RECORDS

Federal NPL site list

NPL..... National Priority List
Proposed NPL..... Proposed National Priority List Sites
NPL LIENS..... Federal Superfund Liens

Federal Delisted NPL site list

Delisted NPL..... National Priority List Deletions

Federal CERCLIS list

FEDERAL FACILITY..... Federal Facility Site Information listing
SEMS..... Superfund Enterprise Management System

Federal RCRA generators list

RCRA-SQG..... RCRA - Small Quantity Generators

Federal institutional controls / engineering controls registries

LUCIS..... Land Use Control Information System
US ENG CONTROLS..... Engineering Controls Sites List
US INST CONTROLS..... Institutional Controls Sites List

Federal ERNS list

ERNS..... Emergency Response Notification System

State- and tribal - equivalent NPL

SHWS..... State Superfund Registry

State and tribal landfill and/or solid waste disposal site lists

SWF/LF..... Permitted Solid Waste Facilities
DEBRIS..... DEBRIS

EXECUTIVE SUMMARY

WASTE MGMT..... Commercial Hazardous & Solid Waste Management Facilities

State and tribal leaking storage tank lists

INDIAN LUST..... Leaking Underground Storage Tanks on Indian Land

State and tribal registered storage tank lists

FEMA UST..... Underground Storage Tank Listing

AST..... Petroleum Storage Tank Database

INDIAN UST..... Underground Storage Tanks on Indian Land

State and tribal institutional control / engineering control registries

AUL..... Sites with Controls

State and tribal voluntary cleanup sites

INDIAN VCP..... Voluntary Cleanup Priority Listing

VCP..... Voluntary Cleanup Program Database

State and tribal Brownfields sites

BROWNFIELDS..... Brownfields Site Assessments

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS..... A Listing of Brownfields Sites

Local Lists of Landfill / Solid Waste Disposal Sites

SWRCY..... Recycling Facility Listing

INDIAN ODI..... Report on the Status of Open Dumps on Indian Lands

ODI..... Open Dump Inventory

DEBRIS REGION 9..... Torres Martinez Reservation Illegal Dump Site Locations

IHS OPEN DUMPS..... Open Dumps on Indian Land

Local Lists of Hazardous waste / Contaminated Sites

US HIST CDL..... Delisted National Clandestine Laboratory Register

CDL..... CDL

PRIORITYCLEANERS..... Dry Cleaner Remediation Program Prioritization List

DEL SHWS..... Deleted Superfund Registry Sites

US CDL..... National Clandestine Laboratory Register

CENTRAL REGISTRY..... CENTRAL REGISTRY

PFAS..... PFAS Contamination Site Location Listing

Local Lists of Registered Storage Tanks

NON REGIST PST..... Petroleum Storage Tank Non Registered

Local Land Records

HIST LIENS..... Environmental Liens Listing

EXECUTIVE SUMMARY

LIENS..... Environmental Liens Listing
 LIENS 2..... CERCLA Lien Information

Records of Emergency Release Reports

HMIRS..... Hazardous Materials Information Reporting System
 SPILLS..... Spills Database
 SPILLS 90..... SPILLS 90 data from FirstSearch
 SPILLS 80..... SPILLS 80 data from FirstSearch

Other Ascertainable Records

FUDS..... Formerly Used Defense Sites
 DOD..... Department of Defense Sites
 SCRD DRYCLEANERS..... State Coalition for Remediation of Drycleaners Listing
 US FIN ASSUR..... Financial Assurance Information
 EPA WATCH LIST..... EPA WATCH LIST
 TSCA..... Toxic Substances Control Act
 TRIS..... Toxic Chemical Release Inventory System
 SSTS..... Section 7 Tracking Systems
 ROD..... Records Of Decision
 RMP..... Risk Management Plans
 RAATS..... RCRA Administrative Action Tracking System
 PRP..... Potentially Responsible Parties
 PADS..... PCB Activity Database System
 ICIS..... Integrated Compliance Information System
 FTTS..... FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
 MLTS..... Material Licensing Tracking System
 COAL ASH DOE..... Steam-Electric Plant Operation Data
 COAL ASH EPA..... Coal Combustion Residues Surface Impoundments List
 PCB TRANSFORMER..... PCB Transformer Registration Database
 RADINFO..... Radiation Information Database
 HIST FTTS..... FIFRA/TSCA Tracking System Administrative Case Listing
 DOT OPS..... Incident and Accident Data
 CONSENT..... Superfund (CERCLA) Consent Decrees
 INDIAN RESERV..... Indian Reservations
 FUSRAP..... Formerly Utilized Sites Remedial Action Program
 UMTRA..... Uranium Mill Tailings Sites
 LEAD SMELTERS..... Lead Smelter Sites
 US AIRS..... Aerometric Information Retrieval System Facility Subsystem
 US MINES..... Mines Master Index File
 ABANDONED MINES..... Abandoned Mines
 FINDS..... Facility Index System/Facility Registry System
 UXO..... Unexploded Ordnance Sites
 ECHO..... Enforcement & Compliance History Information
 DOCKET HWC..... Hazardous Waste Compliance Docket Listing
 FUELS PROGRAM..... EPA Fuels Program Registered Listing
 AIRS..... Current Emission Inventory Data
 APAR..... Affected Property Assessment Report Site Listing
 ASBESTOS..... ASBESTOS
 COAL ASH..... Coal Ash Disposal Sites
 DRYCLEANERS..... Drycleaner Registration Database Listing
 ED AQUIF..... Edwards Aquifer Permits
 ENF..... Notice of Violations Listing

EXECUTIVE SUMMARY

Financial Assurance.....	Financial Assurance Information Listing
GCC.....	Groundwater Contamination Cases
IOP.....	Innocent Owner/Operator Program
LEAD.....	LEAD
MSD.....	Municipal Settings Designations Database
NPDES.....	NPDES Facility List
RWS.....	Radioactive Waste Sites
TIER 2.....	Tier 2 Chemical Inventory Reports
UIC.....	Underground Injection Wells Database Listing
IHW CORR ACTION.....	IHW CORR ACTION
COMP HIST.....	Compliance History Listing
MINES MRDS.....	Mineral Resources Data System

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP.....	EDR Proprietary Manufactured Gas Plants
EDR Hist Cleaner.....	EDR Exclusive Historical Cleaners

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

RGA HWS.....	Recovered Government Archive State Hazardous Waste Facilities List
RGA LF.....	Recovered Government Archive Solid Waste Facilities List

SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified in the following databases.

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property.

Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in ***bold italics*** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

STANDARD ENVIRONMENTAL RECORDS

Federal CERCLIS NFRAP site list

SEMS-ARCHIVE: SEMS-ARCHIVE (Superfund Enterprise Management System Archive) tracks sites that have no further interest under the Federal Superfund Program based on available information. The list was formerly known as the CERCLIS-NFRAP, renamed to SEMS ARCHIVE by the EPA in 2015. EPA may perform a minimal level of assessment work at a site while it is archived if site conditions change and/or new information becomes available. Archived sites have been removed and archived from the inventory of SEMS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has

EXECUTIVE SUMMARY

determined no further steps will be taken to list the site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. The decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be potential NPL site.

A review of the SEMS-ARCHIVE list, as provided by EDR, and dated 04/27/2020 has revealed that there is 1 SEMS-ARCHIVE site within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
BW SERVICES ANGLETON Site ID: 0602350 EPA Id: TXD086467800	1100 WAYNE DR	WSW 1/8 - 1/4 (0.195 mi.)	C14	119

Federal RCRA CORRACTS facilities list

CORRACTS: CORRACTS is a list of handlers with RCRA Corrective Action Activity. This report shows which nationally-defined corrective action core events have occurred for every handler that has had corrective action activity.

A review of the CORRACTS list, as provided by EDR, and dated 03/23/2020 has revealed that there is 1 CORRACTS site within approximately 1 mile of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
BW SERVICES ANGLETON EPA ID:: TXD086467800	1100 WAYNE DR	WSW 1/8 - 1/4 (0.195 mi.)	C14	119

Federal RCRA non-CORRACTS TSD facilities list

RCRA-TSDF: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

A review of the RCRA-TSDF list, as provided by EDR, and dated 03/23/2020 has revealed that there is 1 RCRA-TSDF site within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
BW SERVICES ANGLETON EPA ID:: TXD086467800	1100 WAYNE DR	WSW 1/8 - 1/4 (0.195 mi.)	C14	119

EXECUTIVE SUMMARY

Federal RCRA generators list

RCRA-LQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

A review of the RCRA-LQG list, as provided by EDR, and dated 03/23/2020 has revealed that there is 1 RCRA-LQG site within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
BW SERVICES ANGLETON EPA ID:: TXD086467800	1100 WAYNE DR	WSW 1/8 - 1/4 (0.195 mi.)	C14	119

RCRA-VSQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Very small quantity generators (VSQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

A review of the RCRA-VSQG list, as provided by EDR, and dated 03/23/2020 has revealed that there is 1 RCRA-VSQG site within approximately 0.25 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
UNITED PARCEL SERVIC EPA ID:: TX0000242230	113 CEMETERY RD	SW 0 - 1/8 (0.120 mi.)	B10	96

State and tribal landfill and/or solid waste disposal site lists

CLI: Closed and abandoned landfills (permitted as well as unauthorized) across the state of Texas. For current information regarding any of the sites included in this database, contact the appropriate Council of Governments agency.

A review of the CLI list, as provided by EDR, has revealed that there is 1 CLI site within approximately 0.5 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
HURTA SITE Database: CLI, Date of Government Version: 08/30/1999 Database: H-GAC CLI, Date of Government Version: 09/30/2019 Date Closed: 1976 Site Id: U183	ACROSS FROM BOWLING	S 1/8 - 1/4 (0.150 mi.)	11	98

EXECUTIVE SUMMARY

State and tribal leaking storage tank lists

LPST: The Leaking Petroleum Storage Tank Incident Reports contain an inventory of reported leaking petroleum storage tank incidents. The data come from the Texas Commission on Environmental Quality's Leaking Petroleum Storage Tank Database.

A review of the LPST list, as provided by EDR, and dated 12/19/2019 has revealed that there are 2 LPST sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
T M GROCERY LPST Id: 113399 CA Status: 6A - FINAL CONCURRENCE ISSUED Facility ID: 0032740 Status Code: FINAL CONCURRENCE ISSUED, CASE CLOSED	1039 S VELASCO ST	W 0 - 1/8 (0.011 mi.)	A2	62
BEACHWAY CENTER LPST Id: 106071 LPST Id: 108820 CA Status: 6A - FINAL CONCURRENCE ISSUED Facility ID: 0049564 Status Code: FINAL CONCURRENCE ISSUED, CASE CLOSED	1101 S VELASCO ST	S 0 - 1/8 (0.027 mi.)	A3	63

State and tribal registered storage tank lists

UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Texas Commission on Environmental Quality's Petroleum Storage Tank Database.

A review of the UST list, as provided by EDR, and dated 11/05/2019 has revealed that there are 4 UST sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
T & M GROCERY Facility Status: ACTIVE Facility Id: 32740 Facility Num: 83626 AI Number: 268776722002087	1039 S VELASCO ST	W 0 - 1/8 (0.011 mi.)	A1	8
BEACHWAY CENTER Facility Status: INACTIVE Facility Id: 49564 Facility Num: 81269 AI Number: 179391752002088	1101 S VELASCO ST	S 0 - 1/8 (0.027 mi.)	A3	63
RICHMOND INDUSTRIES Facility Status: INACTIVE Facility Id: 41755 Facility Num: 61377 AI Number: 419687822003073	1021 S FRONT ST	WNW 1/8 - 1/4 (0.154 mi.)	12	100
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
UNITED PARCEL SERVIC	113 CEMETARY RD	SW 0 - 1/8 (0.120 mi.)	B8	83

EXECUTIVE SUMMARY

Facility Status: INACTIVE
Facility Id: 15678
Facility Num: 77629
AI Number: 17849152002154

ADDITIONAL ENVIRONMENTAL RECORDS

Other Ascertainable Records

RCRA NonGen / NLR: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

A review of the RCRA NonGen / NLR list, as provided by EDR, and dated 03/23/2020 has revealed that there is 1 RCRA NonGen / NLR site within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
MALLINCKRODT MEDICAL EPA ID:: TXD033586777	1111 S VELASCO ST	SW 0 - 1/8 (0.033 mi.)	A4	75

2020 COR ACTION: The EPA has set ambitious goals for the RCRA Corrective Action program by creating the 2020 Corrective Action Universe. This RCRA cleanup baseline includes facilities expected to need corrective action. The 2020 universe contains a wide variety of sites. Some properties are heavily contaminated while others were contaminated but have since been cleaned up. Still others have not been fully investigated yet, and may require little or no remediation. Inclusion in the 2020 Universe does not necessarily imply failure on the part of a facility to meet its RCRA obligations.

A review of the 2020 COR ACTION list, as provided by EDR, and dated 09/30/2017 has revealed that there is 1 2020 COR ACTION site within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
BW SERVICES ANGLETON EPA ID:: TXD086467800	1100 WAYNE DR	WSW 1/8 - 1/4 (0.195 mi.)	C14	119

Ind. Haz Waste: The Industrial and Hazardous Waste Database contains summary reports by waste handlers, generators and shippers in Texas.

A review of the Ind. Haz Waste list, as provided by EDR, and dated 11/05/2019 has revealed that there are 3 Ind. Haz Waste sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
MALLINCKRODT MEDICAL Registration Number: 37403	1111 S VELASCO ST	SW 0 - 1/8 (0.033 mi.)	A5	79
BW SERVICES ANGLETON	1100 WAYNE DR	WSW 1/8 - 1/4 (0.195 mi.)	C13	104

EXECUTIVE SUMMARY

Registration Number: 30207

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
UNITED PARCEL SERVIC Registration Number: 70594	113 CEMETARY RD	SW 0 - 1/8 (0.120 mi.)	B9	92

PST STAGE 2: State II Vapor Recovery. Decommissioning of Stage II Rule - Gasoline dispensing facilities (GDFs) may begin the process of removing Stage II equipment on May 16, 2014 providing that all other requirements for decommissioning have been met, including appropriate notification.

A review of the PST STAGE 2 list, as provided by EDR, and dated 07/17/2019 has revealed that there is 1 PST STAGE 2 site within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
T & M GROCERY	1039 S VELASCO ST	W 0 - 1/8 (0.011 mi.)	A1	8

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR Hist Auto: EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

A review of the EDR Hist Auto list, as provided by EDR, has revealed that there are 2 EDR Hist Auto sites within approximately 0.125 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
CHRISTOPHERSON TEXAC	1029 S VELASCO	NW 0 - 1/8 (0.077 mi.)	7	82
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
WAGNER RAY DAEWOO	1100 S VELASCO ST	SW 0 - 1/8 (0.069 mi.)	B6	82

EXECUTIVE SUMMARY

There were no unmapped sites in this report.

OVERVIEW MAP - 6085945.2S



 Target Property

 Sites at elevations higher than or equal to the target property

 Sites at elevations lower than the target property

 Manufactured Gas Plants

 National Priority List Sites

 Dept. Defense Sites

 Indian Reservations BIA

 Power transmission lines

 Pipelines

 Special Flood Hazard Area (1%)

 0.2% Annual Chance Flood Hazard

 National Wetland Inventory


 State Wetlands

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME: Safe Harbor Self Storage
ADDRESS: 103 Cemetery Road
ANGLETON TX 77515
LAT/LONG: 29.150715 / 95.429486

CLIENT: Partner Engineering and Science, Inc.
CONTACT: Larissa Lopez
INQUIRY #: 6085945.2s
DATE: June 08, 2020 6:10 pm

DETAIL MAP - 6085945.2S

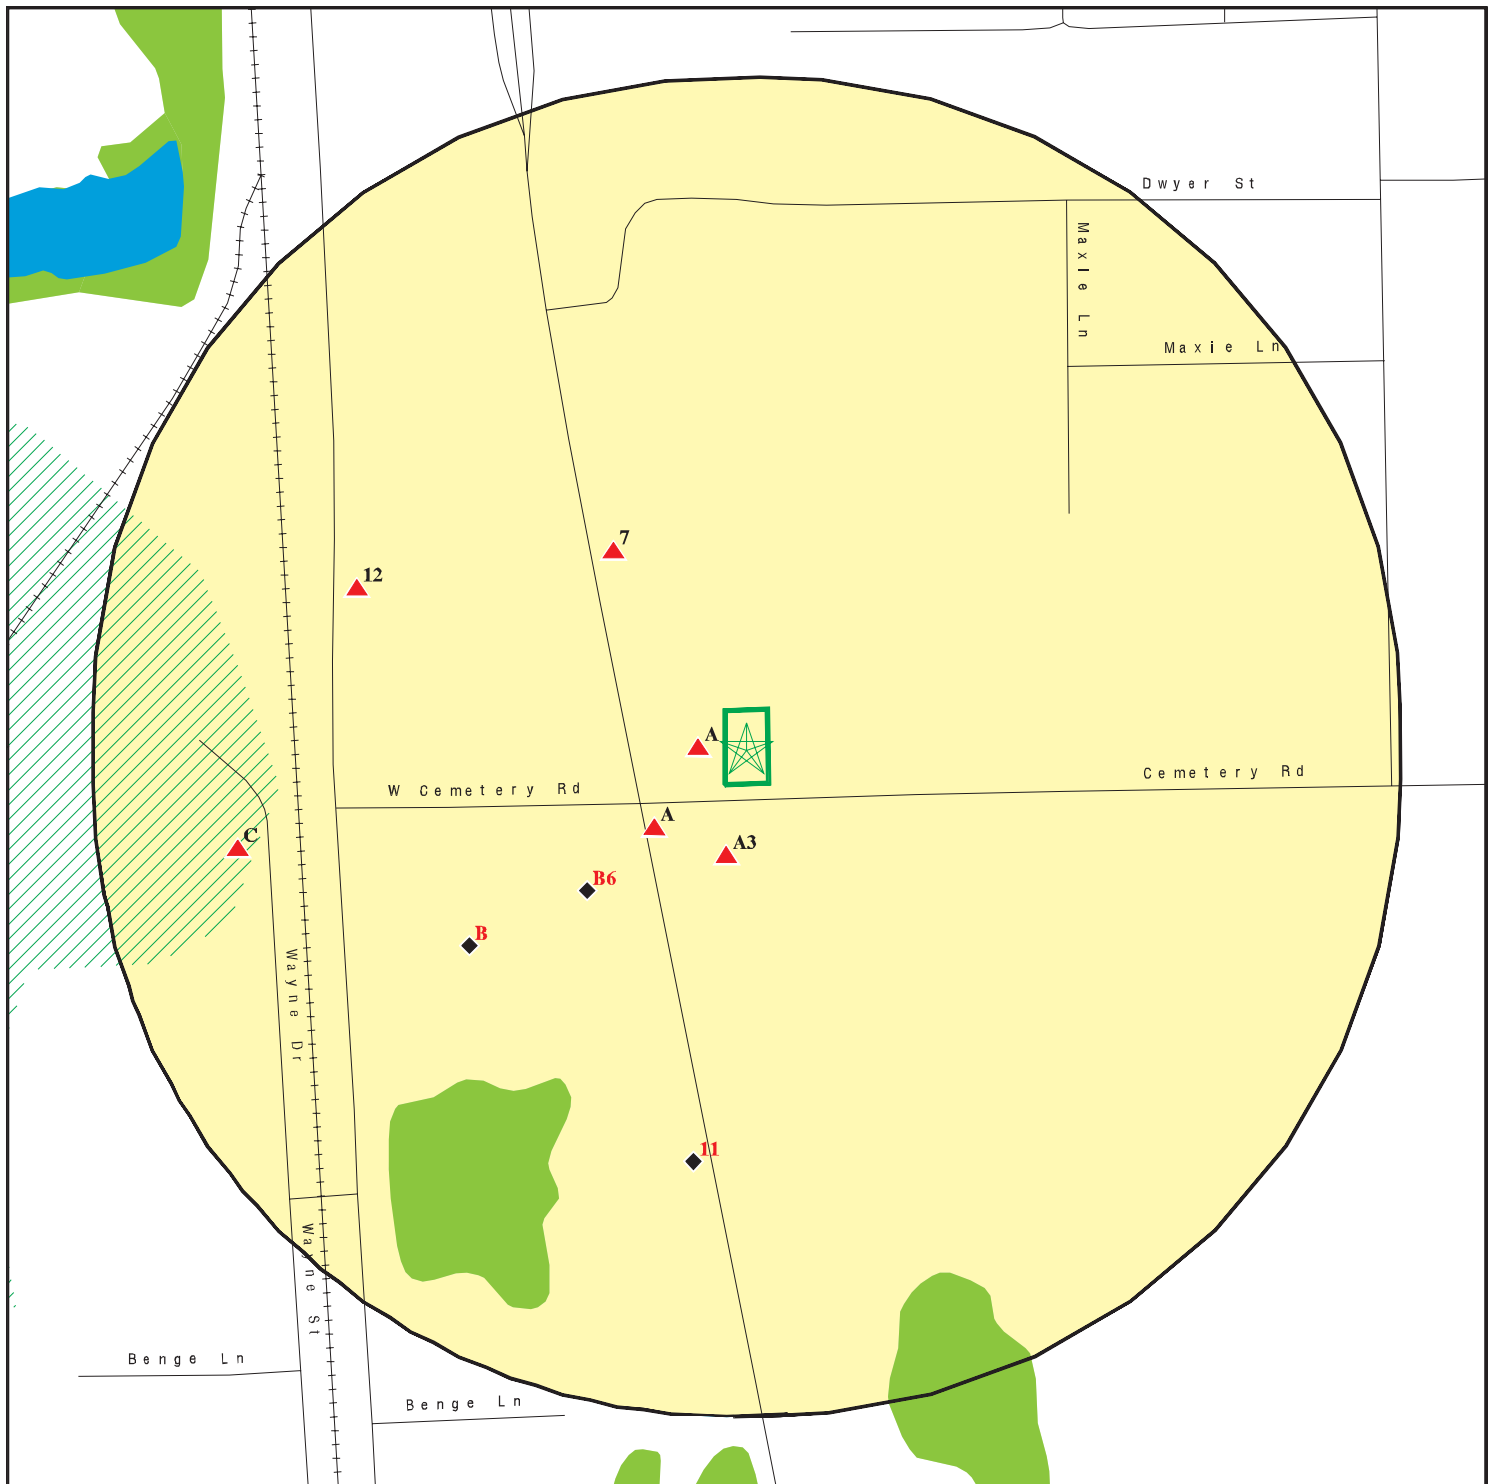

- Target Property
- Sites at elevations higher than or equal to the target property
- Sites at elevations lower than the target property
- Manufactured Gas Plants
- Sensitive Receptors
- National Priority List Sites
- Dept. Defense Sites

- Indian Reservations BIA
- Special Flood Hazard Area (1%)
- 0.2% Annual Chance Flood Hazard
- National Wetland Inventory
- State Wetlands

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME: Safe Harbor Self Storage
 ADDRESS: 103 Cemetery Road
 ANGLETON TX 77515
 LAT/LONG: 29.150715 / 95.429486

CLIENT: Partner Engineering and Science, Inc.
 CONTACT: Larissa Lopez
 INQUIRY #: 6085945.2s
 DATE: June 08, 2020 6:11 pm

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
STANDARD ENVIRONMENTAL RECORDS								
<i>Federal NPL site list</i>								
NPL	1.000		0	0	0	0	NR	0
Proposed NPL	1.000		0	0	0	0	NR	0
NPL LIENS	1.000		0	0	0	0	NR	0
<i>Federal Delisted NPL site list</i>								
Delisted NPL	1.000		0	0	0	0	NR	0
<i>Federal CERCLIS list</i>								
FEDERAL FACILITY	0.500		0	0	0	NR	NR	0
SEMS	0.500		0	0	0	NR	NR	0
<i>Federal CERCLIS NFRAP site list</i>								
SEMS-ARCHIVE	0.500		0	1	0	NR	NR	1
<i>Federal RCRA CORRACTS facilities list</i>								
CORRACTS	1.000		0	1	0	0	NR	1
<i>Federal RCRA non-CORRACTS TSD facilities list</i>								
RCRA-TSDF	0.500		0	1	0	NR	NR	1
<i>Federal RCRA generators list</i>								
RCRA-LQG	0.250		0	1	NR	NR	NR	1
RCRA-SQG	0.250		0	0	NR	NR	NR	0
RCRA-VSQG	0.250		1	0	NR	NR	NR	1
<i>Federal institutional controls / engineering controls registries</i>								
LUCIS	0.500		0	0	0	NR	NR	0
US ENG CONTROLS	0.500		0	0	0	NR	NR	0
US INST CONTROLS	0.500		0	0	0	NR	NR	0
<i>Federal ERNS list</i>								
ERNS	TP		NR	NR	NR	NR	NR	0
<i>State- and tribal - equivalent NPL</i>								
SHWS	1.000		0	0	0	0	NR	0
<i>State and tribal landfill and/or solid waste disposal site lists</i>								
SWF/LF	0.500		0	0	0	NR	NR	0
DEBRIS	0.500		0	0	0	NR	NR	0
CLI	0.500		0	1	0	NR	NR	1
WASTE MGMT	TP		NR	NR	NR	NR	NR	0
<i>State and tribal leaking storage tank lists</i>								
INDIAN LUST	0.500		0	0	0	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
LPST	0.500		2	0	0	NR	NR	2
State and tribal registered storage tank lists								
FEMA UST	0.250		0	0	NR	NR	NR	0
UST	0.250		3	1	NR	NR	NR	4
AST	0.250		0	0	NR	NR	NR	0
INDIAN UST	0.250		0	0	NR	NR	NR	0
State and tribal institutional control / engineering control registries								
AUL	0.500		0	0	0	NR	NR	0
State and tribal voluntary cleanup sites								
INDIAN VCP	0.500		0	0	0	NR	NR	0
VCP	0.500		0	0	0	NR	NR	0
State and tribal Brownfields sites								
BROWNFIELDS	0.500		0	0	0	NR	NR	0
ADDITIONAL ENVIRONMENTAL RECORDS								
Local Brownfield lists								
US BROWNFIELDS	0.500		0	0	0	NR	NR	0
Local Lists of Landfill / Solid Waste Disposal Sites								
SWRCY	0.500		0	0	0	NR	NR	0
INDIAN ODI	0.500		0	0	0	NR	NR	0
ODI	0.500		0	0	0	NR	NR	0
DEBRIS REGION 9	0.500		0	0	0	NR	NR	0
IHS OPEN DUMPS	0.500		0	0	0	NR	NR	0
Local Lists of Hazardous waste / Contaminated Sites								
US HIST CDL	TP		NR	NR	NR	NR	NR	0
CDL	TP		NR	NR	NR	NR	NR	0
PRIORITYCLEANERS	0.500		0	0	0	NR	NR	0
DEL SHWS	1.000		0	0	0	0	NR	0
US CDL	TP		NR	NR	NR	NR	NR	0
CENTRAL REGISTRY	TP		NR	NR	NR	NR	NR	0
PFAS	0.500		0	0	0	NR	NR	0
Local Lists of Registered Storage Tanks								
NON REGIST PST	0.250		0	0	NR	NR	NR	0
Local Land Records								
HIST LIENS	TP		NR	NR	NR	NR	NR	0
LIENS	TP		NR	NR	NR	NR	NR	0
LIENS 2	TP		NR	NR	NR	NR	NR	0
Records of Emergency Release Reports								
HMIRS	TP		NR	NR	NR	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
SPILLS	TP		NR	NR	NR	NR	NR	0
SPILLS 90	TP		NR	NR	NR	NR	NR	0
SPILLS 80	TP		NR	NR	NR	NR	NR	0
Other Ascertainable Records								
RCRA NonGen / NLR	0.250		1	0	NR	NR	NR	1
FUDS	1.000		0	0	0	0	NR	0
DOD	1.000		0	0	0	0	NR	0
SCRD DRYCLEANERS	0.500		0	0	0	NR	NR	0
US FIN ASSUR	TP		NR	NR	NR	NR	NR	0
EPA WATCH LIST	TP		NR	NR	NR	NR	NR	0
2020 COR ACTION	0.250		0	1	NR	NR	NR	1
TSCA	TP		NR	NR	NR	NR	NR	0
TRIS	TP		NR	NR	NR	NR	NR	0
SSTS	TP		NR	NR	NR	NR	NR	0
ROD	1.000		0	0	0	0	NR	0
RMP	TP		NR	NR	NR	NR	NR	0
RAATS	TP		NR	NR	NR	NR	NR	0
PRP	TP		NR	NR	NR	NR	NR	0
PADS	TP		NR	NR	NR	NR	NR	0
ICIS	TP		NR	NR	NR	NR	NR	0
FTTS	TP		NR	NR	NR	NR	NR	0
MLTS	TP		NR	NR	NR	NR	NR	0
COAL ASH DOE	TP		NR	NR	NR	NR	NR	0
COAL ASH EPA	0.500		0	0	0	NR	NR	0
PCB TRANSFORMER	TP		NR	NR	NR	NR	NR	0
RADINFO	TP		NR	NR	NR	NR	NR	0
HIST FTTS	TP		NR	NR	NR	NR	NR	0
DOT OPS	TP		NR	NR	NR	NR	NR	0
CONSENT	1.000		0	0	0	0	NR	0
INDIAN RESERV	1.000		0	0	0	0	NR	0
FUSRAP	1.000		0	0	0	0	NR	0
UMTRA	0.500		0	0	0	NR	NR	0
LEAD SMELTERS	TP		NR	NR	NR	NR	NR	0
US AIRS	TP		NR	NR	NR	NR	NR	0
US MINES	0.250		0	0	NR	NR	NR	0
ABANDONED MINES	0.250		0	0	NR	NR	NR	0
FINDS	TP		NR	NR	NR	NR	NR	0
UXO	1.000		0	0	0	0	NR	0
ECHO	TP		NR	NR	NR	NR	NR	0
DOCKET HWC	TP		NR	NR	NR	NR	NR	0
FUELS PROGRAM	0.250		0	0	NR	NR	NR	0
AIRS	TP		NR	NR	NR	NR	NR	0
APAR	TP		NR	NR	NR	NR	NR	0
ASBESTOS	TP		NR	NR	NR	NR	NR	0
COAL ASH	0.500		0	0	0	NR	NR	0
DRYCLEANERS	0.250		0	0	NR	NR	NR	0
ED AQUIF	TP		NR	NR	NR	NR	NR	0
ENF	TP		NR	NR	NR	NR	NR	0
Financial Assurance	TP		NR	NR	NR	NR	NR	0
GCC	TP		NR	NR	NR	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
IOP	TP		NR	NR	NR	NR	NR	0
LEAD	TP		NR	NR	NR	NR	NR	0
Ind. Haz Waste	0.250		2	1	NR	NR	NR	3
MSD	0.500		0	0	0	NR	NR	0
NPDES	TP		NR	NR	NR	NR	NR	0
RWS	TP		NR	NR	NR	NR	NR	0
TIER 2	TP		NR	NR	NR	NR	NR	0
UIC	TP		NR	NR	NR	NR	NR	0
IHW CORR ACTION	0.250		0	0	NR	NR	NR	0
PST STAGE 2	0.250		1	0	NR	NR	NR	1
COMP HIST	TP		NR	NR	NR	NR	NR	0
MINES MRDS	TP		NR	NR	NR	NR	NR	0

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP	1.000		0	0	0	0	NR	0
EDR Hist Auto	0.125		2	NR	NR	NR	NR	2
EDR Hist Cleaner	0.125		0	NR	NR	NR	NR	0

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

RGA HWS	TP		NR	NR	NR	NR	NR	0
RGA LF	TP		NR	NR	NR	NR	NR	0

- Totals --		0	12	8	0	0	0	20

NOTES:

TP = Target Property

NR = Not Requested at this Search Distance

Sites may be listed in more than one database

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

A1
West
< 1/8
0.011 mi.
56 ft.

T & M GROCERY
1039 S VELASCO ST
ANGLETON, TX 77515

Site 1 of 5 in cluster A

UST
Financial Assurance
GCC
PST STAGE 2
CENTRAL REGISTRY

U001265912
N/A

Relative:
Higher

Actual:
26 ft.

UST:
Name: T & M GROCERY
Address: 1039 S VELASCO ST
City,State,Zip: ANGLETON, TX 775155249
AI Number: 32740
Facility Type: RETAIL
Facility Begin Date: 08/31/1987
Facility Status: ACTIVE
Additional ID: 268776722002087
Facility Exempt Status: N
Records Off-Site: No
UST Financial Assurance Required: Yes
Number Of Active UST: 2
Site Location Description: Not reported
Site Location (Nearest City Name): Not reported
Site Location (County Name): BRAZORIA
Site Location (Tceq Region): 12
Site Location (Location Zip): 77515
Contact Name/Title: RAHIM MAKNOJIA,REP
Contact Organization Name: T & M GROCERY
Contact Mailing Address1: Not reported
Contact Mailing Address2: Not reported
Contact Mailing City/State/Zip: Not reported
Contact Telephone: 9798493006
Facility Contact Address Deliverable: Not reported
Contact Fax Number: Not reported
Contact Email Address: Not reported
Signature Date On Earliest Reg Form: 01/01/2016
Signature Name/Title On Earliest Reg Form: AKBAR MOMIN,PRESIDENT
Application Received Date On Earliest Reg Form: 01/26/2016
Signature Role On Earliest Reg Form: OWNER
Signature Company On Earliest Reg Form: Not reported
Enforcement Action: No
Facility Not Inspectable: No

Operator:
Princ ID: 259776722002087
Additional ID: 268776722002087
AI Number: 32740
Operator CN: CN600992275
Operator Name: GOD BLESS INC
Operator Effective Begin Date: 09/01/1987
Operator Type: CO
Operator Role: OPRCON
Contact Name: AKBAR MOMIN/REP
Contact Organization Name: GOD BLESS INC
Contact Mailing Address (Delivery): 1039 S VELASCO ST
Contact Mailing Address (Internal Delivery): Not reported
Contact Mailing City/State/Zip: ANGLETON TX 77515-5249
Contact Phone Country Code: 1
Contact Phone Area Code: 979
Contact Phone Number: 8493006
Contact Phone Extension: 0
Contact Fax Country Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Contact Fax Area Code:	Not reported
Contact Fax Number:	Not reported
Contact Fax Extension:	Not reported
Contact Email Address:	Not reported
Contact Address Deliverable:	Not reported

Owner:

Owner CN:	CN600992275
Owner Last Name:	GOD BLESS INC
Owner First Name:	Not reported
Owner Middle Name:	Not reported
Owner Type:	CO
Contact Mailing Address (Delivery):	1039 S VELASCO ST
Contact Mailing Address (Internal Delivery):	Not reported
Contact Mailing City:	ANGLETON
Contact Mailing State:	TX
Contact Mailing Zip:	77515
Contact Mailing Zip5:	5249
Contact Phone Number/Ext:	1 979 8493006/0
Contact Fax Country Code:	Not reported
Contact Fax Number/Ext:	/
Contact Email Address:	Not reported
Contact Address Deliverable:	Not reported
Princ ID:	259776722002087
Additional ID:	268776722002087
AI Number:	32740
Owner Effective Begin Date:	09/01/1987
State Tax ID:	17602847323
Contact Role:	OWNCON
Contact Name/Title:	AKBAR MOMIN/REP
Contact Organization Name:	GOD BLESS INC

Self Certification:

Self Cert ID:	83626
Cert ID:	264268
AI Number:	32740
Self Certification Date:	01/01/2016
Signature Name/Title:	AKBAR MOMIN PRESIDENT
Signature Type Role:	OWNER
Filing Status:	RENEWAL
Registration Self Certification Flag:	Y
Facility Fees Self Certification Flag:	Y
Financial Assurance Self Certification Flag:	Y
Technical Standards Self Certification Flag:	Y
Delivery Certificate Expiration Date:	01/31/2017
Reporting Method:	P
Tank Corrosion Protection Compliance:	Y
Piping Corrosion Protection Compliance:	Y
Compartment Release Detection Compliance:	Y
Piping Release Detection Compliance:	Y
Spill Prevention/Overfill Compliance:	Y

Self Cert ID:	83626
Cert ID:	247155
AI Number:	32740
Self Certification Date:	12/16/2014

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Signature Name/Title:	AKBAR MOMIN PRES
Signature Type Role:	OWNER
Filing Status:	RENEWAL
Registration Self Certification Flag:	Y
Facility Fees Self Certification Flag:	Y
Financial Assurance Self Certification Flag:	Y
Technical Standards Self Certification Flag:	Y
Delivery Certificate Expiration Date:	01/31/2016
Reporting Method:	P
Tank Corrosion Protection Compliance:	Y
Piping Corrosion Protection Compliance:	Y
Compartment Release Detection Compliance:	Y
Piping Release Detection Compliance:	Y
Spill Prevention/Overfill Compliance:	Y
Self Cert ID:	83626
Cert ID:	231901
AI Number:	32740
Self Certification Date:	01/01/2014
Signature Name/Title:	AKBAR MOMIN PRESIDENT
Signature Type Role:	OWNER
Filing Status:	RENEWAL
Registration Self Certification Flag:	Y
Facility Fees Self Certification Flag:	Y
Financial Assurance Self Certification Flag:	Y
Technical Standards Self Certification Flag:	Y
Delivery Certificate Expiration Date:	01/31/2015
Reporting Method:	P
Tank Corrosion Protection Compliance:	Y
Piping Corrosion Protection Compliance:	Y
Compartment Release Detection Compliance:	Y
Piping Release Detection Compliance:	Y
Spill Prevention/Overfill Compliance:	Y
Self Cert ID:	83626
Cert ID:	133799
AI Number:	32740
Self Certification Date:	11/05/2012
Signature Name/Title:	WES COOPER REP
Signature Type Role:	LEGAL AUTH REP OWNER
Filing Status:	RENEWAL
Registration Self Certification Flag:	Y
Facility Fees Self Certification Flag:	Y
Financial Assurance Self Certification Flag:	Y
Technical Standards Self Certification Flag:	Y
Delivery Certificate Expiration Date:	01/31/2014
Reporting Method:	Not reported
Tank Corrosion Protection Compliance:	Not reported
Piping Corrosion Protection Compliance:	Not reported
Compartment Release Detection Compliance:	Not reported
Piping Release Detection Compliance:	Not reported
Spill Prevention/Overfill Compliance:	Not reported
Self Cert ID:	83626
Cert ID:	133798
AI Number:	32740
Self Certification Date:	12/03/2011

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Signature Name/Title:	MUSTAK S MARIDIA REP
Signature Type Role:	OWNER
Filing Status:	RENEWAL
Registration Self Certification Flag:	Y
Facility Fees Self Certification Flag:	Y
Financial Assurance Self Certification Flag:	Y
Technical Standards Self Certification Flag:	Y
Delivery Certificate Expiration Date:	01/31/2013
Reporting Method:	Not reported
Tank Corrosion Protection Compliance:	Not reported
Piping Corrosion Protection Compliance:	Not reported
Compartment Release Detection Compliance:	Not reported
Piping Release Detection Compliance:	Not reported
Spill Prevention/Overfill Compliance:	Not reported
Self Cert ID:	83626
Cert ID:	133797
AI Number:	32740
Self Certification Date:	01/06/2011
Signature Name/Title:	AKBAR MOMIN REP
Signature Type Role:	LEGAL AUTH REP OWNER
Filing Status:	RENEWAL
Registration Self Certification Flag:	Y
Facility Fees Self Certification Flag:	Y
Financial Assurance Self Certification Flag:	Y
Technical Standards Self Certification Flag:	Y
Delivery Certificate Expiration Date:	01/31/2012
Reporting Method:	Not reported
Tank Corrosion Protection Compliance:	Not reported
Piping Corrosion Protection Compliance:	Not reported
Compartment Release Detection Compliance:	Not reported
Piping Release Detection Compliance:	Not reported
Spill Prevention/Overfill Compliance:	Not reported
Self Cert ID:	83626
Cert ID:	133796
AI Number:	32740
Self Certification Date:	11/26/2009
Signature Name/Title:	MUSTAK MAREDIAY REP
Signature Type Role:	LEGAL AUTH REP OWNER
Filing Status:	RENEWAL
Registration Self Certification Flag:	Y
Facility Fees Self Certification Flag:	Y
Financial Assurance Self Certification Flag:	Y
Technical Standards Self Certification Flag:	Y
Delivery Certificate Expiration Date:	01/31/2011
Reporting Method:	Not reported
Tank Corrosion Protection Compliance:	Not reported
Piping Corrosion Protection Compliance:	Not reported
Compartment Release Detection Compliance:	Not reported
Piping Release Detection Compliance:	Not reported
Spill Prevention/Overfill Compliance:	Not reported
Self Cert ID:	83626
Cert ID:	133795
AI Number:	32740
Self Certification Date:	11/05/2008

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Signature Name/Title: NANCY WENDEL REP
Signature Type Role: LEGAL AUTH REP OWNER
Filing Status: RENEWAL
Registration Self Certification Flag: Y
Facility Fees Self Certification Flag: Y
Financial Assurance Self Certification Flag: Y
Technical Standards Self Certification Flag: Y
Delivery Certificate Expiration Date: 01/31/2010
Reporting Method: Not reported
Tank Corrosion Protection Compliance: Not reported
Piping Corrosion Protection Compliance: Not reported
Compartment Release Detection Compliance: Not reported
Piping Release Detection Compliance: Not reported
Spill Prevention/Overfill Compliance: Not reported

Self Cert ID: 83626
Cert ID: 133794
AI Number: 32740
Self Certification Date: 02/28/2008
Signature Name/Title: I GHATONI REP
Signature Type Role: LEGAL AUTH REP OWNER
Filing Status: RENEWAL
Registration Self Certification Flag: Y
Facility Fees Self Certification Flag: Y
Financial Assurance Self Certification Flag: Y
Technical Standards Self Certification Flag: Y
Delivery Certificate Expiration Date: 01/31/2009
Reporting Method: Not reported
Tank Corrosion Protection Compliance: Not reported
Piping Corrosion Protection Compliance: Not reported
Compartment Release Detection Compliance: Not reported
Piping Release Detection Compliance: Not reported
Spill Prevention/Overfill Compliance: Not reported

Self Cert ID: 83626
Cert ID: 133793
AI Number: 32740
Self Certification Date: 11/07/2006
Signature Name/Title: WEDAILL JAVID REP
Signature Type Role: LEGAL AUTH REP OWNER
Filing Status: RENEWAL
Registration Self Certification Flag: Y
Facility Fees Self Certification Flag: Y
Financial Assurance Self Certification Flag: Y
Technical Standards Self Certification Flag: Y
Delivery Certificate Expiration Date: 01/31/2008
Reporting Method: Not reported
Tank Corrosion Protection Compliance: Not reported
Piping Corrosion Protection Compliance: Not reported
Compartment Release Detection Compliance: Not reported
Piping Release Detection Compliance: Not reported
Spill Prevention/Overfill Compliance: Not reported

Self Cert ID: 83626
Cert ID: 133792
AI Number: 32740
Self Certification Date: 11/07/2005

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Signature Name/Title: MIKE BAHNDRI REP
Signature Type Role: LEGAL AUTH REP OWNER
Filing Status: RENEWAL
Registration Self Certification Flag: Y
Facility Fees Self Certification Flag: Y
Financial Assurance Self Certification Flag: Y
Technical Standards Self Certification Flag: Y
Delivery Certificate Expiration Date: 01/31/2007
Reporting Method: Not reported
Tank Corrosion Protection Compliance: Not reported
Piping Corrosion Protection Compliance: Not reported
Compartment Release Detection Compliance: Not reported
Piping Release Detection Compliance: Not reported
Spill Prevention/Overfill Compliance: Not reported

Self Cert ID: 83626
Cert ID: 133791
AI Number: 32740
Self Certification Date: 11/01/2004
Signature Name/Title: SADIK ALI REP
Signature Type Role: LEGAL AUTH REP OWNER
Filing Status: RENEWAL
Registration Self Certification Flag: Y
Facility Fees Self Certification Flag: Y
Financial Assurance Self Certification Flag: Y
Technical Standards Self Certification Flag: Y
Delivery Certificate Expiration Date: 01/31/2006
Reporting Method: Not reported
Tank Corrosion Protection Compliance: Not reported
Piping Corrosion Protection Compliance: Not reported
Compartment Release Detection Compliance: Not reported
Piping Release Detection Compliance: Not reported
Spill Prevention/Overfill Compliance: Not reported

Self Cert ID: 83626
Cert ID: 133790
AI Number: 32740
Self Certification Date: 12/05/2003
Signature Name/Title: SOHAIL ALI REP
Signature Type Role: LEGAL AUTH REP OWNER
Filing Status: RENEWAL
Registration Self Certification Flag: Y
Facility Fees Self Certification Flag: Y
Financial Assurance Self Certification Flag: Y
Technical Standards Self Certification Flag: Y
Delivery Certificate Expiration Date: 01/31/2005
Reporting Method: Not reported
Tank Corrosion Protection Compliance: Not reported
Piping Corrosion Protection Compliance: Not reported
Compartment Release Detection Compliance: Not reported
Piping Release Detection Compliance: Not reported
Spill Prevention/Overfill Compliance: Not reported

Self Cert ID: 83626
Cert ID: 133789
AI Number: 32740
Self Certification Date: 01/07/2003

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Signature Name/Title: ALI SAEDE
Signature Type Role: LEGAL AUTH REP OWNER
Filing Status: RENEWAL
Registration Self Certification Flag: Y
Facility Fees Self Certification Flag: Y
Financial Assurance Self Certification Flag: Y
Technical Standards Self Certification Flag: Y
Delivery Certificate Expiration Date: 01/31/2004
Reporting Method: Not reported
Tank Corrosion Protection Compliance: Not reported
Piping Corrosion Protection Compliance: Not reported
Compartment Release Detection Compliance: Not reported
Piping Release Detection Compliance: Not reported
Spill Prevention/Overfill Compliance: Not reported

Self Cert ID: 83626
Cert ID: 133788
AI Number: 32740
Self Certification Date: 05/09/2002
Signature Name/Title: SCOTT BAXTER OWNERS REP
Signature Type Role: LEGAL AUTH REP OWNER
Filing Status: RENEWAL
Registration Self Certification Flag: Y
Facility Fees Self Certification Flag: Y
Financial Assurance Self Certification Flag: Y
Technical Standards Self Certification Flag: Y
Delivery Certificate Expiration Date: 01/31/2003
Reporting Method: Not reported
Tank Corrosion Protection Compliance: Not reported
Piping Corrosion Protection Compliance: Not reported
Compartment Release Detection Compliance: Not reported
Piping Release Detection Compliance: Not reported
Spill Prevention/Overfill Compliance: Not reported

Self Cert ID: 83626
Cert ID: 133787
AI Number: 32740
Self Certification Date: 12/01/2001
Signature Name/Title: AKBAR MOMIN PRES
Signature Type Role: OWNER
Filing Status: INITIAL
Registration Self Certification Flag: Y
Facility Fees Self Certification Flag: Y
Financial Assurance Self Certification Flag: Y
Technical Standards Self Certification Flag: Y
Delivery Certificate Expiration Date: 01/31/2002
Reporting Method: Not reported
Tank Corrosion Protection Compliance: Not reported
Piping Corrosion Protection Compliance: Not reported
Compartment Release Detection Compliance: Not reported
Piping Release Detection Compliance: Not reported
Spill Prevention/Overfill Compliance: Not reported

Tank:

Install Date: 01/01/1960
Tank Registration Date: 05/08/1986
Number of Compartments: 1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Tank Capacity:	4000
Tank Singlewall:	N
Tank Doublewall:	N
Pipe Type:	Not reported
UST ID:	85940
Facility ID:	83626
Ai Number:	32740
Tank Id:	1A
Tank Status (Current):	REMOVED FROM GROUND
Tank Status Date:	02/05/2001
Empty:	N
Tank Regulatory Status:	FULLY REGULATED
Tank Int Prot (Internal Tank Lining Date):	Not reported
Piping Design (Single Wall):	N
Piping Design (Double Wall):	N
Tank Ext Cont(Fac-Built Nonmetallic Jacket):	N
Tank Ext Cont(Syn Tank-Pit/Piping-Trench Liner):	N
Tank Ext Cont(Tank Vault/Rigid Trench Liner):	N
Piping Ext Cont(Fac-Built Nonmetallic Jacket):	N
Piping Ext Cont(Syn Tank-Pit/Piping-Trench Liner):	N
Piping Ext Cont(Tank Vault/Rigid Trench Liner):	N
Tank Material (Steel):	Y
Tank Material(Frp(Fiberglass-Reinforced Plastic):	N
Tank Mat(Composite (Steel W/Ext Frp Cladding)):	N
Tank Mat(Concrete):	N
Tank Mat(Jacketed (Steel W/Ext Nonmetallic Jck)):	N
Tank Mat(Coated(Steel W/ExtPolyurethane Cladding)):	N
Piping Material (Steel):	Y
Piping Mat(Frp(Fiberglass Reinforced Plastic):	N
Piping Mat(Concrete):	N
Piping Mat(Jacketed(Steel W/Ext Nonmetallic Jacket)):	N
Piping Mat(Nonmetallic Flex Piping):	N
PipingConnect/Valves(Shear/Impact Valves(Under Disp)):	N
Piping Connect/Valves(Steel Swing-Joints(End Of Piping)):	N
Piping Connect/Valves (Flex Connectors(Ends Of Piping)):	N
Tank Corr Prot Meth(TCPM)(Cathodic-Field Installation):	N
TCPM (ExtDielectricCoat/Laminate/Tape/Wrap):	N
TCPM(Cathodic Prot-FacInstallation):	N
TCPM(Composite Tank(Steel W/Frp Ext Laminate):	N
TCPMeth(Coated Tank(Steel W/ExtPolyurethaneLaminate):	N
TCPM(FRP Tank Or Piping(Noncorrodible)):	N
TCPM(Ext Nonmetallic Jacket):	N
TCPMeth(Unnecessary Per Corrosion Prot Spec):	N
Piping Corr Prot Meth(Dielectric Coat/Laminate/Tape/Wrap):	N
Piping Corr Prot Method(PCPM) (Cathodic Factory Install):	N
PCPM(Cathodic Prot-Field Install):	N
PCPMethod (FRP Tank Or Piping(Noncorrodible):	N
PCPM(Nonmetallic FlexPiping (Noncorrodible)):	N
PCPMeth(Isolated Open Area/2nd Containment):	N
PCPM (Dual Protected):	N
PCPM(Unnec Per Corrosion Prot Specialist):	N
Tank Corr Prot Compliance Flag:	N
Piping Corr Prot Compliance Flag:	N
Tank Corrosion Prot Variance:	N
Piping Corrosion Prot Variance:	N
Temp Out Of Service Compliance:	N
Technical Compliance Flag:	N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Tank Tested Flag:	Y
Installation Signature Date:	11/16/1990
Compartment Records:	
Tank ID:	1A
Tank Capacity:	4000
UST Comprt ID:	127465
UST ID:	85940
AI Number:	32740
Compartment ID:	A
Substance Stored1:	GASOLINE
Substance Stored2:	Not reported
Substance Stored3:	Not reported
CompartmentReleaseDetectionMethod(Vapor):	N
CRDM(GW Monitoring):	N
CRDM(Monitoring Of Secondary Cont Barrier):	N
CRDM(Auto Tank Gauge Test/Inv Control):	N
CRDM(Interstitial Monitoring SecWall/Jacket):	N
CRDM(Wkly Manual Gauging(Tanks<=1000 G):	N
CRDM(Mthly Tank Gauging(Emer Gen Tanks):	N
CRDM(Sir (Stat Inv Reconciliation)/Inv Control):	N
PipingReleaseDetectionMethod(PRDM)(Vapor):	N
PRDM(Groundwater Monitoring):	N
PRDM(Monitoring Sec Containment Barrier):	N
PRDM(InterstitialMonitoring w/in SecWall/Jacket):	N
PRDM(Mthly Piping Tightness Test)@.2Gph:	N
PRDM(AnnualPipingTightTest/ElecMon@.1Gph:	N
PRDM(TriennialTightTest(Suction/GravityPiping):	N
PRDM AutoLineLeakDet(3.0 Gph PressPiping):	N
PRDM(Sir(StatInv Recon)/Inv Control):	N
PRDM(Exempt System Suction:	N
Spill Overfill Prevention Equip(SOPE):	N
SOPE(Spill Cont/Bucket/Sump):	N
SOPE(DelShut-Off Valve):	N
SOPE(FlowRestrictorValue:	N
SOPE(Alarm (Set@<=90%) W/3a Or 3b:	N
SOPE(N/A Deliveries To Tank<=25G):	N
Compartment Release Det Compliance Flag:	N
Piping Release Detection Compliance Flag):	N
Spill/OverfillPreventionCompliance Flag:	N
Compartment Release Detection Variance:	N
Piping Release Detection Variance:	N
Spill And Overfill Prevention Variance:	N
Stage I Vapor Recovery:	Not reported
Stage 1 Installation Date:	Not reported
More Self Certification:	
Self Cert ID:	12560
Cert ID:	278773
UST Comprt ID:	803732
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	312656

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

UST Comprt ID:	904815
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48449
UST Comprt ID:	160791
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48451
UST Comprt ID:	160787
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	295348
UST Comprt ID:	852968
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48448
UST Comprt ID:	160790
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48452
UST Comprt ID:	160786
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48455
UST Comprt ID:	160783
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48460
UST Comprt ID:	160778

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48447
UST Comprt ID:	160789
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48453
UST Comprt ID:	160785
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	261651
UST Comprt ID:	753280
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48456
UST Comprt ID:	160782
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48458
UST Comprt ID:	160780
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48454
UST Comprt ID:	160784
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48450
UST Comprt ID:	160788
UST ID:	43341

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	245553
UST Comprt ID:	705860
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	228542
UST Comprt ID:	655898
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48457
UST Comprt ID:	160781
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48459
UST Comprt ID:	160779
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Install Date:	01/01/1960
Tank Registration Date:	05/08/1986
Number of Compartments:	1
Tank Capacity:	4000
Tank Singlewall:	N
Tank Doublewall:	N
Pipe Type:	Not reported
UST ID:	85941
Facility ID:	83626
AI Number:	32740
Tank Id:	2A
Tank Status (Current):	REMOVED FROM GROUND
Tank Status Date:	02/05/2001
Empty:	N
Tank Regulatory Status:	FULLY REGULATED
Tank Int Prot (Internal Tank Lining Date):	Not reported
Piping Design (Single Wall):	N
Piping Design (Double Wall):	N
Tank Ext Cont(Fac-Built Nonmetallic Jacket):	N
Tank Ext Cont(Syn Tank-Pit/Piping-Trench Liner):	N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Tank Ext Cont(Tank Vault/Rigid Trench Liner):	N
Piping Ext Cont(Fac-Built Nonmetallic Jacket):	N
Piping Ext Cont(Syn Tank-Pit/Piping-Trench Liner):	N
Piping Ext Cont(Tank Vault/Rigid Trench Liner):	N
Tank Material (Steel):	Y
Tank Material(Frp(Fiberglass-Reinforced Plastic):	N
Tank Mat(Composite (Steel W/Ext Frp Cladding)):	N
Tank Mat(Concrete):	N
Tank Mat(Jacketed (Steel W/Ext Nonmetallic Jck)):	N
Tank Mat(Coated(Steel W/ExtPolyurethane Cladding)):	N
Piping Material (Steel):	Y
Piping Mat(Frp(Fiberglass Reinforced Plastic):	N
Piping Mat(Concrete):	N
Piping Mat(Jacketed(Steel W/Ext Nonmetallic Jacket)):	N
Piping Mat(Nonmetallic Flex Piping):	N
PipingConnect/Valves(Shear/Impact Valves(Under Disp)):	N
Piping Connect/Valves(Steel Swing-Joints(End Of Piping)):	N
Piping Connect/Valves (Flex Connectors(Ends Of Piping)):	N
Tank Corr Prot Meth(TCPM)(Cathodic-Field Installation):	N
TCPM (ExtDielectricCoat/Laminate/Tape/Wrap):	N
TCPM(Cathodic Prot-FacInstallation):	N
TCPM(Composite Tank(Steel W/Frp Ext Laminate):	N
TCPMeth(Coated Tank(Steel W/ExtPolyurethaneLaminate):	N
TCPM(FRP Tank Or Piping(Noncorrodible)):	N
TCPM(Ext Nonmetallic Jacket):	N
TCPMeth(Unnecessary Per Corrosion Prot Spec):	N
Piping Corr Prot Meth(Dielectric Coat/Laminate/Tape/Wrap):	N
Piping Corr Prot Method(PCPM) (Cathodic Factory Install):	N
PCPM(Cathodic Prot-Field Install):	N
PCPMethod (FRP Tank Or Piping(Noncorrodible):	N
PCPM(Nonmetallic FlexPiping (Noncorrodible)):	N
PCPMeth(Isolated Open Area/2nd Containment):	N
PCPM (Dual Protected):	N
PCPM(Unnec Per Corrosion Prot Specialist):	N
Tank Corr Prot Compliance Flag:	N
Piping Corr Prot Compliance Flag:	N
Tank Corrosion Prot Variance:	N
Piping Corrosion Prot Variance:	N
Temp Out Of Service Compliance:	N
Technical Compliance Flag:	N
Tank Tested Flag:	Y
Installation Signature Date:	11/16/1990

Compartment Records:

Tank ID:	2A
Tank Capacity:	4000
UST Comprt ID:	127466
UST ID:	85941
AI Number:	32740
Compartment ID:	A
Substance Stored1:	DIESEL
Substance Stored2:	Not reported
Substance Stored3:	Not reported
CompartmentReleaseDetectionMethod(Vapor):	N
CRDM(GW Monitoring):	N
CRDM(Monitoring Of Secondary Cont Barrier):	N
CRDM(Auto Tank Gauge Test/Inv Control):	N
CRDM(Interstitial Monitoring SecWall/Jacket):	N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

CRDM(Wkly Manual Gauging(Tanks<=1000 G):	N
CRDM(Mthly Tank Gauging(Emer Gen Tanks):	N
CRDM(Sir (Stat Inv Reconciliation)/Inv Control):	N
PipingReleaseDetectionMethod(PRDM)(Vapor):	N
PRDM(Groundwater Monitoring):	N
PRDM(Monitoring Sec Containment Barrier):	N
PRDM(InterstitialMonitoring w/in SecWall/Jacket):	N
PRDM(Mthly Piping Tightness Test)@.2Gph:	N
PRDM(AnnualPipingTightTest/ElecMon@.1Gph:	N
PRDM(TriennialTightTest(Suction/GravityPiping):	N
PRDM AutoLineLeakDet(3.0 Gph PressPiping):	N
PRDM(Sir(StatInv Recon)/Inv Control):	N
PRDM(Exempt System Suction:	N
Spill Overfill Prevention Equip(SOPE):	N
SOPE(Spill Cont/Bucket/Sump):	N
SOPE(DelShut-Off Valve):	N
SOPE(FlowRestrictorValue:	N
SOPE(Alarm (Set@<=90%) W/3a Or 3b:	N
SOPE(N/A Deliveries To Tank<=25G):	N
Compartment Release Det Compliance Flag:	N
Piping Release Detection Compliance Flag):	N
Spill/OverfillPreventionCompliance Flag:	N
Compartment Release Detection Variance:	N
Piping Release Detection Variance:	N
Spill And Overfill Prevention Variance:	N
Stage I Vapor Recovery:	Not reported
Stage 1 Installation Date:	Not reported

More Self Certification:

Self Cert ID:	12560
Cert ID:	278773
UST Comprt ID:	803732
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A

Self Cert ID:	12560
Cert ID:	312656
UST Comprt ID:	904815
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A

Self Cert ID:	12560
Cert ID:	48449
UST Comprt ID:	160791
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A

Self Cert ID:	12560
Cert ID:	48451
UST Comprt ID:	160787
UST ID:	43341

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 295348
UST Comprt ID: 852968
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 48448
UST Comprt ID: 160790
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 48452
UST Comprt ID: 160786
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 48455
UST Comprt ID: 160783
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 48460
UST Comprt ID: 160778
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 48447
UST Comprt ID: 160789
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 48453
UST Comprt ID: 160785
UST ID: 43341
AI Number: 32740

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	261651
UST Comprt ID:	753280
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48456
UST Comprt ID:	160782
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48458
UST Comprt ID:	160780
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48454
UST Comprt ID:	160784
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48450
UST Comprt ID:	160788
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	245553
UST Comprt ID:	705860
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	228542
UST Comprt ID:	655898
UST ID:	43341
AI Number:	32740
Tank ID:	1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48457
UST Comprt ID:	160781
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48459
UST Comprt ID:	160779
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Install Date:	01/01/1960
Tank Registration Date:	05/08/1986
Number of Compartments:	1
Tank Capacity:	3000
Tank Singlewall:	N
Tank Doublewall:	N
Pipe Type:	Not reported
UST ID:	85942
Facility ID:	83626
AI Number:	32740
Tank Id:	3
Tank Status (Current):	REMOVED FROM GROUND
Tank Status Date:	02/05/2001
Empty:	N
Tank Regulatory Status:	FULLY REGULATED
Tank Int Prot (Internal Tank Lining Date):	Not reported
Piping Design (Single Wall):	N
Piping Design (Double Wall):	N
Tank Ext Cont(Fac-Built Nonmetallic Jacket):	N
Tank Ext Cont(Syn Tank-Pit/Piping-Trench Liner):	N
Tank Ext Cont(Tank Vault/Rigid Trench Liner):	N
Piping Ext Cont(Fac-Built Nonmetallic Jacket):	N
Piping Ext Cont(Syn Tank-Pit/Piping-Trench Liner):	N
Piping Ext Cont(Tank Vault/Rigid Trench Liner):	N
Tank Material (Steel):	Y
Tank Material(Frp(Fiberglass-Reinforced Plastic):	N
Tank Mat(Composite (Steel W/Ext Frp Cladding)):	N
Tank Mat(Concrete):	N
Tank Mat(Jacketed (Steel W/Ext Nonmetallic Jck)):	N
Tank Mat(Coated(Steel W/ExtPolyurethane Cladding)):	N
Piping Material (Steel):	Y
Piping Mat(Frp(Fiberglass Reinforced Plastic):	N
Piping Mat(Concrete):	N
Piping Mat(Jacketed(Steel W/Ext Nonmetallic Jacket)):	N
Piping Mat(Nonmetallic Flex Piping):	N
PipingConnect/Valves(Shear/Impact Valves(Under Disp)):	N
Piping Connect/Valves(Steel Swing-Joints(End Of Piping)):	N
Piping Connect/Valves (Flex Connectors(Ends Of Piping)):	N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Tank Corr Prot Meth(TCPM)(Cathodic-Field Installation): N
TCPM (ExtDielectricCoat/Laminate/Tape/Wrap): N
TCPM(Cathodic Prot-FacInstallation): N
TCPM(Composite Tank(Steel W/Frp Ext Laminate): N
TCPMeth(Coated Tank(Steel W/ExtPolyurethaneLaminate): N
TCPM(FRP Tank Or Piping(Noncorrodible)): N
TCPM(Ext Nonmetallic Jacket): N
TCPMeth(Unnecessary Per Corrosion Prot Spec): N
Piping Corr Prot Meth(Dielectric Coat/Laminate/Tape/Wrap): N
Piping Corr Prot Method(PCPM) (Cathodic Factory Install): N
PCPM(Cathodic Prot-Field Install): N
PCPMeth (FRP Tank Or Piping(Noncorrodible): N
PCPM(Nonmetallic FlexPiping (Noncorrodible)): N
PCPMeth(Isolated Open Area/2nd Containment): N
PCPM (Dual Protected): N
PCPM(Unnec Per Corrosion Prot Specialist): N
Tank Corr Prot Compliance Flag: N
Piping Corr Prot Compliance Flag: N
Tank Corrosion Prot Variance: N
Piping Corrosion Prot Variance: N
Temp Out Of Service Compliance: N
Technical Compliance Flag: N
Tank Tested Flag: Y
Installation Signature Date: 11/16/1990

Compartment Records:

Tank ID: 3
Tank Capacity: 3000
UST Comprt ID: 127467
UST ID: 85942
AI Number: 32740
Compartment ID: A
Substance Stored1: GASOLINE
Substance Stored2: Not reported
Substance Stored3: Not reported
CompartmentReleaseDetectionMethod(Vapor): N
CRDM(GW Monitoring): N
CRDM(Monitoring Of Secondary Cont Barrier): N
CRDM(Auto Tank Gauge Test/Inv Control): N
CRDM(Interstitial Monitoring SecWall/Jacket): N
CRDM(Wkly Manual Gauging(Tanks<=1000 G): N
CRDM(Mthly Tank Gauging(Emer Gen Tanks): N
CRDM(Sir (Stat Inv Reconciliation)/Inv Control): N
PipingReleaseDetectionMethod(PRDM)(Vapor): N
PRDM(Groundwater Monitoring): N
PRDM(Monitoring Sec Containment Barrier): N
PRDM(InterstitialMonitoring w/in SecWall/Jacket): N
PRDM(Mthly Piping Tightness Test)@.2Gph: N
PRDM(AnnualPipingTightTest/ElecMon@.1Gph: N
PRDM(TriennialTightTest(Suction/GravityPiping): N
PRDM AutoLineLeakDet(3.0 Gph PressPiping): N
PRDM(Sir(StatInv Recon)/Inv Control)): N
PRDM(Exempt System Suction: N
Spill Overfill Prevention Equip(SOPE): N
SOPE(Spill Cont/Bucket/Sump): N
SOPE(DelShut-Off Valve)): N
SOPE(FlowRestrictorValue: N
SOPE(Alarm (Set@<=90%) W/3a Or 3b: N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

SOPE(N/A Deliveries To Tank<=25G): N
Compartment Release Det Compliance Flag: N
Piping Release Detection Compliance Flag): N
Spill/OverfillPreventionCompliance Flag: N
Compartment Release Detection Variance: N
Piping Release Detection Variance: N
Spill And Overfill Prevention Variance: N
Stage I Vapor Recovery: Not reported
Stage 1 Installation Date: Not reported

More Self Certification:

Self Cert ID: 12560
Cert ID: 278773
UST Comprt ID: 803732
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 312656
UST Comprt ID: 904815
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 48449
UST Comprt ID: 160791
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 48451
UST Comprt ID: 160787
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 295348
UST Comprt ID: 852968
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 48448
UST Comprt ID: 160790
UST ID: 43341
AI Number: 32740
Tank ID: 1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48452
UST Comprt ID:	160786
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48455
UST Comprt ID:	160783
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48460
UST Comprt ID:	160778
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48447
UST Comprt ID:	160789
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48453
UST Comprt ID:	160785
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	261651
UST Comprt ID:	753280
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48456
UST Comprt ID:	160782
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Self Cert ID: 12560
Cert ID: 48458
UST Comprt ID: 160780
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 48454
UST Comprt ID: 160784
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 48450
UST Comprt ID: 160788
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 245553
UST Comprt ID: 705860
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 228542
UST Comprt ID: 655898
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 48457
UST Comprt ID: 160781
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 48459
UST Comprt ID: 160779
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Install Date:	01/01/1960
Tank Registration Date:	05/08/1986
Number of Compartments:	1
Tank Capacity:	500
Tank Singlewall:	N
Tank Doublewall:	N
Pipe Type:	Not reported
UST ID:	85943
Facility ID:	83626
Ai Number:	32740
Tank Id:	5
Tank Status (Current):	REMOVED FROM GROUND
Tank Status Date:	02/05/2001
Empty:	N
Tank Regulatory Status:	FULLY REGULATED
Tank Int Prot (Internal Tank Lining Date):	Not reported
Piping Design (Single Wall):	N
Piping Design (Double Wall):	N
Tank Ext Cont(Fac-Built Nonmetallic Jacket):	N
Tank Ext Cont(Syn Tank-Pit/Piping-Trench Liner):	N
Tank Ext Cont(Tank Vault/Rigid Trench Liner):	N
Piping Ext Cont(Fac-Built Nonmetallic Jacket):	N
Piping Ext Cont(Syn Tank-Pit/Piping-Trench Liner):	N
Piping Ext Cont(Tank Vault/Rigid Trench Liner):	N
Tank Material (Steel):	Y
Tank Material(Frp(Fiberglass-Reinforced Plastic):	N
Tank Mat(Composite (Steel W/Ext Frp Cladding)):	N
Tank Mat(Concrete):	N
Tank Mat(Jacketed (Steel W/Ext Nonmetallic Jck)):	N
Tank Mat(Coated(Steel W/ExtPolyurethane Cladding)):	N
Piping Material (Steel):	Y
Piping Mat(Frp(Fiberglass Reinforced Plastic):	N
Piping Mat(Concrete):	N
Piping Mat(Jacketed(Steel W/Ext Nonmetallic Jacket)):	N
Piping Mat(Nonmetallic Flex Piping):	N
PipingConnect/Valves(Shear/Impact Valves(Under Disp)):	N
Piping Connect/Valves(Steel Swing-Joints(End Of Piping)):	N
Piping Connect/Valves (Flex Connectors(Ends Of Piping)):	N
Tank Corr Prot Meth(TCPM)(Cathodic-Field Installation):	N
TCPM (ExtDielectricCoat/Laminate/Tape/Wrap):	N
TCPM(Cathodic Prot-FacInstallation):	N
TCPM(Composite Tank(Steel W/Frp Ext Laminate):	N
TCPMeth(Coated Tank(Steel W/ExtPolyurethaneLaminate):	N
TCPM(FRP Tank Or Piping(Noncorrodible)):	N
TCPM(Ext Nonmetallic Jacket):	N
TCPMeth(Unnecessary Per Corrosion Prot Spec):	N
Piping Corr Prot Meth(Dielectric Coat/Laminate/Tape/Wrap):	N
Piping Corr Prot Method(PCPM) (Cathodic Factory Install):	N
PCPM(Cathodic Prot-Field Install):	N
PCPMeth (FRP Tank Or Piping(Noncorrodible):	N
PCPM(Nonmetallic FlexPiping (Noncorrodible)):	N
PCPMeth(Isolated Open Area/2nd Containment):	N
PCPM (Dual Protected):	N
PCPM(Unnec Per Corrosion Prot Specialist):	N
Tank Corr Prot Compliance Flag:	N
Piping Corr Prot Compliance Flag:	N
Tank Corrosion Prot Variance:	N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Piping Corrosion Prot Variance: N
Temp Out Of Service Compliance: N
Technical Compliance Flag: N
Tank Tested Flag: Y
Installation Signature Date: 11/16/1990

Compartment Records:

Tank ID: 5
Tank Capacity: 500
UST Comprt ID: 127468
UST ID: 85943
AI Number: 32740
Compartment ID: A
Substance Stored1: USED OIL
Substance Stored2: Not reported
Substance Stored3: Not reported
CompartmentReleaseDetectionMethod(Vapor): N
CRDM(GW Monitoring): N
CRDM(Monitoring Of Secondary Cont Barrier): N
CRDM(Auto Tank Gauge Test/Inv Control): N
CRDM(Interstitial Monitoring SecWall/Jacket): N
CRDM(Wkly Manual Gauging(Tanks<=1000 G): N
CRDM(Mthly Tank Gauging(Emer Gen Tanks): N
CRDM(Sir (Stat Inv Reconciliation)/Inv Control): N
PipingReleaseDetectionMethod(PRDM)(Vapor): N
PRDM(Groundwater Monitoring): N
PRDM(Monitoring Sec Containment Barrier): N
PRDM(InterstitialMonitoring w/in SecWall/Jacket): N
PRDM(Mthly Piping Tightness Test)@.2Gph: N
PRDM(AnnualPipingTightTest/ElecMon@.1Gph: N
PRDM(TriennialTightTest(Suction/GravityPiping): N
PRDM AutoLineLeakDet(3.0 Gph PressPiping): N
PRDM(Sir(StatInv Recon)/Inv Control)): N
PRDM(Exempt System Suction: N
Spill Overfill Prevention Equip(SOPE): N
SOPE(Spill Cont/Bucket/Sump): N
SOPE(DelShut-Off Valve): N
SOPE(FlowRestrictorValue: N
SOPE(Alarm (Set@<=90%) W/3a Or 3b: N
SOPE(N/A Deliveries To Tank<=25G): N
Compartment Release Det Compliance Flag: N
Piping Release Detection Compliance Flag): N
Spill/OverfillPreventionCompliance Flag: N
Compartment Release Detection Variance: N
Piping Release Detection Variance: N
Spill And Overfill Prevention Variance: N
Stage I Vapor Recovery: Not reported
Stage 1 Installation Date: Not reported

More Self Certification:

Self Cert ID: 12560
Cert ID: 278773
UST Comprt ID: 803732
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Self Cert ID: 12560
Cert ID: 312656
UST Comprt ID: 904815
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 48449
UST Comprt ID: 160791
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 48451
UST Comprt ID: 160787
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 295348
UST Comprt ID: 852968
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 48448
UST Comprt ID: 160790
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 48452
UST Comprt ID: 160786
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 48455
UST Comprt ID: 160783
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Cert ID:	48460
UST Comprt ID:	160778
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48447
UST Comprt ID:	160789
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48453
UST Comprt ID:	160785
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	261651
UST Comprt ID:	753280
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48456
UST Comprt ID:	160782
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48458
UST Comprt ID:	160780
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48454
UST Comprt ID:	160784
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48450

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

UST Comprt ID: 160788
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 245553
UST Comprt ID: 705860
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 228542
UST Comprt ID: 655898
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 48457
UST Comprt ID: 160781
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 48459
UST Comprt ID: 160779
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Install Date: 01/01/1960
Tank Registration Date: 05/08/1986
Number of Compartments: 1
Tank Capacity: 3000
Tank Singlewall: N
Tank Doublewall: N
Pipe Type: Not reported
UST ID: 85944
Facility ID: 83626
AI Number: 32740
Tank Id: 4
Tank Status (Current): REMOVED FROM GROUND
Tank Status Date: 02/05/2001
Empty: N
Tank Regulatory Status: FULLY REGULATED
Tank Int Prot (Internal Tank Lining Date): Not reported
Piping Design (Single Wall): N
Piping Design (Double Wall): N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Tank Ext Cont(Fac-Built Nonmetallic Jacket):	N
Tank Ext Cont(Syn Tank-Pit/Piping-Trench Liner):	N
Tank Ext Cont(Tank Vault/Rigid Trench Liner):	N
Piping Ext Cont(Fac-Built Nonmetallic Jacket):	N
Piping Ext Cont(Syn Tank-Pit/Piping-Trench Liner):	N
Piping Ext Cont(Tank Vault/Rigid Trench Liner):	N
Tank Material (Steel):	Y
Tank Material(Frp(Fiberglass-Reinforced Plastic):	N
Tank Mat(Composite (Steel W/Ext Frp Cladding)):	N
Tank Mat(Concrete):	N
Tank Mat(Jacketed (Steel W/Ext Nonmetallic Jck)):	N
Tank Mat(Coated(Steel W/ExtPolyurethane Cladding)):	N
Piping Material (Steel):	Y
Piping Mat(Frp(Fiberglass Reinforced Plastic):	N
Piping Mat(Concrete):	N
Piping Mat(Jacketed(Steel W/Ext Nonmetallic Jacket)):	N
Piping Mat(Nonmetallic Flex Piping):	N
PipingConnect/Valves(Shear/Impact Valves(Under Disp)):	N
Piping Connect/Valves(Steel Swing-Joints(End Of Piping)):	N
Piping Connect/Valves (Flex Connectors(Ends Of Piping)):	N
Tank Corr Prot Meth(TCPM)(Cathodic-Field Installation):	N
TCPM (ExtDielectricCoat/Laminate/Tape/Wrap):	N
TCPM(Cathodic Prot-FacInstallation):	N
TCPM(Composite Tank(Steel W/Frp Ext Laminate):	N
TCPMeth(Coated Tank(Steel W/ExtPolyurethaneLaminate):	N
TCPM(FRP Tank Or Piping(Noncorrodible)):	N
TCPM(Ext Nonmetallic Jacket):	N
TCPMeth(Unnecessary Per Corrosion Prot Spec):	N
Piping Corr Prot Meth(Dielectric Coat/Laminate/Tape/Wrap):	N
Piping Corr Prot Method(PCPM) (Cathodic Factory Install):	N
PCPM(Cathodic Prot-Field Install):	N
PCPMeth (FRP Tank Or Piping(Noncorrodible):	N
PCPM(Nonmetallic FlexPiping (Noncorrodible)):	N
PCPMeth(Isolated Open Area/2nd Containment):	N
PCPM (Dual Protected):	N
PCPM(Unnec Per Corrosion Prot Specialist):	N
Tank Corr Prot Compliance Flag:	N
Piping Corr Prot Compliance Flag:	N
Tank Corrosion Prot Variance:	N
Piping Corrosion Prot Variance:	N
Temp Out Of Service Compliance:	N
Technical Compliance Flag:	N
Tank Tested Flag:	Y
Installation Signature Date:	11/16/1990
Compartment Records:	
Tank ID:	4
Tank Capacity:	3000
UST Comprt ID:	127469
UST ID:	85944
AI Number:	32740
Compartment ID:	A
Substance Stored1:	GASOLINE
Substance Stored2:	Not reported
Substance Stored3:	Not reported
CompartmentReleaseDetectionMethod(Vapor):	N
CRDM(GW Monitoring):	N
CRDM(Monitoring Of Secondary Cont Barrier):	N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

CRDM(Auto Tank Gauge Test/Inv Control):	N
CRDM(Interstitial Monitoring SecWall/Jacket):	N
CRDM(Wkly Manual Gauging(Tanks<=1000 G):	N
CRDM(Mthly Tank Gauging(Emer Gen Tanks):	N
CRDM(Sir (Stat Inv Reconciliation)/Inv Control):	N
PipingReleaseDetectionMethod(PRDM)(Vapor):	N
PRDM(Groundwater Monitoring):	N
PRDM(Monitoring Sec Containment Barrier):	N
PRDM(InterstitialMonitoring w/in SecWall/Jacket):	N
PRDM(Mthly Piping Tightness Test)@.2Gph:	N
PRDM(AnnualPipingTightTest/ElecMon@.1Gph:	N
PRDM(TriennialTightTest(Suction/GravityPiping):	N
PRDM AutoLineLeakDet(3.0 Gph PressPiping):	N
PRDM(Sir(StatInv Recon)/Inv Control)):	N
PRDM(Exempt System Suction:	N
Spill Overfill Prevention Equip(SOPE):	N
SOPE(Spill Cont/Bucket/Sump):	N
SOPE(DelShut-Off Valve):	N
SOPE(FlowRestrictorValue:	N
SOPE(Alarm (Set@<=90%) W/3a Or 3b:	N
SOPE(N/A Deliveries To Tank<=25G):	N
Compartment Release Det Compliance Flag:	N
Piping Release Detection Compliance Flag):	N
Spill/OverfillPreventionCompliance Flag:	N
Compartment Release Detection Variance:	N
Piping Release Detection Variance:	N
Spill And Overfill Prevention Variance:	N
Stage I Vapor Recovery:	Not reported
Stage 1 Installation Date:	Not reported

More Self Certification:

Self Cert ID:	12560
Cert ID:	278773
UST Comprt ID:	803732
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	312656
UST Comprt ID:	904815
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48449
UST Comprt ID:	160791
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48451

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

UST Comprt ID:	160787
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	295348
UST Comprt ID:	852968
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48448
UST Comprt ID:	160790
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48452
UST Comprt ID:	160786
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48455
UST Comprt ID:	160783
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48460
UST Comprt ID:	160778
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48447
UST Comprt ID:	160789
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48453
UST Comprt ID:	160785

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	261651
UST Comprt ID:	753280
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48456
UST Comprt ID:	160782
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48458
UST Comprt ID:	160780
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48454
UST Comprt ID:	160784
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48450
UST Comprt ID:	160788
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	245553
UST Comprt ID:	705860
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	228542
UST Comprt ID:	655898
UST ID:	43341

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48457
UST Comprt ID:	160781
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48459
UST Comprt ID:	160779
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Install Date:	02/05/2001
Tank Registration Date:	12/06/2001
Number of Compartments:	1
Tank Capacity:	12000
Tank Singlewall:	Y
Tank Doublewall:	N
Pipe Type:	P
UST ID:	198922
Facility ID:	83626
AI Number:	32740
Tank Id:	1
Tank Status (Current):	IN USE
Tank Status Date:	02/05/2001
Empty:	N
Tank Regulatory Status:	FULLY REGULATED
Tank Int Prot (Internal Tank Lining Date):	Not reported
Piping Design (Single Wall):	N
Piping Design (Double Wall):	Y
Tank Ext Cont(Fac-Built Nonmetallic Jacket):	N
Tank Ext Cont(Syn Tank-Pit/Piping-Trench Liner):	N
Tank Ext Cont(Tank Vault/Rigid Trench Liner):	N
Piping Ext Cont(Fac-Built Nonmetallic Jacket):	N
Piping Ext Cont(Syn Tank-Pit/Piping-Trench Liner):	N
Piping Ext Cont(Tank Vault/Rigid Trench Liner):	N
Tank Material (Steel):	N
Tank Material(Frp(Fiberglass-Reinforced Plastic):	N
Tank Mat(Composite (Steel W/Ext Frp Cladding)):	Y
Tank Mat(Concrete):	N
Tank Mat(Jacketed (Steel W/Ext Nonmetallic Jck)):	N
Tank Mat(Coated(Steel W/ExtPolyurethane Cladding)):	N
Piping Material (Steel):	N
Piping Mat(Frp(Fiberglass Reinforced Plastic):	N
Piping Mat(Concrete):	N
Piping Mat(Jacketed(Steel W/Ext Nonmetallic Jacket)):	N
Piping Mat(Nonmetallic Flex Piping):	Y
PipingConnect/Valves(Shear/Impact Valves(Under Disp)):	N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Piping Connect/Valves(Steel Swing-Joints(End Of Piping)): N
Piping Connect/Valves (Flex Connectors(Ends Of Piping)): N
Tank Corr Prot Meth(TCPM)(Cathodic-Field Installation): N
TCPM (ExtDielectricCoat/Laminate/Tape/Wrap): N
TCPM(Cathodic Prot-FacInstallation): N
TCPM(Composite Tank(Steel W/Frp Ext Laminate): Y
TCPMeth(Coated Tank(Steel W/ExtPolyurethaneLaminate): N
TCPM(FRP Tank Or Piping(Noncorrodible)): N
TCPM(Ext Nonmetallic Jacket): N
TCPMeth(Unnecessary Per Corrosion Prot Spec): N
Piping Corr Prot Meth(Dielectric Coat/Laminate/Tape/Wrap): N
Piping Corr Prot Method(PCPM) (Cathodic Factory Install): N
PCPM(Cathodic Prot-Field Install): N
PCPMeth (FRP Tank Or Piping(Noncorrodible): N
PCPM(Nonmetallic FlexPiping (Noncorrodible)): Y
PCPMeth(Isolated Open Area/2nd Containment): N
PCPM (Dual Protected): N
PCPM(Unnec Per Corrosion Prot Specialist): N
Tank Corr Prot Compliance Flag: Y
Piping Corr Prot Compliance Flag: Y
Tank Corrosion Prot Variance: N
Piping Corrosion Prot Variance: N
Temp Out Of Service Compliance: N
Technical Compliance Flag: N
Tank Tested Flag: Y
Installation Signature Date: 06/15/2001

Compartment Records:

Tank ID: 1
Tank Capacity: 12000
UST Comprt ID: 127470
UST ID: 198922
AI Number: 32740
Compartment ID: A
Substance Stored1: GASOLINE
Substance Stored2: Not reported
Substance Stored3: Not reported
CompartmentReleaseDetectionMethod(Vapor): N
CRDM(GW Monitoring): N
CRDM(Monitoring Of Secondary Cont Barrier): N
CRDM(Auto Tank Gauge Test/Inv Control): Y
CRDM(Interstitial Monitoring SecWall/Jacket): N
CRDM(Wkly Manual Gauging(Tanks<=1000 G): N
CRDM(Mthly Tank Gauging(Emer Gen Tanks): N
CRDM(Sir (Stat Inv Reconciliation)/Inv Control): N
PipingReleaseDetectionMethod(PRDM)(Vapor): N
PRDM(Groundwater Monitoring): N
PRDM(Monitoring Sec Containment Barrier): N
PRDM(InterstitialMonitoring w/in SecWall/Jacket): N
PRDM(Mthly Piping Tightness Test)@.2Gph: N
PRDM(AnnualPipingTightTest/ElecMon@.1Gph: Y
PRDM(TriennialTightTest(Suction/GravityPiping): N
PRDM AutoLineLeakDet(3.0 Gph PressPiping): Y
PRDM(Sir(StatInv Recon)/Inv Control)): N
PRDM(Exempt System Suction: N
Spill Overfill Prevention Equip(SOPE): Y
SOPE(Spill Cont/Bucket/Sump): Y
SOPE(DelShut-Off Valve): N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

SOPE(FlowRestrictorValue: Y
SOPE(Alarm (Set@<=90%) W/3a Or 3b: N
SOPE(N/A Deliveries To Tank<=25G): N
Compartment Release Det Compliance Flag: Y
Piping Release Detection Compliance Flag): Y
Spill/OverfillPreventionCompliance Flag: Y
Compartment Release Detection Variance: N
Piping Release Detection Variance: N
Spill And Overfill Prevention Variance: N
Stage I Vapor Recovery: TWO POINT SYSTEM
Stage 1 Installation Date: 02/05/2001

More Self Certification:

Self Cert ID: 12560
Cert ID: 278773
UST Comprt ID: 803732
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 312656
UST Comprt ID: 904815
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 48449
UST Comprt ID: 160791
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 48451
UST Comprt ID: 160787
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 295348
UST Comprt ID: 852968
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 48448
UST Comprt ID: 160790
UST ID: 43341

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48452
UST Comprt ID:	160786
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48455
UST Comprt ID:	160783
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48460
UST Comprt ID:	160778
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48447
UST Comprt ID:	160789
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48453
UST Comprt ID:	160785
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	261651
UST Comprt ID:	753280
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48456
UST Comprt ID:	160782
UST ID:	43341
AI Number:	32740

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48458
UST Comprt ID:	160780
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48454
UST Comprt ID:	160784
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48450
UST Comprt ID:	160788
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	245553
UST Comprt ID:	705860
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	228542
UST Comprt ID:	655898
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48457
UST Comprt ID:	160781
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48459
UST Comprt ID:	160779
UST ID:	43341
AI Number:	32740
Tank ID:	1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Compartment ID:	A
Install Date:	02/05/2001
Tank Registration Date:	12/06/2001
Number of Compartments:	2
Tank Capacity:	12000
Tank Singlewall:	Y
Tank Doublewall:	N
Pipe Type:	P
UST ID:	198923
Facility ID:	83626
Ai Number:	32740
Tank Id:	2
Tank Status (Current):	IN USE
Tank Status Date:	02/05/2001
Empty:	N
Tank Regulatory Status:	FULLY REGULATED
Tank Int Prot (Internal Tank Lining Date):	Not reported
Piping Design (Single Wall):	N
Piping Design (Double Wall):	Y
Tank Ext Cont(Fac-Built Nonmetallic Jacket):	N
Tank Ext Cont(Syn Tank-Pit/Piping-Trench Liner):	N
Tank Ext Cont(Tank Vault/Rigid Trench Liner):	N
Piping Ext Cont(Fac-Built Nonmetallic Jacket):	N
Piping Ext Cont(Syn Tank-Pit/Piping-Trench Liner):	N
Piping Ext Cont(Tank Vault/Rigid Trench Liner):	N
Tank Material (Steel):	N
Tank Material(Frp(Fiberglass-Reinforced Plastic):	N
Tank Mat(Composite (Steel W/Ext Frp Cladding)):	Y
Tank Mat(Concrete):	N
Tank Mat(Jacketed (Steel W/Ext Nonmetallic Jck)):	N
Tank Mat(Coated(Steel W/ExtPolyurethane Cladding)):	N
Piping Material (Steel):	N
Piping Mat(Frp(Fiberglass Reinforced Plastic):	N
Piping Mat(Concrete):	N
Piping Mat(Jacketed(Steel W/Ext Nonmetallic Jacket)):	N
Piping Mat(Nonmetallic Flex Piping):	Y
PipingConnect/Valves(Shear/Impact Valves(Under Disp)):	N
Piping Connect/Valves(Steel Swing-Joints(End Of Piping)):	N
Piping Connect/Valves (Flex Connectors(Ends Of Piping)):	N
Tank Corr Prot Meth(TCPM)(Cathodic-Field Installation):	N
TCPM (ExtDielectricCoat/Laminate/Tape/Wrap):	N
TCPM(Cathodic Prot-FacInstallation):	N
TCPM(Composite Tank(Steel W/Frp Ext Laminate):	Y
TCPMeth(Coated Tank(Steel W/ExtPolyurethaneLaminate):	N
TCPM(FRP Tank Or Piping(Noncorrodible)):	N
TCPM(Ext Nonmetallic Jacket):	N
TCPMeth(Unnecessary Per Corrosion Prot Spec):	N
Piping Corr Prot Meth(Dielectric Coat/Laminate/Tape/Wrap):	N
Piping Corr Prot Method(PCPM) (Cathodic Factory Install):	N
PCPM(Cathodic Prot-Field Install):	N
PCPMeth (FRP Tank Or Piping(Noncorrodible):	N
PCPM(Nonmetallic FlexPiping (Noncorrodible)):	Y
PCPMeth(Isolated Open Area/2nd Containment):	N
PCPM (Dual Protected):	N
PCPM(Unnec Per Corrosion Prot Specialist):	N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Tank Corr Prot Compliance Flag: Y
Piping Corr Prot Compliance Flag: Y
Tank Corrosion Prot Variance: N
Piping Corrosion Prot Variance: N
Temp Out Of Service Compliance: N
Technical Compliance Flag: N
Tank Tested Flag: Y
Installation Signature Date: 06/15/2001

Compartment Records:

Tank ID: 2
Tank Capacity: 8000
UST Comprt ID: 127471
UST ID: 198923
AI Number: 32740
Compartment ID: A
Substance Stored1: GASOLINE
Substance Stored2: Not reported
Substance Stored3: Not reported
CompartmentReleaseDetectionMethod(Vapor): N
CRDM(GW Monitoring): N
CRDM(Monitoring Of Secondary Cont Barrier): N
CRDM(Auto Tank Gauge Test/Inv Control): Y
CRDM(Interstitial Monitoring SecWall/Jacket): N
CRDM(Wkly Manual Gauging(Tanks<=1000 G): N
CRDM(Mthly Tank Gauging(Emer Gen Tanks): N
CRDM(Sir (Stat Inv Reconciliation)/Inv Control): N
PipingReleaseDetectionMethod(PRDM)(Vapor): N
PRDM(Groundwater Monitoring): N
PRDM(Monitoring Sec Containment Barrier): N
PRDM(InterstitialMonitoring w/in SecWall/Jacket): N
PRDM(Mthly Piping Tightness Test)@.2Gph: N
PRDM(AnnualPipingTightTest/ElecMon@.1Gph: Y
PRDM(TriennialTightTest(Suction/GravityPiping): N
PRDM AutoLineLeakDet(3.0 Gph PressPiping): Y
PRDM(Sir(StatInv Recon)/Inv Control)): N
PRDM(Exempt System Suction: N
Spill Overfill Prevention Equip(SOPE): Y
SOPE(Spill Cont/Bucket/Sump): Y
SOPE(DelShut-Off Valve): N
SOPE(FlowRestrictorValue: Y
SOPE(Alarm (Set@<=90%) W/3a Or 3b: N
SOPE(N/A Deliveries To Tank<=25G): N
Compartment Release Det Compliance Flag: Y
Piping Release Detection Compliance Flag): Y
Spill/OverfillPreventionCompliance Flag: Y
Compartment Release Detection Variance: N
Piping Release Detection Variance: N
Spill And Overfill Prevention Variance: N
Stage I Vapor Recovery: TWO POINT SYSTEM
Stage 1 Installation Date: 02/05/2001

Tank ID: 2
Tank Capacity: 4000
UST Comprt ID: 127472
UST ID: 198923
AI Number: 32740
Compartment ID: B

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Substance Stored1:	DIESEL
Substance Stored2:	Not reported
Substance Stored3:	Not reported
CompartmentReleaseDetectionMethod(Vapor):	N
CRDM(GW Monitoring):	N
CRDM(Monitoring Of Secondary Cont Barrier):	N
CRDM(Auto Tank Gauge Test/Inv Control):	Y
CRDM(Interstitial Monitoring SecWall/Jacket):	N
CRDM(Wkly Manual Gauging(Tanks<=1000 G):	N
CRDM(Mthly Tank Gauging(Emer Gen Tanks):	N
CRDM(Sir (Stat Inv Reconciliation)/Inv Control):	N
PipingReleaseDetectionMethod(PRDM)(Vapor):	N
PRDM(Groundwater Monitoring):	N
PRDM(Monitoring Sec Containment Barrier):	N
PRDM(InterstitialMonitoring w/in SecWall/Jacket):	N
PRDM(Mthly Piping Tightness Test)@.2Gph:	N
PRDM(AnnualPipingTightTest/ElecMon@.1Gph:	Y
PRDM(TriennialTightTest(Suction/GravityPiping):	N
PRDM AutoLineLeakDet(3.0 Gph PressPiping):	Y
PRDM(Sir(StatInv Recon)/Inv Control):	N
PRDM(Exempt System Suction:	N
Spill Overfill Prevention Equip(SOPE):	Y
SOPE(Spill Cont/Bucket/Sump):	Y
SOPE(DelShut-Off Valve):	N
SOPE(FlowRestrictorValue:	Y
SOPE(Alarm (Set@<=90%) W/3a Or 3b:	N
SOPE(N/A Deliveries To Tank<=25G):	N
Compartment Release Det Compliance Flag:	Y
Piping Release Detection Compliance Flag):	Y
Spill/OverfillPreventionCompliance Flag:	Y
Compartment Release Detection Variance:	N
Piping Release Detection Variance:	N
Spill And Overfill Prevention Variance:	N
Stage I Vapor Recovery:	TWO POINT SYSTEM
Stage 1 Installation Date:	02/05/2001

More Self Certification:

Self Cert ID:	12560
Cert ID:	278773
UST Comprt ID:	803732
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A

Self Cert ID:	12560
Cert ID:	312656
UST Comprt ID:	904815
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A

Self Cert ID:	12560
Cert ID:	48449
UST Comprt ID:	160791
UST ID:	43341

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48451
UST Comprt ID:	160787
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	295348
UST Comprt ID:	852968
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48448
UST Comprt ID:	160790
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48452
UST Comprt ID:	160786
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48455
UST Comprt ID:	160783
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48460
UST Comprt ID:	160778
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48447
UST Comprt ID:	160789
UST ID:	43341
AI Number:	32740

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48453
UST Comprt ID:	160785
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	261651
UST Comprt ID:	753280
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48456
UST Comprt ID:	160782
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48458
UST Comprt ID:	160780
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48454
UST Comprt ID:	160784
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	48450
UST Comprt ID:	160788
UST ID:	43341
AI Number:	32740
Tank ID:	1
Compartment ID:	A
Self Cert ID:	12560
Cert ID:	245553
UST Comprt ID:	705860
UST ID:	43341
AI Number:	32740
Tank ID:	1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Compartment ID: A

Self Cert ID: 12560
Cert ID: 228542
UST Comprt ID: 655898
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 48457
UST Comprt ID: 160781
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Self Cert ID: 12560
Cert ID: 48459
UST Comprt ID: 160779
UST ID: 43341
AI Number: 32740
Tank ID: 1
Compartment ID: A

Construction Notification:
NOC ID: 12949
Facility ID: 83626
AI Number: 32740
Application Received Date: 11/16/2000
Scheduled Construction Date: 11/20/2000
UST Improvement: N
UST Installation: N
UST Removal: N
UST Repair: N
UST Return To Service: N
UST Replacement: Y
UST Abandonment: N
UST Stage I: N
AST Installation: N
AST Stage I: N
Historical Tracking Number: M11116010
Waiver Flag: N
Late Filing Flag: Y
Form Received Date: Not reported
Signature Date On Form: Not reported
Signature Name On Form: Not reported
Signature Company On Form: Not reported
Signature Title On Form: Not reported
Signature Role: Not reported
Owner Name At Time Of Construction: Not reported
Owner CN At Time Of Construction: Not reported
Owner AR At Time Of Construction: 28271
General Desc Of Prop Construct: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

NOC ID: 12948
Facility ID: 83626
AI Number: 32740
Application Received Date: 11/16/2000
Scheduled Construction Date: 11/20/2000
UST Improvement: N
UST Installation: N
UST Removal: Y
UST Repair: N
UST Return To Service: N
UST Replacement: N
UST Abandonment: N
UST Stage I: N
AST Installation: N
AST Stage I: N
Historical Tracking Number: M11116010
Waiver Flag: N
Late Filing Flag: Y
Form Received Date: Not reported
Signature Date On Form: Not reported
Signature Name On Form: Not reported
Signature Company On Form: Not reported
Signature Title On Form: Not reported
Signature Role: Not reported
Owner Name At Time Of Construction: Not reported
Owner CN At Time Of Construction: Not reported
Owner AR At Time Of Construction: 28271
General Desc Of Prop Construct: Not reported

Contractor, Consultant and Installer:
Cont/Cons/Installer ID: 13913
UST ID: Not reported
NOC ID: 12948
AI Number: 32740
Type Of Contact: CONTRACTOR
Contractor CRP Number Or Installer ILP Number: CRP001317
Company Name: Not reported
Representative Name: Not reported
Mailing Address (Delivery): Not reported
Mailing Address (Internal Delivery): Not reported
Mailing City: Not reported
Mailing State: Not reported
Mailing Zip: Not reported
Mailing Foreign Postal Code: Not reported
Mailing County Code: Not reported
Phone Number Country Code: 1
Phone Number Area Code: Not reported
Phone Number: Not reported
Phone Number Extension: Not reported
Fax Number Country Code: Not reported
Fax Number Area Code: Not reported
Fax Number: Not reported
Email Address: Not reported

Cont/Cons/Installer ID: 31240
UST ID: 198923
NOC ID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

AI Number: 32740
Type Of Contact: CONTRACTOR
Contractor CRP Number Or Installer ILP Number: CRP000317
Company Name: MC Services
Representative Name: Not reported
Mailing Address (Delivery): Not reported
Mailing Address (Internal Delivery): Not reported
Mailing City: Not reported
Mailing State: Not reported
Mailing Zip: Not reported
Mailing Foreign Postal Code: Not reported
Mailing County Code: Not reported
Phone Number Country Code: Not reported
Phone Number Area Code: Not reported
Phone Number: Not reported
Phone Number Extension: Not reported
Fax Number Country Code: Not reported
Fax Number Area Code: Not reported
Fax Number: Not reported
Email Address: Not reported

Cont/Cons/Installer ID: 31239
UST ID: 198922
NOC ID: Not reported
AI Number: 32740
Type Of Contact: CONTRACTOR
Contractor CRP Number Or Installer ILP Number: CRP000317
Company Name: MC Services
Representative Name: Not reported
Mailing Address (Delivery): Not reported
Mailing Address (Internal Delivery): Not reported
Mailing City: Not reported
Mailing State: Not reported
Mailing Zip: Not reported
Mailing Foreign Postal Code: Not reported
Mailing County Code: Not reported
Phone Number Country Code: Not reported
Phone Number Area Code: Not reported
Phone Number: Not reported
Phone Number Extension: Not reported
Fax Number Country Code: Not reported
Fax Number Area Code: Not reported
Fax Number: Not reported
Email Address: Not reported

Cont/Cons/Installer ID: 13914
UST ID: Not reported
NOC ID: 12949
AI Number: 32740
Type Of Contact: CONTRACTOR
Contractor CRP Number Or Installer ILP Number: CRP001317
Company Name: Not reported
Representative Name: Not reported
Mailing Address (Delivery): Not reported
Mailing Address (Internal Delivery): Not reported
Mailing City: Not reported
Mailing State: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Mailing Zip:	Not reported
Mailing Foreign Postal Code:	Not reported
Mailing County Code:	Not reported
Phone Number Country Code:	1
Phone Number Area Code:	Not reported
Phone Number:	Not reported
Phone Number Extension:	Not reported
Fax Number Country Code:	Not reported
Fax Number Area Code:	Not reported
Fax Number:	Not reported
Email Address:	Not reported
Cont/Cons/Installer ID:	46401
UST ID:	198923
NOC ID:	Not reported
AI Number:	32740
Type Of Contact:	INSTALLER
Contractor CRP Number Or Installer ILP Number:	ILP000496
Company Name:	Not reported
Representative Name:	MIKE BEEVERS
Mailing Address (Delivery):	Not reported
Mailing Address (Internal Delivery):	Not reported
Mailing City:	Not reported
Mailing State:	Not reported
Mailing Zip:	Not reported
Mailing Foreign Postal Code:	Not reported
Mailing County Code:	Not reported
Phone Number Country Code:	Not reported
Phone Number Area Code:	Not reported
Phone Number:	Not reported
Phone Number Extension:	Not reported
Fax Number Country Code:	Not reported
Fax Number Area Code:	Not reported
Fax Number:	Not reported
Email Address:	Not reported
Cont/Cons/Installer ID:	46400
UST ID:	198922
NOC ID:	Not reported
AI Number:	32740
Type Of Contact:	INSTALLER
Contractor CRP Number Or Installer ILP Number:	ILP000496
Company Name:	Not reported
Representative Name:	MIKE BEEVERS
Mailing Address (Delivery):	Not reported
Mailing Address (Internal Delivery):	Not reported
Mailing City:	Not reported
Mailing State:	Not reported
Mailing Zip:	Not reported
Mailing Foreign Postal Code:	Not reported
Mailing County Code:	Not reported
Phone Number Country Code:	Not reported
Phone Number Area Code:	Not reported
Phone Number:	Not reported
Phone Number Extension:	Not reported
Fax Number Country Code:	Not reported
Fax Number Area Code:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Fax Number: Not reported
Email Address: Not reported

Facility Billing Contacts:

Contact Organization Name: GOD BLESS INC
Contact Mailing Address (Delivery): 1039 S VELASCO ST
Contact Mailing Address (Internal Delivery): Not reported
Contact Mailing City/State/Zip: ANGLETON, TX 77515 5249
Phone Number/Ext: /
Contact Fax Number/Ext: /
Contact Email Address: Not reported
Contact Address Deliverable: Y
Facility ID: 83626
Additional ID: 268776722002087
Princ ID: 259776722002087
AI Number: 32740
Facility Name: T & M GROCERY
AR Number: 28271
AR UST Number Suffix: Not reported
AR AST Number Suffix: U
Contact Name/Title: AKBAR MOMIN/

TX Financial Assurance 2:

Name: T & M GROCERY
Address: 1039 S VELASCO ST
City,State,Zip: ANGLETON, TX 77515
Region: 2
Facility ID: 83626
Finass ID: 155852
AI: 32740
Mechanism Type Other: Not reported
Multiple Mechanism Types: N
Coverage Amt per Annual Aggregate: 1,000,000
Meets Financial Assurance Req Flag: Y
Financial Responsibility Type: INSURANCE OR RISK RETENTION
Corrective Action MET Flag: Y
3rd Party MET Flag: Y
Financial Assurance Begin Date: 12/04/2015
Date Financial Assurance Form Rec: 01/26/2016
Issuer Name: MID-CONTINENT INS CO
Issuer Phone: 1 800 7224994
Policy Number: 04-TO-94947
Coverage Amount: 1,000,000
Coverage Expiration Date: 12/04/2016
Ins Premium Pre-Paid For Entire Yr: Yes
Proof of Financial Assurance: Yes

Name: T & M GROCERY
Address: 1039 S VELASCO ST
City,State,Zip: ANGLETON, TX 77515
Region: 2
Facility ID: 83626
Finass ID: 138707
AI: 32740
Mechanism Type Other: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Multiple Mechanism Types: N
Coverage Amt per Annual Aggregate: 1,000,000
Meets Financial Assurance Req Flag: Y
Financial Responsibility Type: INSURANCE OR RISK RETENTION
Corrective Action MET Flag: Y
3rd Party MET Flag: Y
Financial Assurance Begin Date: 12/04/2014
Date Financial Assurance Form Rec: 01/26/2016
Issuer Name: MID-CONTINENT INS CO
Issuer Phone: Not reported
Policy Number: 04TO00090678
Coverage Amount: 1,000,000
Coverage Expiration Date: 12/04/2015
Ins Premium Pre-Paid For Entire Yr: Yes
Proof of Financial Assurance: Yes

Name: T & M GROCERY
Address: 1039 S VELASCO ST
City,State,Zip: ANGLETON, TX 77515
Region: 2
Facility ID: 83626
Finass ID: 122955
AI: 32740
Mechanism Type Other: Not reported
Multiple Mechanism Types: N
Coverage Amt per Annual Aggregate: 1,000,000
Meets Financial Assurance Req Flag: Y
Financial Responsibility Type: INSURANCE OR RISK RETENTION
Corrective Action MET Flag: Y
3rd Party MET Flag: Y
Financial Assurance Begin Date: 12/04/2013
Date Financial Assurance Form Rec: 01/26/2016
Issuer Name: MID-CONTINENT INS CO
Issuer Phone: 1 281 7528000
Policy Number: 04-TO-00083764
Coverage Amount: 1,000,000
Coverage Expiration Date: 12/04/2014
Ins Premium Pre-Paid For Entire Yr: Yes
Proof of Financial Assurance: Yes

Name: T & M GROCERY
Address: 1039 S VELASCO ST
City,State,Zip: ANGLETON, TX 77515
Region: 2
Facility ID: 83626
Finass ID: 10892
AI: 32740
Mechanism Type Other: Not reported
Multiple Mechanism Types: N
Coverage Amt per Annual Aggregate: Not reported
Meets Financial Assurance Req Flag: Not reported
Financial Responsibility Type: INSURANCE OR RISK RETENTION
Corrective Action MET Flag: Y
3rd Party MET Flag: Y
Financial Assurance Begin Date: 12/04/2012
Date Financial Assurance Form Rec: 01/26/2016
Issuer Name: MID-CONTINENT INS CO

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Issuer Phone: 1 800 7224994
Policy Number: 04-TO00083764
Coverage Amount: 1,000,000
Coverage Expiration Date: 12/04/2013
Ins Premium Pre-Paid For Entire Yr: Yes
Proof of Financial Assurance: Yes

Name: T & M GROCERY
Address: 1039 S VELASCO ST
City,State,Zip: ANGLETON, TX 77515
Region: 2
Facility ID: 83626
Finass ID: 70727
AI: 32740
Mechanism Type Other: Not reported
Multiple Mechanism Types: N
Coverage Amt per Annual Aggregate: Not reported
Meets Financial Assurance Req Flag: Not reported
Financial Responsibility Type: INSURANCE OR RISK RETENTION
Corrective Action MET Flag: Y
3rd Party MET Flag: Y
Financial Assurance Begin Date: 12/04/2011
Date Financial Assurance Form Rec: 01/26/2016
Issuer Name: ZURICH AMERICAN INS CO
Issuer Phone: 1 800 7131158
Policy Number: USC9271304-10
Coverage Amount: 1000000
Coverage Expiration Date: 12/04/2012
Ins Premium Pre-Paid For Entire Yr: Yes
Proof of Financial Assurance: Yes

Name: T & M GROCERY
Address: 1039 S VELASCO ST
City,State,Zip: ANGLETON, TX 77515
Region: 2
Facility ID: 83626
Finass ID: 70728
AI: 32740
Mechanism Type Other: Not reported
Multiple Mechanism Types: N
Coverage Amt per Annual Aggregate: Not reported
Meets Financial Assurance Req Flag: Not reported
Financial Responsibility Type: INSURANCE OR RISK RETENTION
Corrective Action MET Flag: Y
3rd Party MET Flag: Y
Financial Assurance Begin Date: 12/04/2010
Date Financial Assurance Form Rec: 01/26/2016
Issuer Name: ZURICH AMERICAN INS CO
Issuer Phone: 1 800 7131158
Policy Number: USC9271304-09
Coverage Amount: 1000000
Coverage Expiration Date: 12/04/2011
Ins Premium Pre-Paid For Entire Yr: Yes
Proof of Financial Assurance: Yes

Name: T & M GROCERY
Address: 1039 S VELASCO ST

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

City,State,Zip: ANGLETON, TX 77515
Region: 2
Facility ID: 83626
Finass ID: 70729
AI: 32740
Mechanism Type Other: Not reported
Multiple Mechanism Types: N
Coverage Amt per Annual Aggregate: Not reported
Meets Financial Assurance Req Flag: Not reported
Financial Responsibility Type: INSURANCE OR RISK RETENTION
Corrective Action MET Flag: Y
3rd Party MET Flag: Y
Financial Assurance Begin Date: 12/04/2009
Date Financial Assurance Form Rec: 01/26/2016
Issuer Name: ZURICH AMERICAN INS CO
Issuer Phone: 1 800 7131158
Policy Number: USC9271304-08
Coverage Amount: 1000000
Coverage Expiration Date: 12/04/2010
Ins Premium Pre-Paid For Entire Yr: Yes
Proof of Financial Assurance: No

Name: T & M GROCERY
Address: 1039 S VELASCO ST
City,State,Zip: ANGLETON, TX 77515
Region: 2
Facility ID: 83626
Finass ID: 70730
AI: 32740
Mechanism Type Other: Not reported
Multiple Mechanism Types: N
Coverage Amt per Annual Aggregate: Not reported
Meets Financial Assurance Req Flag: Not reported
Financial Responsibility Type: INSURANCE OR RISK RETENTION
Corrective Action MET Flag: Y
3rd Party MET Flag: Y
Financial Assurance Begin Date: 12/04/2008
Date Financial Assurance Form Rec: 01/26/2016
Issuer Name: ZURICH AMERICAN INS CO
Issuer Phone: 1 800 7131158
Policy Number: USC9271304-07
Coverage Amount: 1000000
Coverage Expiration Date: 12/04/2009
Ins Premium Pre-Paid For Entire Yr: Yes
Proof of Financial Assurance: Yes

Name: T & M GROCERY
Address: 1039 S VELASCO ST
City,State,Zip: ANGLETON, TX 77515
Region: 2
Facility ID: 83626
Finass ID: 70731
AI: 32740
Mechanism Type Other: Not reported
Multiple Mechanism Types: N
Coverage Amt per Annual Aggregate: Not reported
Meets Financial Assurance Req Flag: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Financial Responsibility Type: INSURANCE OR RISK RETENTION
Corrective Action MET Flag: Y
3rd Party MET Flag: Y
Financial Assurance Begin Date: 12/04/2007
Date Financial Assurance Form Rec: 01/26/2016
Issuer Name: ZURICH AMERICAN INS CO
Issuer Phone: 1 800 7131158
Policy Number: USC9271304-06
Coverage Amount: 1000000
Coverage Expiration Date: 12/04/2008
Ins Premium Pre-Paid For Entire Yr: No
Proof of Financial Assurance: No

Name: T & M GROCERY
Address: 1039 S VELASCO ST
City,State,Zip: ANGLETON, TX 77515
Region: 2
Facility ID: 83626
Finass ID: 70732
AI: 32740
Mechanism Type Other: Not reported
Multiple Mechanism Types: N
Coverage Amt per Annual Aggregate: Not reported
Meets Financial Assurance Req Flag: Not reported
Financial Responsibility Type: INSURANCE OR RISK RETENTION
Corrective Action MET Flag: Y
3rd Party MET Flag: Y
Financial Assurance Begin Date: 01/01/1901
Date Financial Assurance Form Rec: 01/26/2016
Issuer Name: Not reported
Issuer Phone: Not reported
Policy Number: Unknown
Coverage Amount: 0
Coverage Expiration Date: 01/01/1901
Ins Premium Pre-Paid For Entire Yr: No
Proof of Financial Assurance: No

GCC:

Name: MOMIN AKBAR
Address: 1039 S VELASCO
City,State,Zip: ANGLETON, TX
Division: RMD/PST
New Cases: Not reported
File Number: 113399
Contamination Description: GASOLINE, DIESEL, WASTE OIL
Date Of Earliest Known Contamination Confirmation: 8/19/1998
Enforcement Status - Level Of Agency Response: 6 -
Enforcement Status - Site Activity Status: 6 - Action Completed
Data Quality 1: E,Q
Section 5236: Not reported
Type: TEXAS COMMISSION ON ENVIRONMENTAL QUALITY
Agency: Not reported
Section: Not reported
Year Deleted: Not reported
Location: Not reported
Data Quality 2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

PST STAGE 2:

Regulated Number: RN101824993
Region Location: 12
Has Active Violation: YES
PST ID: 32740
Start Date: 08/31/1987
Stage 2 Type: ASSIST SYSTEM
Stage 2 Install Date: 06/01/2001
Last Inspection Activity: DECOMMCEI
EACT Status: ACTIVE
ADDN ID: 32740
Last Inspection Number: 1240698
Last Inspection Status Date: 04/23/2015
Last Inspection Status: DAPPROVED
Last Inspection Activity 2: DECOMMCEI
Last Inspection Conducted By: REGION 12 - HOUSTON
Facility Not Inspected: Not reported
Facility Not Inspected Reason: Not reported
ADDN Status: ACTIVE
Status: ACTIVE
Signed Date: 01/01/2016
Expired Date: 01/31/2017
Tank Status: IN USE
Type: RETAIL
UST Number: 2
Latitude: 0
Longitude: 0

Stage2 Detail:

RN: RN101824993
Reg Status: FULLY REGULATED
CN: CN600992275
Princ Name: GOD BLESS INC
Princ Legal Name: God Bless, Inc.
Role: OWNOPR
First Name: Not reported
Middle Name: Not reported
Last Name: Not reported
PST UST ID: 85940
UST Tank ID: 1A
Num UST Compr: 1
Install Date: 01/01/1960
Regis Date: 05/08/1986
Capacity Qty: 4000
Substance Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

CENTRAL REGISTRY:

Regulated Entity Number:	RN101824993
Name:	T & M GROCERY
Address:	1039 S VELASCO ST
Address 2:	Not reported
City,State,Zip:	ANGLETON, TX 77515
TCEQ Regional Office City Name:	HOUSTON
TCEQ Region Number:	12
Status:	ACTIVE
Status Date:	03/28/2002
Customer Number:	CN600992275
Customer Name:	GOD BLESS INC
Customer Legal Name:	God Bless, Inc.
Customer Ownership Type Code:	Not reported
Customer Ownership Type:	CORPORATION
Affiliation Begin Date:	09/01/1987
Affiliation End Date:	12/31/3000
Customer Status:	ACTIVE
Primary NAICS Industry Type Code:	Not reported
Primary NAICS Industry Type Description:	Not reported
Primary SIC Industry Type Code:	Not reported
Primary SIC Industry Type Description:	Not reported
Physical Location Description:	Not reported
Regulated Entity Number:	RN101824993
Name:	T & M GROCERY
Address:	1039 S VELASCO ST
Address 2:	Not reported
City,State,Zip:	ANGLETON, TX 77515
TCEQ Regional Office City Name:	HOUSTON
TCEQ Region Number:	12
Status:	ACTIVE
Status Date:	03/28/2002
Customer Number:	CN601021215
Customer Name:	STEWART, ROBERT B
Customer Legal Name:	Not reported
Customer Ownership Type Code:	Not reported
Customer Ownership Type:	INDIVIDUAL OWNER TYPE
Affiliation Begin Date:	08/30/1987
Affiliation End Date:	08/31/1987
Customer Status:	ACTIVE
Primary NAICS Industry Type Code:	Not reported
Primary NAICS Industry Type Description:	Not reported
Primary SIC Industry Type Code:	Not reported
Primary SIC Industry Type Description:	Not reported
Physical Location Description:	Not reported
Regulated Entity Number:	RN101824993
Name:	T & M GROCERY
Address:	1039 S VELASCO ST
Address 2:	Not reported
City,State,Zip:	ANGLETON, TX 77515
TCEQ Regional Office City Name:	HOUSTON
TCEQ Region Number:	12
Status:	ACTIVE
Status Date:	03/28/2002
Customer Number:	CN604459933

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Customer Name: MOMIN, AKBAR
Customer Legal Name: Not reported
Customer Ownership Type Code: Not reported
Customer Ownership Type: INDIVIDUAL OWNER TYPE
Affiliation Begin Date: 01/01/1800
Affiliation End Date: 12/31/3000
Customer Status: ACTIVE
Primary NAICS Industry Type Code: Not reported
Primary NAICS Industry Type Description: Not reported
Primary SIC Industry Type Code: Not reported
Primary SIC Industry Type Description: Not reported
Physical Location Description: Not reported

Regulated Entity Number: RN101824993
Name: T & M GROCERY
Address: 1039 S VELASCO ST
Address 2: Not reported
City,State,Zip: ANGLETON, TX 77515
TCEQ Regional Office City Name: HOUSTON
TCEQ Region Number: 12
Status: ACTIVE
Status Date: 03/28/2002
Customer Number: CN600992275
Customer Name: GOD BLESS INC
Customer Legal Name: God Bless, Inc.
Customer Ownership Type Code: Not reported
Customer Ownership Type: CORPORATION
Affiliation Begin Date: 09/01/1987
Affiliation End Date: 12/31/3000
Customer Status: ACTIVE
Primary NAICS Industry Type Code: Not reported
Primary NAICS Industry Type Description: Not reported
Primary SIC Industry Type Code: Not reported
Primary SIC Industry Type Description: Not reported
Physical Location Description: Not reported

Regulated Entity Number: RN101824993
Name: T & M GROCERY
Address: 1039 S VELASCO ST
Address 2: Not reported
City,State,Zip: ANGLETON, TX 77515
TCEQ Regional Office City Name: HOUSTON
TCEQ Region Number: 12
Status: ACTIVE
Status Date: 03/28/2002
Customer Number: CN600992275
Customer Name: GOD BLESS INC
Customer Legal Name: God Bless, Inc.
Customer Ownership Type Code: Not reported
Customer Ownership Type: CORPORATION
Affiliation Begin Date: 09/01/1987
Affiliation End Date: 12/31/3000
Customer Status: ACTIVE
Primary NAICS Industry Type Code: Not reported
Primary NAICS Industry Type Description: Not reported
Primary SIC Industry Type Code: Not reported
Primary SIC Industry Type Description: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Physical Location Description:	Not reported
Regulated Entity Number:	RN101824993
Name:	T & M GROCERY
Address:	1039 S VELASCO ST
Address 2:	Not reported
City,State,Zip:	ANGLETON, TX 77515
TCEQ Regional Office City Name:	HOUSTON
TCEQ Region Number:	12
Status:	ACTIVE
Status Date:	03/28/2002
Customer Number:	CN601021215
Customer Name:	STEWART, ROBERT B
Customer Legal Name:	Not reported
Customer Ownership Type Code:	Not reported
Customer Ownership Type:	INDIVIDUAL OWNER TYPE
Affiliation Begin Date:	08/30/1987
Affiliation End Date:	08/31/1987
Customer Status:	ACTIVE
Primary NAICS Industry Type Code:	Not reported
Primary NAICS Industry Type Description:	Not reported
Primary SIC Industry Type Code:	Not reported
Primary SIC Industry Type Description:	Not reported
Physical Location Description:	Not reported
Regulated Entity Number:	RN101824993
Name:	T & M GROCERY
Address:	1039 S VELASCO ST
Address 2:	Not reported
City,State,Zip:	ANGLETON, TX 77515
TCEQ Regional Office City Name:	HOUSTON
TCEQ Region Number:	12
Status:	ACTIVE
Status Date:	03/28/2002
Customer Number:	CN601021215
Customer Name:	STEWART, ROBERT B
Customer Legal Name:	Not reported
Customer Ownership Type Code:	Not reported
Customer Ownership Type:	INDIVIDUAL OWNER TYPE
Affiliation Begin Date:	08/30/1987
Affiliation End Date:	08/31/1987
Customer Status:	ACTIVE
Primary NAICS Industry Type Code:	Not reported
Primary NAICS Industry Type Description:	Not reported
Primary SIC Industry Type Code:	Not reported
Primary SIC Industry Type Description:	Not reported
Physical Location Description:	Not reported
Regulated Entity Number:	RN101824993
Name:	T & M GROCERY
Address:	1039 S VELASCO ST
Address 2:	Not reported
City,State,Zip:	ANGLETON, TX 77515
TCEQ Regional Office City Name:	HOUSTON
TCEQ Region Number:	12
Status:	ACTIVE
Status Date:	03/28/2002

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Customer Number: CN604459933
Customer Name: MOMIN, AKBAR
Customer Legal Name: Not reported
Customer Ownership Type Code: Not reported
Customer Ownership Type: INDIVIDUAL OWNER TYPE
Affiliation Begin Date: 01/01/1800
Affiliation End Date: 12/31/3000
Customer Status: ACTIVE
Primary NAICS Industry Type Code: Not reported
Primary NAICS Industry Type Description: Not reported
Primary SIC Industry Type Code: Not reported
Primary SIC Industry Type Description: Not reported
Physical Location Description: Not reported

Regulated Entity Number: RN101824993
Name: T & M GROCERY
Address: 1039 S VELASCO ST
Address 2: Not reported
City,State,Zip: ANGLETON, TX 77515
TCEQ Regional Office City Name: HOUSTON
TCEQ Region Number: 12
Status: ACTIVE
Status Date: 03/28/2002
Customer Number: CN604459933
Customer Name: MOMIN, AKBAR
Customer Legal Name: Not reported
Customer Ownership Type Code: Not reported
Customer Ownership Type: INDIVIDUAL OWNER TYPE
Affiliation Begin Date: 01/01/1800
Affiliation End Date: 12/31/3000
Customer Status: ACTIVE
Primary NAICS Industry Type Code: Not reported
Primary NAICS Industry Type Description: Not reported
Primary SIC Industry Type Code: Not reported
Primary SIC Industry Type Description: Not reported
Physical Location Description: Not reported

Regulated Entity Number: RN101824993
Name: T & M GROCERY
Address: Not reported
Address 2: Not reported
City,State,Zip: TX
TCEQ Regional Office City Name: HOUSTON
TCEQ Region Number: 12
Status: ACTIVE
Status Date: 03/28/2002
Customer Number: CN600992275
Customer Name: GOD BLESS INC
Customer Legal Name: God Bless, Inc.
Customer Ownership Type Code: Not reported
Customer Ownership Type: CORPORATION
Affiliation Begin Date: 09/01/1987
Affiliation End Date: 12/31/3000
Customer Status: ACTIVE
Primary NAICS Industry Type Code: Not reported
Primary NAICS Industry Type Description: Not reported
Primary SIC Industry Type Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & M GROCERY (Continued)

U001265912

Primary SIC Industry Type Description: Not reported
Physical Location Description: Not reported

Regulated Entity Number: RN101824993
Name: T & M GROCERY
Address: Not reported
Address 2: Not reported
City,State,Zip: TX
TCEQ Regional Office City Name: HOUSTON
TCEQ Region Number: 12
Status: ACTIVE
Status Date: 03/28/2002
Customer Number: CN601021215
Customer Name: STEWART, ROBERT B
Customer Legal Name: Not reported
Customer Ownership Type Code: Not reported
Customer Ownership Type: INDIVIDUAL OWNER TYPE
Affiliation Begin Date: 08/30/1987
Affiliation End Date: 08/31/1987
Customer Status: ACTIVE
Primary NAICS Industry Type Code: Not reported
Primary NAICS Industry Type Description: Not reported
Primary SIC Industry Type Code: Not reported
Primary SIC Industry Type Description: Not reported
Physical Location Description: Not reported

[Click this hyperlink](#) while viewing on your computer to access
2 additional TX CENTRAL REG: record(s) in the EDR Site Report.

A2
West
< 1/8
0.011 mi.
56 ft.

T M GROCERY
1039 S VELASCO ST
ANGLETON, TX 77515

Site 2 of 5 in cluster A

LPST S116699682
N/A

Relative:
Higher

Actual:
26 ft.

LPST:
Name: T M GROCERY
Address: 1039 S VELASCO ST
City,State,Zip: ANGLETON, TX 77515
Facility ID: 0032740
LPST Id: 113399
Facility Location: 1039 S VELASCO
TCEQ Region# and City: REGION 12 - HOUSTON
Region City: HOUSTON
Discovered Date: 05/23/2008
Entered Date: 08/19/1998
Reported Date: 08/13/1998
Closure Date: 07/16/1998
Priority: 2.5 - GW IMPACT PUBLIC/DOMESTIC WATER SUPPLY WELL W/IN 0.25mi
Program: 1P - PRIVATIZATION CONTRACTOR
CA Status: 6A - FINAL CONCURRENCE ISSUED
Priority Description: Groundwater is affected and a public or domestic water supply well is located within 0.25 miles of the UST/AST system or source area.

Status:
Coordinators Primary: 1P/1/1P/1
Coordinators RPR: DB2
Responsible Party Name: Not reported
Responsible Party Contact: AKBAR MOMIN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T M GROCERY (Continued)

S116699682

Responsible Party Address: 13514 ISLAND PALM CT
Responsible Party City,St,Zip: HOUSTON, TX 77099
Responsible Party Telephone: 979/849-3006
Reported Date: 08/13/1998
Case Start Date: 07/16/1998

A3
South
< 1/8
0.027 mi.
145 ft.

BEACHWAY CENTER
1101 S VELASCO ST
ANGLETON, TX 77515

LPST **U001280477**
UST **N/A**
CENTRAL REGISTRY

Site 3 of 5 in cluster A

Relative:
Higher

LPST:

Actual:
26 ft.

Name: BEACHWAY CENTER
Address: 1101 S VELASCO ST
City,State,Zip: ANGLETON, TX 77515
Facility ID: 0049564
LPST Id: 106071
Facility Location: 1101 S VELASCO
TCEQ Region# and City: REGION 12 - HOUSTON
Region City: HOUSTON
Discovered Date: 02/20/2007
Entered Date: 02/12/1993
Reported Date: 11/30/1992
Closure Date: 11/15/1992
Priority: 3.1 - GW IMPACT PUB/DOM WATER SUPPLY WELL W/IN .25 - .5mi
Program: 1 - RPR
CA Status: 6A - FINAL CONCURRENCE ISSUED
Priority Description: Groundwater is affected and a public or domestic water supply well is located between 0.25 and 0.5 miles from the UST/AST system or source area.

Status:

FINAL CONCURRENCE ISSUED, CASE CLOSED

Coordinators Primary: 1
Coordinators RPR: MAO
Responsible Party Name: Not reported
Responsible Party Contact: PHIL BEUTEL
Responsible Party Address: 3 CHASE LN
Responsible Party City,St,Zip: COLORADO SPRINGS, CO 80906
Responsible Party Telephone: 719/733-7432
Reported Date: 11/30/1992
Case Start Date: 11/15/1992

Name: BEACHWAY CENTER
Address: 1101 S VELASCO ST
City,State,Zip: ANGLETON, TX 77515
Facility ID: 0049564
LPST Id: 108820
Facility Location: 1111 S VELASCO
TCEQ Region# and City: REGION 12 - HOUSTON
Region City: HOUSTON
Discovered Date: 06/27/1995
Entered Date: 12/12/1994
Reported Date: 10/14/1994
Closure Date: 08/26/1994
Priority: 4.1 - GW IMPACTED NO APPARENT THREATS OR IMPACTS TO RECEPTORS
Program: 1 - RPR
CA Status: 6A - FINAL CONCURRENCE ISSUED
Priority Description: Groundwater is affected.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BEACHWAY CENTER (Continued)

U001280477

Status: **FINAL CONCURRENCE ISSUED, CASE CLOSED**
Coordinators Primary: 1/2
Coordinators RPR: ZL
Responsible Party Name: Not reported
Responsible Party Contact: PHIL BEUTEL
Responsible Party Address: 3 CHASE LN
Responsible Party City,St,Zip: COLORADO SPRINGS, CO
Responsible Party Telephone: /-
Reported Date: 10/14/1994
Case Start Date: 08/26/1994

UST:

Name: BEACHWAY CENTER
Address: 1101 S VELASCO ST
City,State,Zip: ANGLETON, TX 775155251
AI Number: 49564
Facility Type: UNKNOWN
Facility Begin Date: 01/05/1990
Facility Status: INACTIVE
Additional ID: 179391752002088
Facility Exempt Status: N
Records Off-Site: No
UST Financial Assurance Required: No
Number Of Active UST: 0
Site Location Description: Not reported
Site Location (Nearest City Name): Not reported
Site Location (County Name): BRAZORIA
Site Location (Tceq Region): 12
Site Location (Location Zip): 77515
Contact Name/Title: '
Contact Organization Name: BEACHWAY CENTER
Contact Mailing Address1: Not reported
Contact Mailing Address2: Not reported
Contact Mailing City/State/Zip: Not reported
Contact Telephone: 4092975555
Facility Contact Address Deliverable: Not reported
Contact Fax Number: Not reported
Contact Email Address: Not reported
Signature Date On Earliest Reg Form: 11/14/1989
Signature Name/Title On Earliest Reg Form: SAME,SAME
Application Received Date On Earliest Reg Form: 11/20/1989
Signature Role On Earliest Reg Form: Not reported
Signature Company On Earliest Reg Form: Not reported
Enforcement Action: Not reported
Facility Not Inspectable: No

Owner:

Owner CN: CN601541972
Owner Last Name: BEUTEL
Owner First Name: PHILLIP
Owner Middle Name: Not reported
Owner Type: IN
Contact Mailing Address (Delivery): Not reported
Contact Mailing Address (Internal Delivery): Not reported
Contact Mailing City: Not reported
Contact Mailing State: Not reported
Contact Mailing Zip: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BEACHWAY CENTER (Continued)

U001280477

Contact Mailing Zip5:	Not reported
Contact Phone Number/Ext:	/
Contact Fax Country Code:	Not reported
Contact Fax Number/Ext:	/
Contact Email Address:	Not reported
Contact Address Deliverable:	Not reported
Princ ID:	190309612003043
Additional ID:	179391752002088
AI Number:	49564
Owner Effective Begin Date:	01/05/1990
State Tax ID:	Not reported
Contact Role:	Not reported
Contact Name/Title:	/
Contact Organization Name:	Not reported

Tank:

Install Date:	01/01/1969
Tank Registration Date:	11/20/1989
Number of Compartments:	1
Tank Capacity:	Not reported
Tank Singlewall:	N
Tank Doublewall:	N
Pipe Type:	Not reported
UST ID:	128611
Facility ID:	81269
AI Number:	49564
Tank Id:	1
Tank Status (Current):	REMOVED FROM GROUND
Tank Status Date:	05/10/1990
Empty:	N
Tank Regulatory Status:	FULLY REGULATED
Tank Int Prot (Internal Tank Lining Date):	Not reported
Piping Design (Single Wall):	N
Piping Design (Double Wall):	N
Tank Ext Cont(Fac-Built Nonmetallic Jacket):	N
Tank Ext Cont(Syn Tank-Pit/Piping-Trench Liner):	N
Tank Ext Cont(Tank Vault/Rigid Trench Liner):	N
Piping Ext Cont(Fac-Built Nonmetallic Jacket):	N
Piping Ext Cont(Syn Tank-Pit/Piping-Trench Liner):	N
Piping Ext Cont(Tank Vault/Rigid Trench Liner):	N
Tank Material (Steel):	N
Tank Material(Frp(Fiberglass-Reinforced Plastic):	N
Tank Mat(Composite (Steel W/Ext Frp Cladding)):	N
Tank Mat(Concrete):	N
Tank Mat(Jacketed (Steel W/Ext Nonmetallic Jck)):	N
Tank Mat(Coated(Steel W/ExtPolyurethane Cladding)):	N
Piping Material (Steel):	N
Piping Mat(Frp(Fiberglass Reinforced Plastic):	N
Piping Mat(Concrete):	N
Piping Mat(Jacketed(Steel W/Ext Nonmetallic Jacket)):	N
Piping Mat(Nonmetallic Flex Piping):	N
PipingConnect/Valves(Shear/Impact Valves(Under Disp)):	N
Piping Connect/Valves(Steel Swing-Joints(End Of Piping)):	N
Piping Connect/Valves (Flex Connectors(Ends Of Piping)):	N
Tank Corr Prot Meth(TCPM)(Cathodic-Field Installation):	N
TCPM (ExtDielectricCoat/Laminate/Tape/Wrap):	N
TCPM(Cathodic Prot-FacInstallation):	N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BEACHWAY CENTER (Continued)

U001280477

TCPM(Composite Tank(Steel W/Frp Ext Laminate):	N
TCPMeth(Coated Tank(Steel W/ExtPolyurethaneLaminate):	N
TCPM(FRP Tank Or Piping(Noncorrodible)):	N
TCPM(Ext Nonmetallic Jacket):	N
TCPMeth(Unnecessary Per Corrosion Prot Spec):	N
Piping Corr Prot Meth(Dielectric Coat/Laminate/Tape/Wrap):	N
Piping Corr Prot Method(PCPM) (Cathodic Factory Install):	N
PCPM(Cathodic Prot-Field Install):	N
PCPMeth (FRP Tank Or Piping(Noncorrodible):	N
PCPM(Nonmetallic FlexPiping (Noncorrodible)):	N
PCPMeth(Isolated Open Area/2nd Containment):	N
PCPM (Dual Protected):	N
PCPM(Unnec Per Corrosion Prot Specialist):	N
Tank Corr Prot Compliance Flag:	N
Piping Corr Prot Compliance Flag:	N
Tank Corrosion Prot Variance:	N
Piping Corrosion Prot Variance:	N
Temp Out Of Service Compliance:	N
Technical Compliance Flag:	N
Tank Tested Flag:	N
Installation Signature Date:	10/21/1989

Compartment Records:

Tank ID:	1
Tank Capacity:	0
UST Comprt ID:	126142
UST ID:	128611
AI Number:	49564
Compartment ID:	A
Substance Stored1:	UNKNOWN
Substance Stored2:	Not reported
Substance Stored3:	Not reported
CompartmentReleaseDetectionMethod(Vapor):	N
CRDM(GW Monitoring):	N
CRDM(Monitoring Of Secondary Cont Barrier):	N
CRDM(Auto Tank Gauge Test/Inv Control):	N
CRDM(Interstitial Monitoring SecWall/Jacket):	N
CRDM(Wkly Manual Gauging(Tanks<=1000 G):	N
CRDM(Mthly Tank Gauging(Emer Gen Tanks):	N
CRDM(Sir (Stat Inv Reconciliation)/Inv Control):	N
PipingReleaseDetectionMethod(PRDM)(Vapor):	N
PRDM(Groundwater Monitoring):	N
PRDM(Monitoring Sec Containment Barrier):	N
PRDM(InterstitialMonitoring w/in SecWall/Jacket):	N
PRDM(Mthly Piping Tightness Test)@.2Gph:	N
PRDM(AnnualPipingTightTest/ElecMon@.1Gph:	N
PRDM(TriennialTightTest(Suction/GravityPiping):	N
PRDM AutoLineLeakDet(3.0 Gph PressPiping):	N
PRDM(Sir(StatInv Recon)/Inv Control)):	N
PRDM(Exempt System Suction:	N
Spill Overfill Prevention Equip(SOPE):	N
SOPE(Spill Cont/Bucket/Sump):	N
SOPE(DelShut-Off Valve)):	N
SOPE(FlowRestrictorValue:	N
SOPE(Alarm (Set@<=90%) W/3a Or 3b:	N
SOPE(N/A Deliveries To Tank<=25G):	N
Compartment Release Det Compliance Flag:	N
Piping Release Detection Compliance Flag):	N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BEACHWAY CENTER (Continued)

U001280477

Spill/Overfill Prevention Compliance Flag: N
Compartment Release Detection Variance: N
Piping Release Detection Variance: N
Spill And Overfill Prevention Variance: N
Stage I Vapor Recovery: Not reported
Stage 1 Installation Date: Not reported

More Self Certification:

Self Cert ID: 19017
Cert ID: 17483
UST Comprt ID: 50647
UST ID: 15350
AI Number: 49564
Tank ID: 3
Compartment ID: A

Self Cert ID: 19017
Cert ID: 17477
UST Comprt ID: 50653
UST ID: 15350
AI Number: 49564
Tank ID: 3
Compartment ID: A

Self Cert ID: 19017
Cert ID: 17486
UST Comprt ID: 50644
UST ID: 15350
AI Number: 49564
Tank ID: 3
Compartment ID: A

Self Cert ID: 19017
Cert ID: 267691
UST Comprt ID: 771102
UST ID: 15350
AI Number: 49564
Tank ID: 3
Compartment ID: A

Self Cert ID: 19017
Cert ID: 17481
UST Comprt ID: 50649
UST ID: 15350
AI Number: 49564
Tank ID: 3
Compartment ID: A

Self Cert ID: 19017
Cert ID: 17485
UST Comprt ID: 50645
UST ID: 15350
AI Number: 49564
Tank ID: 3
Compartment ID: A

Self Cert ID: 19017

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BEACHWAY CENTER (Continued)

U001280477

Cert ID: 250594
UST Comprt ID: 720370
UST ID: 15350
AI Number: 49564
Tank ID: 3
Compartment ID: A

Self Cert ID: 19017
Cert ID: 17482
UST Comprt ID: 50648
UST ID: 15350
AI Number: 49564
Tank ID: 3
Compartment ID: A

Self Cert ID: 19017
Cert ID: 17474
UST Comprt ID: 50654
UST ID: 15350
AI Number: 49564
Tank ID: 3
Compartment ID: A

Self Cert ID: 19017
Cert ID: 17479
UST Comprt ID: 50651
UST ID: 15350
AI Number: 49564
Tank ID: 3
Compartment ID: A

Self Cert ID: 19017
Cert ID: 17484
UST Comprt ID: 50646
UST ID: 15350
AI Number: 49564
Tank ID: 3
Compartment ID: A

Self Cert ID: 19017
Cert ID: 17475
UST Comprt ID: 50655
UST ID: 15350
AI Number: 49564
Tank ID: 3
Compartment ID: A

Self Cert ID: 19017
Cert ID: 17478
UST Comprt ID: 50652
UST ID: 15350
AI Number: 49564
Tank ID: 3
Compartment ID: A

Self Cert ID: 19017
Cert ID: 235656

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BEACHWAY CENTER (Continued)

U001280477

UST Comprt ID:	676486
UST ID:	15350
AI Number:	49564
Tank ID:	3
Compartment ID:	A
Self Cert ID:	19017
Cert ID:	17476
UST Comprt ID:	50656
UST ID:	15350
AI Number:	49564
Tank ID:	3
Compartment ID:	A
Self Cert ID:	19017
Cert ID:	17480
UST Comprt ID:	50650
UST ID:	15350
AI Number:	49564
Tank ID:	3
Compartment ID:	A
Install Date:	01/01/1969
Tank Registration Date:	11/20/1989
Number of Compartments:	1
Tank Capacity:	Not reported
Tank Singlewall:	N
Tank Doublewall:	N
Pipe Type:	Not reported
UST ID:	128612
Facility ID:	81269
AI Number:	49564
Tank Id:	2
Tank Status (Current):	REMOVED FROM GROUND
Tank Status Date:	05/10/1990
Empty:	N
Tank Regulatory Status:	FULLY REGULATED
Tank Int Prot (Internal Tank Lining Date):	Not reported
Piping Design (Single Wall):	N
Piping Design (Double Wall):	N
Tank Ext Cont(Fac-Built Nonmetallic Jacket):	N
Tank Ext Cont(Syn Tank-Pit/Piping-Trench Liner):	N
Tank Ext Cont(Tank Vault/Rigid Trench Liner):	N
Piping Ext Cont(Fac-Built Nonmetallic Jacket):	N
Piping Ext Cont(Syn Tank-Pit/Piping-Trench Liner):	N
Piping Ext Cont(Tank Vault/Rigid Trench Liner):	N
Tank Material (Steel):	N
Tank Material(Frp(Fiberglass-Reinforced Plastic):	N
Tank Mat(Composite (Steel W/Ext Frp Cladding)):	N
Tank Mat(Concrete):	N
Tank Mat(Jacketed (Steel W/Ext Nonmetallic Jck)):	N
Tank Mat(Coated(Steel W/ExtPolyurethane Cladding)):	N
Piping Material (Steel):	N
Piping Mat(Frp(Fiberglass Reinforced Plastic):	N
Piping Mat(Concrete):	N
Piping Mat(Jacketed(Steel W/Ext Nonmetallic Jacket)):	N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BEACHWAY CENTER (Continued)

U001280477

Piping Mat(Nonmetallic Flex Piping):	N
PipingConnect/Valves(Shear/Impact Valves(Under Disp)):	N
Piping Connect/Valves(Steel Swing-Joints(End Of Piping)):	N
Piping Connect/Valves (Flex Connectors(Ends Of Piping)):	N
Tank Corr Prot Meth(TCPM)(Cathodic-Field Installation):	N
TCPM (ExtDielectricCoat/Laminate/Tape/Wrap):	N
TCPM(Cathodic Prot-FacInstallation):	N
TCPM(Composite Tank(Steel W/Frp Ext Laminate):	N
TCPMeth(Coated Tank(Steel W/ExtPolyurethaneLaminate):	N
TCPM(FRP Tank Or Piping(Noncorrodible):	N
TCPM(Ext Nonmetallic Jacket):	N
TCPMeth(Unnecessary Per Corrosion Prot Spec):	N
Piping Corr Prot Meth(Dielectric Coat/Laminate/Tape/Wrap):	N
Piping Corr Prot Method(PCPM) (Cathodic Factory Install):	N
PCPM(Cathodic Prot-Field Install):	N
PCPMeth (FRP Tank Or Piping(Noncorrodible):	N
PCPM(Nonmetallic FlexPiping (Noncorrodible):	N
PCPMeth(Isolated Open Area/2nd Containment):	N
PCPM (Dual Protected):	N
PCPM(Unnec Per Corrosion Prot Specialist):	N
Tank Corr Prot Compliance Flag:	N
Piping Corr Prot Compliance Flag:	N
Tank Corrosion Prot Variance:	N
Piping Corrosion Prot Variance:	N
Temp Out Of Service Compliance:	N
Technical Compliance Flag:	N
Tank Tested Flag:	N
Installation Signature Date:	10/21/1989

Compartment Records:

Tank ID:	2
Tank Capacity:	0
UST Comprt ID:	126143
UST ID:	128612
AI Number:	49564
Compartment ID:	A
Substance Stored1:	UNKNOWN
Substance Stored2:	Not reported
Substance Stored3:	Not reported
CompartmentReleaseDetectionMethod(Vapor):	N
CRDM(GW Monitoring):	N
CRDM(Monitoring Of Secondary Cont Barrier):	N
CRDM(Auto Tank Gauge Test/Inv Control):	N
CRDM(Interstitial Monitoring SecWall/Jacket):	N
CRDM(Wkly Manual Gauging(Tanks<=1000 G):	N
CRDM(Mthly Tank Gauging(Emer Gen Tanks):	N
CRDM(Sir (Stat Inv Reconciliation)/Inv Control):	N
PipingReleaseDetectionMethod(PRDM)(Vapor):	N
PRDM(Groundwater Monitoring):	N
PRDM(Monitoring Sec Containment Barrier):	N
PRDM(InterstitialMonitoring w/in SecWall/Jacket):	N
PRDM(Mthly Piping Tightness Test)@.2Gph:	N
PRDM(AnnualPipingTightTest/ElecMon@.1Gph:	N
PRDM(TriennialTightTest(Suction/GravityPiping):	N
PRDM AutoLineLeakDet(3.0 Gph PressPiping):	N
PRDM(Sir(StatInv Recon)/Inv Control):	N
PRDM(Exempt System Suction:	N
Spill Overfill Prevention Equip(SOPE):	N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BEACHWAY CENTER (Continued)

U001280477

SOPE(Spill Cont/Bucket/Sump):	N
SOPE(DelShut-Off Valve):	N
SOPE(FlowRestrictorValue:	N
SOPE(Alarm (Set@<=90%) W/3a Or 3b:	N
SOPE(N/A Deliveries To Tank<=25G):	N
Compartment Release Det Compliance Flag:	N
Piping Release Detection Compliance Flag):	N
Spill/OverfillPreventionCompliance Flag:	N
Compartment Release Detection Variance:	N
Piping Release Detection Variance:	N
Spill And Overfill Prevention Variance:	N
Stage I Vapor Recovery:	Not reported
Stage 1 Installation Date:	Not reported

More Self Certification:

Self Cert ID:	19017
Cert ID:	17483
UST Comprt ID:	50647
UST ID:	15350
AI Number:	49564
Tank ID:	3
Compartment ID:	A

Self Cert ID:	19017
Cert ID:	17477
UST Comprt ID:	50653
UST ID:	15350
AI Number:	49564
Tank ID:	3
Compartment ID:	A

Self Cert ID:	19017
Cert ID:	17486
UST Comprt ID:	50644
UST ID:	15350
AI Number:	49564
Tank ID:	3
Compartment ID:	A

Self Cert ID:	19017
Cert ID:	267691
UST Comprt ID:	771102
UST ID:	15350
AI Number:	49564
Tank ID:	3
Compartment ID:	A

Self Cert ID:	19017
Cert ID:	17481
UST Comprt ID:	50649
UST ID:	15350
AI Number:	49564
Tank ID:	3
Compartment ID:	A

Self Cert ID:	19017
Cert ID:	17485

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BEACHWAY CENTER (Continued)

U001280477

UST Comprt ID: 50645
UST ID: 15350
AI Number: 49564
Tank ID: 3
Compartment ID: A

Self Cert ID: 19017
Cert ID: 250594
UST Comprt ID: 720370
UST ID: 15350
AI Number: 49564
Tank ID: 3
Compartment ID: A

Self Cert ID: 19017
Cert ID: 17482
UST Comprt ID: 50648
UST ID: 15350
AI Number: 49564
Tank ID: 3
Compartment ID: A

Self Cert ID: 19017
Cert ID: 17474
UST Comprt ID: 50654
UST ID: 15350
AI Number: 49564
Tank ID: 3
Compartment ID: A

Self Cert ID: 19017
Cert ID: 17479
UST Comprt ID: 50651
UST ID: 15350
AI Number: 49564
Tank ID: 3
Compartment ID: A

Self Cert ID: 19017
Cert ID: 17484
UST Comprt ID: 50646
UST ID: 15350
AI Number: 49564
Tank ID: 3
Compartment ID: A

Self Cert ID: 19017
Cert ID: 17475
UST Comprt ID: 50655
UST ID: 15350
AI Number: 49564
Tank ID: 3
Compartment ID: A

Self Cert ID: 19017
Cert ID: 17478
UST Comprt ID: 50652

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BEACHWAY CENTER (Continued)

U001280477

UST ID: 15350
AI Number: 49564
Tank ID: 3
Compartment ID: A

Self Cert ID: 19017
Cert ID: 235656
UST Comprt ID: 676486
UST ID: 15350
AI Number: 49564
Tank ID: 3
Compartment ID: A

Self Cert ID: 19017
Cert ID: 17476
UST Comprt ID: 50656
UST ID: 15350
AI Number: 49564
Tank ID: 3
Compartment ID: A

Self Cert ID: 19017
Cert ID: 17480
UST Comprt ID: 50650
UST ID: 15350
AI Number: 49564
Tank ID: 3
Compartment ID: A

Facility Billing Contacts:

Contact Organization Name: BEUTEL PHILLIP
Contact Mailing Address (Delivery): 135 OYSTER CREEK DR
Contact Mailing Address (Internal Delivery): Not reported
Contact Mailing City/State/Zip: LAKE JACKSON, TX 77566 4183
Phone Number/Ext: /
Contact Fax Number/Ext: /
Contact Email Address: Not reported
Contact Address Deliverable: Y
Facility ID: 81269
Additional ID: 179391752002088
Princ ID: 190309612003043
AI Number: 49564
Facility Name: BEACHWAY CENTER
AR Number: Not reported
AR UST Number Suffix: Not reported
AR AST Number Suffix: Not reported
Contact Name/Title: /

CENTRAL REGISTRY:

Regulated Entity Number: RN101837128
Name: BEACHWAY CENTER
Address: 1101 S VELASCO ST
Address 2: Not reported
City,State,Zip: ANGLETON, TX 77515

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BEACHWAY CENTER (Continued)

U001280477

TCEQ Regional Office City Name: HOUSTON
TCEQ Region Number: 12
Status: ACTIVE
Status Date: 03/29/2002
Customer Number: CN601541972
Customer Name: BEUTEL, PHILLIP
Customer Legal Name: Not reported
Customer Ownership Type Code: Not reported
Customer Ownership Type: INDIVIDUAL OWNER TYPE
Affiliation Begin Date: 01/05/1990
Affiliation End Date: 12/31/3000
Customer Status: ACTIVE
Primary NAICS Industry Type Code: Not reported
Primary NAICS Industry Type Description: Not reported
Primary SIC Industry Type Code: Not reported
Primary SIC Industry Type Description: Not reported
Physical Location Description: Not reported

Regulated Entity Number: RN101837128
Name: BEACHWAY CENTER
Address: 1101 S VELASCO ST
Address 2: Not reported
City,State,Zip: ANGLETON, TX 77515
TCEQ Regional Office City Name: HOUSTON
TCEQ Region Number: 12
Status: ACTIVE
Status Date: 03/29/2002
Customer Number: CN601541972
Customer Name: BEUTEL, PHILLIP
Customer Legal Name: Not reported
Customer Ownership Type Code: Not reported
Customer Ownership Type: INDIVIDUAL OWNER TYPE
Affiliation Begin Date: 01/05/1990
Affiliation End Date: 12/31/3000
Customer Status: ACTIVE
Primary NAICS Industry Type Code: Not reported
Primary NAICS Industry Type Description: Not reported
Primary SIC Industry Type Code: Not reported
Primary SIC Industry Type Description: Not reported
Physical Location Description: Not reported

Regulated Entity Number: RN101837128
Name: BEACHWAY CENTER
Address: 1101 S VELASCO ST
Address 2: Not reported
City,State,Zip: ANGLETON, TX 77515
TCEQ Regional Office City Name: HOUSTON
TCEQ Region Number: 12
Status: ACTIVE
Status Date: 03/29/2002
Customer Number: CN601541972
Customer Name: BEUTEL, PHILLIP
Customer Legal Name: Not reported
Customer Ownership Type Code: Not reported
Customer Ownership Type: INDIVIDUAL OWNER TYPE
Affiliation Begin Date: 01/05/1990
Affiliation End Date: 12/31/3000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BEACHWAY CENTER (Continued)

U001280477

Customer Status: ACTIVE
Primary NAICS Industry Type Code: Not reported
Primary NAICS Industry Type Description: Not reported
Primary SIC Industry Type Code: Not reported
Primary SIC Industry Type Description: Not reported
Physical Location Description: Not reported

Regulated Entity Number: RN101837128
Name: BEACHWAY CENTER
Address: Not reported
Address 2: Not reported
City,State,Zip: TX
TCEQ Regional Office City Name: HOUSTON
TCEQ Region Number: 12
Status: ACTIVE
Status Date: 03/29/2002
Customer Number: CN601541972
Customer Name: BEUTEL, PHILLIP
Customer Legal Name: Not reported
Customer Ownership Type Code: Not reported
Customer Ownership Type: INDIVIDUAL OWNER TYPE
Affiliation Begin Date: 01/05/1990
Affiliation End Date: 12/31/3000
Customer Status: ACTIVE
Primary NAICS Industry Type Code: Not reported
Primary NAICS Industry Type Description: Not reported
Primary SIC Industry Type Code: Not reported
Primary SIC Industry Type Description: Not reported
Physical Location Description: Not reported

**A4
SW
< 1/8
0.033 mi.
173 ft.**

**MALLINCKRODT MEDICAL
1111 S VELASCO ST
ANGLETON, TX 77515**

**RCRA NonGen / NLR 1000285270
US AIRS TXD033586777
FINDS**

Site 4 of 5 in cluster A

**Relative:
Higher**

RCRA NonGen / NLR:

**Actual:
26 ft.**

Date form received by agency: 2013-07-08 00:00:00.0
Facility name: MALLINCKRODT MEDICAL
Facility address: 1111 S VELASCO ST
ANGLETON, TX 77515-5251

EPA ID: TXD033586777
Contact: RICHARD A DOTY
Contact address: 1111 S VELASCO ST
ANGLETON, TX 77515-5251

Contact country: US
Contact telephone: 409-848-5000
Contact email: Not reported
EPA Region: 06
Land type: Private
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: MALLINCKRODT INC
Owner/operator address: 1111 S VELASCO ST
ANGLETON, TX 77515

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MALLINCKRODT MEDICAL (Continued)

1000285270

Owner/operator country: US
Owner/operator telephone: 409-848-5000
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 2001-02-15 00:00:00.
Owner/Op end date: Not reported

Owner/operator name: MALLINCKRODT INC
Owner/operator address: 1111 S VELASCO ST
ANGLETON, TX 77515

Owner/operator country: US
Owner/operator telephone: 409-848-5000
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 2001-02-15 00:00:00.
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 2006-11-15 00:00:00.0
Site name: MALLINCKRODT INC
Classification: Not a generator, verified

Date form received by agency: 2001-02-15 00:00:00.0
Site name: MALLINCKRODT MEDICAL INC
Classification: Not a generator, verified

Date form received by agency: 1987-06-12 00:00:00.0
Site name: MALLINCKRODT MED
Classification: Small Quantity Generator

Hazardous Waste Summary:

. Waste code: D001

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MALLINCKRODT MEDICAL (Continued)

1000285270

- . Waste name: IGNITABLE WASTE
- . Waste code: D002
- . Waste name: CORROSIVE WASTE
- . Waste code: D018
- . Waste name: BENZENE
- . Waste code: D027
- . Waste name: 1,4-DICHLOROBENZENE
- . Waste code: D039
- . Waste name: TETRACHLOROETHYLENE
- . Waste code: F001
- . Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING: TETRACHLOROETHYLENE, TRICHLORETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE AND CHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Facility Has Received Notices of Violations:

Regulation violated: FR - 40 CFR 262.44(b)
Area of violation: Generators - Records/Reporting
Date violation determined: 1998-05-29 00:00:00.0
Date achieved compliance: Not reported
Violation lead agency: EPA
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 1998-08-24 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: EPA
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 40 CFR 262.60(b)
Area of violation: Generators - Manifest
Date violation determined: 1998-05-29 00:00:00.0
Date achieved compliance: Not reported
Violation lead agency: EPA
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 1998-08-24 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: EPA
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:

Evaluation date: 1998-05-29 00:00:00.0
Evaluation: FOCUSED COMPLIANCE INSPECTION

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MALLINCKRODT MEDICAL (Continued)

1000285270

Area of violation: Generators - Manifest
Date achieved compliance: Not reported
Evaluation lead agency: EPA

Evaluation date: 1998-05-29 00:00:00.0
Evaluation: FOCUSED COMPLIANCE INSPECTION
Area of violation: Generators - Records/Reporting
Date achieved compliance: Not reported
Evaluation lead agency: EPA

US AIRS MINOR:

Envid: 1000285270
Region Code: 06
Programmatic ID: AIR TX0000004803900093
Facility Registry ID: 110001869577
D and B Number: Not reported
Primary SIC Code: 3841
NAICS Code: 339112
Default Air Classification Code: MIN
Facility Type of Ownership Code: POF
Air CMS Category Code: Not reported
HPV Status: Not reported

FINDS:

Registry ID: 110001869577
Facility URL: http://ofmpub.epa.gov/enviro/fii_query_detail.disp_program_facility?p_registry_id=110001869577

Environmental Interest/Information System:

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AFS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

US EPA TRIS (Toxics Release Inventory System) contains information from facilities on the amounts of over 300 listed toxic chemicals that these facilities release directly to air, water, land, or that are transported off-site.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

AIR MINOR

Texas Commission on Environmental Quality - Agency Central Registry (TX-TCEQ ACR) is a computer application that allows the Texas Commission on Environmental Quality (TCEQ) to use a single, centralized area to record common information, such as the company names, addresses, and telephone numbers of those the TCEQ regulates. It also contains additional IDs (permits, registrations, authorizations, etc) and their status.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MALLINCKRODT MEDICAL (Continued)

1000285270

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

A5
SW
< 1/8
0.033 mi.
173 ft.

MALLINCKRODT MEDICAL
1111 S VELASCO ST
ANGLETON, TX 77515
Site 5 of 5 in cluster A

Ind. Haz Waste **S102743573**
N/A

Relative:
Higher

Actual:
26 ft.

Ind. Haz Waste:
Name: MALLINCKRODT MEDICAL
Address: 1111 S VELASCO ST
City,State,Zip: ANGLETON, TX 77515
Registration Number: 37403
Registration Initial Notification Date: 08/28/1987
Registration Last Amendment Date: 07/08/2013
EPA Identification: TXD033586777
Primary NAICS Code: 339112
Status Change Date: 20130715
Land Type: PRIVATE
Description of Facility Site Location: 1111 S Velasco, Angleton, TX
Site Primary Standard Industrial Code: Not reported
Site Primary SIC Description: Not reported
Registration is Generator of Waste: Yes
Registration is Receivers of Waste: No
Registration is Transporter of Waste: No
Registration is Transfer Facility: No
Facility is STEERS Reporter: No
Required to Submit Annual Waste Summary: No
Facility Involved In Recycling: No
Revr Has Monthly Reporting Requirement: 0
Mexican Facility: Represents a Maquiladora (Mexican Facility)
Type of Generator: NON INDUS, CLASS1
TNRCC Region: Not reported
Company Name: MALLINCKRODT LLC
Contact Name: RICHARD A DOTY
Contact Telephone Number: 409-8485000
Mailing Address: 1111 S VELASCO ST
Mailing Address2: Not reported
Mailing City,St,Zip: ANGLETON, TX 77515251
Mailing County: UNITED STATES
Facility Country: UNITED STATES
TNRCC Facility ID: 14077
Site Owner Tax ID: 431479062
Site Location Latitude: -00.000
Site Location Longitude: -000.000
Last Update to NOR Data: 20130715
Ind. waste permit Number: Not reported
Mun waste permit Number: Not reported
Non Notifier: No

Business Records Not Found for this RegNo/Year:

Owner:

Owner Mailing Address: 1111 S VELASCO ST
Owner Mailing Address2: Not reported
Owner Mailing Address3: Not reported
Owner City,St,Zip: ANGLETON, TX 77515 5251
Owner Country: UNITED STA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MALLINCKRODT MEDICAL (Continued)

S102743573

Owner Phone Number: 1-409-8485000
Owner Fax Number: Not reported
Owner Email Address: Not reported
Owner Business Type: Unknown
Owner Tax Id: 14314790628
Owner Bankruptcy Code: Not reported

Operator:

Operator Last Name: MALLINCKRODT LLC
Operator First Name: Not reported
Operator Name: MALLINCKRODT LLC
Operator Mailing Address: 1111 S VELASCO ST
Operator Mailing Address 2: Not reported
Operator Mailing City,St,Zip: ANGLETON, TX 77515 5251
Operator Country: UNITED STA
Operator Phone: 1-409-8485000
Operator Fax: Not reported
Operator Email: Not reported
Operator Business Type: Unknown
Operator Tax Id: 14314790628
Operator Bankruptcy Code: Not reported

Contact:

Contact Name: Not reported
Contact Title: Not reported
Contact Role: OWNOPRCON
Contact Address: 1111 S VELASCO ST
Contact Address2: Not reported
Contact City,St,Zip: ANGLETON, TX 77515 5251
Contact Phone: 1-409-8485000
Contact Fax: Not reported
Contact Email: Not reported

Contact:

Contact Name: RICHARD A DOTY
Contact Title: ENV MGR
Contact Role: PRICONT
Contact Address: 1111 S VELASCO ST
Contact Address2: Not reported
Contact City,St,Zip: ANGLETON, TX 77515 5251
Contact Phone: 1-409-8485000
Contact Fax: Not reported
Contact Email: Not reported

Unit:

Unit No: 001
Deed Record Needed: Not reported
Deed Recording Date: Not reported
Unit Type Code: 22
Unit Type: Not reported
Unit Status: ACTIVE
Unit Regulatory Status: Not reported
UIC Permit Number: Not reported
Capacity: Not reported
Capacity Measurment: Not reported
Off Site Hazardous Waste: No
Off Site Class 1 Waste: Not reported
Off Site Class 2 Waste: Not reported
Off Site Class 3 Waste: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MALLINCKRODT MEDICAL (Continued)

S102743573

Off Site Non Indstrl Sld Wst: Not reported
System Type Code: Not reported
System Type: Not reported
System Type Code 1: 141
System Type 1: Not reported
System Type Code 2: Not reported
System Type 2: Not reported
System Type Code 3: Not reported
System Type 3: Not reported
System Type Code 4: Not reported
System Type 4: Not reported
Permit Seq #: Not reported
Unit Description on NOR: solvent parts cleaned in shop area.
Dt Last Changed: 19930722

One Time Shipper Records Not Found for this RegNo/Year:

Receiver Type: Not reported
Transporter for hire: 0
Transport own waste: 0
Eq 01, if transport waste type = 1: Not reported
Eq 02, if transport waste type = 2: Not reported
Eq 03, if transport waste type = 3: Not reported
Eq 04, if transport waste type = H: Not reported
Target TCEQ unique facid for discarded(merged) facility: Not reported

Waste:

Waste ID: 72473
Waste Description: Spent solvent from cleaning and degreasing machine parts; initial generation: 7
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 0501203H
Waste Code Status: INACTIVE
Waste Form: Not reported
Waste Classification: H
Waste is Radioactive: No
Waste Treated Off Site: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Measurement Point: Not reported
Primary Origin: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: No
Company Waste ID: Not reported
Primary NAICS Code: 339113
EPA Waste Form Code: W203
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

Waste:

Waste ID: 107351
Waste Description: Waste Freon
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 9999202H
Waste Code Status: INACTIVE
Waste Form: Not reported
Waste Classification: H

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MALLINCKRODT MEDICAL (Continued)

S102743573

Waste is Radioactive: No
Waste Treated Off Site: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Measurement Point: Not reported
Primary Origin: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: No
Company Waste ID: Not reported
Primary NAICS Code: 339112
EPA Waste Form Code: W202
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

**B6
SW
< 1/8
0.069 mi.
364 ft.**

**WAGNER RAY DAEWOO
1100 S VELASCO ST
ANGLETON, TX 77515**

**EDR Hist Auto 1020992386
N/A**

Site 1 of 4 in cluster B

**Relative:
Lower**

EDR Hist Auto

**Actual:
25 ft.**

Year:	Name:	Type:
2001	WAGNER RAY DAEWOO	General Automotive Repair Shops
2002	WAGNER RAY DAEWOO	General Automotive Repair Shops
2006	REYES TRANSMISSION & AUTO	Automotive Transmission Repair Shops
2007	REYES TRANSMISSION & AUTO	Automotive Transmission Repair Shops

**7
NW
< 1/8
0.077 mi.
409 ft.**

**CHRISTOPHERSON TEXACO
1029 S VELASCO
ANGLETON, TX 77515**

**EDR Hist Auto 1020951876
N/A**

**Relative:
Higher**

EDR Hist Auto

**Actual:
26 ft.**

Year:	Name:	Type:
1977	CHRISTOPHERSON TEXACO	Gasoline Service Stations
1978	CHRISTOPHERSON TEXACO	Gasoline Service Stations
1982	LAVERNS TEXACO	Gasoline Service Stations
1983	LAVERNS TEXACO	Gasoline Service Stations
1985	LAVERNS TEXACO	Gasoline Service Stations
1986	LAVERNS TEXACO	Gasoline Service Stations
1987	LAVERNS TEXACO	Gasoline Service Stations
1988	LAVERNS TEXACO	Gasoline Service Stations

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

B8
SW
< 1/8
0.120 mi.
632 ft.

UNITED PARCEL SERVICE
113 CEMETARY RD
ANGLETON, TX 77515

Site 2 of 4 in cluster B

UST U001250945
N/A

Relative:
Lower

Actual:
25 ft.

UST:

Name: UNITED PARCEL SERVICE
Address: 113 CEMETARY RD
City,State,Zip: ANGLETON, TX 775155239
AI Number: 15678
Facility Type: FLEET REFUELING
Facility Begin Date: 09/01/1990
Facility Status: INACTIVE
Additional ID: 17849152002154
Facility Exempt Status: N
Records Off-Site: No
UST Financial Assurance Required: No
Number Of Active UST: 0
Site Location Description: Not reported
Site Location (Nearest City Name): Not reported
Site Location (County Name): BRAZORIA
Site Location (Tceq Region): 12
Site Location (Location Zip): 77515
Contact Name/Title: RICHARD WAGNER,CTR MGR
Contact Organization Name: UNITED PARCEL SERVICE
Contact Mailing Address1: Not reported
Contact Mailing Address2: Not reported
Contact Mailing City/State/Zip: Not reported
Contact Telephone: 4098499773
Facility Contact Address Deliverable: Not reported
Contact Fax Number: Not reported
Contact Email Address: Not reported
Signature Date On Earliest Reg Form: 04/11/1986
Signature Name/Title On Earliest Reg Form: KERMIT NABORS,MAINT MGR
Application Received Date On Earliest Reg Form: 05/08/1986
Signature Role On Earliest Reg Form: Not reported
Signature Company On Earliest Reg Form: Not reported
Enforcement Action: Not reported
Facility Not Inspectable: No

Owner:

Owner CN: CN602297624
Owner Last Name: UNITED PARCEL SERVICE INC
Owner First Name: Not reported
Owner Middle Name: Not reported
Owner Type: CO
Contact Mailing Address (Delivery): Not reported
Contact Mailing Address (Internal Delivery): Not reported
Contact Mailing City: Not reported
Contact Mailing State: Not reported
Contact Mailing Zip: Not reported
Contact Mailing Zip5: Not reported
Contact Phone Number/Ext: /
Contact Fax Country Code: Not reported
Contact Fax Number/Ext: /
Contact Email Address: Not reported
Contact Address Deliverable: Not reported
Princ ID: 151337522003218
Additional ID: 17849152002154

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

UNITED PARCEL SERVICE (Continued)

U001250945

AI Number: 15678
Owner Effective Begin Date: 09/01/1990
State Tax ID: 13624073816
Contact Role: Not reported
Contact Name/Title: /
Contact Organization Name: Not reported

Tank:

Install Date: 01/01/1983
Tank Registration Date: 05/08/1986
Number of Compartments: 1
Tank Capacity: 250
Tank Singlewall: N
Tank Doublewall: N
Pipe Type: Not reported
UST ID: 40317
Facility ID: 77629
AI Number: 15678
Tank Id: 2
Tank Status (Current): REMOVED FROM GROUND
Tank Status Date: 08/02/1994
Empty: N
Tank Regulatory Status: FULLY REGULATED
Tank Int Prot (Internal Tank Lining Date): Not reported
Piping Design (Single Wall): N
Piping Design (Double Wall): N
Tank Ext Cont(Fac-Built Nonmetallic Jacket): N
Tank Ext Cont(Syn Tank-Pit/Piping-Trench Liner): N
Tank Ext Cont(Tank Vault/Rigid Trench Liner): N
Piping Ext Cont(Fac-Built Nonmetallic Jacket): N
Piping Ext Cont(Syn Tank-Pit/Piping-Trench Liner): N
Piping Ext Cont(Tank Vault/Rigid Trench Liner): N
Tank Material (Steel): Y
Tank Material(Frp(Fiberglass-Reinforced Plastic): N
Tank Mat(Composite (Steel W/Ext Frp Cladding)): N
Tank Mat(Concrete): N
Tank Mat(Jacketed (Steel W/Ext Nonmetallic Jck)): N
Tank Mat(Coated(Steel W/ExtPolyurethane Cladding)): N
Piping Material (Steel): Y
Piping Mat(Frp(Fiberglass Reinforced Plastic): N
Piping Mat(Concrete): N
Piping Mat(Jacketed(Steel W/Ext Nonmetallic Jacket)): N
Piping Mat(Nonmetallic Flex Piping): N
PipingConnect/Valves(Shear/Impact Valves(Under Disp)): N
Piping Connect/Valves(Steel Swing-Joints(End Of Piping)): N
Piping Connect/Valves (Flex Connectors(Ends Of Piping)): N
Tank Corr Prot Meth(TCPM)(Cathodic-Field Installation): N
TCPM (ExtDielectricCoat/Laminate/Tape/Wrap): N
TCPM(Cathodic Prot-FacInstallation): N
TCPM(Composite Tank(Steel W/Frp Ext Laminate): N
TCPMeth(Coated Tank(Steel W/ExtPolyurethaneLaminate): N
TCPM(FRP Tank Or Piping(Noncorrodible)): N
TCPM(Ext Nonmetallic Jacket): N
TCPMeth(Unnecessary Per Corrosion Prot Spec): N
Piping Corr Prot Meth(Dielectric Coat/Laminate/Tape/Wrap): N
Piping Corr Prot Method(PCPM) (Cathodic Factory Install): N
PCPM(Cathodic Prot-Field Install): N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

UNITED PARCEL SERVICE (Continued)

U001250945

PCPMethod (FRP Tank Or Piping(Noncorrodible):	N
PCPM(Nonmetallic FlexPiping (Noncorrodible)):	N
PCPMeth(Isolated Open Area/2nd Containment):	N
PCPM (Dual Protected):	N
PCPM(Unnec Per Corrosion Prot Specialist):	N
Tank Corr Prot Compliance Flag:	N
Piping Corr Prot Compliance Flag:	N
Tank Corrosion Prot Variance:	N
Piping Corrosion Prot Variance:	N
Temp Out Of Service Compliance:	N
Technical Compliance Flag:	N
Tank Tested Flag:	N
Installation Signature Date:	10/29/1990
Compartment Records:	
Tank ID:	2
Tank Capacity:	250
UST Comprt ID:	109776
UST ID:	40317
AI Number:	15678
Compartment ID:	A
Substance Stored1:	USED OIL
Substance Stored2:	Not reported
Substance Stored3:	Not reported
CompartmentReleaseDetectionMethod(Vapor):	Y
CRDM(GW Monitoring):	N
CRDM(Monitoring Of Secondary Cont Barrier):	N
CRDM(Auto Tank Gauge Test/Inv Control):	N
CRDM(Interstitial Monitoring SecWall/Jacket):	N
CRDM(Wkly Manual Gauging(Tanks<=1000 G):	N
CRDM(Mthly Tank Gauging(Emer Gen Tanks):	N
CRDM(Sir (Stat Inv Reconciliation)/Inv Control):	N
PipingReleaseDetectionMethod(PRDM)(Vapor):	Y
PRDM(Groundwater Monitoring):	N
PRDM(Monitoring Sec Containment Barrier):	N
PRDM(InterstitialMonitoring w/in SecWall/Jacket):	N
PRDM(Mthly Piping Tightness Test)@.2Gph:	N
PRDM(AnnualPipingTightTest/ElecMon@.1Gph:	N
PRDM(TriennialTightTest(Suction/GravityPiping):	N
PRDM AutoLineLeakDet(3.0 Gph PressPiping):	Y
PRDM(Sir(StatInv Recon)/Inv Control):	N
PRDM(Exempt System Suction:	N
Spill Overfill Prevention Equip(SOPE):	Y
SOPE(Spill Cont/Bucket/Sump):	Y
SOPE(DelShut-Off Valve):	N
SOPE(FlowRestrictorValue:	N
SOPE(Alarm (Set@<=90%) W/3a Or 3b:	N
SOPE(N/A Deliveries To Tank<=25G):	N
Compartment Release Det Compliance Flag:	Y
Piping Release Detection Compliance Flag):	N
Spill/OverfillPreventionCompliance Flag:	N
Compartment Release Detection Variance:	N
Piping Release Detection Variance:	N
Spill And Overfill Prevention Variance:	N
Stage I Vapor Recovery:	Not reported
Stage 1 Installation Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

UNITED PARCEL SERVICE (Continued)

U001250945

More Self Certification:

Self Cert ID: 6122
Cert ID: 5153
UST Comprt ID: 17001
UST ID: 5739
AI Number: 15678
Tank ID: 4
Compartment ID: A

Self Cert ID: 6122
Cert ID: 5152
UST Comprt ID: 17002
UST ID: 5739
AI Number: 15678
Tank ID: 4
Compartment ID: A

Self Cert ID: 6122
Cert ID: 5154
UST Comprt ID: 17000
UST ID: 5739
AI Number: 15678
Tank ID: 4
Compartment ID: A

Self Cert ID: 6122
Cert ID: 5155
UST Comprt ID: 16999
UST ID: 5739
AI Number: 15678
Tank ID: 4
Compartment ID: A

Self Cert ID: 6122
Cert ID: 223597
UST Comprt ID: 641307
UST ID: 5739
AI Number: 15678
Tank ID: 4
Compartment ID: A

Self Cert ID: 6122
Cert ID: 5149
UST Comprt ID: 17005
UST ID: 5739
AI Number: 15678
Tank ID: 4
Compartment ID: A

Self Cert ID: 6122
Cert ID: 5159
UST Comprt ID: 16995
UST ID: 5739
AI Number: 15678
Tank ID: 4
Compartment ID: A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

UNITED PARCEL SERVICE (Continued)

U001250945

Self Cert ID: 6122
Cert ID: 241948
UST Comprt ID: 695125
UST ID: 5739
AI Number: 15678
Tank ID: 4
Compartment ID: A

Self Cert ID: 6122
Cert ID: 5158
UST Comprt ID: 16996
UST ID: 5739
AI Number: 15678
Tank ID: 4
Compartment ID: A

Self Cert ID: 6122
Cert ID: 5150
UST Comprt ID: 17006
UST ID: 5739
AI Number: 15678
Tank ID: 4
Compartment ID: A

Self Cert ID: 6122
Cert ID: 5148
UST Comprt ID: 17004
UST ID: 5739
AI Number: 15678
Tank ID: 4
Compartment ID: A

Self Cert ID: 6122
Cert ID: 5157
UST Comprt ID: 16997
UST ID: 5739
AI Number: 15678
Tank ID: 4
Compartment ID: A

Self Cert ID: 6122
Cert ID: 259489
UST Comprt ID: 746939
UST ID: 5739
AI Number: 15678
Tank ID: 4
Compartment ID: A

Self Cert ID: 6122
Cert ID: 5156
UST Comprt ID: 16998
UST ID: 5739
AI Number: 15678
Tank ID: 4
Compartment ID: A

Self Cert ID: 6122

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

UNITED PARCEL SERVICE (Continued)

U001250945

Cert ID:	5151
UST Comprt ID:	17003
UST ID:	5739
AI Number:	15678
Tank ID:	4
Compartment ID:	A
Install Date:	01/01/1983
Tank Registration Date:	05/08/1986
Number of Compartments:	1
Tank Capacity:	10000
Tank Singlewall:	N
Tank Doublewall:	N
Pipe Type:	Not reported
UST ID:	40316
Facility ID:	77629
AI Number:	15678
Tank Id:	1
Tank Status (Current):	REMOVED FROM GROUND
Tank Status Date:	08/02/1994
Empty:	N
Tank Regulatory Status:	FULLY REGULATED
Tank Int Prot (Internal Tank Lining Date):	Not reported
Piping Design (Single Wall):	N
Piping Design (Double Wall):	N
Tank Ext Cont(Fac-Built Nonmetallic Jacket):	N
Tank Ext Cont(Syn Tank-Pit/Piping-Trench Liner):	N
Tank Ext Cont(Tank Vault/Rigid Trench Liner):	N
Piping Ext Cont(Fac-Built Nonmetallic Jacket):	N
Piping Ext Cont(Syn Tank-Pit/Piping-Trench Liner):	N
Piping Ext Cont(Tank Vault/Rigid Trench Liner):	N
Tank Material (Steel):	N
Tank Material(Frp(Fiberglass-Reinforced Plastic):	Y
Tank Mat(Composite (Steel W/Ext Frp Cladding)):	N
Tank Mat(Concrete):	N
Tank Mat(Jacketed (Steel W/Ext Nonmetallic Jck)):	N
Tank Mat(Coated(Steel W/ExtPolyurethane Cladding)):	N
Piping Material (Steel):	Y
Piping Mat(Frp(Fiberglass Reinforced Plastic):	N
Piping Mat(Concrete):	N
Piping Mat(Jacketed(Steel W/Ext Nonmetallic Jacket)):	N
Piping Mat(Nonmetallic Flex Piping):	N
PipingConnect/Valves(Shear/Impact Valves(Under Disp)):	N
Piping Connect/Valves(Steel Swing-Joints(End Of Piping)):	N
Piping Connect/Valves (Flex Connectors(Ends Of Piping)):	N
Tank Corr Prot Meth(TCPM)(Cathodic-Field Installation):	N
TCPM (ExtDielectricCoat/Laminate/Tape/Wrap):	N
TCPM(Cathodic Prot-FacInstallation):	N
TCPM(Composite Tank(Steel W/Frp Ext Laminate):	N
TCPMeth(Coated Tank(Steel W/ExtPolyurethaneLaminate):	N
TCPM(FRP Tank Or Piping(Noncorrodible):	Y
TCPM(Ext Nonmetallic Jacket):	N
TCPMeth(Unnecessary Per Corrosion Prot Spec):	N
Piping Corr Prot Meth(Dielectric Coat/Laminate/Tape/Wrap):	N
Piping Corr Prot Method(PCPM) (Cathodic Factory Install):	N
PCPM(Cathodic Prot-Field Install):	N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

UNITED PARCEL SERVICE (Continued)

U001250945

PCPMethod (FRP Tank Or Piping(Noncorrodible):	N
PCPM(Nonmetallic FlexPiping (Noncorrodible)):	N
PCPMeth(Isolated Open Area/2nd Containment):	N
PCPM (Dual Protected):	N
PCPM(Unnec Per Corrosion Prot Specialist):	N
Tank Corr Prot Compliance Flag:	Y
Piping Corr Prot Compliance Flag:	N
Tank Corrosion Prot Variance:	N
Piping Corrosion Prot Variance:	N
Temp Out Of Service Compliance:	N
Technical Compliance Flag:	N
Tank Tested Flag:	N
Installation Signature Date:	10/29/1990
Compartment Records:	
Tank ID:	1
Tank Capacity:	10000
UST Comprt ID:	109775
UST ID:	40316
AI Number:	15678
Compartment ID:	A
Substance Stored1:	GASOLINE
Substance Stored2:	Not reported
Substance Stored3:	Not reported
CompartmentReleaseDetectionMethod(Vapor):	Y
CRDM(GW Monitoring):	N
CRDM(Monitoring Of Secondary Cont Barrier):	N
CRDM(Auto Tank Gauge Test/Inv Control):	N
CRDM(Interstitial Monitoring SecWall/Jacket):	N
CRDM(Wkly Manual Gauging(Tanks<=1000 G):	N
CRDM(Mthly Tank Gauging(Emer Gen Tanks):	N
CRDM(Sir (Stat Inv Reconciliation)/Inv Control):	N
PipingReleaseDetectionMethod(PRDM)(Vapor):	Y
PRDM(Groundwater Monitoring):	N
PRDM(Monitoring Sec Containment Barrier):	N
PRDM(InterstitialMonitoring w/in SecWall/Jacket):	N
PRDM(Mthly Piping Tightness Test)@.2Gph:	N
PRDM(AnnualPipingTightTest/ElecMon@.1Gph:	N
PRDM(TriennialTightTest(Suction/GravityPiping):	N
PRDM AutoLineLeakDet(3.0 Gph PressPiping):	Y
PRDM(Sir(StatInv Recon)/Inv Control)):	N
PRDM(Exempt System Suction:	N
Spill Overfill Prevention Equip(SOPE):	Y
SOPE(Spill Cont/Bucket/Sump):	Y
SOPE(DelShut-Off Valve):	N
SOPE(FlowRestrictorValue:	N
SOPE(Alarm (Set@<=90%) W/3a Or 3b:	N
SOPE(N/A Deliveries To Tank<=25G):	N
Compartment Release Det Compliance Flag:	Y
Piping Release Detection Compliance Flag):	N
Spill/OverfillPreventionCompliance Flag:	N
Compartment Release Detection Variance:	N
Piping Release Detection Variance:	N
Spill And Overfill Prevention Variance:	N
Stage I Vapor Recovery:	Not reported
Stage 1 Installation Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

UNITED PARCEL SERVICE (Continued)

U001250945

More Self Certification:

Self Cert ID: 6122
Cert ID: 5153
UST Comprt ID: 17001
UST ID: 5739
AI Number: 15678
Tank ID: 4
Compartment ID: A

Self Cert ID: 6122
Cert ID: 5152
UST Comprt ID: 17002
UST ID: 5739
AI Number: 15678
Tank ID: 4
Compartment ID: A

Self Cert ID: 6122
Cert ID: 5154
UST Comprt ID: 17000
UST ID: 5739
AI Number: 15678
Tank ID: 4
Compartment ID: A

Self Cert ID: 6122
Cert ID: 5155
UST Comprt ID: 16999
UST ID: 5739
AI Number: 15678
Tank ID: 4
Compartment ID: A

Self Cert ID: 6122
Cert ID: 223597
UST Comprt ID: 641307
UST ID: 5739
AI Number: 15678
Tank ID: 4
Compartment ID: A

Self Cert ID: 6122
Cert ID: 5149
UST Comprt ID: 17005
UST ID: 5739
AI Number: 15678
Tank ID: 4
Compartment ID: A

Self Cert ID: 6122
Cert ID: 5159
UST Comprt ID: 16995
UST ID: 5739
AI Number: 15678
Tank ID: 4
Compartment ID: A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

UNITED PARCEL SERVICE (Continued)

U001250945

Self Cert ID: 6122
Cert ID: 241948
UST Comprt ID: 695125
UST ID: 5739
AI Number: 15678
Tank ID: 4
Compartment ID: A

Self Cert ID: 6122
Cert ID: 5158
UST Comprt ID: 16996
UST ID: 5739
AI Number: 15678
Tank ID: 4
Compartment ID: A

Self Cert ID: 6122
Cert ID: 5150
UST Comprt ID: 17006
UST ID: 5739
AI Number: 15678
Tank ID: 4
Compartment ID: A

Self Cert ID: 6122
Cert ID: 5148
UST Comprt ID: 17004
UST ID: 5739
AI Number: 15678
Tank ID: 4
Compartment ID: A

Self Cert ID: 6122
Cert ID: 5157
UST Comprt ID: 16997
UST ID: 5739
AI Number: 15678
Tank ID: 4
Compartment ID: A

Self Cert ID: 6122
Cert ID: 259489
UST Comprt ID: 746939
UST ID: 5739
AI Number: 15678
Tank ID: 4
Compartment ID: A

Self Cert ID: 6122
Cert ID: 5156
UST Comprt ID: 16998
UST ID: 5739
AI Number: 15678
Tank ID: 4
Compartment ID: A

Self Cert ID: 6122

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

UNITED PARCEL SERVICE (Continued)

U001250945

Cert ID: 5151
UST Comprt ID: 17003
UST ID: 5739
AI Number: 15678
Tank ID: 4
Compartment ID: A

Facility Billing Contacts:

Contact Organization Name: UNITED PARCEL SERVICE INC
Contact Mailing Address (Delivery): 901 S PORTLAND AVE
Contact Mailing Address (Internal Delivery): Not reported
Contact Mailing City/State/Zip: OKLAHOMA CITY, OK 73108 2011
Phone Number/Ext: /
Contact Fax Number/Ext: /
Contact Email Address: Not reported
Contact Address Deliverable: Y
Facility ID: 77629
Additional ID: 17849152002154
Princ ID: 151337522003218
AI Number: 15678
Facility Name: UNITED PARCEL SERVICE
AR Number: Not reported
AR UST Number Suffix: Not reported
AR AST Number Suffix: Not reported
Contact Name/Title: DALE CALLICOAT/

**B9
SW
< 1/8
0.120 mi.
632 ft.**

**UNITED PARCEL SERVICE
113 CEMETARY RD
ANGLETON, TX 77515**

**Ind. Haz Waste S104854409
CENTRAL REGISTRY N/A**

Site 3 of 4 in cluster B

**Relative:
Lower
Actual:
25 ft.**

Ind. Haz Waste:
Name: UNITED PARCEL SERVICE
Address: 113 CEMETARY RD
City,State,Zip: ANGLETON, TX 77515
Registration Number: 70594
Registration Initial Notification Date: 09/26/1986
Registration Last Amendment Date: 07/06/1993
EPA Identification: TX0000242230
Primary NAICS Code: 492210
Status Change Date: 19860926
Land Type: Not reported
Description of Facility Site Location: 113 Cemetery Rd, Angleton, TX
Site Primary Standard Industrial Code: Not reported
Site Primary SIC Description: Not reported
Registration is Generator of Waste: Yes
Registration is Receivers of Waste: No
Registration is Transporter of Waste: No
Registration is Transfer Facility: No
Facility is STEERS Reporter: No
Required to Submit Annual Waste Summary: No
Facility Involved In Recycling: No
Revcr Has Monthly Reporting Requirement: 0
Mexican Facility: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

UNITED PARCEL SERVICE (Continued)

S104854409

Type of Generator: NON INDUS, CESQG
TNRCC Region: Not reported
Company Name: UNITED PARCEL SERVICE INC
Contact Name: ROGER DAIGGER
Contact Telephone Number: 713-8476603
Mailing Address: 8330 SWEETWATER LN
Mailing Address2: Not reported
Mailing City,St,Zip: HOUSTON, TX 770373616
Mailing County: UNITED STATES
Facility Country: UNITED STATES
TNRCC Facility ID: 25406
Site Owner Tax ID: 362407381
Site Location Latitude: -00.000
Site Location Longitude: -000.000
Last Update to NOR Data: 20021010
Ind. waste permit Number: Not reported
Mun waste permit Number: Not reported
Non Notifier: No

Business Records Not Found for this RegNo/Year:

Owner:

Owner Mailing Address: 8330 SWEETWATER LN
Owner Mailing Address2: Not reported
Owner Mailing Address3: Not reported
Owner City,St,Zip: HOUSTON, TX 77037 3616
Owner Country: UNITED STA
Owner Phone Number: 1-713-8476603
Owner Fax Number: Not reported
Owner Email Address: Not reported
Owner Business Type: Corporation
Owner Tax Id: 13624073816
Owner Bankruptcy Code: Not reported

Operator:

Operator Last Name: UNITED PARCEL SERVICE INC
Operator First Name: Not reported
Operator Name: UNITED PARCEL SERVICE INC
Operator Mailing Address: 8330 SWEETWATER LN
Operator Mailing Address 2: Not reported
Operator Mailing City,St,Zip: HOUSTON, TX 77037 3616
Operator Country: UNITED STA
Operator Phone: 1-713-8476603
Operator Fax: Not reported
Operator Email: Not reported
Operator Business Type: Corporation
Operator Tax Id: 13624073816
Operator Bankruptcy Code: Not reported

Contact:

Contact Name: Not reported
Contact Title: Not reported
Contact Role: OWNCON
Contact Address: 8330 SWEETWATER LN
Contact Address2: Not reported
Contact City,St,Zip: HOUSTON, TX 77037 3616
Contact Phone: 1-713-8476603
Contact Fax: Not reported
Contact Email: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

UNITED PARCEL SERVICE (Continued)

S104854409

Contact:

Contact Name: ROGER DAIGGER
Contact Title: DIST PE MGR
Contact Role: PRICONT
Contact Address: 8330 SWEETWATER LN
Contact Address2: Not reported
Contact City,St,Zip: HOUSTON, TX 77037 3616
Contact Phone: 1-713-8476603
Contact Fax: Not reported
Contact Email: Not reported

Contact:

Contact Name: Not reported
Contact Title: Not reported
Contact Role: OPRCON
Contact Address: 8330 SWEETWATER LN
Contact Address2: Not reported
Contact City,St,Zip: HOUSTON, TX 77037 3616
Contact Phone: 1-713-8476603
Contact Fax: Not reported
Contact Email: Not reported

Unit Records Not Found for this RegNo/Year:

One Time Shipper Records Not Found for this RegNo/Year:

Receiver Type: Not reported
Transporter for hire: 0
Transport own waste: 0
Eq 01, if transport waste type = 1: Not reported
Eq 02, if transport waste type = 2: Not reported
Eq 03, if transport waste type = 3: Not reported
Eq 04, if transport waste type = H: Not reported
Target TCEQ unique facid for discarded(merged) facility: Not reported

Waste Records Not Found for this RegNo/Year:

CENTRAL REGISTRY:

Regulated Entity Number: RN100703495
Name: UNITED PARCEL SERVICE
Address: 113 CEMETARY RD
Address 2: Not reported
City,State,Zip: ANGLETON, TX 77515
TCEQ Regional Office City Name: HOUSTON
TCEQ Region Number: 12
Status: ACTIVE
Status Date: 01/01/1800
Customer Number: CN602297624
Customer Name: UNITED PARCEL SERVICE INC
Customer Legal Name: United Parcel Service, Inc.
Customer Ownership Type Code: Not reported
Customer Ownership Type: CORPORATION
Affiliation Begin Date: 09/01/1990
Affiliation End Date: 12/31/3000
Customer Status: ACTIVE
Primary NAICS Industry Type Code: 49221
Primary NAICS Industry Type Description: Local Messengers and Local Delivery
Primary SIC Industry Type Code: Not reported
Primary SIC Industry Type Description: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

UNITED PARCEL SERVICE (Continued)

S104854409

Physical Location Description: 113 Cemetery Rd, Angleton, TX

Regulated Entity Number: RN100703495
Name: UNITED PARCEL SERVICE
Address: 113 CEMETARY RD
Address 2: Not reported
City,State,Zip: ANGLETON, TX 77515
TCEQ Regional Office City Name: HOUSTON
TCEQ Region Number: 12
Status: ACTIVE
Status Date: 01/01/1800
Customer Number: CN602297624
Customer Name: UNITED PARCEL SERVICE INC
Customer Legal Name: United Parcel Service, Inc.
Customer Ownership Type Code: Not reported
Customer Ownership Type: CORPORATION
Affiliation Begin Date: 09/01/1990
Affiliation End Date: 12/31/3000
Customer Status: ACTIVE
Primary NAICS Industry Type Code: 49221
Primary NAICS Industry Type Description: Local Messengers and Local Delivery
Primary SIC Industry Type Code: Not reported
Primary SIC Industry Type Description: Not reported
Physical Location Description: 113 Cemetery Rd, Angleton, TX

Regulated Entity Number: RN100703495
Name: UNITED PARCEL SERVICE
Address: 113 CEMETARY RD
Address 2: Not reported
City,State,Zip: ANGLETON, TX 77515
TCEQ Regional Office City Name: HOUSTON
TCEQ Region Number: 12
Status: ACTIVE
Status Date: 01/01/1800
Customer Number: CN602297624
Customer Name: UNITED PARCEL SERVICE INC
Customer Legal Name: United Parcel Service, Inc.
Customer Ownership Type Code: Not reported
Customer Ownership Type: CORPORATION
Affiliation Begin Date: 09/01/1990
Affiliation End Date: 12/31/3000
Customer Status: ACTIVE
Primary NAICS Industry Type Code: 49221
Primary NAICS Industry Type Description: Local Messengers and Local Delivery
Primary SIC Industry Type Code: Not reported
Primary SIC Industry Type Description: Not reported
Physical Location Description: 113 Cemetery Rd, Angleton, TX

Regulated Entity Number: RN100703495
Name: UNITED PARCEL SERVICE
Address: 113 CEMETARY RD
Address 2: Not reported
City,State,Zip: ANGLETON, TX 77515
TCEQ Regional Office City Name: HOUSTON
TCEQ Region Number: 12
Status: ACTIVE
Status Date: 01/01/1800

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

UNITED PARCEL SERVICE (Continued)

S104854409

Customer Number: CN602297624
Customer Name: UNITED PARCEL SERVICE INC
Customer Legal Name: United Parcel Service, Inc.
Customer Ownership Type Code: Not reported
Customer Ownership Type: CORPORATION
Affiliation Begin Date: 09/01/1990
Affiliation End Date: 12/31/3000
Customer Status: ACTIVE
Primary NAICS Industry Type Code: 49221
Primary NAICS Industry Type Description: Local Messengers and Local Delivery
Primary SIC Industry Type Code: Not reported
Primary SIC Industry Type Description: Not reported
Physical Location Description: 113 Cemetery Rd, Angleton, TX

Regulated Entity Number: RN100703495
Name: UNITED PARCEL SERVICE
Address: Not reported
Address 2: Not reported
City,State,Zip: TX
TCEQ Regional Office City Name: HOUSTON
TCEQ Region Number: 12
Status: ACTIVE
Status Date: 01/01/1800
Customer Number: CN602297624
Customer Name: UNITED PARCEL SERVICE INC
Customer Legal Name: United Parcel Service, Inc.
Customer Ownership Type Code: Not reported
Customer Ownership Type: CORPORATION
Affiliation Begin Date: 09/01/1990
Affiliation End Date: 12/31/3000
Customer Status: ACTIVE
Primary NAICS Industry Type Code: 49221
Primary NAICS Industry Type Description: Local Messengers and Local Delivery
Primary SIC Industry Type Code: Not reported
Primary SIC Industry Type Description: Not reported
Physical Location Description: 113 Cemetery Rd, Angleton, TX

B10
SW
< 1/8
0.120 mi.
632 ft.

UNITED PARCEL SERVICE
113 CEMETERY RD
ANGLETON, TX 77515

RCRA-VSQG **1004783495**
FINDS **TX0000242230**
ECHO

Site 4 of 4 in cluster B

Relative:
Lower

RCRA-VSQG:
Date form received by agency: 1994-04-22 00:00:00.0
Facility name: UNITED PARCEL SERVICE
Facility address: 113 CEMETERY RD
ANGLETON, TX 77515
EPA ID: TX0000242230
Mailing address: CEMETERY RD
ANGLETON, TX 77515
Contact: KEENAN WALLACE
Contact address: 113 CEMETERY RD
ANGLETON, TX 77515
Contact country: US
Contact telephone: 214-788-7724
Contact email: Not reported
EPA Region: 06

Actual:
25 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

UNITED PARCEL SERVICE (Continued)

1004783495

Classification: Conditionally Exempt Small Quantity Generator
Description: Handler: generates 100 kg or less of hazardous waste per calendar month, and accumulates 1000 kg or less of hazardous waste at any time; or generates 1 kg or less of acutely hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste

Owner/Operator Summary:

Owner/operator name: ABITEX CORP
Owner/operator address: 400 PERIMETER CENTER
ATLANTA, GA 30346
Owner/operator country: Not reported
Owner/operator telephone: 404-913-6054
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 1993-07-06 00:00:00.0
Site name: UNITED PARCEL SERVICE INC
Classification: Not a generator, verified

Hazardous Waste Summary:

Waste code: D000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

UNITED PARCEL SERVICE (Continued)

1004783495

. Waste name: Not Defined

. Waste code: D001
. Waste name: IGNITABLE WASTE

. Waste code: D002
. Waste name: CORROSIVE WASTE

. Waste code: D003
. Waste name: REACTIVE WASTE

. Waste code: D007
. Waste name: CHROMIUM

. Waste code: D008
. Waste name: LEAD

. Waste code: D009
. Waste name: MERCURY

. Waste code: D018
. Waste name: BENZENE

Violation Status: No violations found

FINDS:

Registry ID: 110005015633
Facility URL: http://ofmpub.epa.gov/enviro/fii_query_detail.disp_program_facility?p_registry_id=110005015633

Environmental Interest/Information System:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1004783495
Registry ID: 110005015633
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110005015633>
Name: UNITED PARCEL SERVICE
Address: 113 CEMETERY RD
City,State,Zip: ANGLETON, TX 77515

11
South
1/8-1/4
0.150 mi.
790 ft.

HURTA SITE
ACROSS FROM BOWLING ALLEY IN ANGLETON
BRAZORIA (County), TX 77515

CLI S103259395
N/A

Relative:
Lower
Actual:
25 ft.

H-GAC CLI:
Name: HURTA SITE
Address: ACROSS FROM BOWLING ALLEY IN ANGLETON
City,State,Zip: TX 77515

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HURTA SITE (Continued)

S103259395

Site Id:	U183
Quadrant:	Not reported
Amendment letter to permit num:	Not reported
Date rec:	Not reported
Type facility:	Not reported
Site status:	Not reported
County code:	Not reported
Extraterritorial jurisdiction:	Not reported
Accuracy:	1
Source:	1
Applicant Name:	Not reported
Applicant Address:	Not reported
Applicant City/State/Zip:	0
Applicant Phone:	0 0
Permit Status:	Not reported
Original Acreage:	0.00
Population Served:	0
Area Served:	Not reported
Tons Accepted Per Day:	0
Cubic Yds Accepted Per Day:	0.00
Est Closure Date:	0
River Code:	0
Bus Code:	0
State rem:	Not reported
Responsible Eng:	Not reported
Stat Date:	0
A open date:	Not reported
A close date:	0
Update:	0
MaP URL:	http://arcgis02.h-gac.com/Reference/CLI/Sitemaps/U183.pdf
Report URL:	http://arcgis02.h-gac.com/Reference/CLI/Reports/U183.pdf

CLI:

Facility ID:	Not reported
Facility Name2:	Not reported
Site Status:	Not reported
Date Recieved:	Not reported
County:	Not reported
Region:	Not reported
Near City:	Not reported
Organic Acres:	Not reported
Area Served:	Not reported
Population Srvd:	Not reported
Tons per Day:	Not reported
Yards per Day:	Not reported
Permit Status:	Not reported
Removal Status:	Not reported
Status Date:	Not reported
Engineer:	Not reported
Source:	1
Source Code:	A
Date Opened:	1976
Date Closed:	1976
Size - Acres:	Not reported
Size - Cubic Yrds:	Not reported
Lat Deg:	29
Lat Min:	8.90

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HURTA SITE (Continued)

S103259395

Long Deg: 95
Long Min: 25.79
Lat/Long (deg): 29.148333 / -95.429833
Owner: Dan Hurta
Owner Address: Not reported
Owner C,S,Z: Not reported
Business Type: Not reported
Facility Type: Not reported
Version of Amendment: Not reported
Extra Territorial Jurisdiction: Not reported
Applicant Name: Not reported
Applicant Address: Not reported
Applicant City,St,Zip: Not reported
Applicant Phone: Not reported
Est Cleanup Date: Not reported
River Basin Code: Not reported
Earliest Date in the Records: Not reported
Last Date in Records Site Accepted Waste: Not reported
Texas Council of Government Code: 16
Texas Water Commision District Code: 7
Code for Landfill: 1
Parties: Individuals
Accepts House Hold: Yes
Accepts Construction Demolition: Not reported
Accepts Industrial Waste: Not reported
Accepts Tires: Not reported
Accepts Agriculture: Not reported
Accepts Brush: Not reported
Accepts Other: Not reported
Accepts Other Description: Not reported
Haz Waste Unlikely: Yes
Haz Waste Probably: Not reported
Haz Waste Likey: Not reported
Legal: Not reported
Maximum Depth: *****
Depth Code: Not reported
Final Cover Has Been Applied: Not reported
Minimun Thickness of Final Cover: Not reported
In Use Inspector: Uk
Inspc Comments: 05/04/76 - Area fill operation; No burning observed; Owner agreed to close site.
Comments: ???
Update: 0
Reviewer: Not reported
Flag: Not reported

12
WNW
1/8-1/4
0.154 mi.
811 ft.

RICHMOND INDUSTRIES
1021 S FRONT ST
ANGLETON, TX 77515

UST 1000649902
N/A

Relative:
Higher

UST:

Actual:
26 ft.

Name: RICHMOND INDUSTRIES
Address: 1021 S FRONT ST
City,State,Zip: ANGLETON, TX 775158224
AI Number: 41755
Facility Type: UNKNOWN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RICHMOND INDUSTRIES (Continued)

1000649902

Facility Begin Date:	01/26/1987
Facility Status:	INACTIVE
Additional ID:	419687822003073
Facility Exempt Status:	N
Records Off-Site:	No
UST Financial Assurance Required:	No
Number Of Active UST:	0
Site Location Description:	Not reported
Site Location (Nearest City Name):	Not reported
Site Location (County Name):	BRAZORIA
Site Location (Tceq Region):	12
Site Location (Location Zip):	77515
Contact Name/Title:	A A RODRIGUEZ,SUPT.
Contact Organization Name:	RICHMOND INDUSTRIES
Contact Mailing Address1:	Not reported
Contact Mailing Address2:	Not reported
Contact Mailing City/State/Zip:	Not reported
Contact Telephone:	4098498554
Facility Contact Address Deliverable:	Not reported
Contact Fax Number:	Not reported
Contact Email Address:	Not reported
Signature Date On Earliest Reg Form:	04/23/1986
Signature Name/Title On Earliest Reg Form:	A A RODRIGUEZ,SUPT
Application Received Date On Earliest Reg Form:	05/08/1986
Signature Role On Earliest Reg Form:	Not reported
Signature Company On Earliest Reg Form:	Not reported
Enforcement Action:	Not reported
Facility Not Inspectable:	No
Owner:	
Owner CN:	CN600399273
Owner Last Name:	RICHMOND TANK CAR COMPANY
Owner First Name:	Not reported
Owner Middle Name:	Not reported
Owner Type:	CO
Contact Mailing Address (Delivery):	Not reported
Contact Mailing Address (Internal Delivery):	Not reported
Contact Mailing City:	Not reported
Contact Mailing State:	Not reported
Contact Mailing Zip:	Not reported
Contact Mailing Zip5:	Not reported
Contact Phone Number/Ext:	/
Contact Fax Country Code:	Not reported
Contact Fax Number/Ext:	/
Contact Email Address:	Not reported
Contact Address Deliverable:	Not reported
Princ ID:	499771772001309
Additional ID:	419687822003073
AI Number:	41755
Owner Effective Begin Date:	01/26/1987
State Tax ID:	17417720350
Contact Role:	Not reported
Contact Name/Title:	/
Contact Organization Name:	Not reported
Tank:	
Install Date:	08/31/1987

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RICHMOND INDUSTRIES (Continued)

1000649902

Tank Registration Date:	05/08/1986
Number of Compartments:	1
Tank Capacity:	Not reported
Tank Singlewall:	N
Tank Doublewall:	N
Pipe Type:	Not reported
UST ID:	110595
Facility ID:	61377
Ai Number:	41755
Tank Id:	1
Tank Status (Current):	REMOVED FROM GROUND
Tank Status Date:	11/14/1988
Empty:	N
Tank Regulatory Status:	FULLY REGULATED
Tank Int Prot (Internal Tank Lining Date):	Not reported
Piping Design (Single Wall):	N
Piping Design (Double Wall):	N
Tank Ext Cont(Fac-Built Nonmetallic Jacket):	N
Tank Ext Cont(Syn Tank-Pit/Piping-Trench Liner):	N
Tank Ext Cont(Tank Vault/Rigid Trench Liner):	N
Piping Ext Cont(Fac-Built Nonmetallic Jacket):	N
Piping Ext Cont(Syn Tank-Pit/Piping-Trench Liner):	N
Piping Ext Cont(Tank Vault/Rigid Trench Liner):	N
Tank Material (Steel):	N
Tank Material(Frp(Fiberglass-Reinforced Plastic):	N
Tank Mat(Composite (Steel W/Ext Frp Cladding)):	N
Tank Mat(Concrete):	N
Tank Mat(Jacketed (Steel W/Ext Nonmetallic Jck)):	N
Tank Mat(Coated(Steel W/ExtPolyurethane Cladding)):	N
Piping Material (Steel):	N
Piping Mat(Frp(Fiberglass Reinforced Plastic):	N
Piping Mat(Concrete):	N
Piping Mat(Jacketed(Steel W/Ext Nonmetallic Jacket)):	N
Piping Mat(Nonmetallic Flex Piping):	N
PipingConnect/Valves(Shear/Impact Valves(Under Disp)):	N
Piping Connect/Valves(Steel Swing-Joints(End Of Piping)):	N
Piping Connect/Valves (Flex Connectors(Ends Of Piping)):	N
Tank Corr Prot Meth(TCPM)(Cathodic-Field Installation):	N
TCPM (ExtDielectricCoat/Laminate/Tape/Wrap):	N
TCPM(Cathodic Prot-FacInstallation):	N
TCPM(Composite Tank(Steel W/Frp Ext Laminate):	N
TCPMeth(Coated Tank(Steel W/ExtPolyurethaneLaminate):	N
TCPM(FRP Tank Or Piping(Noncorrodible):	N
TCPM(Ext Nonmetallic Jacket):	N
TCPMeth(Unnecessary Per Corrosion Prot Spec):	N
Piping Corr Prot Meth(Dielectric Coat/Laminate/Tape/Wrap):	N
Piping Corr Prot Method(PCPM) (Cathodic Factory Install):	N
PCPM(Cathodic Prot-Field Install):	N
PCPMeth (FRP Tank Or Piping(Noncorrodible):	N
PCPM(Nonmetallic FlexPiping (Noncorrodible)):	N
PCPMeth(Isolated Open Area/2nd Containment):	N
PCPM (Dual Protected):	N
PCPM(Unnec Per Corrosion Prot Specialist):	N
Tank Corr Prot Compliance Flag:	N
Piping Corr Prot Compliance Flag:	N
Tank Corrosion Prot Variance:	N
Piping Corrosion Prot Variance:	N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RICHMOND INDUSTRIES (Continued)

1000649902

Temp Out Of Service Compliance: N
Technical Compliance Flag: N
Tank Tested Flag: Y
Installation Signature Date: 07/18/1990

Compartment Records:

Tank ID: 1
Tank Capacity: 0
UST Comprt ID: 58251
UST ID: 110595
AI Number: 41755
Compartment ID: A
Substance Stored1: UNKNOWN
Substance Stored2: Not reported
Substance Stored3: Not reported
CompartmentReleaseDetectionMethod(Vapor): N
CRDM(GW Monitoring): N
CRDM(Monitoring Of Secondary Cont Barrier): N
CRDM(Auto Tank Gauge Test/Inv Control): N
CRDM(Interstitial Monitoring SecWall/Jacket): N
CRDM(Wkly Manual Gauging(Tanks<=1000 G): N
CRDM(Mthly Tank Gauging(Emer Gen Tanks): N
CRDM(Sir (Stat Inv Reconciliation)/Inv Control): N
PipingReleaseDetectionMethod(PRDM)(Vapor): N
PRDM(Groundwater Monitoring): N
PRDM(Monitoring Sec Containment Barrier): N
PRDM(InterstitialMonitoring w/in SecWall/Jacket): N
PRDM(Mthly Piping Tightness Test)@.2Gph: N
PRDM(AnnualPipingTightTest/ElecMon@.1Gph: N
PRDM(TriennialTightTest(Suction/GravityPiping): N
PRDM AutoLineLeakDet(3.0 Gph PressPiping): N
PRDM(Sir(StatInv Recon)/Inv Control)): N
PRDM(Exempt System Suction: N
Spill Overfill Prevention Equip(SOPE): N
SOPE(Spill Cont/Bucket/Sump): N
SOPE(DelShut-Off Valve)): N
SOPE(FlowRestrictorValue: N
SOPE(Alarm (Set@<=90%) W/3a Or 3b: N
SOPE(N/A Deliveries To Tank<=25G): N
Compartment Release Det Compliance Flag: N
Piping Release Detection Compliance Flag): N
Spill/OverfillPreventionCompliance Flag: N
Compartment Release Detection Variance: N
Piping Release Detection Variance: N
Spill And Overfill Prevention Variance: N
Stage I Vapor Recovery: Not reported
Stage 1 Installation Date: Not reported

Facility Billing Contacts:

Contact Organization Name: RICHMOND TANK CAR COMPANY
Contact Mailing Address (Delivery): 1700 WEST LOOP S STE 1500
Contact Mailing Address (Internal Delivery): Not reported
Contact Mailing City/State/Zip: HOUSTON, TX 77027 3089
Phone Number/Ext: /
Contact Fax Number/Ext: /
Contact Email Address: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RICHMOND INDUSTRIES (Continued)

1000649902

Contact Address Deliverable: Y
Facility ID: 61377
Additional ID: 419687822003073
Princ ID: 499771772001309
AI Number: 41755
Facility Name: RICHMOND INDUSTRIES
AR Number: Not reported
AR UST Number Suffix: Not reported
AR AST Number Suffix: Not reported
Contact Name/Title: D ASTRAN/

C13
WSW
1/8-1/4
0.195 mi.
1027 ft.

BW SERVICES ANGLETON CAR SHOP
1100 WAYNE DR
ANGLETON, TX 77515

Ind. Haz Waste S104852620
N/A

Site 1 of 2 in cluster C

Relative:
Higher

Ind. Haz Waste:

Actual:
28 ft.

Name: BW SERVICES ANGLETON CAR SHOP
Address: 1100 WAYNE DR
City,State,Zip: ANGLETON, TX 77515
Registration Number: 30207
Registration Initial Notification Date: 05/26/1980
Registration Last Amendment Date: 02/22/2012
EPA Identification: TXD086467800
Primary NAICS Code: 488210
Status Change Date: 20131122
Land Type: PRIVATE
Description of Facility Site Location: 1100 WAYNE DR ANGLETON TX
Site Primary Standard Industrial Code: Not reported
Site Primary SIC Description: Not reported
Registration is Generator of Waste: Yes
Registration is Receivers of Waste: No
Registration is Transporter of Waste: No
Registration is Transfer Facility: No
Facility is STEERS Reporter: No
Required to Submit Annual Waste Summary: Yes
Facility Involved In Recycling: No
Revcr Has Monthly Reporting Requirement: 0
Mexican Facility: Not reported
Type of Generator: INDUS, LQG
TNRCC Region: Not reported
Company Name: WASHAMERICA INC
Contact Name: BRANDAN WHITE
Contact Telephone Number: 979-8488800
Mailing Address: 1100 WAYNE DR
Mailing Address2: Not reported
Mailing City,St,Zip: ANGLETON, TX 775159351
Mailing County: UNITED STATES
Facility Country: UNITED STATES
TNRCC Facility ID: 7774
Site Owner Tax ID: 0
Site Location Latitude: -00.000
Site Location Longitude: -000.000
Last Update to NOR Data: 20191101
Ind. waste permit Number: Not reported
Mun waste permit Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

S104852620

Non Notifier: No

Business Records Not Found for this RegNo/Year:

Owner:

Owner Mailing Address: 1100 WAYNE DR
Owner Mailing Address2: Not reported
Owner Mailing Address3: Not reported
Owner City,St,Zip: ANGLETON, TX 77515 9351
Owner Country: UNITED STA
Owner Phone Number: 1-979-8488800
Owner Fax Number: Not reported
Owner Email Address: Not reported
Owner Business Type: Corporation
Owner Tax Id: 17518620657
Owner Bankruptcy Code: Not reported

Operator:

Operator Last Name: WASHAMERICA INC
Operator First Name: Not reported
Operator Name: WASHAMERICA INC
Operator Mailing Address: 1100 WAYNE DR
Operator Mailing Address 2: Not reported
Operator Mailing City,St,Zip: ANGLETON, TX 77515 9351
Operator Country: UNITED STA
Operator Phone: 1-979-8488800
Operator Fax: 1-979-8489990
Operator Email: brandan@bwservices.biz
Operator Business Type: Corporation
Operator Tax Id: 17518620657
Operator Bankruptcy Code: Not reported

Contact:

Contact Name: Not reported
Contact Title: Not reported
Contact Role: OWNCON
Contact Address: 1100 WAYNE DR
Contact Address2: Not reported
Contact City,St,Zip: ANGLETON, TX 77515 9351
Contact Phone: 1-979-8488800
Contact Fax: Not reported
Contact Email: Not reported

Contact:

Contact Name: Not reported
Contact Title: Not reported
Contact Role: OPRCON
Contact Address: 1100 WAYNE DR
Contact Address2: Not reported
Contact City,St,Zip: ANGLETON, TX 77515 9351
Contact Phone: 1-979-8488800
Contact Fax: 1-979-8489990
Contact Email: brandan@bwservices.biz

Contact:

Contact Name: BRANDAN WHITE
Contact Title: PLANT MANAGER
Contact Role: PRICON
Contact Address: 1100 WAYNE DR
Contact Address2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

S104852620

Contact City,St,Zip: ANGLETON, TX 77515 9351
Contact Phone: 1-979-8488800
Contact Fax: 1-979-8489990
Contact Email: brandan@bwservices.biz

Unit:

Unit No: 001
Deed Record Needed: Not reported
Deed Recording Date: Not reported
Unit Type Code: 01
Unit Type: Not reported
Unit Status: CLOSED
Unit Regulatory Status: Not reported
UIC Permit Number: Not reported
Capacity: Not reported
Capacity Measurment: Not reported
Off Site Hazardous Waste: No
Off Site Class 1 Waste: Not reported
Off Site Class 2 Waste: Not reported
Off Site Class 3 Waste: Not reported
Off Site Non Indstrl Sld Wst: Not reported
System Type Code: Not reported
System Type: Not reported
System Type Code 1: Not reported
System Type 1: Not reported
System Type Code 2: Not reported
System Type 2: Not reported
System Type Code 3: Not reported
System Type 3: Not reported
System Type Code 4: Not reported
System Type 4: Not reported
Permit Seq #: Not reported
Unit Description on NOR: closure certified 05-16-89
Dt Last Changed: 19890501

Unit:

Unit No: 002
Deed Record Needed: Not reported
Deed Recording Date: Not reported
Unit Type Code: 01
Unit Type: Not reported
Unit Status: CLOSED
Unit Regulatory Status: Not reported
UIC Permit Number: Not reported
Capacity: Not reported
Capacity Measurment: Not reported
Off Site Hazardous Waste: No
Off Site Class 1 Waste: Not reported
Off Site Class 2 Waste: Not reported
Off Site Class 3 Waste: Not reported
Off Site Non Indstrl Sld Wst: Not reported
System Type Code: Not reported
System Type: Not reported
System Type Code 1: Not reported
System Type 1: Not reported
System Type Code 2: Not reported
System Type 2: Not reported
System Type Code 3: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

S104852620

System Type 3:	Not reported
System Type Code 4:	Not reported
System Type 4:	Not reported
Permit Seq #:	Not reported
Unit Description on NOR:	NEVER USED-----FREASHWATER IMPOUNDMENT
Dt Last Changed:	19890501

Unit:

Unit No:	003
Deed Record Needed:	Not reported
Deed Recording Date:	Not reported
Unit Type Code:	01
Unit Type:	Not reported
Unit Status:	CLOSED
Unit Regulatory Status:	Not reported
UIC Permit Number:	Not reported
Capacity:	Not reported
Capacity Measurment:	Not reported
Off Site Hazardous Waste:	No
Off Site Class 1 Waste:	Not reported
Off Site Class 2 Waste:	Not reported
Off Site Class 3 Waste:	Not reported
Off Site Non Indstrl Sld Wst:	Not reported
System Type Code:	Not reported
System Type:	Not reported
System Type Code 1:	Not reported
System Type 1:	Not reported
System Type Code 2:	Not reported
System Type 2:	Not reported
System Type Code 3:	Not reported
System Type 3:	Not reported
System Type Code 4:	Not reported
System Type 4:	Not reported
Permit Seq #:	Not reported
Unit Description on NOR:	NERVER USED--FRESHWATER IMPOUNDMENT
Dt Last Changed:	19890501

Unit:

Unit No:	004
Deed Record Needed:	Not reported
Deed Recording Date:	Not reported
Unit Type Code:	19
Unit Type:	Not reported
Unit Status:	CLOSED
Unit Regulatory Status:	Not reported
UIC Permit Number:	Not reported
Capacity:	Not reported
Capacity Measurment:	Not reported
Off Site Hazardous Waste:	No
Off Site Class 1 Waste:	Not reported
Off Site Class 2 Waste:	Not reported
Off Site Class 3 Waste:	Not reported
Off Site Non Indstrl Sld Wst:	Not reported
System Type Code:	Not reported
System Type:	Not reported
System Type Code 1:	Not reported
System Type 1:	Not reported
System Type Code 2:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

S104852620

System Type 2:	Not reported
System Type Code 3:	Not reported
System Type 3:	Not reported
System Type Code 4:	Not reported
System Type 4:	Not reported
Permit Seq #:	Not reported
Unit Description on NOR:	OIL/SOLIDS SEPARATOR CLOSURE CERTIFIED 05-16-89 Cap: 15000 GAL.
Dt Last Changed:	19890501

Unit:

Unit No:	006
Deed Record Needed:	Not reported
Deed Recording Date:	Not reported
Unit Type Code:	03
Unit Type:	Not reported
Unit Status:	CLOSED
Unit Regulatory Status:	Not reported
UIC Permit Number:	Not reported
Capacity:	Not reported
Capacity Measurment:	Not reported
Off Site Hazardous Waste:	No
Off Site Class 1 Waste:	Not reported
Off Site Class 2 Waste:	Not reported
Off Site Class 3 Waste:	Not reported
Off Site Non Indstrl Sld Wst:	Not reported
System Type Code:	Not reported
System Type:	Not reported
System Type Code 1:	Not reported
System Type 1:	Not reported
System Type Code 2:	Not reported
System Type 2:	Not reported
System Type Code 3:	Not reported
System Type 3:	Not reported
System Type Code 4:	Not reported
System Type 4:	Not reported
Permit Seq #:	Not reported
Unit Description on NOR:	CLOSURE CERTIFIED 05-16-89
Dt Last Changed:	19881101

Unit:

Unit No:	018
Deed Record Needed:	Not reported
Deed Recording Date:	Not reported
Unit Type Code:	14
Unit Type:	Not reported
Unit Status:	ACTIVE
Unit Regulatory Status:	03
UIC Permit Number:	Not reported
Capacity:	Not reported
Capacity Measurment:	Not reported
Off Site Hazardous Waste:	No
Off Site Class 1 Waste:	Not reported
Off Site Class 2 Waste:	Not reported
Off Site Class 3 Waste:	Not reported
Off Site Non Indstrl Sld Wst:	Not reported
System Type Code:	Not reported
System Type:	Not reported
System Type Code 1:	141

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

S104852620

System Type 1:	Not reported
System Type Code 2:	Not reported
System Type 2:	Not reported
System Type Code 3:	Not reported
System Type 3:	Not reported
System Type Code 4:	Not reported
System Type 4:	Not reported
Permit Seq #:	Not reported
Unit Description on NOR:	LT 90 DAY DRUM STORAGE BUILDING WITH CONTAINMENT
Dt Last Changed:	20120222

Unit:

Unit No:	019
Deed Record Needed:	Not reported
Deed Recording Date:	Not reported
Unit Type Code:	14
Unit Type:	Not reported
Unit Status:	ACTIVE
Unit Regulatory Status:	03
UIC Permit Number:	Not reported
Capacity:	Not reported
Capacity Measurment:	Not reported
Off Site Hazardous Waste:	No
Off Site Class 1 Waste:	Not reported
Off Site Class 2 Waste:	Not reported
Off Site Class 3 Waste:	Not reported
Off Site Non Indstrl Sld Wst:	Not reported
System Type Code:	Not reported
System Type:	Not reported
System Type Code 1:	141
System Type 1:	Not reported
System Type Code 2:	Not reported
System Type 2:	Not reported
System Type Code 3:	Not reported
System Type 3:	Not reported
System Type Code 4:	Not reported
System Type 4:	Not reported
Permit Seq #:	Not reported
Unit Description on NOR:	DAF FILTER SLUDGE - OIL, GREASE, SOLIDS, WATER. ROLL OFF CONTAINER
Dt Last Changed:	20120222

Unit:

Unit No:	020
Deed Record Needed:	Not reported
Deed Recording Date:	Not reported
Unit Type Code:	22
Unit Type:	Not reported
Unit Status:	ACTIVE
Unit Regulatory Status:	05
UIC Permit Number:	Not reported
Capacity:	Not reported
Capacity Measurment:	Not reported
Off Site Hazardous Waste:	No
Off Site Class 1 Waste:	Not reported
Off Site Class 2 Waste:	Not reported
Off Site Class 3 Waste:	Not reported
Off Site Non Indstrl Sld Wst:	Not reported
System Type Code:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

S104852620

System Type:	Not reported
System Type Code 1:	141
System Type 1:	Not reported
System Type Code 2:	Not reported
System Type 2:	Not reported
System Type Code 3:	Not reported
System Type 3:	Not reported
System Type Code 4:	Not reported
System Type 4:	Not reported
Permit Seq #:	Not reported
Unit Description on NOR:	PLANT REFUSE - FLOOR SWEEPING, RUST, SCALE, DEBRIS - NON-HAZ ROLL OFF BOX
Dt Last Changed:	20120222

Unit:

Unit No:	021
Deed Record Needed:	Not reported
Deed Recording Date:	Not reported
Unit Type Code:	22
Unit Type:	Not reported
Unit Status:	ACTIVE
Unit Regulatory Status:	05
UIC Permit Number:	Not reported
Capacity:	Not reported
Capacity Measurment:	Not reported
Off Site Hazardous Waste:	No
Off Site Class 1 Waste:	Not reported
Off Site Class 2 Waste:	Not reported
Off Site Class 3 Waste:	Not reported
Off Site Non Indstrl Sld Wst:	Not reported
System Type Code:	Not reported
System Type:	Not reported
System Type Code 1:	141
System Type 1:	Not reported
System Type Code 2:	Not reported
System Type 2:	Not reported
System Type Code 3:	Not reported
System Type 3:	Not reported
System Type Code 4:	Not reported
System Type 4:	Not reported
Permit Seq #:	Not reported
Unit Description on NOR:	HOPPER CAR RESIDUALS - WAXES, PLASTICS, NON-HAZ SOLIDS
Dt Last Changed:	20120222

One Time Shipper Records Not Found for this RegNo/Year:

Receiver Type:	Not reported
Transporter for hire:	0
Transport own waste:	0
Eq 01, if transport waste type = 1:	Not reported
Eq 02, if transport waste type = 2:	Not reported
Eq 03, if transport waste type = 3:	Not reported
Eq 04, if transport waste type = H:	Not reported
Target TCEQ unique facid for discarded(merged) facility:	Not reported

Waste:

Waste ID:	96747
Waste Description:	HOPPER CAR RESIDUAL SOLIDS - WAXES, PLASTICS - NON HAZARDOUS GENERATION DATE 11/
Desc of Waste:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

S104852620

Texas Waste Code: Not reported
Texas Waste Code 2: 00114091
Waste Code Status: ACTIVE
Waste Form: Not reported
Waste Classification: 1
Waste is Radioactive: No
Waste Treated Off Site: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Measurement Point: Not reported
Primary Origin: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: No
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

Waste:

Waste ID: 79249
Waste Description: OTHER TANK CAR RESIDUALS - HAZARDOUS SOLVENTS GENERATION DATE
11/18/2013

Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 0010219H
Waste Code Status: ACTIVE
Waste Form: Not reported
Waste Classification: H
Waste is Radioactive: No
Waste Treated Off Site: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Measurement Point: Not reported
Primary Origin: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: No
Company Waste ID: Not reported
Primary NAICS Code: 488210
EPA Waste Form Code: W219
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

Waste:

Waste ID: 77449
Waste Description: HAZARDOUS HALOGENATED/NON HALOGENATED SOLVENTS GENERATION DATE
11/18/2013

Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 0009204H
Waste Code Status: ACTIVE
Waste Form: Not reported
Waste Classification: H
Waste is Radioactive: No
Waste Treated Off Site: Not reported
Standard Industrial Classification: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

S104852620

Primary Source: Not reported
Primary Measurement Point: Not reported
Primary Origin: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: No
Company Waste ID: Not reported
Primary NAICS Code: 488210
EPA Waste Form Code: W204
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

Waste:

Waste ID: 70658
Waste Description: RAIL CAR RESIDUALS HAL HAZ ORGANIC SOLID
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 0008407H
Waste Code Status: ACTIVE
Waste Form: Not reported
Waste Classification: H
Waste is Radioactive: No
Waste Treated Off Site: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Measurement Point: Not reported
Primary Origin: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: No
Company Waste ID: Not reported
Primary NAICS Code: 488210
EPA Waste Form Code: W409
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

Waste:

Waste ID: 67886
Waste Description: Sulfur
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 00073192
Waste Code Status: INACTIVE
Waste Form: Not reported
Waste Classification: 2
Waste is Radioactive: No
Waste Treated Off Site: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Measurement Point: Not reported
Primary Origin: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: Yes
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

S104852620

EPA Haz Waste: Not reported

Waste:

Waste ID: 67885
Waste Description: TANK CAR RESIDUALS - NON HAZ ORGANIC LIQUIDS GENERATION DATE 11/18/2013
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 00062191
Waste Code Status: ACTIVE
Waste Form: Not reported
Waste Classification: 1
Waste is Radioactive: No
Waste Treated Off Site: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Measurement Point: Not reported
Primary Origin: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: No
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

Waste:

Waste ID: 67884
Waste Description: NAPHTHALENE D001 OTHER NON HALOGENATED HAZARDOUS ORGANIC SOLIDS GENERATION DATE 1
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 0005409H
Waste Code Status: ACTIVE
Waste Form: Not reported
Waste Classification: H
Waste is Radioactive: No
Waste Treated Off Site: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Measurement Point: Not reported
Primary Origin: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: No
Company Waste ID: Not reported
Primary NAICS Code: 488210
EPA Waste Form Code: W409
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

Waste:

Waste ID: 67883
Waste Description: FLAMMABLE HAZARDOUS SOLIDS - MAY BE REACTIVE IGNITABLE D003 D001 PHTHALIC ANHYDR
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 0004409H

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

S104852620

Waste Code Status: ACTIVE
Waste Form: Not reported
Waste Classification: H
Waste is Radioactive: No
Waste Treated Off Site: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Measurement Point: Not reported
Primary Origin: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: No
Company Waste ID: Not reported
Primary NAICS Code: 488210
EPA Waste Form Code: W409
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

Waste:

Waste ID: 67882
Waste Description: FLAMMABLE PRODUCTS RESIDUALS D001 - WASTE RESIN SOLUTION FLAMMABLE
REACTIVE RESI

Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 0003219H
Waste Code Status: ACTIVE
Waste Form: Not reported
Waste Classification: H
Waste is Radioactive: No
Waste Treated Off Site: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Measurement Point: Not reported
Primary Origin: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: No
Company Waste ID: Not reported
Primary NAICS Code: 488210
EPA Waste Form Code: W219
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

Waste:

Waste ID: 67422
Waste Description: CAUSTIC SOLUTION FROM TANK CAR CLEANING GENERATION DATE 11/18/2013
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 0001110H
Waste Code Status: ACTIVE
Waste Form: Not reported
Waste Classification: H
Waste is Radioactive: No
Waste Treated Off Site: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Measurement Point: Not reported
Primary Origin: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

S104852620

Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: No
Company Waste ID: Not reported
Primary NAICS Code: 488210
EPA Waste Form Code: W110
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

Waste:

Waste ID: 67421
Waste Description: 4227 METHYL METHACRYLATE TANK CAR HELL - HAZ WASTE SOLVENT GENERATION
DATE 11/18
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 0002204H
Waste Code Status: ACTIVE
Waste Form: Not reported
Waste Classification: H
Waste is Radioactive: No
Waste Treated Off Site: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Measurement Point: Not reported
Primary Origin: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: No
Company Waste ID: Not reported
Primary NAICS Code: 488210
EPA Waste Form Code: W204
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

Waste:

Waste ID: 357603
Waste Description: VARYING CONCENTRATIONS OF SULFURIC ACID PRODUCT FROM TANK CARS
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 0016105H
Waste Code Status: ACTIVE
Waste Form: Not reported
Waste Classification: H
Waste is Radioactive: No
Waste Treated Off Site: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Measurement Point: Not reported
Primary Origin: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: No
Company Waste ID: Not reported
Primary NAICS Code: 488210
EPA Waste Form Code: W105
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

S104852620

Waste:

Waste ID: 291922
Waste Description: Not reported
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: D7Y94032
Waste Code Status: INACTIVE
Waste Form: Not reported
Waste Classification: 2
Waste is Radioactive: No
Waste Treated Off Site: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Measurement Point: Not reported
Primary Origin: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: No
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

Waste:

Waste ID: 277709
Waste Description: Not reported
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: CRGQ3021
Waste Code Status: INACTIVE
Waste Form: Not reported
Waste Classification: 1
Waste is Radioactive: No
Waste Treated Off Site: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Measurement Point: Not reported
Primary Origin: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: No
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

Waste:

Waste ID: 267967
Waste Description: Not reported
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: CCNW4032
Waste Code Status: INACTIVE
Waste Form: Not reported
Waste Classification: 2
Waste is Radioactive: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

S104852620

Waste Treated Off Site: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Measurement Point: Not reported
Primary Origin: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: No
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

Waste:

Waste ID: 262049
Waste Description: Not reported
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: C4JY110H
Waste Code Status: INACTIVE
Waste Form: Not reported
Waste Classification: H
Waste is Radioactive: No
Waste Treated Off Site: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Measurement Point: Not reported
Primary Origin: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: No
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

Waste:

Waste ID: 260450
Waste Description: Not reported
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: C2L3105H
Waste Code Status: INACTIVE
Waste Form: Not reported
Waste Classification: H
Waste is Radioactive: No
Waste Treated Off Site: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Measurement Point: Not reported
Primary Origin: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: No
Company Waste ID: Not reported
Primary NAICS Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

S104852620

EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

Waste:

Waste ID: 171484
Waste Description: The composition of the material will be hazardous according to the criteria stip
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 0015208H
Waste Code Status: INACTIVE
Waste Form: Not reported
Waste Classification: H
Waste is Radioactive: No
Waste Treated Off Site: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Measurement Point: Not reported
Primary Origin: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: No
Company Waste ID: Not reported
Primary NAICS Code: 811211
EPA Waste Form Code: W219
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

Waste:

Waste ID: 103547
Waste Description: Non-Haz Wax/Asphalt/Plastics removed from railcars prior to the cleaning process
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 00134091
Waste Code Status: INACTIVE
Waste Form: Not reported
Waste Classification: 1
Waste is Radioactive: No
Waste Treated Off Site: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Measurement Point: Not reported
Primary Origin: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: No
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: UNKNOWN
EPA Haz Waste: Not reported

Waste:

Waste ID: 101969
Waste Description: DAF SLUDGE - NON-HAZARDOUS SLUDGE FROM WATER TREATMENT SYSTEM
GENERATION DATE 11
Desc of Waste: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

S104852620

Texas Waste Code: Not reported
Texas Waste Code 2: 00146091
Waste Code Status: ACTIVE
Waste Form: Not reported
Waste Classification: 1
Waste is Radioactive: No
Waste Treated Off Site: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Measurement Point: Not reported
Primary Origin: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: No
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

Waste:

Waste ID: 101964
Waste Description: PLANT REFUSE - FLOOR SWEEPING, RUST, SCALE, DEBRIS - NON-HAZARDOUS
ROLL-OFF BOX

Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 00129012
Waste Code Status: ACTIVE
Waste Form: Not reported
Waste Classification: 2
Waste is Radioactive: No
Waste Treated Off Site: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Measurement Point: Not reported
Primary Origin: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: No
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

C14
WSW
1/8-1/4
0.195 mi.
1027 ft.

BW SERVICES ANGLETON CAR SHOP
1100 WAYNE DR
ANGLETON, TX 77515
Site 2 of 2 in cluster C

SEMS-ARCHIVE 1015736922
CORRACTS TXD086467800
RCRA-TSDF
RCRA-LQG
2020 COR ACTION

Relative:
Higher

Actual:
28 ft.

SEMS Archive:
Site ID: 0602350
EPA ID: TXD086467800
Name: RICHMOND TANK CAR COMPANY
Address: OLD CLUTE RD(P.O. BOX 1000)
Address 2: Not reported
City,State,Zip: ANGELTON, TX 77515

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

Cong District: 22
FIPS Code: 48039
FF: N
NPL: Not on the NPL
Non NPL Status: NFRAP-Site does not qualify for the NPL based on existing information

SEMS Archive Detail:

Region: 06
Site ID: 0602350
EPA ID: TXD086467800
Site Name: RICHMOND TANK CAR COMPANY
NPL: N
FF: N
OU: 00
Action Code: VS
Action Name: ARCH SITE
SEQ: 1
Start Date: Not reported
Finish Date: 1985-01-01 05:00:00
Qual: Not reported
Current Action Lead: EPA Perf In-Hse

Region: 06
Site ID: 0602350
EPA ID: TXD086467800
Site Name: RICHMOND TANK CAR COMPANY
NPL: N
FF: N
OU: 00
Action Code: DS
Action Name: DISCVRY
SEQ: 1
Start Date: 1980-08-01 04:00:00
Finish Date: 1980-08-01 04:00:00
Qual: Not reported
Current Action Lead: EPA Perf

Region: 06
Site ID: 0602350
EPA ID: TXD086467800
Site Name: RICHMOND TANK CAR COMPANY
NPL: N
FF: N
OU: 00
Action Code: SI
Action Name: SI
SEQ: 2
Start Date: Not reported
Finish Date: 1997-10-09 04:00:00
Qual: N
Current Action Lead: EPA Perf

Region: 06
Site ID: 0602350
EPA ID: TXD086467800
Site Name: RICHMOND TANK CAR COMPANY
NPL: N
FF: N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

OU: 00
Action Code: PA
Action Name: PA
SEQ: 1
Start Date: 1984-03-01 05:00:00
Finish Date: 1984-03-01 05:00:00
Qual: L
Current Action Lead: St Perf

Region: 06
Site ID: 0602350
EPA ID: TXD086467800
Site Name: RICHMOND TANK CAR COMPANY
NPL: N
FF: N
OU: 00
Action Code: SI
Action Name: SI
SEQ: 1
Start Date: 1985-01-01 05:00:00
Finish Date: 1985-01-01 05:00:00
Qual: D
Current Action Lead: St Perf

CORRACTS:

Region: 06
Name: BW SERVICES ANGLETON CAR SHOP
Address: 1100 WAYNE DR
Address 2: Not reported
City,State,Zip: ANGLETON, TX 77515
EPA ID: TXD086467800
Area Name: ENTIRE FACILITY
Corrective Action: CA075HI
Actual Date: 1998-09-11 00:00:00.0
NAICS Code 1: 48821
NAICS Code 2: Not reported
NAICS Code 3: Not reported
NAICS Code 4: Not reported

Region: 06
Name: BW SERVICES ANGLETON CAR SHOP
Address: 1100 WAYNE DR
Address 2: Not reported
City,State,Zip: ANGLETON, TX 77515
EPA ID: TXD086467800
Area Name: ENTIRE FACILITY
Corrective Action: CA400
Actual Date: 2006-07-24 00:00:00.0
NAICS Code 1: 48821
NAICS Code 2: Not reported
NAICS Code 3: Not reported
NAICS Code 4: Not reported

Region: 06
Name: BW SERVICES ANGLETON CAR SHOP
Address: 1100 WAYNE DR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

Address 2:	Not reported
City,State,Zip:	ANGLETON, TX 77515
EPA ID:	TXD086467800
Area Name:	ENTIRE FACILITY
Corrective Action:	CA550RC
Actual Date:	2006-07-24 00:00:00.0
NAICS Code 1:	48821
NAICS Code 2:	Not reported
NAICS Code 3:	Not reported
NAICS Code 4:	Not reported
Region:	06
Name:	BW SERVICES ANGLETON CAR SHOP
Address:	1100 WAYNE DR
Address 2:	Not reported
City,State,Zip:	ANGLETON, TX 77515
EPA ID:	TXD086467800
Area Name:	ENTIRE FACILITY
Corrective Action:	CA725YE
Actual Date:	2006-08-03 00:00:00.0
NAICS Code 1:	48821
NAICS Code 2:	Not reported
NAICS Code 3:	Not reported
NAICS Code 4:	Not reported
Region:	06
Name:	BW SERVICES ANGLETON CAR SHOP
Address:	1100 WAYNE DR
Address 2:	Not reported
City,State,Zip:	ANGLETON, TX 77515
EPA ID:	TXD086467800
Area Name:	ENTIRE FACILITY
Corrective Action:	CA750YE
Actual Date:	2007-03-06 00:00:00.0
NAICS Code 1:	48821
NAICS Code 2:	Not reported
NAICS Code 3:	Not reported
NAICS Code 4:	Not reported

RCRA-TSDF:

Date form received by agency: 2016-03-01 00:00:00.0

Facility name:	BW SERVICES ANGLETON CAR SHOP
Facility address:	1100 WAYNE DR ANGLETON, TX 77515
EPA ID:	TXD086467800
Mailing address:	WAYNE DR ANGLETON, TX 77515-9351
Contact:	BRANDAN WHITE
Contact address:	WAYNE DR ANGLETON, TX 77515-9351
Contact country:	US
Contact telephone:	979-848-8800
Contact email:	Not reported
EPA Region:	06
Land type:	Private
Classification:	TSDF
Description:	Handler is engaged in the treatment, storage or disposal of hazardous

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

Classification: waste
Description: Large Quantity Generator
Handler: generates 1,000 kg or more of hazardous waste during any calendar month; or generates more than 1 kg of acutely hazardous waste during any calendar month; or generates more than 100 kg of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month; or generates 1 kg or less of acutely hazardous waste during any calendar month, and accumulates more than 1 kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates more than 100 kg of that material at any time

Owner/Operator Summary:

Owner/operator name: BW SERVICES ANGELTON CAR SHOP
Owner/operator address: WAYNE DR
ANGLETON, TX 77515
Owner/operator country: US
Owner/operator telephone: 979-848-8800
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 2012-02-22 00:00:00.
Owner/Op end date: Not reported

Owner/operator name: PHILIP INDUSTRIAL SERVICES GROUP
Owner/operator address: SAN FELIPE STE 1600
HOUSTON, TX 77056
Owner/operator country: US
Owner/operator telephone: 713-623-8777
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 2002-02-14 00:00:00.
Owner/Op end date: Not reported

Owner/operator name: ALLWASTE CONTAINER SERVICES
Owner/operator address: CONCOURSE PKWY NE STE 750
ATLANTA, GA 30328
Owner/operator country: US
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 2002-02-14 00:00:00.
Owner/Op end date: Not reported

Owner/operator name: BW SERVICES ANGLETON CAR SHOP
Owner/operator address: WAYNE DR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

ANGLETON, TX 77515

Owner/operator country: US
Owner/operator telephone: 979-848-8800
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 2012-02-22 00:00:00.
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 2014-03-01 00:00:00.0
Site name: BW SERVICES ANGLETON CAR SHOP
Classification: Large Quantity Generator

Date form received by agency: 2013-07-26 00:00:00.0
Site name: BW SERVICES ANGLETON CAR SHOP
Classification: Large Quantity Generator

Date form received by agency: 2012-02-24 00:00:00.0
Site name: WASHAMERICA INC - BW SERVICES ANGLETON CAR SHOP
Classification: Not a generator, verified

Date form received by agency: 2012-02-22 00:00:00.0
Site name: BW SERVICES ANGLETON CAR SHOP
Classification: Large Quantity Generator

Date form received by agency: 2006-07-05 00:00:00.0
Site name: FITZGERALD RAILCAR SERVICES
Classification: Not a generator, verified

Date form received by agency: 2006-06-07 00:00:00.0
Site name: FITZGERALD RAILCAR SERVICES
Classification: Not a generator, verified

Date form received by agency: 2006-02-13 00:00:00.0
Site name: FITZGERALD RAILCAR SERVICES
Classification: Not a generator, verified

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

Date form received by agency: 2005-11-29 00:00:00.0

Site name: FITZGERALD RAILCAR SERVICES

Classification: Not a generator, verified

Date form received by agency: 2005-05-23 00:00:00.0

Site name: FITZGERALD RAILCAR SERVICES

Classification: Not a generator, verified

Date form received by agency: 2005-03-01 00:00:00.0

Site name: FITZGERALD RAILCAR SERVICES

Classification: Not a generator, verified

Date form received by agency: 2002-03-01 00:00:00.0

Site name: FITZGERALD RAILCAR SERVICES

Classification: Large Quantity Generator

Date form received by agency: 2002-02-14 00:00:00.0

Site name: FITZGERALD RAILCAR SERVICES

Classification: Large Quantity Generator

Date form received by agency: 2000-06-26 00:00:00.0

Site name: FITZGERALD RAILCAR SERVICES

Classification: Large Quantity Generator

Date form received by agency: 1998-01-25 00:00:00.0

Site name: NOT AFFILIATED WITH : S W. REG. NO. 3957

Classification: Large Quantity Generator

Date form received by agency: 1996-03-01 00:00:00.0

Site name: ALLWASTE CONTAINER SERVICES INC.

Classification: Large Quantity Generator

Date form received by agency: 1994-03-01 00:00:00.0

Site name: ALLWASTE CONTAINER SERVICES

Classification: Large Quantity Generator

Date form received by agency: 1992-03-16 00:00:00.0

Site name: ALLWASTE RAILCAR CLEANING

Classification: Large Quantity Generator

Date form received by agency: 1990-03-01 00:00:00.0

Site name: ALLWASTE TANK CLEANING

Classification: Large Quantity Generator

Hazardous Waste Summary:

- . Waste code: D001
- . Waste name: IGNITABLE WASTE
- . Waste code: D002
- . Waste name: CORROSIVE WASTE
- . Waste code: D003
- . Waste name: REACTIVE WASTE
- . Waste code: D004
- . Waste name: ARSENIC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

. Waste code:	D005
. Waste name:	BARIUM
. Waste code:	D006
. Waste name:	CADMIUM
. Waste code:	D007
. Waste name:	CHROMIUM
. Waste code:	D008
. Waste name:	LEAD
. Waste code:	D009
. Waste name:	MERCURY
. Waste code:	D010
. Waste name:	SELENIUM
. Waste code:	D011
. Waste name:	SILVER
. Waste code:	D018
. Waste name:	BENZENE
. Waste code:	D019
. Waste name:	CARBON TETRACHLORIDE
. Waste code:	D021
. Waste name:	CHLOROBENZENE
. Waste code:	D022
. Waste name:	CHLOROFORM
. Waste code:	D023
. Waste name:	O-CRESOL
. Waste code:	D024
. Waste name:	M-CRESOL
. Waste code:	D025
. Waste name:	P-CRESOL
. Waste code:	D026
. Waste name:	CRESOL
. Waste code:	D027
. Waste name:	1,4-DICHLOROBENZENE
. Waste code:	D028
. Waste name:	1,2-DICHLOROETHANE
. Waste code:	D029
. Waste name:	1,1-DICHLOROETHYLENE
. Waste code:	D030
. Waste name:	2,4-DINITROTOLUENE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

- . Waste code: D032
- . Waste name: HEXACHLOROBENZENE

- . Waste code: D033
- . Waste name: HEXACHLOROBUTADIENE

- . Waste code: D034
- . Waste name: HEXACHLOROETHANE

- . Waste code: D035
- . Waste name: METHYL ETHYL KETONE

- . Waste code: D036
- . Waste name: NITROBENZENE

- . Waste code: D038
- . Waste name: PYRIDINE

- . Waste code: D039
- . Waste name: TETRACHLOROETHYLENE

- . Waste code: D040
- . Waste name: TRICHLOROETHYLENE

- . Waste code: D043
- . Waste name: VINYL CHLORIDE

- . Waste code: F001
- . Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING: TETRACHLOROETHYLENE, TRICHLOROETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE AND CHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

- . Waste code: F002
- . Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

- . Waste code: F003
- . Waste name: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

- . Waste code: F004
- . Waste name: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: CRESOLS, CRESYLIC ACID, AND NITROBENZENE; AND THE STILL BOTTOMS FROM THE RECOVERY OF THESE SOLVENTS; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
- . Waste code: F005
- . Waste name: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
- . Waste code: K019
- . Waste name: HEAVY ENDS FROM THE DISTILLATION OF ETHYLENE DICHLORIDE IN ETHYLENE DICHLORIDE PRODUCTION.
- . Waste code: K022
- . Waste name: DISTILLATION BOTTOM TARS FROM THE PRODUCTION OF PHENOL/ACETONE FROM CUMENE.
- . Waste code: K048
- . Waste name: DISSOLVED AIR FLOTATION (DAF) FLOAT FROM THE PETROLEUM REFINING INDUSTRY.
- . Waste code: K049
- . Waste name: SLOP OIL EMULSION SOLIDS FROM THE PETROLEUM REFINING INDUSTRY.
- . Waste code: K050
- . Waste name: HEAT EXCHANGER BUNDLE CLEANING SLUDGE FROM THE PETROLEUM REFINING INDUSTRY.
- . Waste code: K052
- . Waste name: TANK BOTTOMS (LEADED) FROM THE PETROLEUM REFINING INDUSTRY.
- . Waste code: K086
- . Waste name: SOLVENT WASHES AND SLUDGES, CAUSTIC WASHES AND SLUDGES, OR WATER WASHES AND SLUDGES FROM CLEANING TUBS AND EQUIPMENT USED IN THE FORMULATION OF INK FROM PIGMENTS, DRIERS, SOAPS, AND STABILIZERS CONTAINING CHROMIUM AND LEAD.
- . Waste code: K094
- . Waste name: DISTILLATION BOTTOMS FROM THE PRODUCTION OF PHTHALIC ANHYDRIDE FROM ORTHO-XYLENE.
- . Waste code: U001
- . Waste name: ACETALDEHYDE (I) (OR) ETHANAL (I)
- . Waste code: U002

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

. Waste name:	2-PROPANONE (I) (OR) ACETONE (I)
. Waste code:	U003
. Waste name:	ACETONITRILE (I,T)
. Waste code:	U004
. Waste name:	ACETOPHENONE (OR) ETHANONE, 1-PHENYL-
. Waste code:	U008
. Waste name:	2-PROPENOIC ACID (I) (OR) ACRYLIC ACID (I)
. Waste code:	U012
. Waste name:	ANILINE (I,T) (OR) BENZENAMINE (I,T)
. Waste code:	U019
. Waste name:	BENZENE (I,T)
. Waste code:	U031
. Waste name:	1-BUTANOL (I) (OR) N-BUTYL ALCOHOL (I)
. Waste code:	U043
. Waste name:	ETHENE, CHLORO- (OR) VINYL CHLORIDE
. Waste code:	U044
. Waste name:	CHLOROFORM (OR) METHANE, TRICHLORO-
. Waste code:	U045
. Waste name:	METHANE, CHLORO- (I,T) (OR) METHYL CHLORIDE (I,T)
. Waste code:	U051
. Waste name:	CREOSOTE
. Waste code:	U052
. Waste name:	CRESOL (CRESYLIC ACID) (OR) PHENOL, METHYL-
. Waste code:	U055
. Waste name:	BENZENE, (1-METHYLETHYL)- (I) (OR) CUMENE (I)
. Waste code:	U056
. Waste name:	BENZENE, HEXAHYDRO- (I) (OR) CYCLOHEXANE (I)
. Waste code:	U057
. Waste name:	CYCLOHEXANONE (I)
. Waste code:	U069
. Waste name:	1,2-BENZENEDICARBOXYLIC ACID, DIBUTYL ESTER (OR) DIBUTYL PHTHALATE
. Waste code:	U071
. Waste name:	BENZENE, 1,3-DICHLORO- (OR) M-DICHLOROBENZENE
. Waste code:	U072
. Waste name:	BENZENE, 1,4-DICHLORO- (OR) P-DICHLOROBENZENE
. Waste code:	U076
. Waste name:	ETHANE, 1,1-DICHLORO- (OR) ETHYLIDENE DICHLORIDE
. Waste code:	U077

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

. Waste name:	ETHANE, 1,2-DICHLORO- (OR) ETHYLENE DICHLORIDE
. Waste code:	U078
. Waste name:	1,1-DICHLOROETHYLENE (OR) ETHENE, 1,1-DICHLORO-
. Waste code:	U079
. Waste name:	1,2-DICHLOROETHYLENE (OR) ETHENE, 1,2-DICHLORO-, (E)-
. Waste code:	U080
. Waste name:	METHANE, DICHLORO- (OR) METHYLENE CHLORIDE
. Waste code:	U084
. Waste name:	1,3-DICHLOROPROPENE (OR) 1-PROPENE, 1,3-DICHLORO-
. Waste code:	U112
. Waste name:	ACETIC ACID, ETHYL ESTER (I) (OR) ETHYL ACETATE (I)
. Waste code:	U117
. Waste name:	ETHANE, 1,1'-OXYBIS-(I) (OR) ETHYL ETHER (I)
. Waste code:	U118
. Waste name:	2-PROPENOIC ACID, 2-METHYL-, ETHYL ESTER (OR) ETHYL METHACRYLATE
. Waste code:	U121
. Waste name:	METHANE, TRICHLOROFLUORO- (OR) TRICHLOROMONOFUOROMETHANE
. Waste code:	U122
. Waste name:	FORMALDEHYDE
. Waste code:	U125
. Waste name:	2-FURANCARBOXALDEHYDE (I) (OR) FURFURAL (I)
. Waste code:	U127
. Waste name:	BENZENE, HEXACHLORO- (OR) HEXACHLOROBENZENE
. Waste code:	U128
. Waste name:	1,3-BUTADIENE, 1,1,2,3,4,4-HEXACHLORO- (OR) HEXACHLOROBUTADIENE
. Waste code:	U131
. Waste name:	ETHANE, HEXACHLORO- (OR) HEXACHLOROETHANE
. Waste code:	U140
. Waste name:	1-PROPANOL, 2-METHYL- (I,T) (OR) ISOBUTYL ALCOHOL (I,T)
. Waste code:	U147
. Waste name:	2,5-FURANDIONE (OR) MALEIC ANHYDRIDE
. Waste code:	U154
. Waste name:	METHANOL (I) (OR) METHYL ALCOHOL (I)
. Waste code:	U159
. Waste name:	2-BUTANONE (I,T) (OR) METHYL ETHYL KETONE (MEK) (I,T)
. Waste code:	U161
. Waste name:	4-METHYL-2-PENTANONE (I) (OR) METHYL ISOBUTYL KETONE (I) (OR) PENTANOL, 4-METHYL-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

. Waste code:	U162
. Waste name:	2-PROPENOIC ACID, 2-METHYL-, METHYL ESTER (I,T) (OR) METHYL METHACRYLATE (I,T)
. Waste code:	U165
. Waste name:	NAPHTHALENE
. Waste code:	U169
. Waste name:	BENZENE, NITRO- (OR) NITROBENZENE (I,T)
. Waste code:	U187
. Waste name:	ACETAMIDE, N-(4-ETHOXYPHENYL)- (OR) PHENACETIN
. Waste code:	U188
. Waste name:	PHENOL
. Waste code:	U190
. Waste name:	1,3-ISOBENZOFURANDIONE (OR) PHTHALIC ANHYDRIDE
. Waste code:	U196
. Waste name:	PYRIDINE
. Waste code:	U207
. Waste name:	1,2,4,5-TETRACHLOROBENZENE (OR) BENZENE, 1,2,4,5-TETRACHLORO-
. Waste code:	U208
. Waste name:	1,1,1,2-TETRACHLOROETHANE (OR) ETHANE, 1,1,1,2-TETRACHLORO-
. Waste code:	U209
. Waste name:	1,1,2,2-TETRACHLOROETHANE (OR) ETHANE, 1,1,2,2-TETRACHLORO-
. Waste code:	U210
. Waste name:	ETHENE, TETRACHLORO- (OR) TETRACHLOROETHYLENE
. Waste code:	U211
. Waste name:	CARBON TETRACHLORIDE (OR) METHANE, TETRACHLORO-
. Waste code:	U213
. Waste name:	FURAN, TETRAHYDRO-(I) (OR) TETRAHYDROFURAN (I)
. Waste code:	U220
. Waste name:	BENZENE, METHYL- (OR) TOLUENE
. Waste code:	U226
. Waste name:	ETHANE, 1,1,1-TRICHLORO- (OR) METHYL CHLOROFORM
. Waste code:	U227
. Waste name:	1,1,2-TRICHLOROETHANE (OR) ETHANE, 1,1,2-TRICHLORO-
. Waste code:	U228
. Waste name:	ETHENE, TRICHLORO- (OR) TRICHLOROETHYLENE
. Waste code:	U239
. Waste name:	BENZENE, DIMETHYL- (I,T) (OR) XYLENE (I)
. Waste code:	U359
. Waste name:	ETHANOL, 2-ETHOXY- (OR) ETHYLENE GLYCOL MONOETHYL ETHER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

Biennial Reports:

Last Biennial Reporting Year: 2017

Annual Waste Handled:

Waste code: D001

Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Amount (Lbs): 15462

Waste code: D002

Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

Amount (Lbs): 1120

Waste code: D003

Waste name: A MATERIAL IS CONSIDERED TO BE A REACTIVE HAZARDOUS WASTE IF IT IS NORMALLY UNSTABLE, REACTS VIOLENTLY WITH WATER, GENERATES TOXIC GASES WHEN EXPOSED TO WATER OR CORROSIVE MATERIALS, OR IF IT IS CAPABLE OF DETONATION OR EXPLOSION WHEN EXPOSED TO HEAT OR A FLAME. ONE EXAMPLE OF SUCH WASTE WOULD BE WASTE GUNPOWDER.

Amount (Lbs): 15022

Corrective Action Summary:

Event date: 1998-09-11 00:00:00.0

Event: CA PRIORITIZATION-HIGH CA PRIORITY

Event date: 2006-07-24 00:00:00.0

Event: REMEDY DECISION

Event date: 2006-07-24 00:00:00.0

Event: REMEDY CONSTRUCTION-REMEDY CONSTRUCTED

Event date: 2006-08-03 00:00:00.0

Event: HUMAN EXPOSURES CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE

Event date: 2007-03-06 00:00:00.0

Event: RELEASE TO GW CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE

Facility Has Received Notices of Violations:

Regulation violated: Not reported

Area of violation: Generators - Pre-transport

Date violation determined: 2011-11-10 00:00:00.0

Date achieved compliance: 2011-11-28 00:00:00.0

Violation lead agency: State

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

Enforcement action: VERBAL INFORMAL
Enforcement action date: 2011-11-10 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: TSD IS-Contingency Plan and Emergency Procedures
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2012-02-06 00:00:00.0
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-01-06 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: TSD IS-Container Use and Management
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2015-03-26 00:00:00.0
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-08-03 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: State Statute or Regulation
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2015-03-26 00:00:00.0
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-01-06 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - Pre-transport
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2012-02-06 00:00:00.0
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

Enforcement action date: 2012-01-06 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: LDR - General
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2015-03-26 00:00:00.0
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-01-06 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: TSD IS-Contingency Plan and Emergency Procedures
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2011-11-28 00:00:00.0
Violation lead agency: State
Enforcement action: VERBAL INFORMAL
Enforcement action date: 2011-11-10 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: State Statute or Regulation
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2015-03-26 00:00:00.0
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-08-03 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: TSD IS-General Facility Standards
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2011-11-28 00:00:00.0
Violation lead agency: State
Enforcement action: VERBAL INFORMAL
Enforcement action date: 2011-11-10 00:00:00.0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: State Statute or Regulation
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2012-02-06 00:00:00.0
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-01-06 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: LDR - General
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2015-03-26 00:00:00.0
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-08-03 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: State Statute or Regulation
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2011-11-28 00:00:00.0
Violation lead agency: State
Enforcement action: VERBAL INFORMAL
Enforcement action date: 2011-11-10 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - Records/Reporting
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2012-02-06 00:00:00.0
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-01-06 00:00:00.0
Enf. disposition status: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - Exports
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2012-02-06 00:00:00.0
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-01-06 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: TSD IS-Tank System Standards
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2015-03-26 00:00:00.0
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-01-06 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: TSD IS-Tank System Standards
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2015-03-26 00:00:00.0
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-08-03 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: TSD IS-Container Use and Management
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2015-03-26 00:00:00.0
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-01-06 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - Pre-transport
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2015-03-26 00:00:00.0
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-08-03 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: State Statute or Regulation
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2012-02-17 00:00:00.0
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-01-06 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - Pre-transport
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2015-03-26 00:00:00.0
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-01-06 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: LDR - General
Date violation determined: 1989-07-13 00:00:00.0
Date achieved compliance: 1989-11-17 00:00:00.0
Violation lead agency: EPA
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 1989-11-15 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: EPA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:

Evaluation date: 2015-05-01 00:00:00.0
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 2012-07-11 00:00:00.0
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 2011-11-10 00:00:00.0
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - Exports
Date achieved compliance: 2012-02-06 00:00:00.0
Evaluation lead agency: State

Evaluation date: 2011-11-10 00:00:00.0
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: LDR - General
Date achieved compliance: 2015-03-26 00:00:00.0
Evaluation lead agency: State

Evaluation date: 2011-11-10 00:00:00.0
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD IS-Tank System Standards
Date achieved compliance: 2015-03-26 00:00:00.0
Evaluation lead agency: State

Evaluation date: 2011-11-10 00:00:00.0
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - Pre-transport
Date achieved compliance: 2012-02-06 00:00:00.0
Evaluation lead agency: State

Evaluation date: 2011-11-10 00:00:00.0
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: State Statute or Regulation
Date achieved compliance: 2011-11-28 00:00:00.0
Evaluation lead agency: State

Evaluation date: 2011-11-10 00:00:00.0
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - Records/Reporting
Date achieved compliance: 2012-02-06 00:00:00.0
Evaluation lead agency: State

Evaluation date: 2011-11-10 00:00:00.0
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD IS-Container Use and Management
Date achieved compliance: 2015-03-26 00:00:00.0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

Evaluation lead agency: State

Evaluation date: 2011-11-10 00:00:00.0
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: State Statute or Regulation
Date achieved compliance: 2015-03-26 00:00:00.0
Evaluation lead agency: State

Evaluation date: 2011-11-10 00:00:00.0
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: State Statute or Regulation
Date achieved compliance: 2012-02-17 00:00:00.0
Evaluation lead agency: State

Evaluation date: 2011-11-10 00:00:00.0
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD IS-Contingency Plan and Emergency Procedures
Date achieved compliance: 2012-02-06 00:00:00.0
Evaluation lead agency: State

Evaluation date: 2011-11-10 00:00:00.0
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD IS-General Facility Standards
Date achieved compliance: 2011-11-28 00:00:00.0
Evaluation lead agency: State

Evaluation date: 2011-11-10 00:00:00.0
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: State Statute or Regulation
Date achieved compliance: 2012-02-06 00:00:00.0
Evaluation lead agency: State

Evaluation date: 2011-11-10 00:00:00.0
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - Pre-transport
Date achieved compliance: 2011-11-28 00:00:00.0
Evaluation lead agency: State

Evaluation date: 2011-11-10 00:00:00.0
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD IS-Contingency Plan and Emergency Procedures
Date achieved compliance: 2011-11-28 00:00:00.0
Evaluation lead agency: State

Evaluation date: 2011-11-10 00:00:00.0
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - Pre-transport
Date achieved compliance: 2015-03-26 00:00:00.0
Evaluation lead agency: State

Evaluation date: 1989-07-13 00:00:00.0
Evaluation: FOCUSED COMPLIANCE INSPECTION
Area of violation: LDR - General
Date achieved compliance: 1989-11-17 00:00:00.0
Evaluation lead agency: EPA

RCRA-LQG:

Date form received by agency: 2016-03-01 00:00:00.0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

Facility name: BW SERVICES ANGLETON CAR SHOP
Facility address: 1100 WAYNE DR
ANGLETON, TX 77515
EPA ID: TXD086467800
Mailing address: WAYNE DR
ANGLETON, TX 77515-9351
Contact: BRANDAN WHITE
Contact address: WAYNE DR
ANGLETON, TX 77515-9351
Contact country: US
Contact telephone: 979-848-8800
Contact email: Not reported
EPA Region: 06
Land type: Private
Classification: TSD
Description: Handler is engaged in the treatment, storage or disposal of hazardous waste
Classification: Large Quantity Generator
Description: Handler: generates 1,000 kg or more of hazardous waste during any calendar month; or generates more than 1 kg of acutely hazardous waste during any calendar month; or generates more than 100 kg of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month; or generates 1 kg or less of acutely hazardous waste during any calendar month, and accumulates more than 1 kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates more than 100 kg of that material at any time

Owner/Operator Summary:

Owner/operator name: BW SERVICES ANGELTON CAR SHOP
Owner/operator address: WAYNE DR
ANGLETON, TX 77515
Owner/operator country: US
Owner/operator telephone: 979-848-8800
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 2012-02-22 00:00:00.
Owner/Op end date: Not reported

Owner/operator name: PHILIP INDUSTRIAL SERVICES GROUP
Owner/operator address: SAN FELIPE STE 1600
HOUSTON, TX 77056
Owner/operator country: US
Owner/operator telephone: 713-623-8777
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 2002-02-14 00:00:00.
Owner/Op end date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

Owner/operator name: ALLWASTE CONTAINER SERVICES
Owner/operator address: CONCOURSE PKWY NE STE 750
ATLANTA, GA 30328
Owner/operator country: US
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 2002-02-14 00:00:00.
Owner/Op end date: Not reported

Owner/operator name: BW SERVICES ANGLETON CAR SHOP
Owner/operator address: WAYNE DR
ANGLETON, TX 77515
Owner/operator country: US
Owner/operator telephone: 979-848-8800
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 2012-02-22 00:00:00.
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 2014-03-01 00:00:00.0
Site name: BW SERVICES ANGLETON CAR SHOP
Classification: Large Quantity Generator

Date form received by agency: 2013-07-26 00:00:00.0
Site name: BW SERVICES ANGLETON CAR SHOP
Classification: Large Quantity Generator

Date form received by agency: 2012-02-24 00:00:00.0
Site name: WASHAMERICA INC - BW SERVICES ANGLETON CAR SHOP
Classification: Not a generator, verified

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

Date form received by agency: 2012-02-22 00:00:00.0
Site name: BW SERVICES ANGLETON CAR SHOP
Classification: Large Quantity Generator

Date form received by agency: 2006-07-05 00:00:00.0
Site name: FITZGERALD RAILCAR SERVICES
Classification: Not a generator, verified

Date form received by agency: 2006-06-07 00:00:00.0
Site name: FITZGERALD RAILCAR SERVICES
Classification: Not a generator, verified

Date form received by agency: 2006-02-13 00:00:00.0
Site name: FITZGERALD RAILCAR SERVICES
Classification: Not a generator, verified

Date form received by agency: 2005-11-29 00:00:00.0
Site name: FITZGERALD RAILCAR SERVICES
Classification: Not a generator, verified

Date form received by agency: 2005-05-23 00:00:00.0
Site name: FITZGERALD RAILCAR SERVICES
Classification: Not a generator, verified

Date form received by agency: 2005-03-01 00:00:00.0
Site name: FITZGERALD RAILCAR SERVICES
Classification: Not a generator, verified

Date form received by agency: 2002-03-01 00:00:00.0
Site name: FITZGERALD RAILCAR SERVICES
Classification: Large Quantity Generator

Date form received by agency: 2002-02-14 00:00:00.0
Site name: FITZGERALD RAILCAR SERVICES
Classification: Large Quantity Generator

Date form received by agency: 2000-06-26 00:00:00.0
Site name: FITZGERALD RAILCAR SERVICES
Classification: Large Quantity Generator

Date form received by agency: 1998-01-25 00:00:00.0
Site name: NOT AFFILIATED WITH : S W. REG. NO. 3957
Classification: Large Quantity Generator

Date form received by agency: 1996-03-01 00:00:00.0
Site name: ALLWASTE CONTAINER SERVICES INC.
Classification: Large Quantity Generator

Date form received by agency: 1994-03-01 00:00:00.0
Site name: ALLWASTE CONTAINER SERVICES
Classification: Large Quantity Generator

Date form received by agency: 1992-03-16 00:00:00.0
Site name: ALLWASTE RAILCAR CLEANING
Classification: Large Quantity Generator

Date form received by agency: 1990-03-01 00:00:00.0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

Site name: ALLWASTE TANK CLEANING
Classification: Large Quantity Generator

Hazardous Waste Summary:

. Waste code: D001
. Waste name: IGNITABLE WASTE

. Waste code: D002
. Waste name: CORROSIVE WASTE

. Waste code: D003
. Waste name: REACTIVE WASTE

. Waste code: D004
. Waste name: ARSENIC

. Waste code: D005
. Waste name: BARIUM

. Waste code: D006
. Waste name: CADMIUM

. Waste code: D007
. Waste name: CHROMIUM

. Waste code: D008
. Waste name: LEAD

. Waste code: D009
. Waste name: MERCURY

. Waste code: D010
. Waste name: SELENIUM

. Waste code: D011
. Waste name: SILVER

. Waste code: D018
. Waste name: BENZENE

. Waste code: D019
. Waste name: CARBON TETRACHLORIDE

. Waste code: D021
. Waste name: CHLOROBENZENE

. Waste code: D022
. Waste name: CHLOROFORM

. Waste code: D023
. Waste name: O-CRESOL

. Waste code: D024
. Waste name: M-CRESOL

. Waste code: D025

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

- . Waste name: P-CRESOL
- . Waste code: D026
- . Waste name: CRESOL
- . Waste code: D027
- . Waste name: 1,4-DICHLOROBENZENE
- . Waste code: D028
- . Waste name: 1,2-DICHLOROETHANE
- . Waste code: D029
- . Waste name: 1,1-DICHLOROETHYLENE
- . Waste code: D030
- . Waste name: 2,4-DINITROTOLUENE
- . Waste code: D032
- . Waste name: HEXACHLOROBENZENE
- . Waste code: D033
- . Waste name: HEXACHLOROBUTADIENE
- . Waste code: D034
- . Waste name: HEXACHLOROETHANE
- . Waste code: D035
- . Waste name: METHYL ETHYL KETONE
- . Waste code: D036
- . Waste name: NITROBENZENE
- . Waste code: D038
- . Waste name: PYRIDINE
- . Waste code: D039
- . Waste name: TETRACHLOROETHYLENE
- . Waste code: D040
- . Waste name: TRICHLOROETHYLENE
- . Waste code: D043
- . Waste name: VINYL CHLORIDE
- . Waste code: F001
- . Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING: TETRACHLOROETHYLENE, TRICHLOROETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE AND CHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
- . Waste code: F002
- . Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE,

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: F003

. Waste name: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: F004

. Waste name: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: CRESOLS, CRESYLIC ACID, AND NITROBENZENE; AND THE STILL BOTTOMS FROM THE RECOVERY OF THESE SOLVENTS; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: F005

. Waste name: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: K019

. Waste name: HEAVY ENDS FROM THE DISTILLATION OF ETHYLENE DICHLORIDE IN ETHYLENE DICHLORIDE PRODUCTION.

. Waste code: K022

. Waste name: DISTILLATION BOTTOM TARS FROM THE PRODUCTION OF PHENOL/ACETONE FROM CUMENE.

. Waste code: K048

. Waste name: DISSOLVED AIR FLOTATION (DAF) FLOAT FROM THE PETROLEUM REFINING INDUSTRY.

. Waste code: K049

. Waste name: SLOP OIL EMULSION SOLIDS FROM THE PETROLEUM REFINING INDUSTRY.

. Waste code: K050

. Waste name: HEAT EXCHANGER BUNDLE CLEANING SLUDGE FROM THE PETROLEUM REFINING INDUSTRY.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

- . Waste code: K052
- . Waste name: TANK BOTTOMS (LEADED) FROM THE PETROLEUM REFINING INDUSTRY.

- . Waste code: K086
- . Waste name: SOLVENT WASHES AND SLUDGES, CAUSTIC WASHES AND SLUDGES, OR WATER WASHES AND SLUDGES FROM CLEANING TUBS AND EQUIPMENT USED IN THE FORMULATION OF INK FROM PIGMENTS, DRIERS, SOAPS, AND STABILIZERS CONTAINING CHROMIUM AND LEAD.

- . Waste code: K094
- . Waste name: DISTILLATION BOTTOMS FROM THE PRODUCTION OF PHTHALIC ANHYDRIDE FROM ORTHO-XYLENE.

- . Waste code: U001
- . Waste name: ACETALDEHYDE (I) (OR) ETHANAL (I)

- . Waste code: U002
- . Waste name: 2-PROPANONE (I) (OR) ACETONE (I)

- . Waste code: U003
- . Waste name: ACETONITRILE (I,T)

- . Waste code: U004
- . Waste name: ACETOPHENONE (OR) ETHANONE, 1-PHENYL-

- . Waste code: U008
- . Waste name: 2-PROPENOIC ACID (I) (OR) ACRYLIC ACID (I)

- . Waste code: U012
- . Waste name: ANILINE (I,T) (OR) BENZENAMINE (I,T)

- . Waste code: U019
- . Waste name: BENZENE (I,T)

- . Waste code: U031
- . Waste name: 1-BUTANOL (I) (OR) N-BUTYL ALCOHOL (I)

- . Waste code: U043
- . Waste name: ETHENE, CHLORO- (OR) VINYL CHLORIDE

- . Waste code: U044
- . Waste name: CHLOROFORM (OR) METHANE, TRICHLORO-

- . Waste code: U045
- . Waste name: METHANE, CHLORO- (I,T) (OR) METHYL CHLORIDE (I,T)

- . Waste code: U051
- . Waste name: CREOSOTE

- . Waste code: U052
- . Waste name: CRESOL (CRESYLIC ACID) (OR) PHENOL, METHYL-

- . Waste code: U055
- . Waste name: BENZENE, (1-METHYLETHYL)- (I) (OR) CUMENE (I)

- . Waste code: U056
- . Waste name: BENZENE, HEXAHYDRO- (I) (OR) CYCLOHEXANE (I)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

. Waste code:	U057
. Waste name:	CYCLOHEXANONE (I)
. Waste code:	U069
. Waste name:	1,2-BENZENEDICARBOXYLIC ACID, DIBUTYL ESTER (OR) DIBUTYL PHTHALATE
. Waste code:	U071
. Waste name:	BENZENE, 1,3-DICHLORO- (OR) M-DICHLOROBENZENE
. Waste code:	U072
. Waste name:	BENZENE, 1,4-DICHLORO- (OR) P-DICHLOROBENZENE
. Waste code:	U076
. Waste name:	ETHANE, 1,1-DICHLORO- (OR) ETHYLIDENE DICHLORIDE
. Waste code:	U077
. Waste name:	ETHANE, 1,2-DICHLORO- (OR) ETHYLENE DICHLORIDE
. Waste code:	U078
. Waste name:	1,1-DICHLOROETHYLENE (OR) ETHENE, 1,1-DICHLORO-
. Waste code:	U079
. Waste name:	1,2-DICHLOROETHYLENE (OR) ETHENE, 1,2-DICHLORO-,(E)-
. Waste code:	U080
. Waste name:	METHANE, DICHLORO- (OR) METHYLENE CHLORIDE
. Waste code:	U084
. Waste name:	1,3-DICHLOROPROPENE (OR) 1-PROPENE, 1,3-DICHLORO-
. Waste code:	U112
. Waste name:	ACETIC ACID, ETHYL ESTER (I) (OR) ETHYL ACETATE (I)
. Waste code:	U117
. Waste name:	ETHANE, 1,1'-OXYBIS-(I) (OR) ETHYL ETHER (I)
. Waste code:	U118
. Waste name:	2-PROPENOIC ACID, 2-METHYL-, ETHYL ESTER (OR) ETHYL METHACRYLATE
. Waste code:	U121
. Waste name:	METHANE, TRICHLOROFLUORO- (OR) TRICHLOROMONOFUOROMETHANE
. Waste code:	U122
. Waste name:	FORMALDEHYDE
. Waste code:	U125
. Waste name:	2-FURANCARBOXALDEHYDE (I) (OR) FURFURAL (I)
. Waste code:	U127
. Waste name:	BENZENE, HEXACHLORO- (OR) HEXACHLOROBENZENE
. Waste code:	U128
. Waste name:	1,3-BUTADIENE, 1,1,2,3,4,4-HEXACHLORO- (OR) HEXACHLOROBUTADIENE
. Waste code:	U131
. Waste name:	ETHANE, HEXACHLORO- (OR) HEXACHLOROETHANE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

- . Waste code: U140
- . Waste name: 1-PROPANOL, 2-METHYL- (I,T) (OR) ISOBUTYL ALCOHOL (I,T)

- . Waste code: U147
- . Waste name: 2,5-FURANDIONE (OR) MALEIC ANHYDRIDE

- . Waste code: U154
- . Waste name: METHANOL (I) (OR) METHYL ALCOHOL (I)

- . Waste code: U159
- . Waste name: 2-BUTANONE (I,T) (OR) METHYL ETHYL KETONE (MEK) (I,T)

- . Waste code: U161
- . Waste name: 4-METHYL-2-PENTANONE (I) (OR) METHYL ISOBUTYL KETONE (I) (OR) PENTANOL, 4-METHYL-

- . Waste code: U162
- . Waste name: 2-PROPENOIC ACID, 2-METHYL-, METHYL ESTER (I,T) (OR) METHYL METHACRYLATE (I,T)

- . Waste code: U165
- . Waste name: NAPHTHALENE

- . Waste code: U169
- . Waste name: BENZENE, NITRO- (OR) NITROBENZENE (I,T)

- . Waste code: U187
- . Waste name: ACETAMIDE, N-(4-ETHOXYPHENYL)- (OR) PHENACETIN

- . Waste code: U188
- . Waste name: PHENOL

- . Waste code: U190
- . Waste name: 1,3-ISOBENZOFURANDIONE (OR) PHTHALIC ANHYDRIDE

- . Waste code: U196
- . Waste name: PYRIDINE

- . Waste code: U207
- . Waste name: 1,2,4,5-TETRACHLOROBENZENE (OR) BENZENE, 1,2,4,5-TETRACHLORO-

- . Waste code: U208
- . Waste name: 1,1,1,2-TETRACHLOROETHANE (OR) ETHANE, 1,1,1,2-TETRACHLORO-

- . Waste code: U209
- . Waste name: 1,1,2,2-TETRACHLOROETHANE (OR) ETHANE, 1,1,2,2-TETRACHLORO-

- . Waste code: U210
- . Waste name: ETHENE, TETRACHLORO- (OR) TETRACHLOROETHYLENE

- . Waste code: U211
- . Waste name: CARBON TETRACHLORIDE (OR) METHANE, TETRACHLORO-

- . Waste code: U213
- . Waste name: FURAN, TETRAHYDRO-(I) (OR) TETRAHYDROFURAN (I)

- . Waste code: U220

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

. Waste name: BENZENE, METHYL- (OR) TOLUENE
. Waste code: U226
. Waste name: ETHANE, 1,1,1-TRICHLORO- (OR) METHYL CHLOROFORM
. Waste code: U227
. Waste name: 1,1,2-TRICHLOROETHANE (OR) ETHANE, 1,1,2-TRICHLORO-
. Waste code: U228
. Waste name: ETHENE, TRICHLORO- (OR) TRICHLOROETHYLENE
. Waste code: U239
. Waste name: BENZENE, DIMETHYL- (I,T) (OR) XYLENE (I)
. Waste code: U359
. Waste name: ETHANOL, 2-ETHOXY- (OR) ETHYLENE GLYCOL MONOETHYL ETHER

Biennial Reports:

Last Biennial Reporting Year: 2017

Annual Waste Handled:

Waste code: D001
Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Amount (Lbs): 15462

Waste code: D002
Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

Amount (Lbs): 1120

Waste code: D003
Waste name: A MATERIAL IS CONSIDERED TO BE A REACTIVE HAZARDOUS WASTE IF IT IS NORMALLY UNSTABLE, REACTS VIOLENTLY WITH WATER, GENERATES TOXIC GASES WHEN EXPOSED TO WATER OR CORROSIVE MATERIALS, OR IF IT IS CAPABLE OF DETONATION OR EXPLOSION WHEN EXPOSED TO HEAT OR A FLAME. ONE EXAMPLE OF SUCH WASTE WOULD BE WASTE GUNPOWDER.

Amount (Lbs): 15022

Corrective Action Summary:

Event date: 1998-09-11 00:00:00.0
Event: CA PRIORITIZATION-HIGH CA PRIORITY

Event date: 2006-07-24 00:00:00.0
Event: REMEDY DECISION

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

Event date: 2006-07-24 00:00:00.0
Event: REMEDY CONSTRUCTION-REMEDY CONSTRUCTED

Event date: 2006-08-03 00:00:00.0
Event: HUMAN EXPOSURES CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE

Event date: 2007-03-06 00:00:00.0
Event: RELEASE TO GW CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE

Facility Has Received Notices of Violations:

Regulation violated: Not reported
Area of violation: Generators - Pre-transport
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2011-11-28 00:00:00.0
Violation lead agency: State
Enforcement action: VERBAL INFORMAL
Enforcement action date: 2011-11-10 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: TSD IS-Contingency Plan and Emergency Procedures
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2012-02-06 00:00:00.0
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-01-06 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: TSD IS-Container Use and Management
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2015-03-26 00:00:00.0
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-08-03 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: State Statute or Regulation
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2015-03-26 00:00:00.0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-01-06 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - Pre-transport
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2012-02-06 00:00:00.0
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-01-06 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: LDR - General
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2015-03-26 00:00:00.0
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-01-06 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: TSD IS-Contingency Plan and Emergency Procedures
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2011-11-28 00:00:00.0
Violation lead agency: State
Enforcement action: VERBAL INFORMAL
Enforcement action date: 2011-11-10 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: State Statute or Regulation
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2015-03-26 00:00:00.0
Violation lead agency: State

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-08-03 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: TSD IS-General Facility Standards
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2011-11-28 00:00:00.0
Violation lead agency: State
Enforcement action: VERBAL INFORMAL
Enforcement action date: 2011-11-10 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: State Statute or Regulation
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2012-02-06 00:00:00.0
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-01-06 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: LDR - General
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2015-03-26 00:00:00.0
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-08-03 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: State Statute or Regulation
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2011-11-28 00:00:00.0
Violation lead agency: State
Enforcement action: VERBAL INFORMAL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

Enforcement action date: 2011-11-10 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - Records/Reporting
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2012-02-06 00:00:00.0
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-01-06 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - Exports
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2012-02-06 00:00:00.0
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-01-06 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: TSD IS-Tank System Standards
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2015-03-26 00:00:00.0
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-01-06 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: TSD IS-Tank System Standards
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2015-03-26 00:00:00.0
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-08-03 00:00:00.0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: TSD IS-Container Use and Management
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2015-03-26 00:00:00.0
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-01-06 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - Pre-transport
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2015-03-26 00:00:00.0
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-08-03 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: State Statute or Regulation
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2012-02-17 00:00:00.0
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-01-06 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - Pre-transport
Date violation determined: 2011-11-10 00:00:00.0
Date achieved compliance: 2015-03-26 00:00:00.0
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 2012-01-06 00:00:00.0
Enf. disposition status: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: LDR - General
Date violation determined: 1989-07-13 00:00:00.0
Date achieved compliance: 1989-11-17 00:00:00.0
Violation lead agency: EPA
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 1989-11-15 00:00:00.0
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: EPA
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:

Evaluation date: 2015-05-01 00:00:00.0
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 2012-07-11 00:00:00.0
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 2011-11-10 00:00:00.0
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - Exports
Date achieved compliance: 2012-02-06 00:00:00.0
Evaluation lead agency: State

Evaluation date: 2011-11-10 00:00:00.0
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: LDR - General
Date achieved compliance: 2015-03-26 00:00:00.0
Evaluation lead agency: State

Evaluation date: 2011-11-10 00:00:00.0
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD IS-Tank System Standards
Date achieved compliance: 2015-03-26 00:00:00.0
Evaluation lead agency: State

Evaluation date: 2011-11-10 00:00:00.0
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - Pre-transport
Date achieved compliance: 2012-02-06 00:00:00.0
Evaluation lead agency: State

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

Evaluation date: 2011-11-10 00:00:00.0
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: State Statute or Regulation
Date achieved compliance: 2011-11-28 00:00:00.0
Evaluation lead agency: State

Evaluation date: 2011-11-10 00:00:00.0
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - Records/Reporting
Date achieved compliance: 2012-02-06 00:00:00.0
Evaluation lead agency: State

Evaluation date: 2011-11-10 00:00:00.0
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD IS-Container Use and Management
Date achieved compliance: 2015-03-26 00:00:00.0
Evaluation lead agency: State

Evaluation date: 2011-11-10 00:00:00.0
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: State Statute or Regulation
Date achieved compliance: 2015-03-26 00:00:00.0
Evaluation lead agency: State

Evaluation date: 2011-11-10 00:00:00.0
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: State Statute or Regulation
Date achieved compliance: 2012-02-17 00:00:00.0
Evaluation lead agency: State

Evaluation date: 2011-11-10 00:00:00.0
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD IS-Contingency Plan and Emergency Procedures
Date achieved compliance: 2012-02-06 00:00:00.0
Evaluation lead agency: State

Evaluation date: 2011-11-10 00:00:00.0
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD IS-General Facility Standards
Date achieved compliance: 2011-11-28 00:00:00.0
Evaluation lead agency: State

Evaluation date: 2011-11-10 00:00:00.0
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: State Statute or Regulation
Date achieved compliance: 2012-02-06 00:00:00.0
Evaluation lead agency: State

Evaluation date: 2011-11-10 00:00:00.0
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - Pre-transport
Date achieved compliance: 2011-11-28 00:00:00.0
Evaluation lead agency: State

Evaluation date: 2011-11-10 00:00:00.0
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD IS-Contingency Plan and Emergency Procedures

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BW SERVICES ANGLETON CAR SHOP (Continued)

1015736922

Date achieved compliance: 2011-11-28 00:00:00.0
Evaluation lead agency: State

Evaluation date: 2011-11-10 00:00:00.0
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - Pre-transport
Date achieved compliance: 2015-03-26 00:00:00.0
Evaluation lead agency: State

Evaluation date: 1989-07-13 00:00:00.0
Evaluation: FOCUSED COMPLIANCE INSPECTION
Area of violation: LDR - General
Date achieved compliance: 1989-11-17 00:00:00.0
Evaluation lead agency: EPA

2020 COR ACTION:

EPA ID: TXD086467800
Region: 6
Action: Remedy Construction

Count: 0 records.

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
NO SITES FOUND					

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

Number of Days to Update: Provides confirmation that EDR is reporting records that have been updated within 90 days from the date the government agency made the information available to the public.

STANDARD ENVIRONMENTAL RECORDS

Federal NPL site list

NPL: National Priority List

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

Date of Government Version: 04/27/2020	Source: EPA
Date Data Arrived at EDR: 05/06/2020	Telephone: N/A
Date Made Active in Reports: 05/28/2020	Last EDR Contact: 06/03/2020
Number of Days to Update: 22	Next Scheduled EDR Contact: 07/13/2020
	Data Release Frequency: Quarterly

NPL Site Boundaries

Sources:

EPA's Environmental Photographic Interpretation Center (EPIC)
Telephone: 202-564-7333

EPA Region 1
Telephone 617-918-1143

EPA Region 6
Telephone: 214-655-6659

EPA Region 3
Telephone 215-814-5418

EPA Region 7
Telephone: 913-551-7247

EPA Region 4
Telephone 404-562-8033

EPA Region 8
Telephone: 303-312-6774

EPA Region 5
Telephone 312-886-6686

EPA Region 9
Telephone: 415-947-4246

EPA Region 10
Telephone 206-553-8665

Proposed NPL: Proposed National Priority List Sites

A site that has been proposed for listing on the National Priorities List through the issuance of a proposed rule in the Federal Register. EPA then accepts public comments on the site, responds to the comments, and places on the NPL those sites that continue to meet the requirements for listing.

Date of Government Version: 04/27/2020	Source: EPA
Date Data Arrived at EDR: 05/06/2020	Telephone: N/A
Date Made Active in Reports: 05/28/2020	Last EDR Contact: 06/03/2020
Number of Days to Update: 22	Next Scheduled EDR Contact: 07/13/2020
	Data Release Frequency: Quarterly

NPL LIENS: Federal Superfund Liens

Federal Superfund Liens. Under the authority granted the USEPA by CERCLA of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner received notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 10/15/1991
Date Data Arrived at EDR: 02/02/1994
Date Made Active in Reports: 03/30/1994
Number of Days to Update: 56

Source: EPA
Telephone: 202-564-4267
Last EDR Contact: 08/15/2011
Next Scheduled EDR Contact: 11/28/2011
Data Release Frequency: No Update Planned

Federal Delisted NPL site list

Delisted NPL: National Priority List Deletions

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425(e), sites may be deleted from the NPL where no further response is appropriate.

Date of Government Version: 04/27/2020
Date Data Arrived at EDR: 05/06/2020
Date Made Active in Reports: 05/28/2020
Number of Days to Update: 22

Source: EPA
Telephone: N/A
Last EDR Contact: 06/03/2020
Next Scheduled EDR Contact: 07/13/2020
Data Release Frequency: Quarterly

Federal CERCLIS list

FEDERAL FACILITY: Federal Facility Site Information listing

A listing of National Priority List (NPL) and Base Realignment and Closure (BRAC) sites found in the Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS) Database where EPA Federal Facilities Restoration and Reuse Office is involved in cleanup activities.

Date of Government Version: 04/03/2019
Date Data Arrived at EDR: 04/05/2019
Date Made Active in Reports: 05/14/2019
Number of Days to Update: 39

Source: Environmental Protection Agency
Telephone: 703-603-8704
Last EDR Contact: 04/03/2020
Next Scheduled EDR Contact: 07/13/2020
Data Release Frequency: Varies

SEMS: Superfund Enterprise Management System

SEMS (Superfund Enterprise Management System) tracks hazardous waste sites, potentially hazardous waste sites, and remedial activities performed in support of EPA's Superfund Program across the United States. The list was formerly known as CERCLIS, renamed to SEMS by the EPA in 2015. The list contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). This dataset also contains sites which are either proposed to or on the National Priorities List (NPL) and the sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 04/27/2020
Date Data Arrived at EDR: 05/06/2020
Date Made Active in Reports: 05/28/2020
Number of Days to Update: 22

Source: EPA
Telephone: 800-424-9346
Last EDR Contact: 06/03/2020
Next Scheduled EDR Contact: 07/27/2020
Data Release Frequency: Quarterly

Federal CERCLIS NFRAP site list

SEMS-ARCHIVE: Superfund Enterprise Management System Archive

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

SEMS-ARCHIVE (Superfund Enterprise Management System Archive) tracks sites that have no further interest under the Federal Superfund Program based on available information. The list was formerly known as the CERCLIS-NFRAP, renamed to SEMS ARCHIVE by the EPA in 2015. EPA may perform a minimal level of assessment work at a site while it is archived if site conditions change and/or new information becomes available. Archived sites have been removed and archived from the inventory of SEMS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list the site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. The decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be potential NPL site.

Date of Government Version: 04/27/2020	Source: EPA
Date Data Arrived at EDR: 05/06/2020	Telephone: 800-424-9346
Date Made Active in Reports: 05/28/2020	Last EDR Contact: 06/03/2020
Number of Days to Update: 22	Next Scheduled EDR Contact: 07/27/2020
	Data Release Frequency: Quarterly

Federal RCRA CORRACTS facilities list

CORRACTS: Corrective Action Report

CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

Date of Government Version: 03/23/2020	Source: EPA
Date Data Arrived at EDR: 03/25/2020	Telephone: 800-424-9346
Date Made Active in Reports: 05/21/2020	Last EDR Contact: 03/25/2020
Number of Days to Update: 57	Next Scheduled EDR Contact: 07/06/2020
	Data Release Frequency: Quarterly

Federal RCRA non-CORRACTS TSD facilities list

RCRA-TSDF: RCRA - Treatment, Storage and Disposal

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

Date of Government Version: 03/23/2020	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/25/2020	Telephone: 214-665-6444
Date Made Active in Reports: 05/21/2020	Last EDR Contact: 03/25/2020
Number of Days to Update: 57	Next Scheduled EDR Contact: 07/06/2020
	Data Release Frequency: Quarterly

Federal RCRA generators list

RCRA-LQG: RCRA - Large Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

Date of Government Version: 03/23/2020	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/25/2020	Telephone: 214-665-6444
Date Made Active in Reports: 05/21/2020	Last EDR Contact: 03/25/2020
Number of Days to Update: 57	Next Scheduled EDR Contact: 07/06/2020
	Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

RCRA-SQG: RCRA - Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

Date of Government Version: 03/23/2020	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/25/2020	Telephone: 214-665-6444
Date Made Active in Reports: 05/21/2020	Last EDR Contact: 03/25/2020
Number of Days to Update: 57	Next Scheduled EDR Contact: 07/06/2020
	Data Release Frequency: Quarterly

RCRA-VSQG: RCRA - Very Small Quantity Generators (Formerly Conditionally Exempt Small Quantity Generators)

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Very small quantity generators (VSQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

Date of Government Version: 03/23/2020	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/25/2020	Telephone: 214-665-6444
Date Made Active in Reports: 05/21/2020	Last EDR Contact: 03/25/2020
Number of Days to Update: 57	Next Scheduled EDR Contact: 07/06/2020
	Data Release Frequency: Quarterly

Federal institutional controls / engineering controls registries

LUCIS: Land Use Control Information System

LUCIS contains records of land use control information pertaining to the former Navy Base Realignment and Closure properties.

Date of Government Version: 11/04/2019	Source: Department of the Navy
Date Data Arrived at EDR: 11/13/2019	Telephone: 843-820-7326
Date Made Active in Reports: 01/28/2020	Last EDR Contact: 05/14/2020
Number of Days to Update: 76	Next Scheduled EDR Contact: 08/24/2020
	Data Release Frequency: Varies

US ENG CONTROLS: Engineering Controls Sites List

A listing of sites with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health.

Date of Government Version: 02/13/2020	Source: Environmental Protection Agency
Date Data Arrived at EDR: 02/20/2020	Telephone: 703-603-0695
Date Made Active in Reports: 05/15/2020	Last EDR Contact: 05/15/2020
Number of Days to Update: 85	Next Scheduled EDR Contact: 09/07/2020
	Data Release Frequency: Varies

US INST CONTROLS: Institutional Controls Sites List

A listing of sites with institutional controls in place. Institutional controls include administrative measures, such as groundwater use restrictions, construction restrictions, property use restrictions, and post remediation care requirements intended to prevent exposure to contaminants remaining on site. Deed restrictions are generally required as part of the institutional controls.

Date of Government Version: 02/13/2020	Source: Environmental Protection Agency
Date Data Arrived at EDR: 02/20/2020	Telephone: 703-603-0695
Date Made Active in Reports: 05/15/2020	Last EDR Contact: 05/15/2020
Number of Days to Update: 85	Next Scheduled EDR Contact: 09/07/2020
	Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Federal ERNS list

ERNS: Emergency Response Notification System

Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances.

Date of Government Version: 12/16/2019
Date Data Arrived at EDR: 12/19/2019
Date Made Active in Reports: 03/06/2020
Number of Days to Update: 78

Source: National Response Center, United States Coast Guard
Telephone: 202-267-2180
Last EDR Contact: 03/24/2020
Next Scheduled EDR Contact: 07/06/2020
Data Release Frequency: Quarterly

State- and tribal - equivalent NPL

SHWS: State Superfund Registry

State Hazardous Waste Sites. State hazardous waste site records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. Available information varies by state.

Date of Government Version: 12/31/2019
Date Data Arrived at EDR: 01/30/2020
Date Made Active in Reports: 04/14/2020
Number of Days to Update: 75

Source: Texas Commission on Environmental Quality
Telephone: 512-239-5680
Last EDR Contact: 03/19/2020
Next Scheduled EDR Contact: 07/06/2020
Data Release Frequency: Semi-Annually

State and tribal landfill and/or solid waste disposal site lists

SWF/LF: Permitted Solid Waste Facilities

Solid Waste Facilities/Landfill Sites. SWF/LF type records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet RCRA Subtitle D Section 4004 criteria for solid waste landfills or disposal sites.

Date of Government Version: 01/27/2020
Date Data Arrived at EDR: 01/30/2020
Date Made Active in Reports: 04/14/2020
Number of Days to Update: 75

Source: Texas Commission on Environmental Quality
Telephone: 512-239-6706
Last EDR Contact: 04/10/2020
Next Scheduled EDR Contact: 08/03/2020
Data Release Frequency: Quarterly

CLI: Closed Landfill Inventory

Closed and abandoned landfills (permitted as well as unauthorized) across the state of Texas. For current information regarding any of the sites included in this database, contact the appropriate Council of Governments agency.

Date of Government Version: 08/30/1999
Date Data Arrived at EDR: 09/28/2000
Date Made Active in Reports: 10/30/2000
Number of Days to Update: 32

Source: Texas Commission on Environmental Quality
Telephone: N/A
Last EDR Contact: 03/23/2020
Next Scheduled EDR Contact: 07/13/2020
Data Release Frequency: Varies

DEBRIS: DEBRIS

A listing of temporary debris management sites and MSW landfills for debris resulting from Hurricane Harvey.

Date of Government Version: 03/27/2018
Date Data Arrived at EDR: 04/04/2018
Date Made Active in Reports: 06/08/2018
Number of Days to Update: 65

Source: Texas Commission on Environmental Quality
Telephone: 512-239-6840
Last EDR Contact: 06/04/2020
Next Scheduled EDR Contact: 09/21/2020
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

H-GAC CLI: Houston-Galveston Closed Landfill Inventory

Closed Landfill Inventory for the Houston-Galveston Area Council Region. In 1993, the Texas Legislature passed House Bill (HB) 2537, which required Councils of Governments (COGs) to develop an inventory of closed municipal solid waste landfills for their regional solid waste management plans.

Date of Government Version: 09/30/2019	Source: Houston-Galveston Area Council
Date Data Arrived at EDR: 10/01/2019	Telephone: 832-681-2518
Date Made Active in Reports: 12/06/2019	Last EDR Contact: 10/01/2019
Number of Days to Update: 66	Next Scheduled EDR Contact: 07/13/2020
	Data Release Frequency: Varies

WASTE MGMT: Commercial Hazardous & Solid Waste Management Facilities

This list contains commercial recycling facilities and facilities permitted or authorized (interim status) by the Texas Natural Resource Conservation Commission.

Date of Government Version: 10/16/2019	Source: Texas Commission on Environmental Quality
Date Data Arrived at EDR: 01/10/2020	Telephone: 512-239-2920
Date Made Active in Reports: 03/18/2020	Last EDR Contact: 04/03/2020
Number of Days to Update: 68	Next Scheduled EDR Contact: 07/13/2020
	Data Release Frequency: Varies

State and tribal leaking storage tank lists

INDIAN LUST R8: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Colorado, Montana, North Dakota, South Dakota, Utah and Wyoming.

Date of Government Version: 10/03/2019	Source: EPA Region 8
Date Data Arrived at EDR: 12/04/2019	Telephone: 303-312-6271
Date Made Active in Reports: 02/14/2020	Last EDR Contact: 05/20/2020
Number of Days to Update: 72	Next Scheduled EDR Contact: 08/03/2020
	Data Release Frequency: Varies

INDIAN LUST R10: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Alaska, Idaho, Oregon and Washington.

Date of Government Version: 10/11/2019	Source: EPA Region 10
Date Data Arrived at EDR: 12/04/2019	Telephone: 206-553-2857
Date Made Active in Reports: 02/10/2020	Last EDR Contact: 05/20/2020
Number of Days to Update: 68	Next Scheduled EDR Contact: 08/03/2020
	Data Release Frequency: Varies

INDIAN LUST R4: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Florida, Mississippi and North Carolina.

Date of Government Version: 10/10/2019	Source: EPA Region 4
Date Data Arrived at EDR: 12/05/2019	Telephone: 404-562-8677
Date Made Active in Reports: 02/10/2020	Last EDR Contact: 05/20/2020
Number of Days to Update: 67	Next Scheduled EDR Contact: 08/03/2020
	Data Release Frequency: Varies

INDIAN LUST R7: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Iowa, Kansas, and Nebraska

Date of Government Version: 10/15/2019	Source: EPA Region 7
Date Data Arrived at EDR: 12/17/2019	Telephone: 913-551-7003
Date Made Active in Reports: 02/10/2020	Last EDR Contact: 05/20/2020
Number of Days to Update: 55	Next Scheduled EDR Contact: 08/03/2020
	Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

INDIAN LUST R5: Leaking Underground Storage Tanks on Indian Land

Leaking underground storage tanks located on Indian Land in Michigan, Minnesota and Wisconsin.

Date of Government Version: 10/01/2019

Date Data Arrived at EDR: 12/04/2019

Date Made Active in Reports: 02/10/2020

Number of Days to Update: 68

Source: EPA, Region 5

Telephone: 312-886-7439

Last EDR Contact: 05/20/2020

Next Scheduled EDR Contact: 08/03/2020

Data Release Frequency: Varies

INDIAN LUST R6: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in New Mexico and Oklahoma.

Date of Government Version: 10/02/2019

Date Data Arrived at EDR: 12/04/2019

Date Made Active in Reports: 02/10/2020

Number of Days to Update: 68

Source: EPA Region 6

Telephone: 214-665-6597

Last EDR Contact: 05/20/2020

Next Scheduled EDR Contact: 08/03/2020

Data Release Frequency: Varies

INDIAN LUST R1: Leaking Underground Storage Tanks on Indian Land

A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 10/01/2019

Date Data Arrived at EDR: 12/04/2019

Date Made Active in Reports: 02/10/2020

Number of Days to Update: 68

Source: EPA Region 1

Telephone: 617-918-1313

Last EDR Contact: 05/20/2020

Next Scheduled EDR Contact: 08/03/2020

Data Release Frequency: Varies

INDIAN LUST R9: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Arizona, California, New Mexico and Nevada

Date of Government Version: 10/04/2019

Date Data Arrived at EDR: 12/04/2019

Date Made Active in Reports: 02/27/2020

Number of Days to Update: 85

Source: Environmental Protection Agency

Telephone: 415-972-3372

Last EDR Contact: 05/20/2020

Next Scheduled EDR Contact: 08/03/2020

Data Release Frequency: Varies

LPST: Leaking Petroleum Storage Tank Database

An inventory of reported leaking petroleum storage tank incidents. Not all states maintain these records, and the information stored varies by state.

Date of Government Version: 12/19/2019

Date Data Arrived at EDR: 01/03/2020

Date Made Active in Reports: 03/17/2020

Number of Days to Update: 74

Source: Texas Commission on Environmental Quality

Telephone: 512-239-2200

Last EDR Contact: 03/17/2020

Next Scheduled EDR Contact: 07/06/2020

Data Release Frequency: Quarterly

State and tribal registered storage tank lists

FEMA UST: Underground Storage Tank Listing

A listing of all FEMA owned underground storage tanks.

Date of Government Version: 08/27/2019

Date Data Arrived at EDR: 08/28/2019

Date Made Active in Reports: 11/11/2019

Number of Days to Update: 75

Source: FEMA

Telephone: 202-646-5797

Last EDR Contact: 03/19/2020

Next Scheduled EDR Contact: 07/20/2020

Data Release Frequency: Varies

UST: Petroleum Storage Tank Database

Registered Underground Storage Tanks. UST's are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA) and must be registered with the state department responsible for administering the UST program. Available information varies by state program.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 11/05/2019
Date Data Arrived at EDR: 12/23/2019
Date Made Active in Reports: 03/04/2020
Number of Days to Update: 72

Source: Texas Commission on Environmental Quality
Telephone: 512-239-2160
Last EDR Contact: 03/25/2020
Next Scheduled EDR Contact: 07/06/2020
Data Release Frequency: Quarterly

AST: Petroleum Storage Tank Database
Registered Aboveground Storage Tanks.

Date of Government Version: 11/05/2019
Date Data Arrived at EDR: 12/23/2019
Date Made Active in Reports: 03/04/2020
Number of Days to Update: 72

Source: Texas Commission on Environmental Quality
Telephone: 512-239-2160
Last EDR Contact: 03/25/2020
Next Scheduled EDR Contact: 07/06/2020
Data Release Frequency: Quarterly

INDIAN UST R10: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 10 (Alaska, Idaho, Oregon, Washington, and Tribal Nations).

Date of Government Version: 10/11/2019
Date Data Arrived at EDR: 12/04/2019
Date Made Active in Reports: 02/10/2020
Number of Days to Update: 68

Source: EPA Region 10
Telephone: 206-553-2857
Last EDR Contact: 05/20/2020
Next Scheduled EDR Contact: 08/03/2020
Data Release Frequency: Varies

INDIAN UST R4: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 4 (Alabama, Florida, Georgia, Kentucky, Mississippi, North Carolina, South Carolina, Tennessee and Tribal Nations)

Date of Government Version: 10/10/2019
Date Data Arrived at EDR: 12/05/2019
Date Made Active in Reports: 02/10/2020
Number of Days to Update: 67

Source: EPA Region 4
Telephone: 404-562-9424
Last EDR Contact: 05/20/2020
Next Scheduled EDR Contact: 08/03/2020
Data Release Frequency: Varies

INDIAN UST R8: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 8 (Colorado, Montana, North Dakota, South Dakota, Utah, Wyoming and 27 Tribal Nations).

Date of Government Version: 10/03/2019
Date Data Arrived at EDR: 12/04/2019
Date Made Active in Reports: 02/14/2020
Number of Days to Update: 72

Source: EPA Region 8
Telephone: 303-312-6137
Last EDR Contact: 05/20/2020
Next Scheduled EDR Contact: 08/03/2020
Data Release Frequency: Varies

INDIAN UST R5: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 5 (Michigan, Minnesota and Wisconsin and Tribal Nations).

Date of Government Version: 10/01/2019
Date Data Arrived at EDR: 12/04/2019
Date Made Active in Reports: 02/10/2020
Number of Days to Update: 68

Source: EPA Region 5
Telephone: 312-886-6136
Last EDR Contact: 05/20/2020
Next Scheduled EDR Contact: 08/03/2020
Data Release Frequency: Varies

INDIAN UST R9: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 9 (Arizona, California, Hawaii, Nevada, the Pacific Islands, and Tribal Nations).

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 10/04/2019
Date Data Arrived at EDR: 12/04/2019
Date Made Active in Reports: 02/27/2020
Number of Days to Update: 85

Source: EPA Region 9
Telephone: 415-972-3368
Last EDR Contact: 05/20/2020
Next Scheduled EDR Contact: 08/03/2020
Data Release Frequency: Varies

INDIAN UST R1: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 1 (Connecticut, Maine, Massachusetts, New Hampshire, Rhode Island, Vermont and ten Tribal Nations).

Date of Government Version: 10/01/2019
Date Data Arrived at EDR: 12/04/2019
Date Made Active in Reports: 02/10/2020
Number of Days to Update: 68

Source: EPA, Region 1
Telephone: 617-918-1313
Last EDR Contact: 05/20/2020
Next Scheduled EDR Contact: 08/03/2020
Data Release Frequency: Varies

INDIAN UST R6: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 6 (Louisiana, Arkansas, Oklahoma, New Mexico, Texas and 65 Tribes).

Date of Government Version: 10/02/2019
Date Data Arrived at EDR: 12/04/2019
Date Made Active in Reports: 02/10/2020
Number of Days to Update: 68

Source: EPA Region 6
Telephone: 214-665-7591
Last EDR Contact: 05/20/2020
Next Scheduled EDR Contact: 08/03/2020
Data Release Frequency: Varies

INDIAN UST R7: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 7 (Iowa, Kansas, Missouri, Nebraska, and 9 Tribal Nations).

Date of Government Version: 10/11/2019
Date Data Arrived at EDR: 12/04/2019
Date Made Active in Reports: 02/10/2020
Number of Days to Update: 68

Source: EPA Region 7
Telephone: 913-551-7003
Last EDR Contact: 05/20/2020
Next Scheduled EDR Contact: 08/03/2020
Data Release Frequency: Varies

State and tribal institutional control / engineering control registries

AUL: Sites with Controls

Activity and use limitations include both engineering controls and institutional controls.

Date of Government Version: 12/30/2019
Date Data Arrived at EDR: 01/16/2020
Date Made Active in Reports: 03/27/2020
Number of Days to Update: 71

Source: Texas Commission on Environmental Quality
Telephone: 512-239-5891
Last EDR Contact: 03/23/2020
Next Scheduled EDR Contact: 07/13/2020
Data Release Frequency: Varies

State and tribal voluntary cleanup sites

INDIAN VCP R7: Voluntary Cleanup Priority Listing

A listing of voluntary cleanup priority sites located on Indian Land located in Region 7.

Date of Government Version: 03/20/2008
Date Data Arrived at EDR: 04/22/2008
Date Made Active in Reports: 05/19/2008
Number of Days to Update: 27

Source: EPA, Region 7
Telephone: 913-551-7365
Last EDR Contact: 04/20/2009
Next Scheduled EDR Contact: 07/20/2009
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

VCP TCEQ: Voluntary Cleanup Program Database

The Texas Voluntary Cleanup Program was established to provide administrative, technical, and legal incentives to encourage the cleanup of contaminated sites in Texas.

Date of Government Version: 01/02/2020
Date Data Arrived at EDR: 01/03/2020
Date Made Active in Reports: 03/18/2020
Number of Days to Update: 75

Source: Texas Commission on Environmental Quality
Telephone: 512-239-5891
Last EDR Contact: 03/17/2020
Next Scheduled EDR Contact: 07/13/2020
Data Release Frequency: Quarterly

INDIAN VCP R1: Voluntary Cleanup Priority Listing

A listing of voluntary cleanup priority sites located on Indian Land located in Region 1.

Date of Government Version: 07/27/2015
Date Data Arrived at EDR: 09/29/2015
Date Made Active in Reports: 02/18/2016
Number of Days to Update: 142

Source: EPA, Region 1
Telephone: 617-918-1102
Last EDR Contact: 03/18/2020
Next Scheduled EDR Contact: 07/06/2020
Data Release Frequency: Varies

VCP RRC: Voluntary Cleanup Program Sites

The Voluntary Cleanup Program (RRC-VCP) provides an incentive to remediate Oil & Gas related pollution by participants as long as they did not cause or contribute to the contamination. Applicants to the program receive a release of liability to the state in exchange for a successful cleanup.

Date of Government Version: 11/14/2019
Date Data Arrived at EDR: 01/02/2020
Date Made Active in Reports: 03/04/2020
Number of Days to Update: 62

Source: Railroad Commission of Texas
Telephone: 512-463-6969
Last EDR Contact: 04/03/2020
Next Scheduled EDR Contact: 07/13/2020
Data Release Frequency: Varies

State and tribal Brownfields sites

BROWNFIELDS: Brownfields Site Assessments

Brownfield site assessments that are being cleaned under EPA grant monies.

Date of Government Version: 12/03/2019
Date Data Arrived at EDR: 01/02/2020
Date Made Active in Reports: 03/04/2020
Number of Days to Update: 62

Source: TCEQ
Telephone: 512-239-5872
Last EDR Contact: 04/01/2020
Next Scheduled EDR Contact: 07/13/2020
Data Release Frequency: Semi-Annually

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS: A Listing of Brownfields Sites

Brownfields are real property, the expansion, redevelopment, or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant, or contaminant. Cleaning up and reinvesting in these properties takes development pressures off of undeveloped, open land, and both improves and protects the environment. Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on brownfields properties assessed or cleaned up with grant funding as well as information on Targeted Brownfields Assessments performed by EPA Regions. A listing of ACRES Brownfield sites is obtained from Cleanups in My Community. Cleanups in My Community provides information on Brownfields properties for which information is reported back to EPA, as well as areas served by Brownfields grant programs.

Date of Government Version: 12/02/2019
Date Data Arrived at EDR: 12/16/2019
Date Made Active in Reports: 03/06/2020
Number of Days to Update: 81

Source: Environmental Protection Agency
Telephone: 202-566-2777
Last EDR Contact: 06/02/2020
Next Scheduled EDR Contact: 06/29/2020
Data Release Frequency: Semi-Annually

Local Lists of Landfill / Solid Waste Disposal Sites

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CAPCOG LI: Capitol Area Landfill Inventory

Permitted and unpermitted landfills for the CAPCOG region. Serving Bastrop, Blanco, Burnet, Caldwell, Fayette, Hays, Lee, Llano, Travis, and Williamson Counties.

Date of Government Version: 01/06/2017
Date Data Arrived at EDR: 01/10/2017
Date Made Active in Reports: 03/15/2017
Number of Days to Update: 64

Source: Capital Area Council of Governments
Telephone: 512-916-6000
Last EDR Contact: 04/03/2020
Next Scheduled EDR Contact: 07/13/2020
Data Release Frequency: Varies

NCTCOG LI: North Central Landfill Inventory

North Central Texas Council of Governments landfill database.

Date of Government Version: 03/17/2020
Date Data Arrived at EDR: 03/18/2020
Date Made Active in Reports: 06/03/2020
Number of Days to Update: 77

Source: North Central Texas Council of Governments
Telephone: 817-695-9223
Last EDR Contact: 03/16/2020
Next Scheduled EDR Contact: 07/13/2020
Data Release Frequency: Varies

SWRCY: Recycling Facility Listing

A listing of recycling facilities in the state.

Date of Government Version: 02/14/2020
Date Data Arrived at EDR: 02/14/2020
Date Made Active in Reports: 04/24/2020
Number of Days to Update: 70

Source: TCEQ
Telephone: 512-239-6700
Last EDR Contact: 04/29/2020
Next Scheduled EDR Contact: 08/24/2020
Data Release Frequency: Varies

INDIAN ODI: Report on the Status of Open Dumps on Indian Lands

Location of open dumps on Indian land.

Date of Government Version: 12/31/1998
Date Data Arrived at EDR: 12/03/2007
Date Made Active in Reports: 01/24/2008
Number of Days to Update: 52

Source: Environmental Protection Agency
Telephone: 703-308-8245
Last EDR Contact: 04/16/2020
Next Scheduled EDR Contact: 08/10/2020
Data Release Frequency: Varies

ODI: Open Dump Inventory

An open dump is defined as a disposal facility that does not comply with one or more of the Part 257 or Part 258 Subtitle D Criteria.

Date of Government Version: 06/30/1985
Date Data Arrived at EDR: 08/09/2004
Date Made Active in Reports: 09/17/2004
Number of Days to Update: 39

Source: Environmental Protection Agency
Telephone: 800-424-9346
Last EDR Contact: 06/09/2004
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

DEBRIS REGION 9: Torres Martinez Reservation Illegal Dump Site Locations

A listing of illegal dump sites location on the Torres Martinez Indian Reservation located in eastern Riverside County and northern Imperial County, California.

Date of Government Version: 01/12/2009
Date Data Arrived at EDR: 05/07/2009
Date Made Active in Reports: 09/21/2009
Number of Days to Update: 137

Source: EPA, Region 9
Telephone: 415-947-4219
Last EDR Contact: 04/09/2020
Next Scheduled EDR Contact: 08/03/2020
Data Release Frequency: No Update Planned

IHS OPEN DUMPS: Open Dumps on Indian Land

A listing of all open dumps located on Indian Land in the United States.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 04/01/2014
Date Data Arrived at EDR: 08/06/2014
Date Made Active in Reports: 01/29/2015
Number of Days to Update: 176

Source: Department of Health & Human Services, Indian Health Service
Telephone: 301-443-1452
Last EDR Contact: 05/01/2020
Next Scheduled EDR Contact: 08/10/2020
Data Release Frequency: Varies

Local Lists of Hazardous waste / Contaminated Sites

US HIST CDL: National Clandestine Laboratory Register

A listing of clandestine drug lab locations that have been removed from the DEAs National Clandestine Laboratory Register.

Date of Government Version: 06/11/2019
Date Data Arrived at EDR: 06/13/2019
Date Made Active in Reports: 09/03/2019
Number of Days to Update: 82

Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 05/18/2020
Next Scheduled EDR Contact: 09/07/2020
Data Release Frequency: No Update Planned

CDL: Clandestine Drug Site Locations Listing

A listing of former clandestine drug site locations

Date of Government Version: 08/07/2017
Date Data Arrived at EDR: 08/15/2017
Date Made Active in Reports: 05/11/2018
Number of Days to Update: 269

Source: Department of Public Safety
Telephone: 512-424-2144
Last EDR Contact: 04/17/2020
Next Scheduled EDR Contact: 08/10/2020
Data Release Frequency: Varies

PRIORITY CLEANERS: Dry Cleaner Remediation Program Prioritization List

A listing of dry cleaner related contaminated sites.

Date of Government Version: 09/01/2019
Date Data Arrived at EDR: 12/05/2019
Date Made Active in Reports: 02/05/2020
Number of Days to Update: 62

Source: Texas Commission on Environmental Quality
Telephone: 512-239-5658
Last EDR Contact: 06/03/2020
Next Scheduled EDR Contact: 09/14/2108
Data Release Frequency: Varies

DEL SHWS: Deleted Superfund Registry Sites

Sites have been deleted from the state Superfund registry in accordance with the Act, 361.189

Date of Government Version: 12/31/2019
Date Data Arrived at EDR: 01/30/2020
Date Made Active in Reports: 04/14/2020
Number of Days to Update: 75

Source: Texas Commission on Environmental Quality
Telephone: 512-239-0666
Last EDR Contact: 03/19/2020
Next Scheduled EDR Contact: 07/06/2020
Data Release Frequency: Quarterly

US CDL: Clandestine Drug Labs

A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

Date of Government Version: 06/11/2019
Date Data Arrived at EDR: 06/13/2019
Date Made Active in Reports: 09/03/2019
Number of Days to Update: 82

Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 05/18/2020
Next Scheduled EDR Contact: 09/07/2020
Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

PFAS: PFAS Contamination Site Location Listing

PFOS and PFOA stand for perfluorooctane sulfonate and perfluorooctanoic acid, respectively. Both are fluorinated organic chemicals, part of a larger family of compounds referred to as perfluoroalkyl substances (PFASs).

Date of Government Version: 02/28/2020

Date Data Arrived at EDR: 02/28/2020

Date Made Active in Reports: 05/18/2020

Number of Days to Update: 80

Source: Texas Commission on Environmental Quality

Telephone: 512-239-2341

Last EDR Contact: 05/28/2020

Next Scheduled EDR Contact: 09/14/2020

Data Release Frequency: Varies

CENTRAL REGISTRY: The Central Registry

The Central Registry, a common record area of the TCEQ, maintains information about TCEQ customers and regulated activities, such as company names, addresses, and telephone numbers. This information is commonly referred to as a core data. The Central Registry provides the regulated community with a central access point within the agency to check core data and make changes when necessary.

Date of Government Version: 01/03/2020

Date Data Arrived at EDR: 01/07/2020

Date Made Active in Reports: 02/19/2020

Number of Days to Update: 43

Source: Texas Commission on Environmental Quality

Telephone: 512-239-5175

Last EDR Contact: 03/23/2020

Next Scheduled EDR Contact: 07/13/2020

Data Release Frequency: Varies

Local Lists of Registered Storage Tanks

NON REGIST PST: Petroleum Storage Tank Non Registered

A listing of non-registered petroleum storage tank site locations.

Date of Government Version: 11/11/2019

Date Data Arrived at EDR: 11/13/2019

Date Made Active in Reports: 01/16/2020

Number of Days to Update: 64

Source: Texas Commission on Environmental Quality

Telephone: 512-239-2081

Last EDR Contact: 05/04/2020

Next Scheduled EDR Contact: 08/17/2020

Data Release Frequency: Quarterly

Local Land Records

HIST LIENS: Environmental Liens Listing

This listing contains information fields that are no longer tracked in the LIENS database.

Date of Government Version: 03/23/2007

Date Data Arrived at EDR: 03/23/2007

Date Made Active in Reports: 05/02/2007

Number of Days to Update: 40

Source: Texas Commission on Environmental Quality

Telephone: 512-239-2209

Last EDR Contact: 12/17/2007

Next Scheduled EDR Contact: 03/17/2008

Data Release Frequency: No Update Planned

LIENS: Environmental Liens Listing

The listing covers TCEQ liens placed against either State Superfund sites or Federal Superfund sites to recover cost incurred by TCEQ.

Date of Government Version: 01/02/2020

Date Data Arrived at EDR: 01/16/2020

Date Made Active in Reports: 03/27/2020

Number of Days to Update: 71

Source: Texas Commission on Environmental Quality

Telephone: 512-239-2209

Last EDR Contact: 03/23/2020

Next Scheduled EDR Contact: 07/13/2020

Data Release Frequency: Varies

LIENS 2: CERCLA Lien Information

A Federal CERCLA ("Superfund") lien can exist by operation of law at any site or property at which EPA has spent Superfund monies. These monies are spent to investigate and address releases and threatened releases of contamination. CERCLIS provides information as to the identity of these sites and properties.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 04/27/2020
Date Data Arrived at EDR: 05/06/2020
Date Made Active in Reports: 05/28/2020
Number of Days to Update: 22

Source: Environmental Protection Agency
Telephone: 202-564-6023
Last EDR Contact: 06/03/2020
Next Scheduled EDR Contact: 07/13/2020
Data Release Frequency: Semi-Annually

Records of Emergency Release Reports

HMIRS: Hazardous Materials Information Reporting System

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 12/05/2019
Date Data Arrived at EDR: 12/06/2019
Date Made Active in Reports: 02/14/2020
Number of Days to Update: 70

Source: U.S. Department of Transportation
Telephone: 202-366-4555
Last EDR Contact: 03/24/2020
Next Scheduled EDR Contact: 07/06/2020
Data Release Frequency: Quarterly

SPILLS: Spills Database

Spills reported to the Emergency Response Division.

Date of Government Version: 08/09/2019
Date Data Arrived at EDR: 08/14/2019
Date Made Active in Reports: 11/01/2019
Number of Days to Update: 79

Source: Texas Commission on Environmental Quality
Telephone: 512-239-2507
Last EDR Contact: 04/02/2020
Next Scheduled EDR Contact: 07/27/2020
Data Release Frequency: Quarterly

SPILLS 90: SPILLS90 data from FirstSearch

Spills 90 includes those spill and release records available exclusively from FirstSearch databases. Typically, they may include chemical, oil and/or hazardous substance spills recorded after 1990. Duplicate records that are already included in EDR incident and release records are not included in Spills 90.

Date of Government Version: 10/23/2012
Date Data Arrived at EDR: 01/03/2013
Date Made Active in Reports: 03/07/2013
Number of Days to Update: 63

Source: FirstSearch
Telephone: N/A
Last EDR Contact: 01/03/2013
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

SPILLS 80: SPILLS80 data from FirstSearch

Spills 80 includes those spill and release records available from FirstSearch databases prior to 1990. Typically, they may include chemical, oil and/or hazardous substance spills recorded before 1990. Duplicate records that are already included in EDR incident and release records are not included in Spills 80.

Date of Government Version: 05/15/2005
Date Data Arrived at EDR: 01/03/2013
Date Made Active in Reports: 03/07/2013
Number of Days to Update: 63

Source: FirstSearch
Telephone: N/A
Last EDR Contact: 01/03/2013
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

Other Ascertainable Records

RCRA NonGen / NLR: RCRA - Non Generators / No Longer Regulated

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

Date of Government Version: 03/23/2020
Date Data Arrived at EDR: 03/25/2020
Date Made Active in Reports: 05/21/2020
Number of Days to Update: 57

Source: Environmental Protection Agency
Telephone: 214-665-6444
Last EDR Contact: 03/25/2020
Next Scheduled EDR Contact: 07/06/2020
Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

FUDS: Formerly Used Defense Sites

The listing includes locations of Formerly Used Defense Sites properties where the US Army Corps of Engineers is actively working or will take necessary cleanup actions.

Date of Government Version: 01/28/2020	Source: U.S. Army Corps of Engineers
Date Data Arrived at EDR: 02/19/2020	Telephone: 202-528-4285
Date Made Active in Reports: 05/14/2020	Last EDR Contact: 05/18/2020
Number of Days to Update: 85	Next Scheduled EDR Contact: 08/31/2020
	Data Release Frequency: Varies

DOD: Department of Defense Sites

This data set consists of federally owned or administered lands, administered by the Department of Defense, that have any area equal to or greater than 640 acres of the United States, Puerto Rico, and the U.S. Virgin Islands.

Date of Government Version: 12/31/2005	Source: USGS
Date Data Arrived at EDR: 11/10/2006	Telephone: 888-275-8747
Date Made Active in Reports: 01/11/2007	Last EDR Contact: 04/10/2020
Number of Days to Update: 62	Next Scheduled EDR Contact: 07/20/2020
	Data Release Frequency: Semi-Annually

FEDLAND: Federal and Indian Lands

Federally and Indian administrated lands of the United States. Lands included are administrated by: Army Corps of Engineers, Bureau of Reclamation, National Wild and Scenic River, National Wildlife Refuge, Public Domain Land, Wilderness, Wilderness Study Area, Wildlife Management Area, Bureau of Indian Affairs, Bureau of Land Management, Department of Justice, Forest Service, Fish and Wildlife Service, National Park Service.

Date of Government Version: 04/02/2018	Source: U.S. Geological Survey
Date Data Arrived at EDR: 04/11/2018	Telephone: 888-275-8747
Date Made Active in Reports: 11/06/2019	Last EDR Contact: 04/06/2020
Number of Days to Update: 574	Next Scheduled EDR Contact: 07/20/2020
	Data Release Frequency: N/A

SCRD DRYCLEANERS: State Coalition for Remediation of Drycleaners Listing

The State Coalition for Remediation of Drycleaners was established in 1998, with support from the U.S. EPA Office of Superfund Remediation and Technology Innovation. It is comprised of representatives of states with established drycleaner remediation programs. Currently the member states are Alabama, Connecticut, Florida, Illinois, Kansas, Minnesota, Missouri, North Carolina, Oregon, South Carolina, Tennessee, Texas, and Wisconsin.

Date of Government Version: 01/01/2017	Source: Environmental Protection Agency
Date Data Arrived at EDR: 02/03/2017	Telephone: 615-532-8599
Date Made Active in Reports: 04/07/2017	Last EDR Contact: 05/15/2020
Number of Days to Update: 63	Next Scheduled EDR Contact: 08/24/2020
	Data Release Frequency: Varies

US FIN ASSUR: Financial Assurance Information

All owners and operators of facilities that treat, store, or dispose of hazardous waste are required to provide proof that they will have sufficient funds to pay for the clean up, closure, and post-closure care of their facilities.

Date of Government Version: 12/16/2019	Source: Environmental Protection Agency
Date Data Arrived at EDR: 12/19/2019	Telephone: 202-566-1917
Date Made Active in Reports: 02/27/2020	Last EDR Contact: 03/24/2020
Number of Days to Update: 70	Next Scheduled EDR Contact: 07/06/2020
	Data Release Frequency: Quarterly

EPA WATCH LIST: EPA WATCH LIST

EPA maintains a "Watch List" to facilitate dialogue between EPA, state and local environmental agencies on enforcement matters relating to facilities with alleged violations identified as either significant or high priority. Being on the Watch List does not mean that the facility has actually violated the law only that an investigation by EPA or a state or local environmental agency has led those organizations to allege that an unproven violation has in fact occurred. Being on the Watch List does not represent a higher level of concern regarding the alleged violations that were detected, but instead indicates cases requiring additional dialogue between EPA, state and local agencies - primarily because of the length of time the alleged violation has gone unaddressed or unresolved.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 08/30/2013
Date Data Arrived at EDR: 03/21/2014
Date Made Active in Reports: 06/17/2014
Number of Days to Update: 88

Source: Environmental Protection Agency
Telephone: 617-520-3000
Last EDR Contact: 05/04/2020
Next Scheduled EDR Contact: 08/17/2020
Data Release Frequency: Quarterly

2020 COR ACTION: 2020 Corrective Action Program List

The EPA has set ambitious goals for the RCRA Corrective Action program by creating the 2020 Corrective Action Universe. This RCRA cleanup baseline includes facilities expected to need corrective action. The 2020 universe contains a wide variety of sites. Some properties are heavily contaminated while others were contaminated but have since been cleaned up. Still others have not been fully investigated yet, and may require little or no remediation. Inclusion in the 2020 Universe does not necessarily imply failure on the part of a facility to meet its RCRA obligations.

Date of Government Version: 09/30/2017
Date Data Arrived at EDR: 05/08/2018
Date Made Active in Reports: 07/20/2018
Number of Days to Update: 73

Source: Environmental Protection Agency
Telephone: 703-308-4044
Last EDR Contact: 05/08/2020
Next Scheduled EDR Contact: 08/17/2020
Data Release Frequency: Varies

TSCA: Toxic Substances Control Act

Toxic Substances Control Act. TSCA identifies manufacturers and importers of chemical substances included on the TSCA Chemical Substance Inventory list. It includes data on the production volume of these substances by plant site.

Date of Government Version: 12/31/2016
Date Data Arrived at EDR: 06/21/2017
Date Made Active in Reports: 01/05/2018
Number of Days to Update: 198

Source: EPA
Telephone: 202-260-5521
Last EDR Contact: 03/20/2020
Next Scheduled EDR Contact: 06/29/2020
Data Release Frequency: Every 4 Years

TRIS: Toxic Chemical Release Inventory System

Toxic Release Inventory System. TRIS identifies facilities which release toxic chemicals to the air, water and land in reportable quantities under SARA Title III Section 313.

Date of Government Version: 12/31/2018
Date Data Arrived at EDR: 02/05/2020
Date Made Active in Reports: 04/24/2020
Number of Days to Update: 79

Source: EPA
Telephone: 202-566-0250
Last EDR Contact: 05/21/2020
Next Scheduled EDR Contact: 08/31/2020
Data Release Frequency: Annually

SSTS: Section 7 Tracking Systems

Section 7 of the Federal Insecticide, Fungicide and Rodenticide Act, as amended (92 Stat. 829) requires all registered pesticide-producing establishments to submit a report to the Environmental Protection Agency by March 1st each year. Each establishment must report the types and amounts of pesticides, active ingredients and devices being produced, and those having been produced and sold or distributed in the past year.

Date of Government Version: 05/01/2019
Date Data Arrived at EDR: 10/23/2019
Date Made Active in Reports: 01/15/2020
Number of Days to Update: 84

Source: EPA
Telephone: 202-564-4203
Last EDR Contact: 04/21/2020
Next Scheduled EDR Contact: 08/03/2020
Data Release Frequency: Annually

ROD: Records Of Decision

Record of Decision. ROD documents mandate a permanent remedy at an NPL (Superfund) site containing technical and health information to aid in the cleanup.

Date of Government Version: 04/27/2020
Date Data Arrived at EDR: 05/06/2020
Date Made Active in Reports: 05/28/2020
Number of Days to Update: 22

Source: EPA
Telephone: 703-416-0223
Last EDR Contact: 06/03/2020
Next Scheduled EDR Contact: 09/14/2020
Data Release Frequency: Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

RMP: Risk Management Plans

When Congress passed the Clean Air Act Amendments of 1990, it required EPA to publish regulations and guidance for chemical accident prevention at facilities using extremely hazardous substances. The Risk Management Program Rule (RMP Rule) was written to implement Section 112(r) of these amendments. The rule, which built upon existing industry codes and standards, requires companies of all sizes that use certain flammable and toxic substances to develop a Risk Management Program, which includes a(n): Hazard assessment that details the potential effects of an accidental release, an accident history of the last five years, and an evaluation of worst-case and alternative accidental releases; Prevention program that includes safety precautions and maintenance, monitoring, and employee training measures; and Emergency response program that spells out emergency health care, employee training measures and procedures for informing the public and response agencies (e.g the fire department) should an accident occur.

Date of Government Version: 11/05/2019	Source: Environmental Protection Agency
Date Data Arrived at EDR: 11/20/2019	Telephone: 202-564-8600
Date Made Active in Reports: 04/17/2020	Last EDR Contact: 04/15/2020
Number of Days to Update: 149	Next Scheduled EDR Contact: 08/03/2020
	Data Release Frequency: Varies

RAATS: RCRA Administrative Action Tracking System

RCRA Administration Action Tracking System. RAATS contains records based on enforcement actions issued under RCRA pertaining to major violators and includes administrative and civil actions brought by the EPA. For administration actions after September 30, 1995, data entry in the RAATS database was discontinued. EPA will retain a copy of the database for historical records. It was necessary to terminate RAATS because a decrease in agency resources made it impossible to continue to update the information contained in the database.

Date of Government Version: 04/17/1995	Source: EPA
Date Data Arrived at EDR: 07/03/1995	Telephone: 202-564-4104
Date Made Active in Reports: 08/07/1995	Last EDR Contact: 06/02/2008
Number of Days to Update: 35	Next Scheduled EDR Contact: 09/01/2008
	Data Release Frequency: No Update Planned

PRP: Potentially Responsible Parties

A listing of verified Potentially Responsible Parties

Date of Government Version: 01/30/2020	Source: EPA
Date Data Arrived at EDR: 02/06/2020	Telephone: 202-564-6023
Date Made Active in Reports: 02/14/2020	Last EDR Contact: 06/03/2020
Number of Days to Update: 8	Next Scheduled EDR Contact: 08/17/2020
	Data Release Frequency: Quarterly

PADS: PCB Activity Database System

PCB Activity Database. PADS Identifies generators, transporters, commercial storers and/or brokers and disposers of PCB's who are required to notify the EPA of such activities.

Date of Government Version: 10/09/2019	Source: EPA
Date Data Arrived at EDR: 10/11/2019	Telephone: 202-566-0500
Date Made Active in Reports: 12/20/2019	Last EDR Contact: 04/10/2020
Number of Days to Update: 70	Next Scheduled EDR Contact: 07/20/2020
	Data Release Frequency: Annually

ICIS: Integrated Compliance Information System

The Integrated Compliance Information System (ICIS) supports the information needs of the national enforcement and compliance program as well as the unique needs of the National Pollutant Discharge Elimination System (NPDES) program.

Date of Government Version: 11/18/2016	Source: Environmental Protection Agency
Date Data Arrived at EDR: 11/23/2016	Telephone: 202-564-2501
Date Made Active in Reports: 02/10/2017	Last EDR Contact: 03/26/2020
Number of Days to Update: 79	Next Scheduled EDR Contact: 07/20/2020
	Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

FTTS: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act). To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 04/09/2009
Date Data Arrived at EDR: 04/16/2009
Date Made Active in Reports: 05/11/2009
Number of Days to Update: 25

Source: EPA/Office of Prevention, Pesticides and Toxic Substances
Telephone: 202-566-1667
Last EDR Contact: 08/18/2017
Next Scheduled EDR Contact: 12/04/2017
Data Release Frequency: No Update Planned

FTTS INSP: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

A listing of FIFRA/TSCA Tracking System (FTTS) inspections and enforcements.

Date of Government Version: 04/09/2009
Date Data Arrived at EDR: 04/16/2009
Date Made Active in Reports: 05/11/2009
Number of Days to Update: 25

Source: EPA
Telephone: 202-566-1667
Last EDR Contact: 08/18/2017
Next Scheduled EDR Contact: 12/04/2017
Data Release Frequency: No Update Planned

MLTS: Material Licensing Tracking System

MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 10/25/2019
Date Data Arrived at EDR: 10/25/2019
Date Made Active in Reports: 01/15/2020
Number of Days to Update: 82

Source: Nuclear Regulatory Commission
Telephone: 301-415-7169
Last EDR Contact: 04/10/2020
Next Scheduled EDR Contact: 08/03/2020
Data Release Frequency: Quarterly

COAL ASH DOE: Steam-Electric Plant Operation Data

A listing of power plants that store ash in surface ponds.

Date of Government Version: 12/31/2018
Date Data Arrived at EDR: 12/04/2019
Date Made Active in Reports: 01/15/2020
Number of Days to Update: 42

Source: Department of Energy
Telephone: 202-586-8719
Last EDR Contact: 06/05/2020
Next Scheduled EDR Contact: 09/14/2020
Data Release Frequency: Varies

COAL ASH EPA: Coal Combustion Residues Surface Impoundments List

A listing of coal combustion residues surface impoundments with high hazard potential ratings.

Date of Government Version: 01/12/2017
Date Data Arrived at EDR: 03/05/2019
Date Made Active in Reports: 11/11/2019
Number of Days to Update: 251

Source: Environmental Protection Agency
Telephone: N/A
Last EDR Contact: 06/01/2020
Next Scheduled EDR Contact: 09/14/2020
Data Release Frequency: Varies

PCB TRANSFORMER: PCB Transformer Registration Database

The database of PCB transformer registrations that includes all PCB registration submittals.

Date of Government Version: 09/13/2019
Date Data Arrived at EDR: 11/06/2019
Date Made Active in Reports: 02/10/2020
Number of Days to Update: 96

Source: Environmental Protection Agency
Telephone: 202-566-0517
Last EDR Contact: 05/08/2020
Next Scheduled EDR Contact: 08/17/2020
Data Release Frequency: Varies

RADINFO: Radiation Information Database

The Radiation Information Database (RADINFO) contains information about facilities that are regulated by U.S. Environmental Protection Agency (EPA) regulations for radiation and radioactivity.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 07/01/2019
Date Data Arrived at EDR: 07/01/2019
Date Made Active in Reports: 09/23/2019
Number of Days to Update: 84

Source: Environmental Protection Agency
Telephone: 202-343-9775
Last EDR Contact: 07/01/2019
Next Scheduled EDR Contact: 07/13/2020
Data Release Frequency: Quarterly

HIST FTTS: FIFRA/TSCA Tracking System Administrative Case Listing

A complete administrative case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006
Date Data Arrived at EDR: 03/01/2007
Date Made Active in Reports: 04/10/2007
Number of Days to Update: 40

Source: Environmental Protection Agency
Telephone: 202-564-2501
Last EDR Contact: 12/17/2007
Next Scheduled EDR Contact: 03/17/2008
Data Release Frequency: No Update Planned

HIST FTTS INSP: FIFRA/TSCA Tracking System Inspection & Enforcement Case Listing

A complete inspection and enforcement case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006
Date Data Arrived at EDR: 03/01/2007
Date Made Active in Reports: 04/10/2007
Number of Days to Update: 40

Source: Environmental Protection Agency
Telephone: 202-564-2501
Last EDR Contact: 12/17/2008
Next Scheduled EDR Contact: 03/17/2008
Data Release Frequency: No Update Planned

DOT OPS: Incident and Accident Data

Department of Transportation, Office of Pipeline Safety Incident and Accident data.

Date of Government Version: 01/02/2020
Date Data Arrived at EDR: 01/28/2020
Date Made Active in Reports: 04/17/2020
Number of Days to Update: 80

Source: Department of Transportation, Office of Pipeline Safety
Telephone: 202-366-4595
Last EDR Contact: 04/28/2020
Next Scheduled EDR Contact: 08/10/2020
Data Release Frequency: Quarterly

CONSENT: Superfund (CERCLA) Consent Decrees

Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters.

Date of Government Version: 12/31/2019
Date Data Arrived at EDR: 01/17/2020
Date Made Active in Reports: 03/06/2020
Number of Days to Update: 49

Source: Department of Justice, Consent Decree Library
Telephone: Varies
Last EDR Contact: 03/26/2020
Next Scheduled EDR Contact: 07/20/2020
Data Release Frequency: Varies

BRS: Biennial Reporting System

The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities.

Date of Government Version: 12/31/2015
Date Data Arrived at EDR: 02/22/2017
Date Made Active in Reports: 09/28/2017
Number of Days to Update: 218

Source: EPA/NTIS
Telephone: 800-424-9346
Last EDR Contact: 03/25/2020
Next Scheduled EDR Contact: 07/06/2020
Data Release Frequency: Biennially

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

INDIAN RESERV: Indian Reservations

This map layer portrays Indian administered lands of the United States that have any area equal to or greater than 640 acres.

Date of Government Version: 12/31/2014
Date Data Arrived at EDR: 07/14/2015
Date Made Active in Reports: 01/10/2017
Number of Days to Update: 546

Source: USGS
Telephone: 202-208-3710
Last EDR Contact: 04/10/2020
Next Scheduled EDR Contact: 07/20/2020
Data Release Frequency: Semi-Annually

FUSRAP: Formerly Utilized Sites Remedial Action Program

DOE established the Formerly Utilized Sites Remedial Action Program (FUSRAP) in 1974 to remediate sites where radioactive contamination remained from Manhattan Project and early U.S. Atomic Energy Commission (AEC) operations.

Date of Government Version: 08/08/2017
Date Data Arrived at EDR: 09/11/2018
Date Made Active in Reports: 09/14/2018
Number of Days to Update: 3

Source: Department of Energy
Telephone: 202-586-3559
Last EDR Contact: 04/29/2020
Next Scheduled EDR Contact: 08/17/2020
Data Release Frequency: Varies

UMTRA: Uranium Mill Tailings Sites

Uranium ore was mined by private companies for federal government use in national defense programs. When the mills shut down, large piles of the sand-like material (mill tailings) remain after uranium has been extracted from the ore. Levels of human exposure to radioactive materials from the piles are low; however, in some cases tailings were used as construction materials before the potential health hazards of the tailings were recognized.

Date of Government Version: 08/30/2019
Date Data Arrived at EDR: 11/15/2019
Date Made Active in Reports: 01/28/2020
Number of Days to Update: 74

Source: Department of Energy
Telephone: 505-845-0011
Last EDR Contact: 05/18/2020
Next Scheduled EDR Contact: 08/31/2020
Data Release Frequency: Varies

LEAD SMELTER 1: Lead Smelter Sites

A listing of former lead smelter site locations.

Date of Government Version: 04/27/2020
Date Data Arrived at EDR: 05/06/2020
Date Made Active in Reports: 05/28/2020
Number of Days to Update: 22

Source: Environmental Protection Agency
Telephone: 703-603-8787
Last EDR Contact: 06/03/2020
Next Scheduled EDR Contact: 07/13/2020
Data Release Frequency: Varies

LEAD SMELTER 2: Lead Smelter Sites

A list of several hundred sites in the U.S. where secondary lead smelting was done from 1931 and 1964. These sites may pose a threat to public health through ingestion or inhalation of contaminated soil or dust.

Date of Government Version: 04/05/2001
Date Data Arrived at EDR: 10/27/2010
Date Made Active in Reports: 12/02/2010
Number of Days to Update: 36

Source: American Journal of Public Health
Telephone: 703-305-6451
Last EDR Contact: 12/02/2009
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

US AIRS (AFS): Aerometric Information Retrieval System Facility Subsystem (AFS)

The database is a sub-system of Aerometric Information Retrieval System (AIRS). AFS contains compliance data on air pollution point sources regulated by the U.S. EPA and/or state and local air regulatory agencies. This information comes from source reports by various stationary sources of air pollution, such as electric power plants, steel mills, factories, and universities, and provides information about the air pollutants they produce. Action, air program, air program pollutant, and general level plant data. It is used to track emissions and compliance data from industrial plants.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 10/12/2016
Date Data Arrived at EDR: 10/26/2016
Date Made Active in Reports: 02/03/2017
Number of Days to Update: 100

Source: EPA
Telephone: 202-564-2496
Last EDR Contact: 09/26/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Annually

US AIRS MINOR: Air Facility System Data

A listing of minor source facilities.

Date of Government Version: 10/12/2016
Date Data Arrived at EDR: 10/26/2016
Date Made Active in Reports: 02/03/2017
Number of Days to Update: 100

Source: EPA
Telephone: 202-564-2496
Last EDR Contact: 09/26/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Annually

MINES VIOLATIONS: MSHA Violation Assessment Data

Mines violation and assessment information. Department of Labor, Mine Safety & Health Administration.

Date of Government Version: 03/31/2020
Date Data Arrived at EDR: 04/01/2020
Date Made Active in Reports: 05/21/2020
Number of Days to Update: 50

Source: DOL, Mine Safety & Health Admini
Telephone: 202-693-9424
Last EDR Contact: 05/27/2020
Next Scheduled EDR Contact: 09/14/2020
Data Release Frequency: Quarterly

US MINES: Mines Master Index File

Contains all mine identification numbers issued for mines active or opened since 1971. The data also includes violation information.

Date of Government Version: 02/11/2020
Date Data Arrived at EDR: 02/25/2020
Date Made Active in Reports: 05/21/2020
Number of Days to Update: 86

Source: Department of Labor, Mine Safety and Health Administration
Telephone: 303-231-5959
Last EDR Contact: 05/21/2020
Next Scheduled EDR Contact: 09/07/2020
Data Release Frequency: Semi-Annually

US MINES 2: Ferrous and Nonferrous Metal Mines Database Listing

This map layer includes ferrous (ferrous metal mines are facilities that extract ferrous metals, such as iron ore or molybdenum) and nonferrous (Nonferrous metal mines are facilities that extract nonferrous metals, such as gold, silver, copper, zinc, and lead) metal mines in the United States.

Date of Government Version: 01/16/2018
Date Data Arrived at EDR: 02/28/2020
Date Made Active in Reports: 05/22/2020
Number of Days to Update: 84

Source: USGS
Telephone: 703-648-7709
Last EDR Contact: 05/27/2020
Next Scheduled EDR Contact: 09/07/2020
Data Release Frequency: Varies

US MINES 3: Active Mines & Mineral Plants Database Listing

Active Mines and Mineral Processing Plant operations for commodities monitored by the Minerals Information Team of the USGS.

Date of Government Version: 04/14/2011
Date Data Arrived at EDR: 06/08/2011
Date Made Active in Reports: 09/13/2011
Number of Days to Update: 97

Source: USGS
Telephone: 703-648-7709
Last EDR Contact: 05/21/2020
Next Scheduled EDR Contact: 09/07/2020
Data Release Frequency: Varies

ABANDONED MINES: Abandoned Mines

An inventory of land and water impacted by past mining (primarily coal mining) is maintained by OSMRE to provide information needed to implement the Surface Mining Control and Reclamation Act of 1977 (SMCRA). The inventory contains information on the location, type, and extent of AML impacts, as well as, information on the cost associated with the reclamation of those problems. The inventory is based upon field surveys by State, Tribal, and OSMRE program officials. It is dynamic to the extent that it is modified as new problems are identified and existing problems are reclaimed.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 03/05/2020
Date Data Arrived at EDR: 03/06/2020
Date Made Active in Reports: 05/29/2020
Number of Days to Update: 84

Source: Department of Interior
Telephone: 202-208-2609
Last EDR Contact: 06/03/2020
Next Scheduled EDR Contact: 09/21/2020
Data Release Frequency: Quarterly

FINDS: Facility Index System/Facility Registry System

Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Date of Government Version: 02/03/2020
Date Data Arrived at EDR: 03/03/2020
Date Made Active in Reports: 05/28/2020
Number of Days to Update: 86

Source: EPA
Telephone: (214) 665-2200
Last EDR Contact: 06/02/2020
Next Scheduled EDR Contact: 09/14/2020
Data Release Frequency: Quarterly

DOCKET HWC: Hazardous Waste Compliance Docket Listing

A complete list of the Federal Agency Hazardous Waste Compliance Docket Facilities.

Date of Government Version: 05/31/2018
Date Data Arrived at EDR: 07/26/2018
Date Made Active in Reports: 10/05/2018
Number of Days to Update: 71

Source: Environmental Protection Agency
Telephone: 202-564-0527
Last EDR Contact: 05/18/2020
Next Scheduled EDR Contact: 09/07/2020
Data Release Frequency: Varies

UXO: Unexploded Ordnance Sites

A listing of unexploded ordnance site locations

Date of Government Version: 12/31/2017
Date Data Arrived at EDR: 01/17/2019
Date Made Active in Reports: 04/01/2019
Number of Days to Update: 74

Source: Department of Defense
Telephone: 703-704-1564
Last EDR Contact: 04/03/2020
Next Scheduled EDR Contact: 07/27/2020
Data Release Frequency: Varies

ECHO: Enforcement & Compliance History Information

ECHO provides integrated compliance and enforcement information for about 800,000 regulated facilities nationwide.

Date of Government Version: 01/05/2020
Date Data Arrived at EDR: 01/07/2020
Date Made Active in Reports: 03/06/2020
Number of Days to Update: 59

Source: Environmental Protection Agency
Telephone: 202-564-2280
Last EDR Contact: 04/07/2020
Next Scheduled EDR Contact: 07/20/2020
Data Release Frequency: Quarterly

FUELS PROGRAM: EPA Fuels Program Registered Listing

This listing includes facilities that are registered under the Part 80 (Code of Federal Regulations) EPA Fuels Programs. All companies now are required to submit new and updated registrations.

Date of Government Version: 02/18/2020
Date Data Arrived at EDR: 02/19/2020
Date Made Active in Reports: 05/14/2020
Number of Days to Update: 85

Source: EPA
Telephone: 800-385-6164
Last EDR Contact: 05/19/2020
Next Scheduled EDR Contact: 08/31/2020
Data Release Frequency: Quarterly

AIRS: Current Emission Inventory Data

The database lists by company, along with their actual emissions, the TNRCC air accounts that emit EPA criteria pollutants.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 03/13/2020
Date Data Arrived at EDR: 03/17/2020
Date Made Active in Reports: 06/03/2020
Number of Days to Update: 78

Source: Texas Commission on Environmental Quality
Telephone: N/A
Last EDR Contact: 06/04/2020
Next Scheduled EDR Contact: 09/21/2020
Data Release Frequency: Semi-Annually

APAR: Affected Property Assessment Report Site Listing

Listing of Sites That Have Received an APAR (Affected Property Assessment Report)

Date of Government Version: 01/07/2020
Date Data Arrived at EDR: 01/15/2020
Date Made Active in Reports: 03/27/2020
Number of Days to Update: 72

Source: Texas Commission on Environmental Quality
Telephone: 512-239-5872
Last EDR Contact: 03/26/2020
Next Scheduled EDR Contact: 07/20/2020
Data Release Frequency: Varies

ASBESTOS: Asbestos Notification Listing

A listing of asbestos notification site locations.

Date of Government Version: 02/07/2020
Date Data Arrived at EDR: 02/21/2020
Date Made Active in Reports: 04/30/2020
Number of Days to Update: 69

Source: Department of State Health Services
Telephone: 512-834-6787
Last EDR Contact: 05/07/2020
Next Scheduled EDR Contact: 08/31/2020
Data Release Frequency: Varies

COAL ASH: Coal Ash Disposal Sites

A listing of facilities that use surface impoundments or landfills to dispose of coal ash.

Date of Government Version: 04/30/2019
Date Data Arrived at EDR: 05/02/2019
Date Made Active in Reports: 06/28/2019
Number of Days to Update: 57

Source: Texas Commission on Environmental Quality
Telephone: 512-239-6624
Last EDR Contact: 04/17/2020
Next Scheduled EDR Contact: 08/10/2020
Data Release Frequency: Varies

DRYCLEANERS: Drycleaner Registration Database Listing

A listing of drycleaning facilities.

Date of Government Version: 02/06/2020
Date Data Arrived at EDR: 02/26/2020
Date Made Active in Reports: 04/14/2020
Number of Days to Update: 48

Source: Texas Commission on Environmental Quality
Telephone: 512-239-2160
Last EDR Contact: 05/27/2020
Next Scheduled EDR Contact: 09/07/2020
Data Release Frequency: Varies

ED AQUIF: Edwards Aquifer Permits

A listing of permits in the Edwards Aquifer Protection Program database. The information provided is for the counties located in the Austin Region (Hays, Travis, and Williamson counties).

Date of Government Version: 01/13/2020
Date Data Arrived at EDR: 01/23/2020
Date Made Active in Reports: 04/03/2020
Number of Days to Update: 71

Source: Texas Commission on Environmental Quality, Austin Region
Telephone: 512-339-2929
Last EDR Contact: 03/19/2020
Next Scheduled EDR Contact: 07/06/2020
Data Release Frequency: Varies

ENFORCEMENT: Notice of Violations Listing

A listing of permit violations.

Date of Government Version: 01/14/2020
Date Data Arrived at EDR: 01/16/2020
Date Made Active in Reports: 04/09/2020
Number of Days to Update: 84

Source: Texas Commission on Environmental Quality
Telephone: 512-239-6012
Last EDR Contact: 03/23/2020
Next Scheduled EDR Contact: 07/13/2020
Data Release Frequency: Semi-Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Financial Assurance 1: Financial Assurance Information Listing

Financial assurance information.

Date of Government Version: 12/18/2019
Date Data Arrived at EDR: 01/03/2020
Date Made Active in Reports: 03/17/2020
Number of Days to Update: 74

Source: Texas Commission on Environmental Quality
Telephone: 512-239-6239
Last EDR Contact: 03/16/2020
Next Scheduled EDR Contact: 07/06/2020
Data Release Frequency: Varies

Financial Assurance 2: Financial Assurance Information Listing

Financial Assurance information for underground storage tank facilities. Financial assurance is intended to ensure that resources are available to pay for the cost of closure, post-closure care, and corrective measures if the owner or operator of a regulated facility is unable or unwilling to pay

Date of Government Version: 11/05/2019
Date Data Arrived at EDR: 12/23/2019
Date Made Active in Reports: 03/04/2020
Number of Days to Update: 72

Source: Texas Commission on Environmental Quality
Telephone: 512-239-0986
Last EDR Contact: 03/25/2020
Next Scheduled EDR Contact: 07/06/2020
Data Release Frequency: Quarterly

GCC: Groundwater Contamination Cases

Texas Water Code, Section 26.406 requires the annual report to describe the current status of groundwater monitoring activities conducted or required by each agency at regulated facilities or associated with regulated activities.

The report is required to contain a description of each case of groundwater contamination documented during the previous calendar year. Also to be included, is a description of each case of contamination documented during previous periods for which voluntary clean up action was incomplete at the time the preceding report was issued. The report is also required to indicate the status of enforcement action for each listed case.

Date of Government Version: 12/31/2018
Date Data Arrived at EDR: 09/06/2019
Date Made Active in Reports: 11/15/2019
Number of Days to Update: 70

Source: Texas Commission on Environmental Quality
Telephone: 512-239-5690
Last EDR Contact: 05/29/2020
Next Scheduled EDR Contact: 09/07/2020
Data Release Frequency: Annually

IOP: Innocent Owner/Operator Program

Contains information on all sites that are in the IOP. An IOP is an innocent owner or operator whose property is contaminated as a result of a release or migration of contaminants from a source or sources not located on the property, and they did not cause or contribute to the source or sources of contamination.

Date of Government Version: 01/03/2020
Date Data Arrived at EDR: 01/03/2020
Date Made Active in Reports: 03/17/2020
Number of Days to Update: 74

Source: Texas Commission on Environmental Quality
Telephone: 512-239-5894
Last EDR Contact: 03/17/2020
Next Scheduled EDR Contact: 07/13/2020
Data Release Frequency: Quarterly

LEAD: Lead Inspection Listing

Lead inspection sites

Date of Government Version: 02/07/2020
Date Data Arrived at EDR: 02/21/2020
Date Made Active in Reports: 04/30/2020
Number of Days to Update: 69

Source: Department of State Health Services
Telephone: 512-834-6600
Last EDR Contact: 05/07/2020
Next Scheduled EDR Contact: 08/31/2020
Data Release Frequency: Varies

Ind. Haz Waste: Industrial & Hazardous Waste Database

Summary reports reported by waste handlers, generators and shippers in Texas.

Date of Government Version: 11/05/2019
Date Data Arrived at EDR: 01/15/2020
Date Made Active in Reports: 03/31/2020
Number of Days to Update: 76

Source: Texas Commission on Environmental Quality
Telephone: 512-239-0985
Last EDR Contact: 04/15/2020
Next Scheduled EDR Contact: 07/27/2020
Data Release Frequency: Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

MSD: Municipal Settings Designations Database

An MSD is an official state designation given to property within a municipality or its extraterritorial jurisdiction that certifies that designated groundwater at the property is not used as potable water, and is prohibited from future use as potable water because that groundwater is contaminated in excess of the applicable potable-water protective concentration level.

Date of Government Version: 01/03/2020
Date Data Arrived at EDR: 01/07/2020
Date Made Active in Reports: 03/17/2020
Number of Days to Update: 70

Source: Texas Commission on Environmental Quality
Telephone: 512-239-4982
Last EDR Contact: 04/17/2020
Next Scheduled EDR Contact: 08/10/2020
Data Release Frequency: Varies

NPDES: NPDES Facility List

Permitted wastewater outfalls.

Date of Government Version: 02/10/2020
Date Data Arrived at EDR: 02/12/2020
Date Made Active in Reports: 04/24/2020
Number of Days to Update: 72

Source: Texas Commission on Environmental Quality
Telephone: 512-239-4591
Last EDR Contact: 05/13/2020
Next Scheduled EDR Contact: 08/24/2020
Data Release Frequency: Varies

RWS: Radioactive Waste Sites

Sites in the State of Texas that have been designated as Radioactive Waste sites.

Date of Government Version: 07/24/2006
Date Data Arrived at EDR: 12/14/2006
Date Made Active in Reports: 01/23/2007
Number of Days to Update: 40

Source: Texas Commission on Environmental Quality
Telephone: 512-239-0859
Last EDR Contact: 05/15/2020
Next Scheduled EDR Contact: 08/24/2020
Data Release Frequency: Semi-Annually

TIER 2: Tier 2 Chemical Inventory Reports

A listing of facilities which store or manufacture hazardous materials and submit a chemical inventory report.

Date of Government Version: 12/31/2012
Date Data Arrived at EDR: 06/07/2013
Date Made Active in Reports: 07/22/2013
Number of Days to Update: 45

Source: Department of State Health Services
Telephone: 512-834-6603
Last EDR Contact: 05/07/2020
Next Scheduled EDR Contact: 08/31/2020
Data Release Frequency: Annually

UIC: Underground Injection Wells Database Listing

Class V injection wells regulated by the TCEQ. Class V wells are used to inject non-hazardous fluids underground. Most Class V wells are used to dispose of wastes into or above underground sources of drinking water and can pose a threat to ground water quality, if not managed properly.

Date of Government Version: 11/06/2019
Date Data Arrived at EDR: 11/07/2019
Date Made Active in Reports: 01/16/2020
Number of Days to Update: 70

Source: Texas Commission on Environmental Quality
Telephone: 512-239-6627
Last EDR Contact: 04/13/2020
Next Scheduled EDR Contact: 07/27/2020
Data Release Frequency: Varies

IHW CORR ACTION: IHW CORR ACTION

Industrial hazardous waste facilities with corrective actions.

Date of Government Version: 01/03/2020
Date Data Arrived at EDR: 01/07/2020
Date Made Active in Reports: 03/17/2020
Number of Days to Update: 70

Source: Texas Commission on Environmental Quality
Telephone: 512-239-5872
Last EDR Contact: 03/23/2020
Next Scheduled EDR Contact: 07/13/2020
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

PST STAGE 2: PST Stage 2

State II Vapor Recovery. Decommissioning of Stage II Rule - Gasoline dispensing facilities (GDFs) may begin the process of removing Stage II equipment on May 16, 2014 providing that all other requirements for decommissioning have been met, including appropriate notification.

Date of Government Version: 07/17/2019
Date Data Arrived at EDR: 07/18/2019
Date Made Active in Reports: 09/24/2019
Number of Days to Update: 68

Source: Texas Commission on Environmental Quality
Telephone: 512-239-2160
Last EDR Contact: 03/27/2020
Next Scheduled EDR Contact: 07/06/2020
Data Release Frequency: Varies

COMP HIST: Compliance History Listing

A listing of compliance histories of regulated entities

Date of Government Version: 11/19/2019
Date Data Arrived at EDR: 11/25/2019
Date Made Active in Reports: 02/04/2020
Number of Days to Update: 71

Source: Txs Commission on Environmental Quality
Telephone: 512-239-3282
Last EDR Contact: 05/29/2020
Next Scheduled EDR Contact: 09/07/2020
Data Release Frequency: Varies

PCS: Permit Compliance System

PCS is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

Date of Government Version: 07/14/2011
Date Data Arrived at EDR: 08/05/2011
Date Made Active in Reports: 09/29/2011
Number of Days to Update: 55

Source: EPA, Office of Water
Telephone: 202-564-2496
Last EDR Contact: 03/09/2020
Next Scheduled EDR Contact: 06/22/2020
Data Release Frequency: Semi-Annually

PCS ENF: Enforcement data

No description is available for this data

Date of Government Version: 12/31/2014
Date Data Arrived at EDR: 02/05/2015
Date Made Active in Reports: 03/06/2015
Number of Days to Update: 29

Source: EPA
Telephone: 202-564-2497
Last EDR Contact: 03/26/2020
Next Scheduled EDR Contact: 07/20/2020
Data Release Frequency: Varies

PCS INACTIVE: Listing of Inactive PCS Permits

An inactive permit is a facility that has shut down or is no longer discharging.

Date of Government Version: 11/05/2014
Date Data Arrived at EDR: 01/06/2015
Date Made Active in Reports: 05/06/2015
Number of Days to Update: 120

Source: EPA
Telephone: 202-564-2496
Last EDR Contact: 03/26/2020
Next Scheduled EDR Contact: 07/20/2020
Data Release Frequency: Semi-Annually

MINES MRDS: Mineral Resources Data System

Mineral Resources Data System

Date of Government Version: 04/06/2018
Date Data Arrived at EDR: 10/21/2019
Date Made Active in Reports: 10/24/2019
Number of Days to Update: 3

Source: USGS
Telephone: 703-648-6533
Last EDR Contact: 05/21/2020
Next Scheduled EDR Contact: 09/07/2020
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP: EDR Proprietary Manufactured Gas Plants

The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

EDR Hist Auto: EDR Exclusive Historical Auto Stations

EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

EDR Hist Cleaner: EDR Exclusive Historical Cleaners

EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

RGA HWS: Recovered Government Archive State Hazardous Waste Facilities List

The EDR Recovered Government Archive State Hazardous Waste database provides a list of SHWS incidents derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the Texas Commission of Environmental Quality in Texas formerly known as Texas Natural Resources Conservation Commission which changed in 2002.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: N/A
Date Data Arrived at EDR: 07/01/2013
Date Made Active in Reports: 12/26/2013
Number of Days to Update: 178

Source: Texas Commission on Environmental Quality
Telephone: N/A
Last EDR Contact: 06/01/2012
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

RGA LF: Recovered Government Archive Solid Waste Facilities List

The EDR Recovered Government Archive Landfill database provides a list of landfills derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the Texas Commission of Environmental Quality in Texas formerly known as Texas Natural Resources Conservation Commission which changed in 2002.

Date of Government Version: N/A
Date Data Arrived at EDR: 07/01/2013
Date Made Active in Reports: 01/13/2014
Number of Days to Update: 196

Source: Texas Commission on Environmental Quality
Telephone: N/A
Last EDR Contact: 06/01/2012
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

COUNTY RECORDS

TRAVIS COUNTY:

HIST UST AUSTIN: Historic Tank Records

A listing of historic records from the City of Austin.

Date of Government Version: 06/25/2012
Date Data Arrived at EDR: 06/29/2012
Date Made Active in Reports: 08/23/2012
Number of Days to Update: 55

Source: Department of Planning & Development Review
Telephone: 512-974-2715
Last EDR Contact: 05/28/2020
Next Scheduled EDR Contact: 09/14/2020
Data Release Frequency: Varies

OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

CT MANIFEST: Hazardous Waste Manifest Data

Facility and manifest data. Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a tsd facility.

Date of Government Version: 01/30/2020
Date Data Arrived at EDR: 01/30/2020
Date Made Active in Reports: 03/09/2020
Number of Days to Update: 39

Source: Department of Energy & Environmental Protection
Telephone: 860-424-3375
Last EDR Contact: 05/12/2020
Next Scheduled EDR Contact: 08/24/2020
Data Release Frequency: No Update Planned

NJ MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2018
Date Data Arrived at EDR: 04/10/2019
Date Made Active in Reports: 05/16/2019
Number of Days to Update: 36

Source: Department of Environmental Protection
Telephone: N/A
Last EDR Contact: 04/10/2020
Next Scheduled EDR Contact: 07/20/2020
Data Release Frequency: Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

NY MANIFEST: Facility and Manifest Data

Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

Date of Government Version: 01/01/2019
Date Data Arrived at EDR: 05/01/2019
Date Made Active in Reports: 06/21/2019
Number of Days to Update: 51

Source: Department of Environmental Conservation
Telephone: 518-402-8651
Last EDR Contact: 04/29/2020
Next Scheduled EDR Contact: 08/10/2020
Data Release Frequency: Quarterly

PA MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 06/30/2018
Date Data Arrived at EDR: 07/19/2019
Date Made Active in Reports: 09/10/2019
Number of Days to Update: 53

Source: Department of Environmental Protection
Telephone: 717-783-8990
Last EDR Contact: 04/02/2020
Next Scheduled EDR Contact: 07/27/2020
Data Release Frequency: Annually

RI MANIFEST: Manifest information

Hazardous waste manifest information

Date of Government Version: 12/31/2018
Date Data Arrived at EDR: 10/02/2019
Date Made Active in Reports: 12/10/2019
Number of Days to Update: 69

Source: Department of Environmental Management
Telephone: 401-222-2797
Last EDR Contact: 05/14/2020
Next Scheduled EDR Contact: 08/31/2020
Data Release Frequency: Annually

VT MANIFEST: Hazardous Waste Manifest Data

Hazardous waste manifest information.

Date of Government Version: 10/28/2019
Date Data Arrived at EDR: 10/29/2019
Date Made Active in Reports: 01/09/2020
Number of Days to Update: 72

Source: Department of Environmental Conservation
Telephone: 802-241-3443
Last EDR Contact: 04/03/2020
Next Scheduled EDR Contact: 07/27/2020
Data Release Frequency: Annually

WI MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 05/31/2018
Date Data Arrived at EDR: 06/19/2019
Date Made Active in Reports: 09/03/2019
Number of Days to Update: 76

Source: Department of Natural Resources
Telephone: N/A
Last EDR Contact: 06/04/2020
Next Scheduled EDR Contact: 09/21/2020
Data Release Frequency: Annually

Oil/Gas Pipelines

Source: Endeavor Business Media

Petroleum Bundle (Crude Oil, Refined Products, Petrochemicals, Gas Liquids (LPG/NGL), and Specialty Gases (Miscellaneous)) N = Natural Gas Bundle (Natural Gas, Gas Liquids (LPG/NGL), and Specialty Gases (Miscellaneous)). This map includes information copyrighted by Endeavor Business Media. This information is provided on a best effort basis and Endeavor Business Media does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of Endeavor Business Media.

Electric Power Transmission Line Data

Source: Endeavor Business Media

This map includes information copyrighted by Endeavor Business Media. This information is provided on a best effort basis and Endeavor Business Media does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of Endeavor Business Media.

Sensitive Receptors: There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

AHA Hospitals:

Source: American Hospital Association, Inc.

Telephone: 312-280-5991

The database includes a listing of hospitals based on the American Hospital Association's annual survey of hospitals.

Medical Centers: Provider of Services Listing

Source: Centers for Medicare & Medicaid Services

Telephone: 410-786-3000

A listing of hospitals with Medicare provider number, produced by Centers of Medicare & Medicaid Services, a federal agency within the U.S. Department of Health and Human Services.

Nursing Homes

Source: National Institutes of Health

Telephone: 301-594-6248

Information on Medicare and Medicaid certified nursing homes in the United States.

Public Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on elementary and secondary public education in the United States. It is a comprehensive, annual, national statistical database of all public elementary and secondary schools and school districts, which contains data that are comparable across all states.

Private Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on private school locations in the United States.

Daycare Centers: Child Care Facility List

Source: Department of Protective & Regulatory Services

Telephone: 512-438-3269

Flood Zone Data: This data was obtained from the Federal Emergency Management Agency (FEMA). It depicts 100-year and 500-year flood zones as defined by FEMA. It includes the National Flood Hazard Layer (NFHL) which incorporates Flood Insurance Rate Map (FIRM) data and Q3 data from FEMA in areas not covered by NFHL.

Source: FEMA

Telephone: 877-336-2627

Date of Government Version: 2003, 2015

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002, 2005 and 2010 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Wetland Inventory

Source: Texas General Land Office

Telephone: 512-463-0745

Current USGS 7.5 Minute Topographic Map

Source: U.S. Geological Survey

STREET AND ADDRESS INFORMATION

© 2015 TomTom North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

GEOCHECK[®] - PHYSICAL SETTING SOURCE ADDENDUM

TARGET PROPERTY ADDRESS

SAFE HARBOR SELF STORAGE
103 CEMETERY ROAD
ANGLETON, TX 77515

TARGET PROPERTY COORDINATES

Latitude (North):	29.150715 - 29° 9' 2.57"
Longitude (West):	95.429486 - 95° 25' 46.15"
Universal Transverse Mercator:	Zone 15
UTM X (Meters):	263670.2
UTM Y (Meters):	3226948.8
Elevation:	26 ft. above sea level

USGS TOPOGRAPHIC MAP

Target Property Map:	5937069 ANGLETON, TX
Version Date:	2013

EDR's GeoCheck Physical Setting Source Addendum is provided to assist the environmental professional in forming an opinion about the impact of potential contaminant migration.

Assessment of the impact of contaminant migration generally has two principle investigative components:

1. Groundwater flow direction, and
2. Groundwater flow velocity.

Groundwater flow direction may be impacted by surface topography, hydrology, hydrogeology, characteristics of the soil, and nearby wells. Groundwater flow velocity is generally impacted by the nature of the geologic strata.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW DIRECTION INFORMATION

Groundwater flow direction for a particular site is best determined by a qualified environmental professional using site-specific well data. If such data is not reasonably ascertainable, it may be necessary to rely on other sources of information, such as surface topographic information, hydrologic information, hydrogeologic data collected on nearby properties, and regional groundwater flow information (from deep aquifers).


TOPOGRAPHIC INFORMATION

Surface topography may be indicative of the direction of surficial groundwater flow. This information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

TARGET PROPERTY TOPOGRAPHY

General Topographic Gradient: General SSW

SURROUNDING TOPOGRAPHY: ELEVATION PROFILES

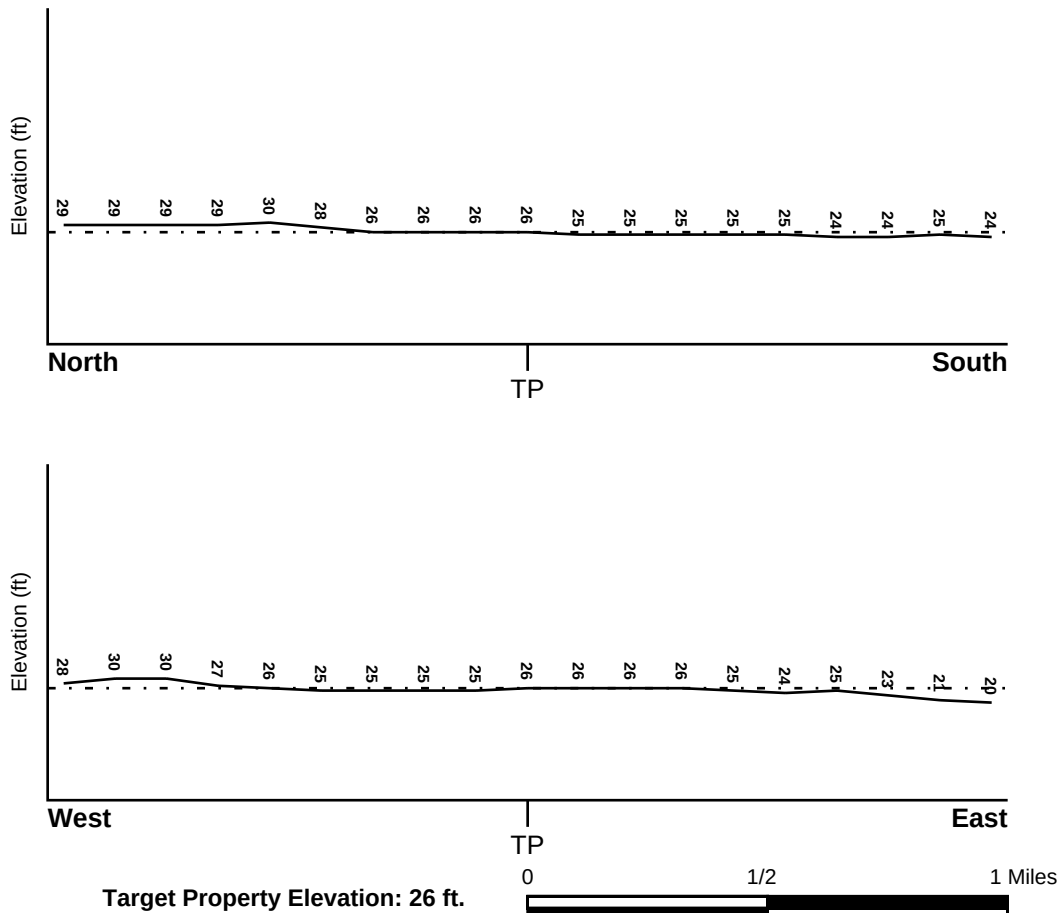

Source: Topography has been determined from the USGS 7.5' Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

HYDROLOGIC INFORMATION

Surface water can act as a hydrologic barrier to groundwater flow. Such hydrologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Refer to the Physical Setting Source Map following this summary for hydrologic information (major waterways and bodies of water).

FEMA FLOOD ZONE

<u>Flood Plain Panel at Target Property</u>	<u>FEMA Source Type</u>
48039C0445H	FEMA Q3 Flood data
<u>Additional Panels in search area:</u>	<u>FEMA Source Type</u>
48039C0440H	FEMA Q3 Flood data

NATIONAL WETLAND INVENTORY

<u>NWI Quad at Target Property</u>	<u>NWI Electronic Data Coverage</u>
ANGLETON	YES - refer to the Overview Map and Detail Map

HYDROGEOLOGIC INFORMATION

Hydrogeologic information obtained by installation of wells on a specific site can often be an indicator of groundwater flow direction in the immediate area. Such hydrogeologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Site-Specific Hydrogeological Data*:

Search Radius:	1.25 miles
Status:	Not found

AQUIFLOW®

Search Radius: 1.000 Mile.

EDR has developed the AQUIFLOW Information System to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted by environmental professionals to regulatory authorities at select sites and has extracted the date of the report, groundwater flow direction as determined hydrogeologically, and the depth to water table.

<u>MAP ID</u>	<u>LOCATION FROM TP</u>	<u>GENERAL DIRECTION GROUNDWATER FLOW</u>
Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW VELOCITY INFORMATION

Groundwater flow velocity information for a particular site is best determined by a qualified environmental professional using site specific geologic and soil strata data. If such data are not reasonably ascertainable, it may be necessary to rely on other sources of information, including geologic age identification, rock stratigraphic unit and soil characteristics data collected on nearby properties and regional soil information. In general, contaminant plumes move more quickly through sandy-gravelly types of soils than silty-clayey types of soils.

GEOLOGIC INFORMATION IN GENERAL AREA OF TARGET PROPERTY

Geologic information can be used by the environmental professional in forming an opinion about the relative speed at which contaminant migration may be occurring.

ROCK STRATIGRAPHIC UNIT


Era:	Cenozoic
System:	Quaternary
Series:	Pleistocene
Code:	Qp (decoded above as Era, System & Series)

GEOLOGIC AGE IDENTIFICATION

Category: Stratified Sequence

Geologic Age and Rock Stratigraphic Unit Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - a digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

SSURGO SOIL MAP - 6085945.2s

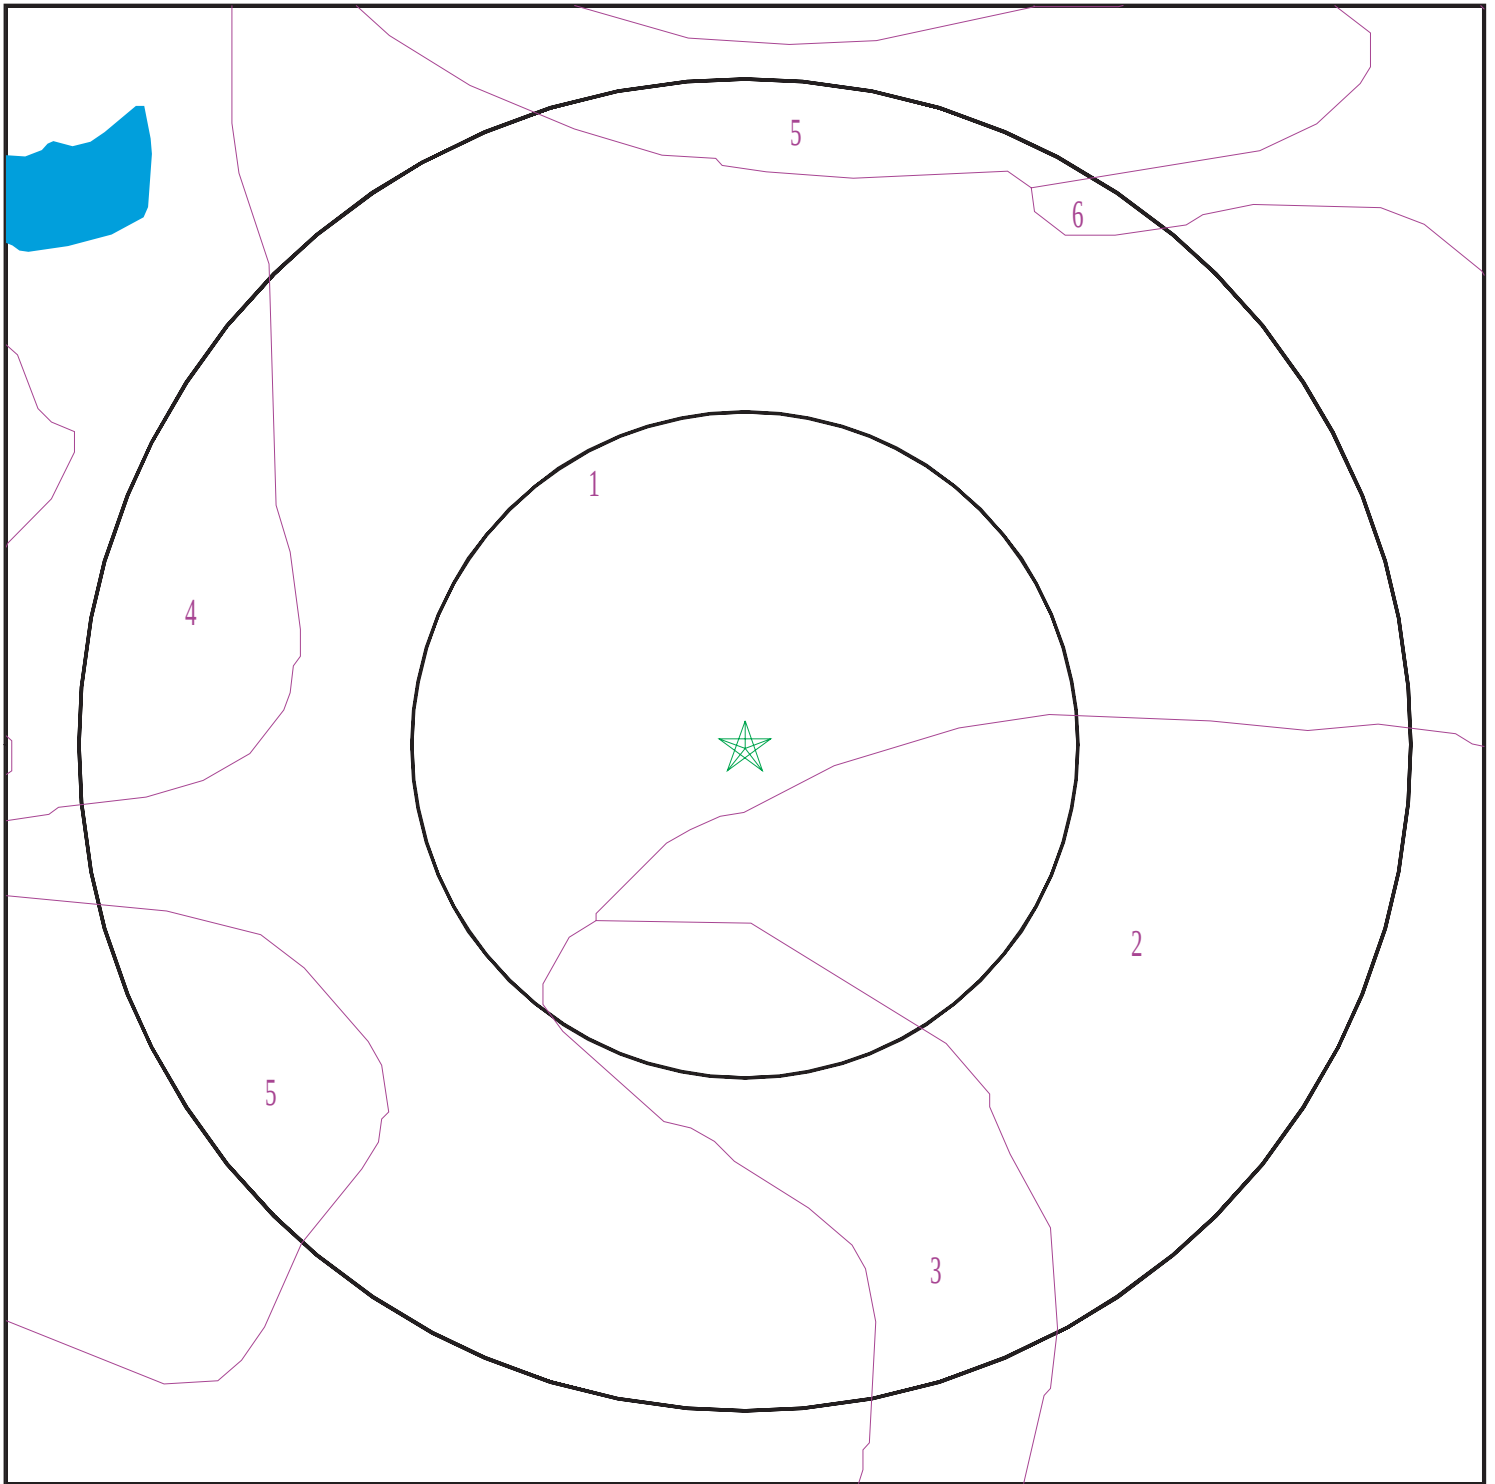

- ★ Target Property
- SSURGO Soil
- Water

0 1/16 1/8 1/4 Miles



SITE NAME: Safe Harbor Self Storage
ADDRESS: 103 Cemetery Road
ANGLETON TX 77515
LAT/LONG: 29.150715 / 95.429486

CLIENT: Partner Engineering and Science, Inc.
CONTACT: Larissa Lopez
INQUIRY #: 6085945.2s
DATE: June 08, 2020 6:12 pm

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

DOMINANT SOIL COMPOSITION IN GENERAL AREA OF TARGET PROPERTY

The U.S. Department of Agriculture's (USDA) Soil Conservation Service (SCS) leads the National Cooperative Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. The following information is based on Soil Conservation Service SSURGO data.

Soil Map ID: 1

Soil Component Name: Bernard

Soil Surface Texture: clay loam

Hydrologic Group: Class D - Very slow infiltration rates. Soils are clayey, have a high water table, or are shallow to an impervious layer.

Soil Drainage Class: Somewhat poorly drained

Hydric Status: Partially hydric

Corrosion Potential - Uncoated Steel: High

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 31 inches

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	11 inches	clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit 50% or more), Fat Clay.	Max: 0.42 Min: 0.01	Max: 8.4 Min: 6.6
2	11 inches	59 inches	clay	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit 50% or more), Fat Clay.	Max: 0.42 Min: 0.01	Max: 8.4 Min: 6.6
3	59 inches	64 inches	silty clay	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit 50% or more), Fat Clay.	Max: 0.42 Min: 0.01	Max: 8.4 Min: 6.6

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Map ID: 2

Soil Component Name: Edna

Soil Surface Texture: fine sandy loam

Hydrologic Group: Class D - Very slow infiltration rates. Soils are clayey, have a high water table, or are shallow to an impervious layer.

Soil Drainage Class: Somewhat poorly drained

Hydric Status: Partially hydric

Corrosion Potential - Uncoated Steel: High

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 61 inches

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	7 inches	fine sandy loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 0.42 Min: 0.01	Max: 8.4 Min: 6.6
2	7 inches	35 inches	clay	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 0.42 Min: 0.01	Max: 8.4 Min: 6.6
3	35 inches	59 inches	clay	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 0.42 Min: 0.01	Max: 8.4 Min: 6.6

Soil Map ID: 3

Soil Component Name: Leton

Soil Surface Texture: loam

Hydrologic Group: Class D - Very slow infiltration rates. Soils are clayey, have a high water table, or are shallow to an impervious layer.

Soil Drainage Class: Poorly drained

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Hydric Status: Partially hydric

Corrosion Potential - Uncoated Steel: High

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 23 inches

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	22 inches	loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 1.4 Min: 0.42	Max: 8.4 Min: 5.6
2	22 inches	61 inches	clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 1.4 Min: 0.42	Max: 8.4 Min: 5.6

Soil Map ID: 4

Soil Component Name: Edna

Soil Surface Texture: fine sandy loam

Hydrologic Group: Class D - Very slow infiltration rates. Soils are clayey, have a high water table, or are shallow to an impervious layer.

Soil Drainage Class: Somewhat poorly drained

Hydric Status: Partially hydric

Corrosion Potential - Uncoated Steel: High

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	7 inches	fine sandy loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 0.42 Min: 0.01	Max: 8.4 Min: 6.6
2	7 inches	48 inches	clay	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 0.42 Min: 0.01	Max: 8.4 Min: 6.6
3	48 inches	59 inches	clay	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 0.42 Min: 0.01	Max: 8.4 Min: 6.6

Soil Map ID: 5

Soil Component Name: Bernard

Soil Surface Texture: clay loam

Hydrologic Group: Class D - Very slow infiltration rates. Soils are clayey, have a high water table, or are shallow to an impervious layer.

Soil Drainage Class: Somewhat poorly drained

Hydric Status: Partially hydric

Corrosion Potential - Uncoated Steel: High

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 31 inches

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	12 inches	clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit 50% or more), Fat Clay.	Max: 0.42 Min: 0.01	Max: 8.4 Min: 6.6
2	12 inches	64 inches	clay	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit 50% or more), Fat Clay.	Max: 0.42 Min: 0.01	Max: 8.4 Min: 6.6
3	64 inches	68 inches	silty clay	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit 50% or more), Fat Clay.	Max: 0.42 Min: 0.01	Max: 8.4 Min: 6.6

Soil Map ID: 6

Soil Component Name: Bernard

Soil Surface Texture: clay loam

Hydrologic Group: Class D - Very slow infiltration rates. Soils are clayey, have a high water table, or are shallow to an impervious layer.

Soil Drainage Class:
Hydric Status: Partially hydric

Corrosion Potential - Uncoated Steel: High

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 31 inches

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	11 inches	clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit 50% or more), Fat Clay.	Max: 0.42 Min: 0.01	Max: 8.4 Min: 6.6
2	11 inches	59 inches	clay	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit 50% or more), Fat Clay.	Max: 0.42 Min: 0.01	Max: 8.4 Min: 6.6
3	59 inches	64 inches	silty clay	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit 50% or more), Fat Clay.	Max: 0.42 Min: 0.01	Max: 8.4 Min: 6.6

LOCAL / REGIONAL WATER AGENCY RECORDS

EDR Local/Regional Water Agency records provide water well information to assist the environmental professional in assessing sources that may impact ground water flow direction, and in forming an opinion about the impact of contaminant migration on nearby drinking water wells.

WELL SEARCH DISTANCE INFORMATION

<u>DATABASE</u>	<u>SEARCH DISTANCE (miles)</u>
Federal USGS	1.000
Federal FRDS PWS	Nearest PWS within 1 mile
State Database	1.000

FEDERAL USGS WELL INFORMATION

<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>
E54	USGS40001162286	1/4 - 1/2 Mile West
M95	USGS40001162291	1/2 - 1 Mile West

FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION

<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
100	TX0200018	1/2 - 1 Mile North

Note: PWS System location is not always the same as well location.

STATE DATABASE WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
A1	TXDOL2000016744	0 - 1/8 Mile South
A2	TXDOL2000016743	0 - 1/8 Mile South
A3	TXDOL2000016748	0 - 1/8 Mile South
A4	TXDOL2000016799	0 - 1/8 Mile South
A5	TXDOL2000016749	0 - 1/8 Mile South
A6	TXPLU5000062590	0 - 1/8 Mile South
A7	TXMON5000066586	0 - 1/8 Mile South
A8	TXPLU5000062592	0 - 1/8 Mile South
A9	TXPLU5000062591	0 - 1/8 Mile South
A10	TXMON5000066582	0 - 1/8 Mile South
A11	TXMON5000066579	0 - 1/8 Mile South
A12	TXMON5000066585	0 - 1/8 Mile South
A13	TXMON5000066584	0 - 1/8 Mile South
A14	TXPLU5000062604	0 - 1/8 Mile South
A15	TXPLU5000062603	0 - 1/8 Mile South
A16	TXPLU5000062610	0 - 1/8 Mile South
A17	TXPLU5000062605	0 - 1/8 Mile South
A18	TXPLU5000062594	0 - 1/8 Mile South
A19	TXPLU5000062593	0 - 1/8 Mile South
A20	TXPLU5000062597	0 - 1/8 Mile South
A21	TXPLU5000062596	0 - 1/8 Mile South
A22	TXDOL2000017578	0 - 1/8 Mile South
A23	TXPLU5000055944	0 - 1/8 Mile South
A24	TXPLU5000055942	0 - 1/8 Mile South
A25	TXMON5000032274	0 - 1/8 Mile South
A26	TXPLU5000106964	0 - 1/8 Mile South
A27	TXPLU5000055957	0 - 1/8 Mile South
A28	TXPLU5000055945	0 - 1/8 Mile South
A29	TXPLU5000055940	0 - 1/8 Mile SSW
A30	TXPLU5000055948	0 - 1/8 Mile SSW
A31	TXPLU5000055958	0 - 1/8 Mile SSW
A32	TXPLU5000055959	0 - 1/8 Mile SW
A33	TXPLU5000055960	0 - 1/8 Mile SW
A34	TXPLU5000055946	0 - 1/8 Mile South
A35	TXPLU5000055947	0 - 1/8 Mile South
A36	TXPLU5000055961	0 - 1/8 Mile South
B37	TXMON5000028065	1/8 - 1/4 Mile SW
B38	TXDOL2000017676	1/8 - 1/4 Mile WSW
39	TXMON5000208718	1/8 - 1/4 Mile South
B40	TXPLU5000055941	1/8 - 1/4 Mile WSW
B41	TXWDB7000109993	1/8 - 1/4 Mile SW
C42	TXMON5000417399	1/8 - 1/4 Mile West
C43	TXMON5000417401	1/8 - 1/4 Mile West

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

STATE DATABASE WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
C44	TXPLU5000046935	1/8 - 1/4 Mile WSW
C45	TXPLU5000046946	1/8 - 1/4 Mile WSW
C46	TXPLU5000046947	1/8 - 1/4 Mile WSW
D47	TXMON5000020954	1/4 - 1/2 Mile NW
D48	TXMON5000020955	1/4 - 1/2 Mile NW
D49	TXMON5000020956	1/4 - 1/2 Mile NW
D50	TXDOL2000017791	1/4 - 1/2 Mile NW
D51	TXDOL2000017792	1/4 - 1/2 Mile NW
D52	TXDOL2000017793	1/4 - 1/2 Mile NW
C53	TXWDB7000109994	1/4 - 1/2 Mile WSW
E55	TXWDB7000109987	1/4 - 1/2 Mile West
F56	TXMON5000288905	1/4 - 1/2 Mile SSE
F57	TXMON5000288906	1/4 - 1/2 Mile SSE
58	TXMON5000215556	1/4 - 1/2 Mile SSW
59	TXPLU5000100255	1/4 - 1/2 Mile WNW
G60	TXMON5000375557	1/2 - 1 Mile NNW
G61	TXMON5000375559	1/2 - 1 Mile NNW
G62	TXMON5000375562	1/2 - 1 Mile NNW
G63	TXMON5000375516	1/2 - 1 Mile NNW
G64	TXMON5000375505	1/2 - 1 Mile NNW
G65	TXMON5000375509	1/2 - 1 Mile NNW
G66	TXMON5000375513	1/2 - 1 Mile NNW
G67	TXPLU5000146419	1/2 - 1 Mile NNW
G68	TXPLU5000146420	1/2 - 1 Mile NNW
G69	TXPLU5000152887	1/2 - 1 Mile NNW
G70	TXPLU5000146411	1/2 - 1 Mile NNW
G71	TXMON5000375563	1/2 - 1 Mile NNW
G72	TXMON5000385472	1/2 - 1 Mile NNW
G73	TXPLU5000146410	1/2 - 1 Mile NNW
H74	TXMON5000001474	1/2 - 1 Mile NW
75	TXMON5000256652	1/2 - 1 Mile ENE
H76	TXDOL2000018253	1/2 - 1 Mile NW
I77	TXMON5000230838	1/2 - 1 Mile South
I78	TXMON5000230840	1/2 - 1 Mile South
J79	TXDOL2000016306	1/2 - 1 Mile SSE
J80	TXMON5000090501	1/2 - 1 Mile SSE
I81	TXMON5000214167	1/2 - 1 Mile South
I82	TXMON5000214172	1/2 - 1 Mile South
I83	TXMON5000214174	1/2 - 1 Mile South
84	TXMON5000374063	1/2 - 1 Mile NNW
K85	TXPLU5000100254	1/2 - 1 Mile NW
L86	TXMON5000009852	1/2 - 1 Mile North
L87	TXMON5000009853	1/2 - 1 Mile North
L88	TXDOL2000018034	1/2 - 1 Mile North
L89	TXDOL2000018035	1/2 - 1 Mile North
K90	TXMON5000020445	1/2 - 1 Mile NW
K91	TXDOL2000017815	1/2 - 1 Mile NW
K92	TXMON5000071135	1/2 - 1 Mile NW
K93	TXDOL2000016696	1/2 - 1 Mile NW
M94	TXPLU5000100252	1/2 - 1 Mile WNW
M96	TXWDB7000109991	1/2 - 1 Mile West
N97	TXMON5000170218	1/2 - 1 Mile SW

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

STATE DATABASE WELL INFORMATION


MAP ID	WELL ID	LOCATION FROM TP
N98	TXDOL2000014662	1/2 - 1 Mile SW
M99	TXWDB7000109992	1/2 - 1 Mile West
O101	TXMON5000256743	1/2 - 1 Mile NE
O102	TXMON5000314463	1/2 - 1 Mile SW
O103	TXMON5000108058	1/2 - 1 Mile North
O104	TXMON5000234806	1/2 - 1 Mile North
O105	TXDOL2000016064	1/2 - 1 Mile North
O106	TXMON5000120007	1/2 - 1 Mile North
O107	TXMON5000151702	1/2 - 1 Mile North
O108	TXPLU5000119902	1/2 - 1 Mile North
O109	TXDOL2000015819	1/2 - 1 Mile North
O110	TXDOL2000015261	1/2 - 1 Mile North
O111	TXMON5000144157	1/2 - 1 Mile North
O112	TXMON5000144156	1/2 - 1 Mile North
O113	TXMON5000120002	1/2 - 1 Mile North
O114	TXMON5000144158	1/2 - 1 Mile North
O115	TXMON5000161901	1/2 - 1 Mile North
O116	TXMON5000161899	1/2 - 1 Mile North
O117	TXMON5000144159	1/2 - 1 Mile North
O118	TXDOL2000015387	1/2 - 1 Mile North
O119	TXDOL2000015391	1/2 - 1 Mile North
O120	TXDOL2000015077	1/2 - 1 Mile North
O121	TXDOL2000015078	1/2 - 1 Mile North
O122	TXDOL2000015392	1/2 - 1 Mile North
O123	TXDOL2000015821	1/2 - 1 Mile North
O124	TXDOL2000015425	1/2 - 1 Mile North
125	TXPLU5000100256	1/2 - 1 Mile West
126	TXMON5000317929	1/2 - 1 Mile SE
P127	TXMON5000390221	1/2 - 1 Mile NNW
P128	TXMON5000390220	1/2 - 1 Mile NNW
P129	TXMON5000390219	1/2 - 1 Mile NNW
P130	TXPLU5000048007	1/2 - 1 Mile NNW
P131	TXPLU5000048006	1/2 - 1 Mile NNW
P132	TXPLU5000048005	1/2 - 1 Mile NNW
O133	TXMON5000120004	1/2 - 1 Mile North
O134	TXDOL2000015820	1/2 - 1 Mile North

OTHER STATE DATABASE INFORMATION

STATE OIL/GAS WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
1	TXOG70001167911	1/2 - 1 Mile South

PHYSICAL SETTING SOURCE MAP - 6085945.2s

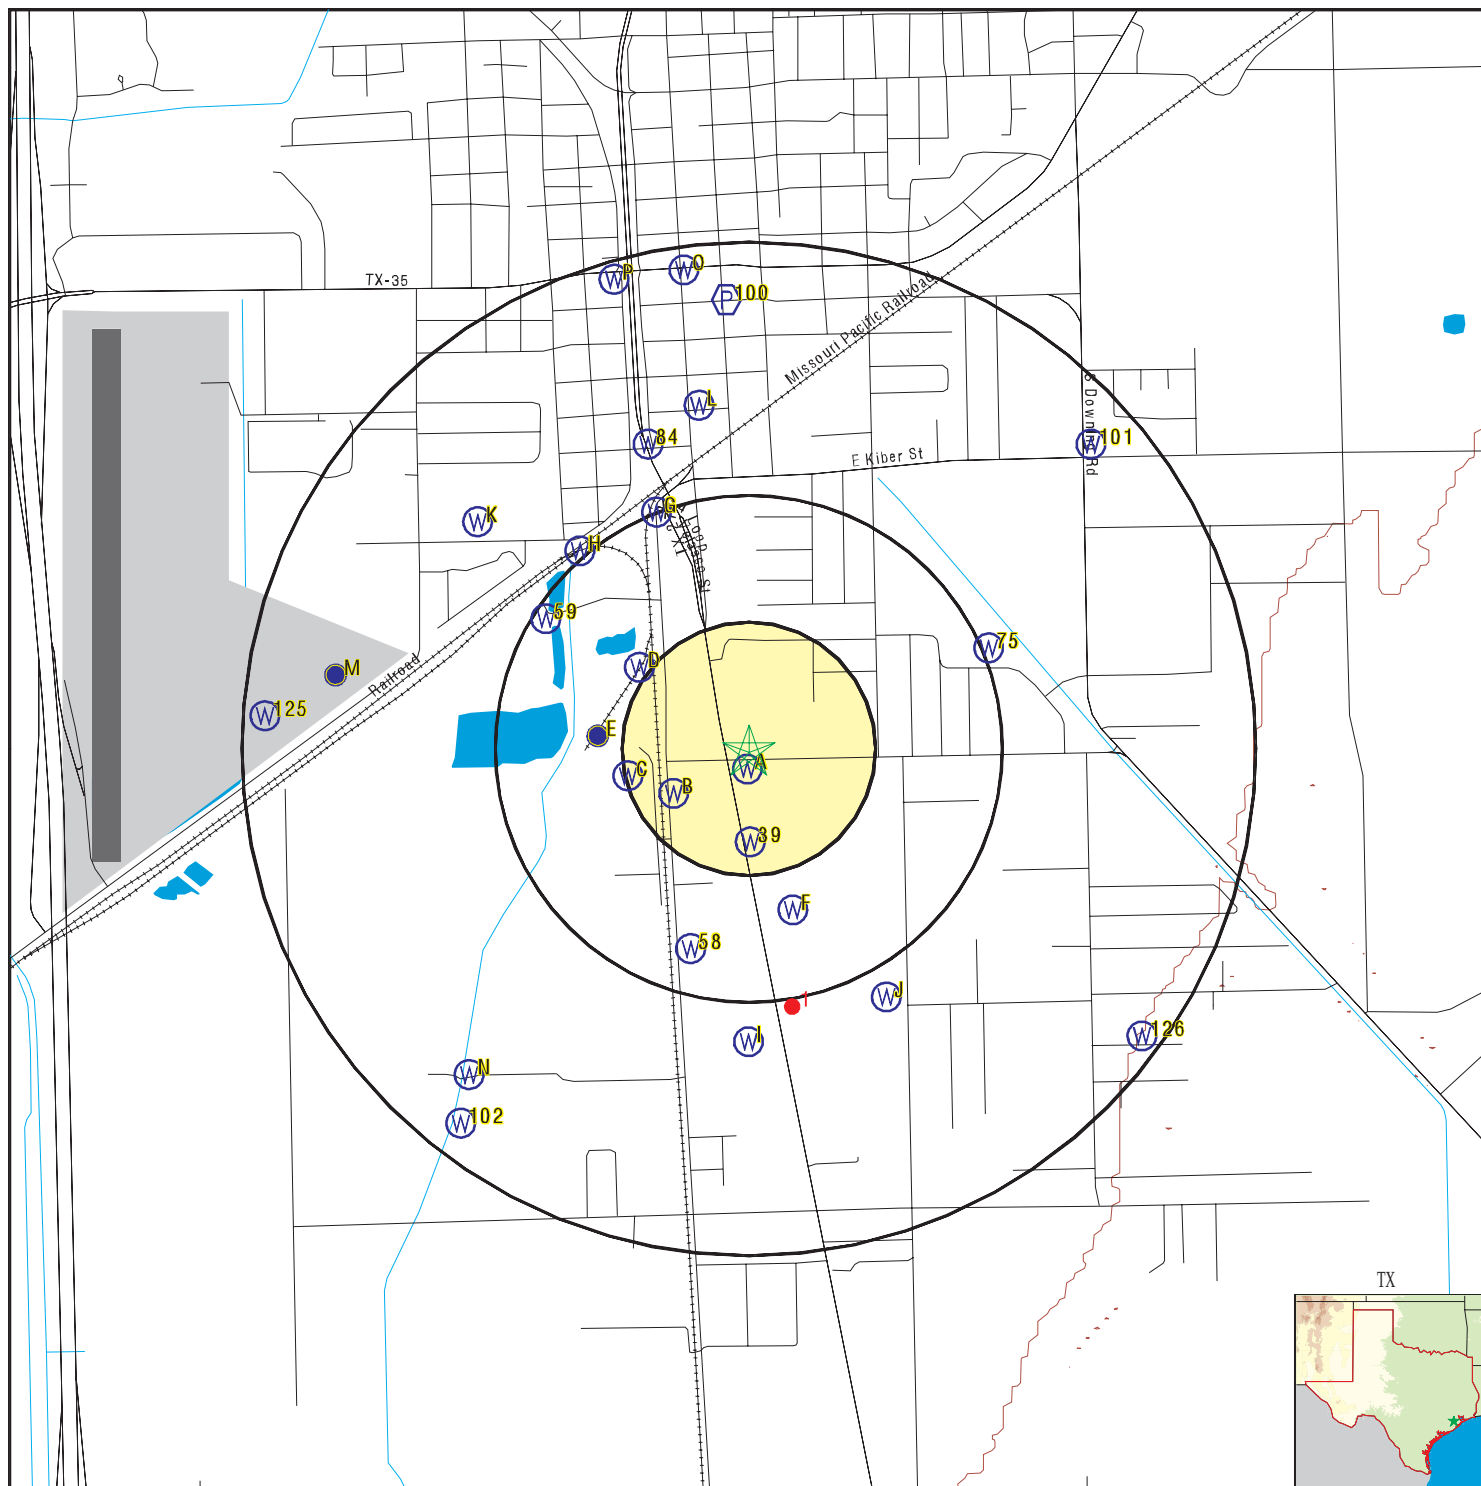

- County Boundary
- Major Roads
- Contour Lines
- Airports
- Earthquake epicenter, Richter 5 or greater
- Water Wells
- Public Water Supply Wells
- Cluster of Multiple Icons

- Groundwater Flow Direction
- Indeterminate Groundwater Flow at Location
- Groundwater Flow Varies at Location
- Closest Hydrogeological Data
- Oil or gas wells

SITE NAME: Safe Harbor Self Storage
 ADDRESS: 103 Cemetery Road
 ANGLETON TX 77515
 LAT/LONG: 29.150715 / 95.429486

CLIENT: Partner Engineering and Science, Inc.
 CONTACT: Larissa Lopez
 INQUIRY #: 6085945.2s
 DATE: June 08, 2020 6:12 pm

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

A1
South
0 - 1/8 Mile
Higher

TX WELLS TXDOL2000016744

Database:	Well Report Database	Fid:	16743
Rec id:	16796	Edr site i:	67821
Owner:	Akbar Momin	Ownerwell:	AMW-12
Address:	13514 Island Palm Court, Houston , TX 77059		
Grid:	65-53-8	Waddress:	1039 South Velasco, Angleton , TX 77515
Lat:	29 09 01 N	County:	Brazoria
Long:	095 25 46 W	Elevation:	No Data
Gpsused:	Magellan GPS Blazer 12	Typeofwork:	New Well
Propuse:	Monitor	Sdate:	Not Reported
Completedd:	Not Reported	Diameter:	8 in From Surface To 15 ft
Dmethod:	Hollow Stem Auger	Bcompleteio:	Not Reported
Packedfrom:	Not Reported	Packsizes:	Not Reported
Finterval:	From 15 ft to 1.5 ft with 13,sand (#sacks and material)		
Sinterval:	From 1.5 ft to 1 ft with 1, bentonite (#sacks and material)		
Tinterval:	From 1 ft to 0 ft with 1,concrete (#sacks and material)		
Usedmethod:	hand mix	Cementedby:	MEDI
Contaminat:	No Data	Propertyli:	No Data
Verrimetho:	No Data	Varriance:	No Data
Surface:	Surface Slab Installed	Staticleve:	No Data
Flow:	No Data	Packers:	bentonite chips 1.5 - 1
Cementinwe:	No Data	Typepump:	No Data
Pumpbowl:	Not Reported	Welltests:	No Data
Yield:	Not Reported	Watertype:	No Data
Stratadept:	No Data	Chemicalma:	No Data
Undesirabl:	No Data	Companynam:	Mathers Environmental Drilling Inc.
Companyadd:	12245 E. FM 529	Ccitystate:	Houston , TX 77041
Licensenum:	54933	Wsignature:	Shannon Mathers
Dsignature:	No Data	Regnum:	No Data
Comments:	no data	Site id:	TXDOL2000016744

A2
South
0 - 1/8 Mile
Higher

TX WELLS TXDOL2000016743

Database:	Well Report Database	Fid:	16742
Rec id:	16795	Edr site i:	67822
Owner:	Akbar Momin	Ownerwell:	AMW-13
Address:	13514 Island Palm Court, Houston , TX 77059		
Grid:	65-53-8	Waddress:	1039 South Velasco, Angleton , TX 77515
Lat:	29 09 01 N	County:	Brazoria
Long:	095 25 46 W	Elevation:	No Data
Gpsused:	Magellan GPS Blazer 12	Typeofwork:	New Well
Propuse:	Monitor	Sdate:	Not Reported
Completedd:	Not Reported	Diameter:	8 in From Surface To 15 ft
Dmethod:	Hollow Stem Auger	Bcompleteio:	Not Reported
Packedfrom:	Not Reported	Packsizes:	Not Reported
Finterval:	From 15 ft to 1.5 ft with 13,sand (#sacks and material)		
Sinterval:	From 1.5 ft to 1 ft with 1, bentonite (#sacks and material)		
Tinterval:	From 1 ft to 0 ft with 1,concrete (#sacks and material)		
Usedmethod:	hand mix	Cementedby:	MEDI
Contaminat:	No Data	Propertyli:	No Data
Verrimetho:	No Data	Varriance:	No Data

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Surface:	Surface Slab Installed	Staticleve:	No Data
Flow:	No Data	Packers:	bentonite chips 1.5 - 1
Cementinwe:	No Data	Typepump:	No Data
Pumpbowl:	Not Reported	Welltests:	No Data
Yield:	Not Reported	Watertype:	No Data
Stratadept:	No Data	Chemicalma:	No Data
Undesirabl:	No Data	Companynam:	Mathers Environmental Drilling Inc.
Companyadd:	12245 E. FM 529	Ccitystate:	Houston , TX 77041
Licensenum:	54933	Wsignature:	Shannon Mathers
Dsignature:	No Data	Regnum:	No Data
Comments:	no data	Site id:	TXDOL2000016743

A3 South 0 - 1/8 Mile Higher

TX WELLS TXDOL2000016748

Database:	Well Report Database	Fid:	16747
Rec id:	16798	Edr site i:	67818
Owner:	Akbar Momin	Ownerwell:	AMW-10
Address:	13514 Island Palm Court, Houston , TX 77059		
Grid:	65-53-8	Waddress:	1039 South Velasco, Angleton , TX 77515
Lat:	29 09 01 N	County:	Brazoria
Long:	095 25 46 W	Elevation:	No Data
Gpsused:	Magellan GPS Blazer 12	Typeofwork:	New Well
Propuse:	Monitor	Sdate:	Not Reported
Completedd:	Not Reported	Diameter:	8 in From Surface To 15 ft
Dmethod:	Hollow Stem Auger	Bcompletio:	Not Reported
Packedfrom:	Not Reported	Packsiz:	Not Reported
Finterval:	From 15 ft to 1.5 ft with 13,sand (#sacks and material)		
Sinterval:	From 1.5 ft to 1 ft with 1, bentonite (#sacks and material)		
Tinterval:	From 1 ft to 0 ft with 1,concrete (#sacks and material)		
Usedmethod:	hand mix	Cementedby:	MEDI
Contaminat:	No Data	Propertyli:	No Data
Verrimetho:	No Data	Varriance:	No Data
Surface:	Surface Slab Installed	Staticleve:	No Data
Flow:	No Data	Packers:	bentonite chips 1.5 - 1
Cementinwe:	No Data	Typepump:	No Data
Pumpbowl:	Not Reported	Welltests:	No Data
Yield:	Not Reported	Watertype:	No Data
Stratadept:	No Data	Chemicalma:	No Data
Undesirabl:	No Data	Companynam:	Mathers Environmental Drilling Inc.
Companyadd:	12245 E. FM 529	Ccitystate:	Houston , TX 77041
Licensenum:	54933	Wsignature:	Shannon Mathers
Dsignature:	No Data	Regnum:	No Data
Comments:	no data	Site id:	TXDOL2000016748

A4 South 0 - 1/8 Mile Higher

TX WELLS TXDOL2000016799

Database:	Well Report Database	Fid:	16798
Rec id:	16797	Edr site i:	67820
Owner:	Akbar Momin	Ownerwell:	AMW-11
Address:	13514 Island Palm Court, Houston , TX 77059		
Grid:	65-53-8	Waddress:	1039 South Velasco, Angleton , TX 77515
Lat:	29 09 01 N	County:	Brazoria

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Long:	095 25 46 W	Elevation:	No Data
Gpsused:	Magellan GPS Blazer 12	Typeofwork:	New Well
Propuse:	Monitor	Sdate:	Not Reported
Completedd:	Not Reported	Diameter:	8 in From Surface To 15 ft
Dmethod:	Hollow Stem Auger	Bcompleteio:	Not Reported
Packedfrom:	Not Reported	Packsizes:	Not Reported
Finterval:	From 15 ft to 1.5 ft with 13,sand (#sacks and material)		
Sinterval:	From 1.5 ft to 1 ft with 1, bentonite (#sacks and material)		
Tinterval:	From 1 ft to 0 ft with 1,concrete (#sacks and material)		
Usedmethod:	hand mix	Cementedby:	MEDI
Contaminat:	No Data	Propertyti:	No Data
Verrimetho:	No Data	Varriance:	No Data
Surface:	Surface Slab Installed	Staticleve:	No Data
Flow:	No Data	Packers:	bentonite chips 1.5 - 1
Cementinwe:	No Data	Typepump:	No Data
Pumpbowl:	Not Reported	Welltests:	No Data
Yield:	Not Reported	Watertype:	No Data
Stratadept:	No Data	Chemicalma:	No Data
Undesirabl:	No Data	Companynam:	Mathers Environmental Drilling Inc.
Companyadd:	12245 E. FM 529	Ccitystate:	Houston , TX 77041
Licensenum:	54933	Wsignature:	Shannon Mathers
Dsignature:	No Data	Regnum:	No Data
Comments:	no data	Site id:	TXDOL2000016799

A5 South 0 - 1/8 Mile Higher

TX WELLS TXDOL2000016749

Database:	Well Report Database	Fid:	16748
Rec id:	16799	Edr site i:	67815
Owner:	Akbar Momin	Ownerwell:	AMW-9
Address:	13514 Island Palm Court, Houston , TX 77059		
Grid:	65-53-8	Waddress:	1039 South Velasco, Angleton , TX 77515
Lat:	29 09 01 N	County:	Brazoria
Long:	095 25 46 W	Elevation:	No Data
Gpsused:	Magellan GPS Blazer 12	Typeofwork:	New Well
Propuse:	Monitor	Sdate:	Not Reported
Completedd:	Not Reported	Diameter:	8 in From Surface To 15 ft
Dmethod:	Hollow Stem Auger	Bcompleteio:	Not Reported
Packedfrom:	Not Reported	Packsizes:	Not Reported
Finterval:	From 15 ft to 1.5 ft with 13,sand (#sacks and material)		
Sinterval:	From 1.5 ft to 1 ft with 1, bentonite (#sacks and material)		
Tinterval:	From 1 ft to 0 ft with 1,concrete (#sacks and material)		
Usedmethod:	hand mix	Cementedby:	MEDI
Contaminat:	No Data	Propertyti:	No Data
Verrimetho:	No Data	Varriance:	No Data
Surface:	Surface Slab Installed	Staticleve:	No Data
Flow:	No Data	Packers:	bentonite chips 1.5 - 1
Cementinwe:	No Data	Typepump:	No Data
Pumpbowl:	Not Reported	Welltests:	No Data
Yield:	Not Reported	Watertype:	No Data
Stratadept:	No Data	Chemicalma:	No Data
Undesirabl:	No Data	Companynam:	Mathers Environmental Drilling Inc.
Companyadd:	12245 E. FM 529	Ccitystate:	Houston , TX 77041
Licensenum:	54933	Wsignature:	Shannon Mathers
Dsignature:	No Data	Regnum:	No Data
Comments:	no data	Site id:	TXDOL2000016749

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

A6
South
0 - 1/8 Mile
Higher

TX WELLS TXPLU5000062590

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	50322	Well Type:	Monitor
Borehole Depth (ft):	15	Well Report #:	67820
Details Reports For:	Plug Data	Submitted Date:	2008-10-09
Owner Name:	Akbar Momin	Well #:	AMW-11
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	Shannon Mathers
Original License #:	54933	Original Well Use:	Monitor
Original Drill Date:	2005-07-27		
Plug Method:	Tremmie pipe cement from bottom to top		
Plug Date:	2008-10-06	Variance #:	Not Reported
Company Name:	Mathers Environmental Drilling Inc.		
Plugging Name:	Shannon Mathers	Driller License:	4850
Apprentice Reg #:	Not Reported	Comments:	No Data
Comments:	Not Reported		
Details Reports For:	Plug Bore Hole	Diameter:	2
Top Depth:	Not Reported	Bottom Depth:	15
Details Reports For:	Plug Casing	Top Depth:	0
Bottom Depth:	15	Diameter:	2
Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	15	Plug Seal:	3
Amount:	Not Reported	Unit:	Not Reported

A7
South
0 - 1/8 Mile
Higher

TX WELLS TXMON5000066586

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	67822	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	15
Injurious Water Quality:	Not Reported	Plugging Rpt #:	50324
Submitted Date:	2005-09-28	Owner Name:	Akbar Momin
Well #:	AMW-13	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2005-07-27	Drill End Date:	2005-07-27
Seal Method:	Other - hand mix	Seal Method Desc:	hand mix
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	No

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Sealed by Name:	MEDI	Surface Completion:	Surface Slab Installed
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	Mathers Environmental Drilling Inc.
Driller Name:	Shannon Mathers	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	50324
Driller License #:	54933	Apprentice Reg #:	Not Reported
Details Reports For:	Well Bore Hole	Diameter:	8
Top Depth:	0	Bottom Depth:	15
Details Reports For:	Well Drilling Method	Drill Method:	Hollow Stem Auger
Details Reports For:	Well Completion	Borehole Completion:	Other - 20/40sand
Details Reports For:	Well Seal Range	Top Depth:	1
Bottom Depth:	1.5	Annular Seal:	1, bentonite
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	1	Annular Seal:	1, concrete
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	1.5
Bottom Depth:	15	Annular Seal:	13, sand
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Packers	Migrated Sort #:	1
Packers:	bentonite chips 1.5' - 1'	Depth:	Not Reported
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	.5
Lithology:	concrete		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	.5	Bottom Depth:	5
Lithology:	gray to dark gray clay		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	5	Bottom Depth:	11
Lithology:	dark orange and gray clay		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	11	Bottom Depth:	15
Lithology:	dark gray to brown silty sand		
Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 new sch. 40 pvc screen 15 - 2.5 0.010 slot		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 new sch. 40 pvc riser 2.5 - 0		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

A8 South 0 - 1/8 Mile Higher

TX WELLS TXPLU5000062592

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	50324	Well Type:	Monitor
Borehole Depth (ft):	15	Well Report #:	67822

Details Reports For:	Plug Data	Submitted Date:	2008-10-09
Owner Name:	Akbar Momin	Well #:	AMW-13
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	Shannon Mathers
Original License #:	54933	Original Well Use:	Monitor
Original Drill Date:	2005-07-27		
Plug Method:	Tremmie pipe cement from bottom to top		
Plug Date:	2008-10-06	Variance #:	Not Reported
Company Name:	Mathers Environmental Drilling Inc.		
Plugging Name:	Shannon Mathers	Driller License:	4850
Apprentice Reg #:	Not Reported	Comments:	No Data
Comments:	Not Reported		

Details Reports For:	Plug Bore Hole	Diameter:	2
Top Depth:	Not Reported	Bottom Depth:	15

Details Reports For:	Plug Casing	Top Depth:	0
Bottom Depth:	15	Diameter:	2

Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	15	Plug Seal:	3
Amount:	Not Reported	Unit:	Not Reported

A9 South 0 - 1/8 Mile Higher

TX WELLS TXPLU5000062591

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	50323	Well Type:	Monitor
Borehole Depth (ft):	15	Well Report #:	67821

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Plug Data	Submitted Date:	2008-10-09
Owner Name:	Akbar Momin	Well #:	AMW-12
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	Shannon Mathers
Original License #:	54933	Original Well Use:	Monitor
Original Drill Date:	2005-07-27		
Plug Method:	Tremmie pipe cement from bottom to top		
Plug Date:	2008-10-06	Variance #:	Not Reported
Company Name:	Mathers Environmental Drilling Inc.		
Plugging Name:	Shannon Mathers	Driller License:	4850
Apprentice Reg #:	Not Reported	Comments:	No Data
Comments:	Not Reported		

Details Reports For:	Plug Bore Hole	Diameter:	2
Top Depth:	Not Reported	Bottom Depth:	15

Details Reports For:	Plug Casing	Top Depth:	0
Bottom Depth:	15	Diameter:	2

Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	15	Plug Seal:	3
Amount:	Not Reported	Unit:	Not Reported

**A10
South
0 - 1/8 Mile
Higher**

TX WELLS TXMON5000066582

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	67818	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	15
Injurious Water Quality:	Not Reported	Plugging Rpt #:	50321

Submitted Date:	2005-09-28	Owner Name:	Akbar Momin
Well #:	AMW-10	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2005-07-27	Drill End Date:	2005-07-27
Seal Method:	Other - hand mix	Seal Method Desc:	hand mix
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	No
Sealed by Name:	MEDI	Surface Completion:	Surface Slab Installed
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	Mathers Environmental Drilling Inc.
Driller Name:	Shannon Mathers	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	50321
Driller License #:	54933	Apprentice Reg #:	Not Reported

Details Reports For:	Well Bore Hole	Diameter:	8
Top Depth:	0	Bottom Depth:	15

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Drilling Method	Drill Method:	Hollow Stem Auger
Details Reports For:	Well Completion	Borehole Completion:	Other - 20/40sand
Details Reports For: Bottom Depth: Amount:	Well Seal Range 1 Not Reported	Top Depth: Annular Seal: Unit:	0 1,concrete Not Reported
Details Reports For: Bottom Depth: Amount:	Well Seal Range 15 Not Reported	Top Depth: Annular Seal: Unit:	1.5 13,sand Not Reported
Details Reports For: Bottom Depth: Amount:	Well Seal Range 1.5 Not Reported	Top Depth: Annular Seal: Unit:	1 1, bentonite Not Reported
Details Reports For: Packers:	Well Packers bentonite chips 1.5' - 1'	Migrated Sort #: Depth:	1 Not Reported
Details Reports For: Top Depth: Lithology:	Well Lithology 0 concrete	Migrated Sort #: Bottom Depth:	0 .5
Details Reports For: Top Depth: Lithology:	Well Lithology .5 bluish gray and orange clay	Migrated Sort #: Bottom Depth:	0 7
Details Reports For: Top Depth: Lithology:	Well Lithology 7 tan silty sand	Migrated Sort #: Bottom Depth:	0 10
Details Reports For: Top Depth: Lithology:	Well Lithology 10 silty sand	Migrated Sort #: Bottom Depth:	0 15
Details Reports For: Top Depth: Migrated Casing Info: Diameter: Casing Material: Schedule:	Well Casing Not Reported 2 new sch. 40 pvc screen 15 - 2.5 0.010 slot Not Reported Not Reported Not Reported	Migrated Sort #: Bottom Depth: Casing Status: Casing Type: Gauge:	1 Not Reported Not Reported Not Reported Not Reported
Details Reports For: Top Depth: Migrated Casing Info: Diameter: Casing Material: Schedule:	Well Casing Not Reported 2 new sch. 40 pvc riser 2.5 - 0 Not Reported Not Reported Not Reported	Migrated Sort #: Bottom Depth: Casing Status: Casing Type: Gauge:	2 Not Reported Not Reported Not Reported Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

A11
South
0 - 1/8 Mile
Higher

TX WELLS TXMON5000066579

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	67815	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	15
Injurious Water Quality:	Not Reported	Plugging Rpt #:	50320
Submitted Date:	2005-09-28	Owner Name:	Akbar Momin
Well #:	AMW-9	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2005-07-27	Drill End Date:	2005-07-27
Seal Method:	Other - hand mix	Seal Method Desc:	hand mix
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	No
Sealed by Name:	MEDI	Surface Completion:	Surface Slab Installed
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	Mathers Environmental Drilling Inc.
Driller Name:	Shannon Mathers	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	50320
Driller License #:	54933	Apprentice Reg #:	Not Reported
Details Reports For:	Well Bore Hole	Diameter:	8
Top Depth:	0	Bottom Depth:	15
Details Reports For:	Well Drilling Method	Drill Method:	Hollow Stem Auger
Details Reports For:	Well Completion	Borehole Completion:	Other - 20/40sand
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	1	Annular Seal:	1,concrete
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	1
Bottom Depth:	1.5	Annular Seal:	1, bentonite
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	1.5
Bottom Depth:	15	Annular Seal:	13,sand
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Packers	Migrated Sort #:	1
Packers:	bentonite chips 1.5' - 1'	Depth:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	.5
Lithology:	concrete		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	.5	Bottom Depth:	6
Lithology:	orange and gray silty clay		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	6	Bottom Depth:	10
Lithology:	light orange silty sand		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	10	Bottom Depth:	15
Lithology:	gray silty sand		
Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 new sch. 40 pvc screen 15 - 2.5 0.010 slot		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported
Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 new sch. 40 pvc riser 2.5 - 0		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

A12
South
0 - 1/8 Mile
Higher

TX WELLS TXMON5000066585

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	67821	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	15
Injurious Water Quality:	Not Reported	Plugging Rpt #:	50323
Submitted Date:	2005-09-28	Owner Name:	Akbar Momin
Well #:	AMW-12	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2005-07-27	Drill End Date:	2005-07-27
Seal Method:	Other - hand mix	Seal Method Desc:	hand mix
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	No
Sealed by Name:	MEDI	Surface Completion:	Surface Slab Installed
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Pump Depth: Injurious Water: Driller Name: Plugged within 48 hrs: Driller License #:	Not Reported Not Reported Shannon Mathers No 54933	Chemical Analysis: Company Name: Comments: Plugging Rpt Tracking #: Apprentice Reg #:	Not Reported Mathers Environmental Drilling Inc. Not Reported 50323 Not Reported
Details Reports For: Top Depth:	Well Bore Hole 0	Diameter: Bottom Depth:	8 15
Details Reports For:	Well Drilling Method	Drill Method:	Hollow Stem Auger
Details Reports For:	Well Completion	Borehole Completion:	Other - 20/40sand
Details Reports For: Bottom Depth: Amount:	Well Seal Range 15 Not Reported	Top Depth: Annular Seal: Unit:	1.5 13,sand Not Reported
Details Reports For: Bottom Depth: Amount:	Well Seal Range 1 Not Reported	Top Depth: Annular Seal: Unit:	0 1,concrete Not Reported
Details Reports For: Bottom Depth: Amount:	Well Seal Range 1.5 Not Reported	Top Depth: Annular Seal: Unit:	1 1, bentonite Not Reported
Details Reports For: Packers:	Well Packers bentonite chips 1.5' - 1'	Migrated Sort #: Depth:	1 Not Reported
Details Reports For: Top Depth: Lithology:	Well Lithology 0 concrete	Migrated Sort #: Bottom Depth:	0 .5
Details Reports For: Top Depth: Lithology:	Well Lithology .5 fill soil	Migrated Sort #: Bottom Depth:	0 5.5
Details Reports For: Top Depth: Lithology:	Well Lithology 5.5 brown silty sand	Migrated Sort #: Bottom Depth:	0 10
Details Reports For: Top Depth: Lithology:	Well Lithology 10 dark gray silty sand	Migrated Sort #: Bottom Depth:	0 15
Details Reports For: Top Depth: Migrated Casing Info: Diameter: Casing Material: Schedule:	Well Casing Not Reported 2 new sch. 40 pvc screen 15 - 2.5 0.010 slot Not Reported Not Reported Not Reported	Migrated Sort #: Bottom Depth: Casing Status: Casing Type: Gauge:	1 Not Reported Not Reported Not Reported Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 new sch. 40 pvc riser 2.5 - 0		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

**A13
South
0 - 1/8 Mile
Higher**

TX WELLS TXMON5000066584

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	67820	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	15
Injurious Water Quality:	Not Reported	Plugging Rpt #:	50322
Submitted Date:	2005-09-28	Owner Name:	Akbar Momin
Well #:	AMW-11	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2005-07-27	Drill End Date:	2005-07-27
Seal Method:	Other - hand mix	Seal Method Desc:	hand mix
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	No
Sealed by Name:	MEDI	Surface Completion:	Surface Slab Installed
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	Mathers Environmental Drilling Inc.
Driller Name:	Shannon Mathers	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	50322
Driller License #:	54933	Apprentice Reg #:	Not Reported
Details Reports For:	Well Bore Hole	Diameter:	8
Top Depth:	0	Bottom Depth:	15
Details Reports For:	Well Drilling Method	Drill Method:	Hollow Stem Auger
Details Reports For:	Well Completion	Borehole Completion:	Other - 20/40sand
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	1	Annular Seal:	1,concrete
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	1
Bottom Depth:	1.5	Annular Seal:	1, bentonite
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	1.5

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Bottom Depth:	15	Annular Seal:	13,sand
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Packers	Migrated Sort #:	1
Packers:	bentonite chips 1.5' - 1'	Depth:	Not Reported
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	.5
Lithology:	concrete		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	.5	Bottom Depth:	3
Lithology:	bluish gray and orange clay		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	3	Bottom Depth:	5
Lithology:	orange brown clay		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	5	Bottom Depth:	10
Lithology:	light brown silty sand		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	10	Bottom Depth:	15
Lithology:	brown silty sand		
Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 new sch. 40 pvc screen 15 - 2.5 0.010 slot	Casing Status:	Not Reported
Diameter:	Not Reported	Casing Type:	Not Reported
Casing Material:	Not Reported	Gauge:	Not Reported
Schedule:	Not Reported		
Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 new sch. 40 pvc riser 2.5 - 0	Casing Status:	Not Reported
Diameter:	Not Reported	Casing Type:	Not Reported
Casing Material:	Not Reported	Gauge:	Not Reported
Schedule:	Not Reported		

A14
South
0 - 1/8 Mile
Higher

TX WELLS TXPLU5000062604

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	50326	Well Type:	Monitor
Borehole Depth (ft):	15	Well Report #:	Not Reported
Details Reports For:	Plug Data	Submitted Date:	2008-10-09
Owner Name:	Akbar Momin	Well #:	BR-3W

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	Allen Hawkins
Original License #:	4929	Original Well Use:	Monitor
Original Drill Date:	1998-12-08		
Plug Method:	Tremmie pipe cement from bottom to top		
Plug Date:	2008-10-06	Variance #:	Not Reported
Company Name:	Mathers Environmental Drilling Inc.		
Plugging Name:	Shannon Mathers	Driller License:	4850
Apprentice Reg #:	Not Reported	Comments:	No Data
Comments:	Not Reported		

Details Reports For:	Plug Bore Hole	Diameter:	2
Top Depth:	Not Reported	Bottom Depth:	15

Details Reports For:	Plug Casing	Top Depth:	0
Bottom Depth:	15	Diameter:	2

Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	15	Plug Seal:	3
Amount:	Not Reported	Unit:	Not Reported

A15
South
0 - 1/8 Mile
Higher

TX WELLS TXPLU5000062603

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	50325	Well Type:	Monitor
Borehole Depth (ft):	15	Well Report #:	Not Reported

Details Reports For:	Plug Data	Submitted Date:	2008-10-09
Owner Name:	Akbar Momin	Well #:	AMW-8
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	Allen Hawkins
Original License #:	4929	Original Well Use:	Monitor
Original Drill Date:	1999-10-15		
Plug Method:	Tremmie pipe cement from bottom to top		
Plug Date:	2008-10-06	Variance #:	Not Reported
Company Name:	Mathers Environmental Drilling Inc.		
Plugging Name:	Shannon Mathers	Driller License:	4850
Apprentice Reg #:	Not Reported	Comments:	No Data
Comments:	Not Reported		

Details Reports For:	Plug Bore Hole	Diameter:	2
Top Depth:	Not Reported	Bottom Depth:	15

Details Reports For:	Plug Casing	Top Depth:	0
Bottom Depth:	15	Diameter:	2

Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	15	Plug Seal:	3
Amount:	Not Reported	Unit:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

A16
South
0 - 1/8 Mile
Higher

TX WELLS TXPLU5000062610

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	50331	Well Type:	Monitor
Borehole Depth (ft):	15	Well Report #:	Not Reported

Details Reports For:	Plug Data	Submitted Date:	2008-10-09
Owner Name:	Akbar Momin	Well #:	AMW-5
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	Not Reported
Original License #:	Not Reported	Original Well Use:	Monitor
Original Drill Date:	Not Reported		
Plug Method:	Tremmie pipe cement from bottom to top		
Plug Date:	2008-10-06	Variance #:	Not Reported
Company Name:	Mathers Environmental Drilling Inc.		
Plugging Name:	Shannon Mathers	Driller License:	4850
Apprentice Reg #:	Not Reported	Comments:	No Data
Comments:	Not Reported		

Details Reports For:	Plug Bore Hole	Diameter:	4
Top Depth:	Not Reported	Bottom Depth:	15

Details Reports For:	Plug Casing	Top Depth:	0
Bottom Depth:	15	Diameter:	4

Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	15	Plug Seal:	4.5
Amount:	Not Reported	Unit:	Not Reported

A17
South
0 - 1/8 Mile
Higher

TX WELLS TXPLU5000062605

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	50327	Well Type:	Monitor
Borehole Depth (ft):	15	Well Report #:	Not Reported

Details Reports For:	Plug Data	Submitted Date:	2008-10-09
Owner Name:	Akbar Momin	Well #:	BR-2W
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	Allen Hawkins
Original License #:	4929	Original Well Use:	Monitor
Original Drill Date:	1998-12-08		
Plug Method:	Tremmie pipe cement from bottom to top		
Plug Date:	2008-10-06	Variance #:	Not Reported
Company Name:	Mathers Environmental Drilling Inc.		
Plugging Name:	Shannon Mathers	Driller License:	4850
Apprentice Reg #:	Not Reported	Comments:	No Data
Comments:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Plug Bore Hole	Diameter:	2
Top Depth:	Not Reported	Bottom Depth:	15
Details Reports For:	Plug Casing	Top Depth:	0
Bottom Depth:	15	Diameter:	2
Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	15	Plug Seal:	3
Amount:	Not Reported	Unit:	Not Reported

A18 South 0 - 1/8 Mile Higher

TX WELLS TXPLU5000062594

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	50329	Well Type:	Monitor
Borehole Depth (ft):	15	Well Report #:	Not Reported

Details Reports For:	Plug Data	Submitted Date:	2008-10-09
Owner Name:	Akbar Momin	Well #:	AMW-4
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	Not Reported
Original License #:	Not Reported	Original Well Use:	Monitor
Original Drill Date:	Not Reported		
Plug Method:	Tremmie pipe cement from bottom to top		
Plug Date:	2008-10-06	Variance #:	Not Reported
Company Name:	Mathers Environmental Drilling Inc.		
Plugging Name:	Shannon Mathers	Driller License:	4850
Apprentice Reg #:	Not Reported	Comments:	No Data
Comments:	Not Reported		

Details Reports For:	Plug Bore Hole	Diameter:	4
Top Depth:	Not Reported	Bottom Depth:	15

Details Reports For:	Plug Casing	Top Depth:	0
Bottom Depth:	15	Diameter:	4

Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	15	Plug Seal:	4.5
Amount:	Not Reported	Unit:	Not Reported

A19 South 0 - 1/8 Mile Higher

TX WELLS TXPLU5000062593

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	50328	Well Type:	Monitor
Borehole Depth (ft):	15	Well Report #:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Plug Data	Submitted Date:	2008-10-09
Owner Name:	Akbar Momin	Well #:	BR-6W
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	Allen Hawkins
Original License #:	4929	Original Well Use:	Monitor
Original Drill Date:	1998-12-08		
Plug Method:	Tremmie pipe cement from bottom to top		
Plug Date:	2008-10-06	Variance #:	Not Reported
Company Name:	Mathers Environmental Drilling Inc.		
Plugging Name:	Shannon Mathers	Driller License:	4850
Apprentice Reg #:	Not Reported	Comments:	No Data
Comments:	Not Reported		

Details Reports For:	Plug Bore Hole	Diameter:	2
Top Depth:	Not Reported	Bottom Depth:	15

Details Reports For:	Plug Casing	Top Depth:	0
Bottom Depth:	15	Diameter:	2

Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	15	Plug Seal:	3
Amount:	Not Reported	Unit:	Not Reported

A20
South
0 - 1/8 Mile
Higher

TX WELLS TXPLU5000062597

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	50321	Well Type:	Monitor
Borehole Depth (ft):	15	Well Report #:	67818

Details Reports For:	Plug Data	Submitted Date:	2008-10-09
Owner Name:	Akbar Momin	Well #:	AMW-10
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	Shannon Mathers
Original License #:	54933	Original Well Use:	Monitor
Original Drill Date:	2005-07-27		
Plug Method:	Tremmie pipe cement from bottom to top		
Plug Date:	2008-10-06	Variance #:	Not Reported
Company Name:	Mathers Environmental Drilling Inc.		
Plugging Name:	Shannon Mathers	Driller License:	4850
Apprentice Reg #:	Not Reported	Comments:	No Data
Comments:	Not Reported		

Details Reports For:	Plug Bore Hole	Diameter:	2
Top Depth:	Not Reported	Bottom Depth:	15

Details Reports For:	Plug Casing	Top Depth:	0
Bottom Depth:	15	Diameter:	2

Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	15	Plug Seal:	3

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Amount: Not Reported Unit: Not Reported

A21
South
0 - 1/8 Mile
Higher

TX WELLS TXPLU5000062596

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	50320	Well Type:	Monitor
Borehole Depth (ft):	15	Well Report #:	67815
Details Reports For:	Plug Data	Submitted Date:	2008-10-09
Owner Name:	Akbar Momin	Well #:	AMW-9
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	Shannon Mathers
Original License #:	54933	Original Well Use:	Monitor
Original Drill Date:	2005-07-27		
Plug Method:	Tremmie pipe cement from bottom to top		
Plug Date:	2008-10-06	Variance #:	Not Reported
Company Name:	Mathers Environmental Drilling Inc.		
Plugging Name:	Shannon Mathers	Driller License:	4850
Apprentice Reg #:	Not Reported	Comments:	No Data
Comments:	Not Reported		
Details Reports For:	Plug Bore Hole	Diameter:	2
Top Depth:	Not Reported	Bottom Depth:	15
Details Reports For:	Plug Casing	Top Depth:	0
Bottom Depth:	15	Diameter:	2
Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	15	Plug Seal:	3
Amount:	Not Reported	Unit:	Not Reported

A22
South
0 - 1/8 Mile
Higher

TX WELLS TXDOL2000017578

Database:	Well Report Database	Fid:	17577
Rec id:	17572	Edr site i:	33249
Owner:	Phillip Beutel	Ownerwell:	1-47
Address:	3 Chase Ln, Colorado Spgs ,CO80906	Grid:	65-53-8
Waddress:	1101 S. Velasco (Hwy 288B), Angleton , TX		77515
Lat:	29 09 00 N	County:	Brazoria
Long:	095 25 46 W	Elevation:	No Data
Gpsused:	No Data	Typeofwork:	New Well
Propuse:	Injection	Sdate:	Not Reported
Completedd:	Not Reported	Diameter:	1.5 in From Surface To 20 ft
Dmethod:	Driven	Bcompletio:	Open Hole
Packedfrom:	Not Reported	Packsizes:	Not Reported
Finterval:	From 0 ft to 20 ft with .6 (#sacks and material)		
Sinterval:	No Data	Tinterval:	No Data
Usedmethod:	Bentonite	Cementedby:	ESN

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Contaminat:	No Data	Propertyli:	No Data
Verrimetho:	No Data	Varriance:	No Data
Surface:	No Data	Staticleve:	No Data
Flow:	No Data	Packers:	No Data
Cementinwe:	No Data	Typepump:	No Data
Pumpbowl:	Not Reported	Welltests:	No Data
Yield:	Not Reported	Watertype:	No Data
Stratadept:	No Data	Chemicalma:	No
Undesirabl:	No	Companynam:	ESN
Companyadd:	14493 S. Padre Island Dr.	Cccitystate:	Corpus Christi , TX 78418
Licensenum:	4928	Wsignature:	John Braden
Dsignature:	No Data	Regnum:	No Data
Comments:	47 injection locations	Site id:	TXDOL2000017578

A23
South
0 - 1/8 Mile
Higher

TX WELLS TXPLU5000055944

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	40466	Well Type:	Monitor
Borehole Depth (ft):	13.76	Well Report #:	Not Reported

Details Reports For:	Plug Data	Submitted Date:	2007-08-15
Owner Name:	Phil Beutel	Well #:	MW-1
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	Not Reported
Original License #:	Not Reported	Original Well Use:	Monitor
Original Drill Date:	Not Reported		
Plug Method:	Tremmie pipe cement from bottom to top		
Plug Date:	2007-08-02	Variance #:	Not Reported
Company Name:	Advanced Drilling Systems, Inc.		
Plugging Name:	Mario Moya	Driller License:	4990
Apprentice Reg #:	Not Reported	Comments:	No Data
Comments:	Not Reported		

Details Reports For:	Plug Bore Hole	Diameter:	4
Top Depth:	Not Reported	Bottom Depth:	14

Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	14	Plug Seal:	2 Portland Cement
Amount:	Not Reported	Unit:	Not Reported

A24
South
0 - 1/8 Mile
Higher

TX WELLS TXPLU5000055942

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	40469	Well Type:	Monitor
Borehole Depth (ft):	18.03	Well Report #:	Not Reported

Details Reports For:	Plug Data	Submitted Date:	2007-08-15
Owner Name:	Phil Beutel	Well #:	MW-4

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	Not Reported
Original License #:	Not Reported	Original Well Use:	Monitor
Original Drill Date:	Not Reported		
Plug Method:	Tremmie pipe cement from bottom to top		
Plug Date:	2007-08-02	Variance #:	Not Reported
Company Name:	Advanced Drilling Systems, Inc.		
Plugging Name:	Mario Moya	Driller License:	4990
Apprentice Reg #:	Not Reported	Comments:	No Data
Comments:	Not Reported		

Details Reports For:	Plug Bore Hole	Diameter:	4
Top Depth:	Not Reported	Bottom Depth:	18

Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	18	Plug Seal:	2 Portland Cement
Amount:	Not Reported	Unit:	Not Reported

A25
South
0 - 1/8 Mile
Higher

TX WELLS TXMON5000032274

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	33249	Well Type:	New Well
Proposed Use:	Injection	Borehole Depth (ft):	20
Injurious Water Quality:	no	Plugging Rpt #:	108885

Submitted Date:	2004-03-01	Owner Name:	Phillip Beutel
Well #:	1-47	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Injection	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2004-02-03	Drill End Date:	2004-02-06
Seal Method:	Other - Bentonite	Seal Method Desc:	Bentonite
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	Yes
Sealed by Name:	Not Reported	Surface Completion:	Unknown
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	No
Injurious Water:	No	Company Name:	ESN
Driller Name:	John W Braden	Comments:	47 injection locations
Plugged within 48 hrs:	Yes	Plugging Rpt Tracking #:	108885
Driller License #:	4928	Apprentice Reg #:	Not Reported

Details Reports For:	Well Bore Hole	Diameter:	1.5
Top Depth:	0	Bottom Depth:	20

Details Reports For:	Well Drilling Method	Drill Method:	Driven

Details Reports For:	Well Completion	Borehole Completion:	Open Hole

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	20	Annular Seal:	.6
Amount:	Not Reported	Unit:	Not Reported

A26 South 0 - 1/8 Mile Higher

TX WELLS TXPLU5000106964

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	108885	Well Type:	Injection
Borehole Depth (ft):	20	Well Report #:	33249
Details Reports For:	Plug Data	Submitted Date:	2004-03-01
Owner Name:	Phillip Beutel	Well #:	1-47
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	ESN	Original Driller:	John W Braden
Original License #:	4928	Original Well Use:	Injection
Original Drill Date:	2004-02-06	Plug Method:	Unknown
Plug Date:	2004-02-06	Variance #:	Not Reported
Company Name:	ESN	Plugging Name:	John Braden
Driller License:	4928	Apprentice Reg #:	Not Reported
Comments:	47 injection locations	Comments:	Not Reported
Details Reports For:	Plug Bore Hole	Diameter:	1.5
Top Depth:	0	Bottom Depth:	20
Details Reports For:	Plug Range	Top Depth:	Not Reported
Bottom Depth:	Not Reported	Plug Seal:	Not Provided
Amount:	Not Reported	Unit:	Not Reported

A27 South 0 - 1/8 Mile Higher

TX WELLS TXPLU5000055957

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	40470	Well Type:	Monitor
Borehole Depth (ft):	17.16	Well Report #:	Not Reported
Details Reports For:	Plug Data	Submitted Date:	2007-08-15
Owner Name:	Phil Beutel	Well #:	MW-5
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	Not Reported
Original License #:	Not Reported	Original Well Use:	Monitor
Original Drill Date:	Not Reported		
Plug Method:	Tremmie pipe cement from bottom to top		
Plug Date:	2007-08-02	Variance #:	Not Reported
Company Name:	Advanced Drilling Systems, Inc.		
Plugging Name:	Mario Moya	Driller License:	4990
Apprentice Reg #:	Not Reported	Comments:	No Data
Comments:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Plug Bore Hole	Diameter:	4
Top Depth:	Not Reported	Bottom Depth:	17
Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	17	Plug Seal:	2, Portland Cement
Amount:	Not Reported	Unit:	Not Reported

A28
South
0 - 1/8 Mile
Higher

TX WELLS TXPLU5000055945

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	40472	Well Type:	Monitor
Borehole Depth (ft):	17.1	Well Report #:	Not Reported

Details Reports For:	Plug Data	Submitted Date:	2007-08-15
Owner Name:	Phil Beutel	Well #:	MW-7
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	Not Reported
Original License #:	Not Reported	Original Well Use:	Monitor
Original Drill Date:	Not Reported		
Plug Method:	Tremmie pipe cement from bottom to top		
Plug Date:	2007-08-02	Variance #:	Not Reported
Company Name:	Advanced Drilling Systems, Inc.		
Plugging Name:	Mario Moya	Driller License:	4990
Apprentice Reg #:	Not Reported	Comments:	No Data
Comments:	Not Reported		

Details Reports For:	Plug Bore Hole	Diameter:	4
Top Depth:	Not Reported	Bottom Depth:	17
Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	17	Plug Seal:	2, Portland Cement
Amount:	Not Reported	Unit:	Not Reported

A29
SSW
0 - 1/8 Mile
Higher

TX WELLS TXPLU5000055940

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	40467	Well Type:	Monitor
Borehole Depth (ft):	15.35	Well Report #:	Not Reported

Details Reports For:	Plug Data	Submitted Date:	2007-08-15
Owner Name:	Phil Beutel	Well #:	MW-2
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	Not Reported
Original License #:	Not Reported	Original Well Use:	Monitor
Original Drill Date:	Not Reported		
Plug Method:	Tremmie pipe cement from bottom to top		
Plug Date:	2007-08-02	Variance #:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Company Name:	Advanced Drilling Systems, Inc.	Driller License:	4990
Plugging Name:	Mario Moya	Comments:	No Data
Apprentice Reg #:	Not Reported		
Comments:	Not Reported		
Details Reports For:	Plug Bore Hole	Diameter:	4
Top Depth:	Not Reported	Bottom Depth:	15
Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	15	Plug Seal:	2 Portland Cement
Amount:	Not Reported	Unit:	Not Reported

A30
SSW
0 - 1/8 Mile
Higher

TX WELLS TXPLU5000055948

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	40478	Well Type:	Monitor
Borehole Depth (ft):	24.29	Well Report #:	Not Reported

Details Reports For:	Plug Data	Submitted Date:	2007-08-15
Owner Name:	Phil Beutel	Well #:	PZ-3
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	Not Reported
Original License #:	Not Reported	Original Well Use:	Monitor
Original Drill Date:	Not Reported		
Plug Method:	Tremmie pipe cement from bottom to top		
Plug Date:	2007-08-02	Variance #:	Not Reported
Company Name:	Advanced Drilling Systems, Inc.		
Plugging Name:	Mario Moya	Driller License:	4990
Apprentice Reg #:	Not Reported	Comments:	No Data
Comments:	Not Reported		

Details Reports For:	Plug Bore Hole	Diameter:	4
Top Depth:	Not Reported	Bottom Depth:	24
Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	24	Plug Seal:	3, Portland Cement
Amount:	Not Reported	Unit:	Not Reported

A31
SSW
0 - 1/8 Mile
Higher

TX WELLS TXPLU5000055958

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	40471	Well Type:	Monitor
Borehole Depth (ft):	16.15	Well Report #:	Not Reported

Details Reports For:	Plug Data	Submitted Date:	2007-08-15
Owner Name:	Phil Beutel	Well #:	MW-6

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	Not Reported
Original License #:	Not Reported	Original Well Use:	Monitor
Original Drill Date:	Not Reported		
Plug Method:	Tremmie pipe cement from bottom to top		
Plug Date:	2007-08-02	Variance #:	Not Reported
Company Name:	Advanced Drilling Systems, Inc.		
Plugging Name:	Mario Moya	Driller License:	4990
Apprentice Reg #:	Not Reported	Comments:	No Data
Comments:	Not Reported		

Details Reports For:	Plug Bore Hole	Diameter:	4
Top Depth:	Not Reported	Bottom Depth:	16

Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	16	Plug Seal:	2, Portland Cement
Amount:	Not Reported	Unit:	Not Reported

**A32
SW
0 - 1/8 Mile
Higher**

TX WELLS TXPLU5000055959

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	40473	Well Type:	Monitor
Borehole Depth (ft):	18.74	Well Report #:	Not Reported

Details Reports For:	Plug Data	Submitted Date:	2007-08-15
Owner Name:	Phil Beutel	Well #:	MW-8
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	Not Reported
Original License #:	Not Reported	Original Well Use:	Monitor
Original Drill Date:	Not Reported		
Plug Method:	Tremmie pipe cement from bottom to top		
Plug Date:	2007-08-02	Variance #:	Not Reported
Company Name:	Advanced Drilling Systems, Inc.		
Plugging Name:	Mario Moya	Driller License:	4990
Apprentice Reg #:	Not Reported	Comments:	No Data
Comments:	Not Reported		

Details Reports For:	Plug Bore Hole	Diameter:	4
Top Depth:	Not Reported	Bottom Depth:	19

Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	19	Plug Seal:	2, Portland Cement
Amount:	Not Reported	Unit:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

A33
SW
0 - 1/8 Mile
Higher

TX WELLS TXPLU5000055960

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	40474	Well Type:	Monitor
Borehole Depth (ft):	17.73	Well Report #:	Not Reported

Details Reports For:	Plug Data	Submitted Date:	2007-08-15
Owner Name:	Phil Beutel	Well #:	MW-9
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	Not Reported
Original License #:	Not Reported	Original Well Use:	Monitor
Original Drill Date:	Not Reported		
Plug Method:	Tremmie pipe cement from bottom to top		
Plug Date:	2007-08-02	Variance #:	Not Reported
Company Name:	Advanced Drilling Systems, Inc.		
Plugging Name:	Mario Moya	Driller License:	4990
Apprentice Reg #:	Not Reported	Comments:	No Data
Comments:	Not Reported		

Details Reports For:	Plug Bore Hole	Diameter:	4
Top Depth:	Not Reported	Bottom Depth:	18

Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	18	Plug Seal:	2, Portland Cement
Amount:	Not Reported	Unit:	Not Reported

A34
South
0 - 1/8 Mile
Higher

TX WELLS TXPLU5000055946

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	40476	Well Type:	Monitor
Borehole Depth (ft):	24.67	Well Report #:	Not Reported

Details Reports For:	Plug Data	Submitted Date:	2007-08-15
Owner Name:	Phil Beutel	Well #:	PZ-1
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	Not Reported
Original License #:	Not Reported	Original Well Use:	Monitor
Original Drill Date:	Not Reported		
Plug Method:	Tremmie pipe cement from bottom to top		
Plug Date:	2007-08-02	Variance #:	Not Reported
Company Name:	Advanced Drilling Systems, Inc.		
Plugging Name:	Mario Moya	Driller License:	4990
Apprentice Reg #:	Not Reported	Comments:	No Data
Comments:	Not Reported		

Details Reports For:	Plug Bore Hole	Diameter:	4
Top Depth:	Not Reported	Bottom Depth:	25

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	25	Plug Seal:	3, Portland Cement
Amount:	Not Reported	Unit:	Not Reported

A35 South 0 - 1/8 Mile Higher

TX WELLS TXPLU5000055947

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	40477	Well Type:	Monitor
Borehole Depth (ft):	24.13	Well Report #:	Not Reported

Details Reports For:	Plug Data	Submitted Date:	2007-08-15
Owner Name:	Phil Beutel	Well #:	PZ-2
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	Not Reported
Original License #:	Not Reported	Original Well Use:	Monitor
Original Drill Date:	Not Reported		
Plug Method:	Tremmie pipe cement from bottom to top		
Plug Date:	2007-08-02	Variance #:	Not Reported
Company Name:	Advanced Drilling Systems, Inc.		
Plugging Name:	Mario Moya	Driller License:	4990
Apprentice Reg #:	Not Reported	Comments:	No Data
Comments:	Not Reported		

Details Reports For:	Plug Bore Hole	Diameter:	4
Top Depth:	Not Reported	Bottom Depth:	24

Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	24	Plug Seal:	3, Portland Cement
Amount:	Not Reported	Unit:	Not Reported

A36 South 0 - 1/8 Mile Higher

TX WELLS TXPLU5000055961

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	40475	Well Type:	Monitor
Borehole Depth (ft):	18.65	Well Report #:	Not Reported

Details Reports For:	Plug Data	Submitted Date:	2007-08-15
Owner Name:	Phil Beutel	Well #:	MW-10
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	Not Reported
Original License #:	Not Reported	Original Well Use:	Monitor
Original Drill Date:	Not Reported		
Plug Method:	Tremmie pipe cement from bottom to top		
Plug Date:	2007-08-02	Variance #:	Not Reported
Company Name:	Advanced Drilling Systems, Inc.		
Plugging Name:	Mario Moya	Driller License:	4990
Apprentice Reg #:	Not Reported	Comments:	No Data
Comments:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Plug Bore Hole	Diameter:	4
Top Depth:	Not Reported	Bottom Depth:	19
Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	19	Plug Seal:	2, Portland Cement
Amount:	Not Reported	Unit:	Not Reported

B37
SW
1/8 - 1/4 Mile
Higher

TX WELLS TXMON5000028065

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	29002	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	18
Injurious Water Quality:	no	Plugging Rpt #:	Not Reported
Submitted Date:	2003-12-03	Owner Name:	Fred Beutel
Well #:	MW-10	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2003-10-09	Drill End Date:	2003-10-09
Seal Method:	Other - grout	Seal Method Desc:	grout
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	Yes
Sealed by Name:	Not Reported	Surface Completion:	Alternative Procedure Used
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	No
Injurious Water:	No	Company Name:	Advanced Drilling Systems
Driller Name:	Mario Palacios Moya	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	4990	Apprentice Reg #:	Not Reported

Details Reports For:	Well Bore Hole	Diameter:	11
Top Depth:	0	Bottom Depth:	18
Details Reports For:	Well Drilling Method	Drill Method:	Hollow Stem Auger
Details Reports For:	Well Completion	Borehole Completion:	Filter Packed
Details Reports For:	Well Filter	Filter Material:	Gravel
Top Depth:	3	Bottom Depth:	18
Size:	20/40		
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	3	Annular Seal:	3
Amount:	Not Reported	Unit:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Levels	Measurement:	12
Measurement Date:	2003-10-09	Artesian Flow:	Not Reported
Measurement Method:	Unknown		

Details Reports For:	Well Lithology	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	0-2: Dark brown, sandy silty clay, firm, med. plasticity, dry		

Details Reports For:	Well Lithology	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	2-3: Light brown, sandy silty clay med. plasticity		

Details Reports For:	Well Lithology	Migrated Sort #:	3
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	3-5: light brown, sandy silty clay, firm med. plasticity		

Details Reports For:	Well Lithology	Migrated Sort #:	4
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	5-8: Light brown clayey sand, wet		

Details Reports For:	Well Lithology	Migrated Sort #:	5
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	8-18: Light brown, sand, saturated		

Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	4 New PVC Casing 0-3 sch-40		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	4 New PVC Slotted 3-18 0.01		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

B38
WSW
1/8 - 1/4 Mile
Higher

TX WELLS TXDOL2000017676

Database:	Well Report Database	Fid:	17675
Rec id:	17673	Edr site i:	29002
Owner:	Fred Beutel	Ownerwell:	MW-10
Address:	3 Chase Ln, Colorado Springs ,CO80906		
Grid:	65-53-8		
Lat:	29 08 58 N		
Long:	095 25 54 W		
Gpsused:	315	Waddress:	1101 S. Velasco St., Angleton , TX 77515
Propuse:	Monitor	County:	Brazoria
Completedd:	Not Reported	Elevation:	No Data
		Typeofwork:	New Well
		Sdate:	Not Reported
		Diameter:	11 in From Surface To 18 ft

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Dmethod:	Hollow Stem Auger	Bcompletio:	Not Reported
Packedfrom:	3 ft to 18 ft	Packsizes:	20/40
Finterval:	From 0 ft to 3 ft with 3 (#sacks and material)		
Sinterval:	No Data	Tinterval:	No Data
Usedmethod:	grout	Cementedby:	Advanced Drilling Systems
Contaminat:	No Data	Propertyli:	No Data
Verrimetho:	No Data	Varriance:	No Data
Surface:	Alternative Procedure Used	Staticleve:	12 ft. below land surface on 10/9/2003
Flow:	No Data	Packers:	No Data
Cementinwe:	No Data	Typepump:	No Data
Pumpbowl:	Not Reported	Welltests:	No Data
Yield:	Not Reported	Watertype:	No Data
Stratadept:	No Data	Chemicalma:	No
Undesirabl:	No	Companynam:	Advanced Drilling Systems
Companyadd:	727 W. 26th St.	Ccystate:	Houston , TX 77008
Licensenum:	4990	Wsignature:	Mario Moya
Dsignature:	No Data	Regnum:	No Data
Comments:	no data	Site id:	TXDOL2000017676

39
South
1/8 - 1/4 Mile
Lower

TX WELLS TXMON5000208718

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	211740	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	20
Injurious Water Quality:	Not Reported	Plugging Rpt #:	Not Reported

Submitted Date:	2010-03-31	Owner Name:	GTI-ANG-WMUCLOS
Well #:	mw-1	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2010-03-24	Drill End Date:	2010-03-24
Seal Method:	Other - hand mix	Seal Method Desc:	hand mix
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	No
Sealed by Name:	medi	Surface Completion:	Surface Slab Installed
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	MATHERS ENVIRONMENTAL DRILLING IN
Driller Name:	Patrick L Stephens	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	4850	Apprentice Reg #:	Not Reported

Details Reports For:	Well Bore Hole	Diameter:	8
Top Depth:	0	Bottom Depth:	20

Details Reports For:	Well Drilling Method	Drill Method:	Hollow Stem Auger

Details Reports For:	Well Drilling Method	Drill Method:	Other - 20/40 sand

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Completion	Borehole Completion:	Other - 20/40 sand
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	1	Annular Seal:	concrete 1
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	1
Bottom Depth:	3	Annular Seal:	bent. chips 1
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	3
Bottom Depth:	20	Annular Seal:	8 sand
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Packers	Migrated Sort #:	1
Packers:	bentonite chips 1-3	Depth:	Not Reported
Details Reports For:	Well Lithology	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	0-3.3"- Silt, slightly moist, soft, very dark gray(5yr3/1) some plasticity, roots, grass		
Details Reports For:	Well Lithology	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	3.3"-5-Silt, clayey, very slightly moist, reddish gray (5yr5/2) less than 5% mottling with reddish yellow (5yr7/8)		
Details Reports For:	Well Lithology	Migrated Sort #:	3
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	5-10-Clay, silty,very slightly moist, reddish gray (5/yr5/2) 20% mottling with reddish yellow (5/yr 7/8)at 8 silty seam, moist at 9.3" silt content increases; at 9.6" moisture content increases.		
Details Reports For:	Well Lithology	Migrated Sort #:	4
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	10-15- sand, moist to wet, fine grained, reddish yellow (7.5 yr 6/6/)		
Details Reports For:	Well Lithology	Migrated Sort #:	5
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	15-20- sand, wet fine grained, pale brown (10yr6/3)		
Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 new sch. 40 pvc. screen 20-5 0.010 slot		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported
Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 new sch. 40 pvc riser 0-5		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Schedule: Not Reported Gauge: Not Reported

B40
WSW
1/8 - 1/4 Mile
Higher

TX WELLS TXPLU5000055941

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	40468	Well Type:	Monitor
Borehole Depth (ft):	14.16	Well Report #:	Not Reported

Details Reports For:	Plug Data	Submitted Date:	2007-08-15
Owner Name:	Phil Beutel	Well #:	MW-3
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	Not Reported
Original License #:	Not Reported	Original Well Use:	Monitor
Original Drill Date:	Not Reported		
Plug Method:	Tremmie pipe cement from bottom to top		
Plug Date:	2007-08-02	Variance #:	Not Reported
Company Name:	Advanced Drilling Systems, Inc.		
Plugging Name:	Mario Moya	Driller License:	4990
Apprentice Reg #:	Not Reported	Comments:	No Data
Comments:	Not Reported		

Details Reports For:	Plug Bore Hole	Diameter:	4
Top Depth:	Not Reported	Bottom Depth:	14

Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	14	Plug Seal:	2 Portland Cement
Amount:	Not Reported	Unit:	Not Reported

B41
SW
1/8 - 1/4 Mile
Higher

TX WELLS TXWDB7000109993

Database:	Groundwater Database	Well #:	6553808
Primary Water Use:	Domestic	Elevation:	25
Well Depth:	52	Observation Type:	None
Water Quality Review:	Y	Aquifer:	112CHCT - Chicot Aquifer
Well Type:	Withdrawal of Water		

C42
West
1/8 - 1/4 Mile
Lower

TX WELLS TXMON5000417399

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	424742	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	30
Injurious Water Quality:	no	Plugging Rpt #:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Submitted Date:	2016-06-22	Owner Name:	Billy White
Well #:	DG-10	# Wells Drilled:	1
Elevation:	25	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2016-06-07	Drill End Date:	2016-06-07
Seal Method:	Tremie	Seal Method Desc:	Not Reported
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	Yes
Sealed by Name:	Not Reported	Surface Completion:	Surface Slab Installed
Surf Complete Desc:	Not Reported	Completed by Driller:	Yes
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	No
Injurious Water:	No	Company Name:	BEST DRILLING SERVICES, INC.
Driller Name:	Alfredo Palacios	Comments:	job no.: 624-1106-0001
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	5036	Apprentice Reg #:	Not Reported
Details Reports For:	Well Bore Hole	Diameter:	8.25
Top Depth:	0	Bottom Depth:	30
Details Reports For:	Well Drilling Method	Drill Method:	Hollow Stem Auger
Details Reports For:	Well Completion	Borehole Completion:	Filter Packed
Details Reports For:	Well Filter	Filter Material:	Sand
Top Depth:	13	Bottom Depth:	30
Size:	20/40		
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	11	Annular Seal:	Cement
Amount:	5	Unit:	Bags/Sacks
Details Reports For:	Well Seal Range	Top Depth:	11
Bottom Depth:	13	Annular Seal:	Bentonite
Amount:	1	Unit:	Bags/Sacks
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	5
Lithology:	SILTY CLAY, drk. brown		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	5	Bottom Depth:	7.5
Lithology:	NO RECOVERY		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	7.5	Bottom Depth:	10
Lithology:	SANDY CLAY, yellow brown		
Details Reports For:	Well Lithology	Migrated Sort #:	0

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Top Depth:	10	Bottom Depth:	13
Lithology:	NO RECOVERY		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	13	Bottom Depth:	15
Lithology:	SAND, lt. brown		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	15	Bottom Depth:	18
Lithology:	NO RECOVERY		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	18	Bottom Depth:	20
Lithology:	SAME AS ABOVE		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	20	Bottom Depth:	30
Lithology:	SAND		
Details Reports For:	Well Casing	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	15
Migrated Casing Info:	Not Reported	Diameter:	2
Casing Status:	New	Casing Material:	Plastic (PVC)
Casing Type:	Riser	Schedule:	40
Gauge:	Not Reported		
Details Reports For:	Well Casing	Migrated Sort #:	0
Top Depth:	15	Bottom Depth:	30
Migrated Casing Info:	Not Reported	Diameter:	2
Casing Status:	New	Casing Material:	Plastic (PVC)
Casing Type:	Screen	Schedule:	40
Gauge:	0.01		

C43
West
1/8 - 1/4 Mile
Lower

TX WELLS TXMON5000417401

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	424741	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	30
Injurious Water Quality:	no	Plugging Rpt #:	Not Reported
Submitted Date:	2016-06-22	Owner Name:	Billy White
Well #:	DG-11	# Wells Drilled:	1
Elevation:	25	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2016-06-06	Drill End Date:	2016-06-06
Seal Method:	Tremie	Seal Method Desc:	Not Reported
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Approved by Variance: Sealed by Name: Surf Complete Desc: Pump Type: Pump Depth: Injurious Water: Driller Name: Plugged within 48 hrs: Driller License #:	Not Reported Not Reported Not Reported Not Reported Not Reported No Alfredo Palacios No 5036	Sealed by Driller: Surface Completion: Completed by Driller: Pump Type Desc: Chemical Analysis: Company Name: Comments: Plugging Rpt Tracking #: Apprentice Reg #:	Yes Surface Slab Installed Yes Not Reported No BEST DRILLING SERVICES, INC. job no.: 624-1106-0001 Not Reported Not Reported
Details Reports For: Top Depth:	Well Bore Hole 0	Diameter: Bottom Depth:	8.25 30
Details Reports For:	Well Drilling Method	Drill Method:	Hollow Stem Auger
Details Reports For:	Well Completion	Borehole Completion:	Filter Packed
Details Reports For: Top Depth: Size:	Well Filter 8 20/40	Filter Material: Bottom Depth:	Sand 30
Details Reports For: Bottom Depth: Amount:	Well Seal Range 6 5	Top Depth: Annular Seal: Unit:	0 Cement Bags/Sacks
Details Reports For: Bottom Depth: Amount:	Well Seal Range 8 1	Top Depth: Annular Seal: Unit:	6 Bentonite Bags/Sacks
Details Reports For: Top Depth: Lithology:	Well Lithology 0 NO RECOVERY	Migrated Sort #: Bottom Depth:	0 4
Details Reports For: Top Depth: Lithology:	Well Lithology 4 SANDY CLAY, red brown	Migrated Sort #: Bottom Depth:	0 10
Details Reports For: Top Depth: Lithology:	Well Lithology 10 NO RECOVERY	Migrated Sort #: Bottom Depth:	0 13
Details Reports For: Top Depth: Lithology:	Well Lithology 13 SAND, brown	Migrated Sort #: Bottom Depth:	0 15
Details Reports For: Top Depth: Lithology:	Well Lithology 15 NO RECOVERY	Migrated Sort #: Bottom Depth:	0 18
Details Reports For:	Well Lithology	Migrated Sort #:	0

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Top Depth:	18	Bottom Depth:	20
Lithology:	SAME AS ABOVE		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	20	Bottom Depth:	23
Lithology:	NO RECOVERY		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	23	Bottom Depth:	30
Lithology:	SAND, reddish brown		
Details Reports For:	Well Casing	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	10
Migrated Casing Info:	Not Reported	Diameter:	2
Casing Status:	New	Casing Material:	Plastic (PVC)
Casing Type:	Riser	Schedule:	40
Gauge:	Not Reported		
Details Reports For:	Well Casing	Migrated Sort #:	0
Top Depth:	10	Bottom Depth:	30
Migrated Casing Info:	Not Reported	Diameter:	2
Casing Status:	New	Casing Material:	Plastic (PVC)
Casing Type:	Screen	Schedule:	40
Gauge:	0.01		

C44
WSW
1/8 - 1/4 Mile
Higher

TX WELLS TXPLU5000046935

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	81876	Well Type:	Monitor
Borehole Depth (ft):	35	Well Report #:	Not Reported
Details Reports For:	Plug Data	Submitted Date:	2012-06-25
Owner Name:	BW Services, Inc.	Well #:	DG-3
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	NA
Original License #:	Not Reported	Original Well Use:	Monitor
Original Drill Date:	1998-12-21		
Plug Method:	Tremmie pipe cement from bottom to top		
Plug Date:	2012-06-12	Variance #:	Not Reported
Company Name:	Best Drilling Services, Inc.		
Pluggger Name:	Alfredo Palacios	Driller License:	5036
Apprentice Reg #:	Not Reported	Comments:	No Data
Comments:	Not Reported		
Details Reports For:	Plug Bore Hole	Diameter:	1
Top Depth:	Not Reported	Bottom Depth:	35
Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	35	Plug Seal:	.5 bentonite grout
Amount:	Not Reported	Unit:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

C45
WSW
1/8 - 1/4 Mile
Higher

TX WELLS TXPLU5000046946

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	81878	Well Type:	Monitor
Borehole Depth (ft):	30	Well Report #:	Not Reported

Details Reports For:	Plug Data	Submitted Date:	2012-06-25
Owner Name:	BW Services, Inc.	Well #:	DG-5
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	NA
Original License #:	Not Reported	Original Well Use:	Monitor
Original Drill Date:	1998-12-21		
Plug Method:	Tremmie pipe cement from bottom to top		
Plug Date:	2012-06-12	Variance #:	Not Reported
Company Name:	Best Drilling Services, Inc.		
Plugging Name:	Alfredo Palacios	Driller License:	5036
Apprentice Reg #:	Not Reported	Comments:	No Data
Comments:	Not Reported		

Details Reports For:	Plug Bore Hole	Diameter:	1
Top Depth:	Not Reported	Bottom Depth:	30

Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	30	Plug Seal:	.5 bentonite grout
Amount:	Not Reported	Unit:	Not Reported

C46
WSW
1/8 - 1/4 Mile
Higher

TX WELLS TXPLU5000046947

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	81879	Well Type:	Monitor
Borehole Depth (ft):	30	Well Report #:	Not Reported

Details Reports For:	Plug Data	Submitted Date:	2012-06-25
Owner Name:	BW Services, Inc.	Well #:	DG-6
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	NA
Original License #:	Not Reported	Original Well Use:	Monitor
Original Drill Date:	1998-12-09		
Plug Method:	Tremmie pipe cement from bottom to top		
Plug Date:	2012-06-12	Variance #:	Not Reported
Company Name:	Best Drilling Services, Inc.		
Plugging Name:	Alfredo Palacios	Driller License:	5036
Apprentice Reg #:	Not Reported	Comments:	No Data
Comments:	Not Reported		

Details Reports For:	Plug Bore Hole	Diameter:	1
Top Depth:	Not Reported	Bottom Depth:	30

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	30	Plug Seal:	.5 bentonite grout
Amount:	Not Reported	Unit:	Not Reported

**D47
NW
1/4 - 1/2 Mile
Higher**

TX WELLS TXMON5000020954

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	21721	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	20
Injurious Water Quality:	Not Reported	Plugging Rpt #:	Not Reported

Submitted Date:	2003-06-17	Owner Name:	Philip Services Corporation
Well #:	UG-1	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2003-05-19	Drill End Date:	2003-05-19
Seal Method:	Not Applicable	Seal Method Desc:	Not Reported
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	No
Sealed by Name:	Not Reported	Surface Completion:	Surface Slab Installed
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	Fugro Geosciences, Inc.
Driller Name:	Ronnie D Simmons	Comments:	fugro job # 0305-1053
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	3311	Apprentice Reg #:	Not Reported

Details Reports For:	Well Bore Hole	Diameter:	2.25
Top Depth:	0	Bottom Depth:	20

Details Reports For:	Well Drilling Method	Drill Method:	Driven

Details Reports For:	Well Completion	Borehole Completion:	Filter Packed

Details Reports For:	Well Filter	Filter Material:	Gravel
Top Depth:	3	Bottom Depth:	20
Size:	Not Reported		

Details Reports For:	Well Packers	Migrated Sort #:	1
Packers:	Bentonite Seal 0-3 ft.	Depth:	Not Reported

Details Reports For:	Well Strata	Migrated Strata Depth:	Not Reported
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Water Type:	Unknown		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	4
Lithology:	Silty Sand-Olive Gray		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	4	Bottom Depth:	20
Lithology:	Silty Sand-Gray		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	4	Bottom Depth:	8
Lithology:	Silty Clayey Sand-Lt-Dk Gray & Lt. Brn-Yellow		
Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	.75 New PVC Riser 0 to 5	Diameter:	Not Reported
Casing Status:	Not Reported	Casing Material:	Not Reported
Casing Type:	Not Reported	Schedule:	Not Reported
Gauge:	Not Reported		
Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	.75 New PVC Screen 5 to 20		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

**D48
NW
1/4 - 1/2 Mile
Higher**

TX WELLS TXMON5000020955

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	21722	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	20
Injurious Water Quality:	Not Reported	Plugging Rpt #:	Not Reported
Submitted Date:	2003-06-17	Owner Name:	Philip Services Corporation
Well #:	UG-2	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2003-05-20	Drill End Date:	2003-05-20
Seal Method:	Not Applicable	Seal Method Desc:	Not Reported
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	No
Sealed by Name:	Not Reported	Surface Completion:	Surface Slab Installed
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	Fugro Geosciences, Inc.
Driller Name:	Ronnie D Simmons	Comments:	fugro job # 0305-1053
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	3311	Apprentice Reg #:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For: Top Depth:	Well Bore Hole 0	Diameter: Bottom Depth:	2.25 20
Details Reports For:	Well Drilling Method	Drill Method:	Driven
Details Reports For:	Well Completion	Borehole Completion:	Filter Packed
Details Reports For: Top Depth: Size:	Well Filter 3 Not Reported	Filter Material: Bottom Depth:	Gravel 20
Details Reports For: Packers:	Well Packers Bentonite Seal 0-3 ft.	Migrated Sort #: Depth:	1 Not Reported
Details Reports For: Top Depth: Water Type:	Well Strata Not Reported Unknown	Migrated Strata Depth: Bottom Depth:	Not Reported Not Reported
Details Reports For: Top Depth: Lithology:	Well Lithology 0 Silty Clay w/ sand and gravel-light gray & brown	Migrated Sort #: Bottom Depth:	0 4
Details Reports For: Top Depth: Lithology:	Well Lithology 4 Silty Clay-Green Gray	Migrated Sort #: Bottom Depth:	0 8
Details Reports For: Top Depth: Lithology:	Well Lithology 8 Silty Sand-Light gray-yellow	Migrated Sort #: Bottom Depth:	0 20
Details Reports For: Top Depth: Migrated Casing Info: Casing Status: Casing Type: Gauge:	Well Casing Not Reported .75 New PVC Riser 0 to 5 Not Reported Not Reported Not Reported	Migrated Sort #: Bottom Depth: Diameter: Casing Material: Schedule:	1 Not Reported Not Reported Not Reported Not Reported
Details Reports For: Top Depth: Migrated Casing Info: Diameter: Casing Material: Schedule:	Well Casing Not Reported .75 New PVC Screen 5 to 20 Not Reported Not Reported Not Reported	Migrated Sort #: Bottom Depth: Casing Status: Casing Type: Gauge:	2 Not Reported Not Reported Not Reported Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

D49
NW
1/4 - 1/2 Mile
Higher

TX WELLS TXMON5000020956

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	21723	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	20
Injurious Water Quality:	Not Reported	Plugging Rpt #:	Not Reported

Submitted Date:	2003-06-17	Owner Name:	Philip Services Corporation
Well #:	UG-3	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2003-05-20	Drill End Date:	2003-05-20
Seal Method:	Not Applicable	Seal Method Desc:	Not Reported
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	No
Sealed by Name:	Not Reported	Surface Completion:	Surface Slab Installed
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	Fugro Geosciences, Inc.
Driller Name:	Ronnie D Simmons	Comments:	fugro job # 0305-1053
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	3311	Apprentice Reg #:	Not Reported

Details Reports For:	Well Bore Hole	Diameter:	2.25
Top Depth:	0	Bottom Depth:	20

Details Reports For:	Well Drilling Method	Drill Method:	Driven

Details Reports For:	Well Completion	Borehole Completion:	Filter Packed

Details Reports For:	Well Filter	Filter Material:	Gravel
Top Depth:	3	Bottom Depth:	20
Size:	Not Reported		

Details Reports For:	Well Packers	Migrated Sort #:	1
Packers:	Bentonite Seal 0-3 ft.	Depth:	Not Reported

Details Reports For:	Well Strata	Migrated Strata Depth:	Not Reported
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Water Type:	Unknown		

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	4
Lithology:	Silty Clay w/ sand-light gray & brown		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	4	Bottom Depth:	20
Lithology:	Silty Sand-Light gray-yellow		
Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	.75 New PVC Riser 0 to 5	Diameter:	Not Reported
Casing Status:	Not Reported	Casing Material:	Not Reported
Casing Type:	Not Reported	Schedule:	Not Reported
Gauge:	Not Reported		
Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	.75 New PVC Screen 5 to 20		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

**D50
NW
1/4 - 1/2 Mile
Higher**

TX WELLS TXDOL2000017791

Database:	Well Report Database	Fid:	17790
Rec id:	17791	Edr site i:	21723
Owner:	Philip Services Corporation	Ownerwell:	UG-3
Address:	1024 S. Front Street, Angleton , TX 77515		
Grid:	65-53-8	Waddress:	1024 S. Front Street, Angleton , TX 77515
Lat:	29 09 11 N	County:	Brazoria
Long:	095 25 59 W	Elevation:	No Data
Gpsused:	No Data	Typeofwork:	New Well
Propuse:	Monitor	Sdate:	Not Reported
Completedd:	Not Reported	Diameter:	2.25 in From Surface To 20 ft
Dmethod:	Driven	Bcompleteio:	Not Reported
Packedfrom:	3 ft to 20 ft	Packsiz:	Not Reported
Finterval:	No Data	Sinterval:	No Data
Tinterval:	No Data	Usedmethod:	Not Reported
Cementedby:	Not Reported	Contaminat:	Not Reported
Propertyli:	Not Reported	Verrimetho:	Not Reported
Varriance:	Not Reported	Surface:	Surface Slab Installed
Staticleve:	No Data	Flow:	No Data
Packers:	Bentonite Seal 0-3 ft.	Cementinwe:	No Data
Typepump:	No Data	Pumpbowl:	Not Reported
Welltests:	No Data	Yield:	Not Reported
Watertype:	Unknown	Stratadept:	No Data
Chemicalma:	No Data	Undesirabl:	No Data
Companynam:	Fugro Geosciences, Inc.	Companyadd:	6105 Rookin
Ccitystate:	Houston , TX 77074	Licensenum:	3311
Wsignature:	Ronnie Simmons	Dsignature:	No Data
Regnum:	No Data	Comments:	fugro job # 0305-1053
Site id:	TXDOL2000017791		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

D51
NW
1/4 - 1/2 Mile
Higher

TX WELLS TXDOL2000017792

Database:	Well Report Database	Fid:	17791
Rec id:	17792	Edr site i:	21722
Owner:	Philip Services Corporation	Ownerwell:	UG-2
Address:	1024 S. Front Street, Angleton , TX 77515		
Grid:	65-53-8	Waddress:	1024 S. Front Street, Angleton , TX 77515
Lat:	29 09 11 N	County:	Brazoria
Long:	095 25 59 W	Elevation:	No Data
Gpsused:	No Data	Typeofwork:	New Well
Propuse:	Monitor	Sdate:	Not Reported
Completedd:	Not Reported	Diameter:	2.25 in From Surface To 20 ft
Dmethod:	Driven	Bcompleto:	Not Reported
Packedfrom:	3 ft to 20 ft	Packsizes:	Not Reported
Finterval:	No Data	Sinterval:	No Data
Tinterval:	No Data	Usedmethod:	Not Reported
Cementedby:	Not Reported	Contaminat:	Not Reported
Propertyli:	Not Reported	Verrimetho:	Not Reported
Varriance:	Not Reported	Surface:	Surface Slab Installed
Staticleve:	No Data	Flow:	No Data
Packers:	Bentonite Seal 0-3 ft.	Cementinwe:	No Data
Typepump:	No Data	Pumpbowl:	Not Reported
Welltests:	No Data	Yield:	Not Reported
Watertype:	Unknown	Stratadept:	No Data
Chemicalma:	No Data	Undesirabl:	No Data
Companynam:	Fugro Geosciences, Inc.	Companyadd:	6105 Rookin
Ccitystate:	Houston , TX 77074	Licensenum:	3311
Wsignature:	Ronnie Simmons	Dsignature:	No Data
Regnum:	No Data	Comments:	fugro job # 0305-1053
Site id:	TXDOL2000017792		

D52
NW
1/4 - 1/2 Mile
Higher

TX WELLS TXDOL2000017793

Database:	Well Report Database	Fid:	17792
Rec id:	17793	Edr site i:	21721
Owner:	Philip Services Corporation	Ownerwell:	UG-1
Address:	1024 S. Front Street, Angleton , TX 77515		
Grid:	65-53-8	Waddress:	1024 S. Front Street, Angleton , TX 77515
Lat:	29 09 11 N	County:	Brazoria
Long:	095 25 59 W	Elevation:	No Data
Gpsused:	No Data	Typeofwork:	New Well
Propuse:	Monitor	Sdate:	Not Reported
Completedd:	Not Reported	Diameter:	2.25 in From Surface To 20 ft
Dmethod:	Driven	Bcompleto:	Not Reported
Packedfrom:	3 ft to 20 ft	Packsizes:	Not Reported
Finterval:	No Data	Sinterval:	No Data
Tinterval:	No Data	Usedmethod:	Not Reported
Cementedby:	Not Reported	Contaminat:	Not Reported
Propertyli:	Not Reported	Verrimetho:	Not Reported
Varriance:	Not Reported	Surface:	Surface Slab Installed
Staticleve:	No Data	Flow:	No Data
Packers:	Bentonite Seal 0-3 ft.	Cementinwe:	No Data

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Typepump:	No Data	Pumpbowl:	Not Reported
Welltests:	No Data	Yield:	Not Reported
Watertype:	Unknown	Stratadept:	No Data
Chemicalma:	No Data	Undesirabl:	No Data
Companynam:	Fugro Geosciences, Inc.	Companyadd:	6105 Rookin
Ccitystate:	Houston , TX 77074	Licenseum:	3311
Wsignature:	Ronnie Simmons	Dsignature:	No Data
Regnum:	No Data	Comments:	fugro job # 0305-1053
Site id:	TXDOL2000017793		

C53
WSW
1/4 - 1/2 Mile
Higher

TX WELLS TXWDB7000109994

Database:	Groundwater Database	Well #:	6553809
Primary Water Use:	Domestic	Elevation:	25
Well Depth:	38	Observation Type:	None
Water Quality Review:	Y	Aquifer:	112CHCT - Chicot Aquifer
Well Type:	Withdrawal of Water		

E54
West
1/4 - 1/2 Mile
Lower

FED USGS USGS40001162286

Organization ID:	USGS-TX	Organization Name:	USGS Texas Water Science Center
Monitor Location:	BH-65-53-802	Type:	Well
Description:	Not Reported	HUC:	12040205
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Coastal lowlands aquifer system	Aquifer Type:	Not Reported
Formation Type:	Chicot Aquifer	Well Depth:	865
Construction Date:	19600922	Well Hole Depth:	Not Reported
Well Depth Units:	ft		
Well Hole Depth Units:	Not Reported		

E55
West
1/4 - 1/2 Mile
Lower

TX WELLS TXWDB7000109987

Database:	Groundwater Database	Well #:	6553802
Primary Water Use:	Industrial	Elevation:	24
Well Depth:	865	Observation Type:	None
Water Quality Review:	Y	Aquifer:	112CHCTL - Chicot Aquifer, Lower
Well Type:	Withdrawal of Water		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

F56
SSE
1/4 - 1/2 Mile
Lower

TX WELLS TXMON5000288905

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	292963	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	20
Injurious Water Quality:	Not Reported	Plugging Rpt #:	Not Reported

Submitted Date:	2012-07-20	Owner Name:	Groendyke Transport Inc.
Well #:	MW-7	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2012-06-28	Drill End Date:	2012-06-28
Seal Method:	Other - HANDMIX	Seal Method Desc:	HANDMIX
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	No
Sealed by Name:	MEDI	Surface Completion:	Surface Slab Installed
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	MATHERS ENVIRONMENTAL DRILLING INC.
Driller Name:	Patrick L Stephens	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	4850	Apprentice Reg #:	Not Reported

Details Reports For:	Well Bore Hole	Diameter:	Not Reported
Top Depth:	0	Bottom Depth:	20

Details Reports For:	Well Drilling Method	Drill Method:	Hollow Stem Auger

Details Reports For:	Well Completion	Borehole Completion:	Filter Packed

Details Reports For:	Well Filter	Filter Material:	Gravel
Top Depth:	3	Bottom Depth:	20
Size:	20/40 SAND		

Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	1	Annular Seal:	1.5 CEMENT
Amount:	Not Reported	Unit:	Not Reported

Details Reports For:	Well Seal Range	Top Depth:	1
Bottom Depth:	3	Annular Seal:	1BG. BENTCHIPS
Amount:	Not Reported	Unit:	Not Reported

Details Reports For:	Well Seal Range	Top Depth:	3
Bottom Depth:	20	Annular Seal:	13 BGS. SAND
Amount:	Not Reported	Unit:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Packers	Migrated Sort #:	1
Packers:	1 BAG BENTONITE CHIPS 3/8 3'-1'		
Depth:	Not Reported		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	8
Lithology:	CONCRETE		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	3	Bottom Depth:	5
Lithology:	CLAY, MOIST, GRAY, RED MOTTLING		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	5	Bottom Depth:	7.5
Lithology:	CLAY, MOIST GRAY, RED, MOTTLING		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	7.5	Bottom Depth:	8
Lithology:	SANDY CLAY		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	8	Bottom Depth:	3
Lithology:	NO RECOVERY		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	8	Bottom Depth:	8.5
Lithology:	CLAYEY SAND		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	8.5	Bottom Depth:	20
Lithology:	SAND BROWN, MOIST 8.5, WET AT 10 GRAY		
Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2" NEW PVC SCREEN SLOT 0.010 20'-5' SCH.40		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported
Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2" NEW PVC BLANK 05'-0 SCH.40		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

F57
SSE
1/4 - 1/2 Mile
Lower

TX WELLS TXMON5000288906

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	292964	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	20
Injurious Water Quality:	Not Reported	Plugging Rpt #:	Not Reported

Submitted Date:	2012-07-20	Owner Name:	Groendyke Transport Inc.
Well #:	MW-8	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2012-06-28	Drill End Date:	2012-06-28
Seal Method:	Other - HANDMIX	Seal Method Desc:	HANDMIX
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	No
Sealed by Name:	MEDI	Surface Completion:	Surface Slab Installed
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	MATHERS ENVIRONMENTAL DRILLING INC.
Driller Name:	Patrick L Stephens	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	4850	Apprentice Reg #:	Not Reported

Details Reports For:	Well Bore Hole	Diameter:	Not Reported
Top Depth:	0	Bottom Depth:	20

Details Reports For:	Well Drilling Method	Drill Method:	Hollow Stem Auger

Details Reports For:	Well Completion	Borehole Completion:	Filter Packed

Details Reports For:	Well Filter	Filter Material:	Gravel
Top Depth:	3	Bottom Depth:	20
Size:	20/40 SAND		

Details Reports For:	Well Seal Range	Top Depth:	3
Bottom Depth:	20	Annular Seal:	13 BGS. SAND
Amount:	Not Reported	Unit:	Not Reported

Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	1	Annular Seal:	1.5 CEMENT
Amount:	Not Reported	Unit:	Not Reported

Details Reports For:	Well Seal Range	Top Depth:	1
Bottom Depth:	3	Annular Seal:	1BG. BENTCHIPS
Amount:	Not Reported	Unit:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Packers	Migrated Sort #:	1
Packers:	1 BAG BENTONITE CHIPS 3/8 3'-1'		
Depth:	Not Reported		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	8
Lithology:	CONCRETE		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	2	Bottom Depth:	6.5
Lithology:	CLAY, SANDY MOIST SOME THIN SAND SEAMS DARK GRAY TO RED		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	6.5	Bottom Depth:	9
Lithology:	CLAY, SANDY DRY, LIGHT GRAY TO RED, MOTTLING		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	8	Bottom Depth:	2
Lithology:	SILT, CLAYEY MOIST SOME GRAVEL DARK GRAY TO BLACK		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	9	Bottom Depth:	20
Lithology:	SAND, MOIST AT 9, WET AT 10, BROWN		
Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2" NEW PVC SCREEN SLOT 0.010 20'-5' SCH.40		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported
Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2" NEW PVC BLANK 05'-0 SCH.40		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

58
SSW
1/4 - 1/2 Mile
Lower

TX WELLS TXMON5000215556

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	218650	Well Type:	New Well
Proposed Use:	Closed-Loop Geothermal	Borehole Depth (ft):	250
Injurious Water Quality:	no	Plugging Rpt #:	Not Reported
Submitted Date:	2010-06-04	Owner Name:	Davis Air Conditioning & Heating
Well #:	Not Reported	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Proposed Use:	Closed-Loop Geothermal	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2010-04-23	Drill End Date:	2010-04-27
Seal Method:	Other - Tremie Pipe	Seal Method Desc:	Tremie Pipe
Dist to Septic/Other Contam:	na	Distance to Septic Tank:	Not Reported
Dist to Property Line:	60	Distance Verify Meth:	Wheel
Approved by Variance:	Not Reported	Sealed by Driller:	Yes
Sealed by Name:	Not Reported	Surface Completion:	Unknown
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	- none	Pump Type Desc:	none
Pump Depth:	Not Reported	Chemical Analysis:	No
Injurious Water:	No	Company Name:	Gearen Drilling Co.
Driller Name:	Dempsey W Gearen Jr	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	2836	Apprentice Reg #:	Not Reported
Details Reports For:	Well Bore Hole	Diameter:	3.875
Top Depth:	0	Bottom Depth:	250
Details Reports For:	Well Drilling Method	Drill Method:	Mud (Hydraulic) Rotary
Details Reports For:	Well Completion	Borehole Completion:	Straight Wall
Details Reports For:	Well Seal Range	Top Depth:	4
Bottom Depth:	250	Annular Seal:	7 Volclay
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	2
Lithology:	Dg Cl		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	2	Bottom Depth:	12
Lithology:	R + G Si Cl		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	12	Bottom Depth:	58
Lithology:	G Sa		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	58	Bottom Depth:	110
Lithology:	G + R Cl		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	110	Bottom Depth:	130
Lithology:	G SA		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	130	Bottom Depth:	170
Lithology:	G + R Cl		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	170	Bottom Depth:	170
Lithology:	G Sa		

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	170	Bottom Depth:	250
Lithology:	R + G Cl		

Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	3/4 New PE 3408 4 - 250	Diameter:	Not Reported
Casing Status:	Not Reported	Casing Material:	Not Reported
Casing Type:	Not Reported	Schedule:	Not Reported
Gauge:	Not Reported		

59
WNW
1/4 - 1/2 Mile
Higher

TX WELLS TXPLU5000100255

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	3539	Well Type:	Monitor
Borehole Depth (ft):	18	Well Report #:	Not Reported

Details Reports For:	Plug Data	Submitted Date:	2001-10-11
Owner Name:	Diamond Shamrock	Well #:	Not Reported
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	Can-Tex
Original License #:	3129	Original Well Use:	Monitor
Original Drill Date:	1996-10-07		
Plug Method:	Tremmie pipe cement from bottom to top		
Plug Date:	2001-05-02	Variance #:	Not Reported
Company Name:	Can-Tex Services	Plugging Name:	Ed Gay
Driller License:	3129	Apprentice Reg #:	Not Reported
Comments:	logged by TF	Comments:	Not Reported

Details Reports For:	Plug Bore Hole	Diameter:	10
Top Depth:	Not Reported	Bottom Depth:	18

Details Reports For:	Plug Casing	Top Depth:	0
Bottom Depth:	0	Diameter:	10

Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	18	Plug Seal:	6
Amount:	Not Reported	Unit:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

G60
NNW
1/2 - 1 Mile
Higher

TX WELLS TXMON5000375557

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	380794	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	15
Injurious Water Quality:	Not Reported	Plugging Rpt #:	148463
Submitted Date:	2014-11-11	Owner Name:	Union Pacific Railroad Co
Well #:	SB-5/MW-3	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2014-10-20	Drill End Date:	2014-10-20
Seal Method:	Other - HAND	Seal Method Desc:	HAND
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	Yes
Sealed by Name:	Not Reported	Surface Completion:	Alternative Procedure Used
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	Vortex Drilling Inc
Driller Name:	William A Clayton	Comments:	Not Reported
Plugged within 48 hrs:	Yes	Plugging Rpt Tracking #:	148463
Driller License #:	53420	Apprentice Reg #:	Not Reported
Details Reports For:	Well Bore Hole	Diameter:	3
Top Depth:	0	Bottom Depth:	15
Details Reports For:	Well Drilling Method	Drill Method:	Driven
Details Reports For:	Well Completion	Borehole Completion:	Filter Packed
Details Reports For:	Well Filter	Filter Material:	Gravel
Top Depth:	7	Bottom Depth:	15
Size:	20/40		
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	2	Annular Seal:	1 Bag Concrete
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	2
Bottom Depth:	7	Annular Seal:	0.35 Bentonite
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Plugback	Top Depth:	Not Reported
Bottom Depth:	Not Reported	Migrated Sort #:	1
Plugback:	No casing was left in the Well		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Plugback	Top Depth:	Not Reported
Bottom Depth:	Not Reported	Migrated Sort #:	2
Plugback:	0-2 Concrete		
Details Reports For:	Well Plugback	Top Depth:	Not Reported
Bottom Depth:	Not Reported	Migrated Sort #:	3
Plugback:	2-15 Bentonite		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	3.2
Lithology:	Silty sandy clay, dark gray to black, moist, firm, medium plasticity, organic material		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	3.2	Bottom Depth:	9.8
Lithology:	Silty sandy clay, gray tan, moist, firm, intervals of calcareous nodules at 6-7		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	9.8	Bottom Depth:	13
Lithology:	Silty sand, fine grained, trace silt, tan, saturated, soft, slightly cohesive, no odor		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	13	Bottom Depth:	15
Lithology:	Silty clay, reddish brown, moist, hard, medium plasticity, homogeneous		
Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	1" New SCH 40 PVC .010 14' to 9' Screen		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported
Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	1" New SCH 40 PVC 9' to 0 Riser		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported
Details Reports For:	Well Casing	Migrated Sort #:	3
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	1" New Top and Bottom Cap		
Casing Status:	Not Reported	Diameter:	Not Reported
Casing Type:	Not Reported	Casing Material:	Not Reported
Gauge:	Not Reported	Schedule:	Not Reported

**G61
NNW
1/2 - 1 Mile
Higher**

TX WELLS TXMON5000375559

Database:	Submitted Drillers Reports Database (Monitoring)	
Well Rpt #:	380796	Well Type: New Well

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Proposed Use:	Environmental Soil Boring	Borehole Depth (ft):	15
Injurious Water Quality:	Not Reported	Plugging Rpt #:	Not Reported
Submitted Date:	2014-11-11	Owner Name:	Union Pacific Railroad Co
Well #:	SB-6	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Environmental Soil Boring	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2014-10-21	Drill End Date:	2014-10-21
Seal Method:	Other - HAND	Seal Method Desc:	HAND
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	Yes
Sealed by Name:	Not Reported	Surface Completion:	Alternative Procedure Used
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	Vortex Drilling Inc
Driller Name:	William A Clayton	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	53420	Apprentice Reg #:	Not Reported
Details Reports For:	Well Bore Hole	Diameter:	3
Top Depth:	0	Bottom Depth:	15
Details Reports For:	Well Drilling Method	Drill Method:	Driven
Details Reports For:	Well Completion	Borehole Completion:	Plugged
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	2	Annular Seal:	1 Bag Concrete
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	2
Bottom Depth:	15	Annular Seal:	0.91 Bentonite
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	2.7
Lithology:	Fill Material, sand and gravel, white and tan, dry, loose		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	2.7	Bottom Depth:	9.9
Lithology:	Silty clay, dark gray and reddish brown, moist, very firm, medium plasticity, iron and manganese nodules throughout, calcareous nodules at 9.7		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	9.9	Bottom Depth:	13
Lithology:	Silty sand, very fine grained, tan saturated, soft, medium dilatency, no odor		
Details Reports For:	Well Lithology	Migrated Sort #:	0

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Top Depth:	13	Bottom Depth:	15
Lithology:	Silty sandy clay, reddish brown with gray mottling, moist, firm medium plasticity		

**G62
NNW
1/2 - 1 Mile
Higher**

TX WELLS TXMON5000375562

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	380799	Well Type:	New Well
Proposed Use:	Environmental Soil Boring	Borehole Depth (ft):	25
Injurious Water Quality:	Not Reported	Plugging Rpt #:	Not Reported
Submitted Date:	2014-11-11	Owner Name:	Union Pacific Railroad Co
Well #:	SB-7	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Environmental Soil Boring	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2014-10-20	Drill End Date:	2014-10-20
Seal Method:	Other - HAND	Seal Method Desc:	HAND
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	Yes
Sealed by Name:	Not Reported	Surface Completion:	Alternative Procedure Used
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	Vortex Drilling Inc
Driller Name:	William A Clayton	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	53420	Apprentice Reg #:	Not Reported
Details Reports For:	Well Bore Hole	Diameter:	3
Top Depth:	0	Bottom Depth:	25
Details Reports For:	Well Drilling Method	Drill Method:	Driven
Details Reports For:	Well Completion	Borehole Completion:	Plugged
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	2	Annular Seal:	1 Bag Concrete
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	2
Bottom Depth:	25	Annular Seal:	1.61 Bentonite
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	2.5
Lithology:	Fill material, silty sandy clay and gravel, tan and gray, moist		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	2.5	Bottom Depth:	7
Lithology:	Silty clay, tan and gray, moist, firm, medium to high plasticity		

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	7	Bottom Depth:	21
Lithology:	Silty clay, gray and reddish brown, moist, very hard, medium plasticity, iron and manganese nodules throughout, calcareous nodules at 7		

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	21	Bottom Depth:	24
Lithology:	Silty sand, very fine grained, tan to reddish brown, saturated, medium dilatency, no odor, thin clay layers inter bedded within		

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	24	Bottom Depth:	25
Lithology:	Sandy clay, reddish brown and tan, moist, very to hard, medium plasticity		

**G63
NNW
1/2 - 1 Mile
Higher**

TX WELLS TXMON5000375516

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	380753	Well Type:	New Well
Proposed Use:	Environmental Soil Boring	Borehole Depth (ft):	15
Injurious Water Quality:	Not Reported	Plugging Rpt #:	Not Reported

Submitted Date:	2014-11-10	Owner Name:	Union Pacific Railroad Co
Well #:	SB-4	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Environmental Soil Boring	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2014-10-21	Drill End Date:	2014-10-21
Seal Method:	Other - HAND	Seal Method Desc:	HAND
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	Yes
Sealed by Name:	Not Reported	Surface Completion:	Alternative Procedure Used
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	Vortex Drilling Inc
Driller Name:	William A Clayton	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	53420	Apprentice Reg #:	Not Reported

Details Reports For:	Well Bore Hole	Diameter:	3
Top Depth:	0	Bottom Depth:	15

Details Reports For:	Well Drilling Method	Drill Method:	Driven

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Completion	Borehole Completion:	Plugged
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	2	Annular Seal:	1 Bag Concrete
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	2
Bottom Depth:	15	Annular Seal:	0.91 Bentonite
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	1.1
Lithology:	Fill material, sand and gravel, white and tan, dry, loose		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	1.1	Bottom Depth:	5.3
Lithology:	Silty clay, dark gray, moist, very firm, medium plasticity		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	5.3	Bottom Depth:	12
Lithology:	Silty clay, gray and reddish brown, moist, very firm, medium plasticity, iron and m manganese modules throughout		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	12	Bottom Depth:	15
Lithology:	Silty sand, fine grained trace silt, reddish brown, saturated, soft, slightly cohesive, no odor		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	15	Bottom Depth:	15
Lithology:	Silty clay, reddish brown, moist, hard, medium plasticity		

**G64
NNW
1/2 - 1 Mile
Higher**

TX WELLS TXMON5000375505

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	380742	Well Type:	New Well
Proposed Use:	Environmental Soil Boring	Borehole Depth (ft):	15
Injurious Water Quality:	Not Reported	Plugging Rpt #:	Not Reported
Submitted Date:	2014-11-10	Owner Name:	Union Pacific Railroad Co
Well #:	SB-1	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Environmental Soil Boring	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2014-10-20	Drill End Date:	2014-10-20
Seal Method:	Other - HAND	Seal Method Desc:	HAND
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	Yes

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Sealed by Name:	Not Reported	Surface Completion:	Alternative Procedure Used
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	Vortex Drilling Inc
Driller Name:	William A Clayton	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	53420	Apprentice Reg #:	Not Reported

Details Reports For:	Well Bore Hole	Diameter:	3
Top Depth:	0	Bottom Depth:	15

Details Reports For:	Well Drilling Method	Drill Method:	Driven

Details Reports For:	Well Completion	Borehole Completion:	Plugged

Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	2	Annular Seal:	1 Bag Concrete
Amount:	Not Reported	Unit:	Not Reported

Details Reports For:	Well Seal Range	Top Depth:	2
Bottom Depth:	15	Annular Seal:	0.91 Bentonite
Amount:	Not Reported	Unit:	Not Reported

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	1.5
Lithology:	Silty sandy clay, dark brown, moist, organic material, cohesive, medium plasticity		

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	1.5	Bottom Depth:	4.3
Lithology:	Sandy clay, gray and tan with trace red mottling, moist, very firm, medium plasticity, iron and manganese nodules		

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	4.3	Bottom Depth:	6
Lithology:	Silty sandy clay, tan, moist, cohesive		

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	6	Bottom Depth:	15
Lithology:	Sand, fine grained, tan, saturated, soft, rapid diligence, no odor		

**G65
NNW
1/2 - 1 Mile
Higher**

TX WELLS TXMON5000375509

Database:	Submitted Drillers Reports Database (Monitoring)	Well Type:	New Well
Well Rpt #:	380746	Borehole Depth (ft):	15
Proposed Use:	Monitor	Plugging Rpt #:	148454
Injurious Water Quality:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Submitted Date:	2014-11-10	Owner Name:	Union Pacific Railroad Co
Well #:	SB-2/TMW-1	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2014-10-20	Drill End Date:	2014-10-20
Seal Method:	Other - HAND	Seal Method Desc:	HAND
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	Yes
Sealed by Name:	Not Reported	Surface Completion:	Alternative Procedure Used
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	Vortex Drilling Inc
Driller Name:	William A Clayton	Comments:	Not Reported
Plugged within 48 hrs:	Yes	Plugging Rpt Tracking #:	148454
Driller License #:	53420	Apprentice Reg #:	Not Reported
Details Reports For:	Well Bore Hole	Diameter:	3
Top Depth:	0	Bottom Depth:	15
Details Reports For:	Well Drilling Method	Drill Method:	Driven
Details Reports For:	Well Completion	Borehole Completion:	Filter Packed
Details Reports For:	Well Filter	Filter Material:	Gravel
Top Depth:	8	Bottom Depth:	15
Size:	20/40		
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	2	Annular Seal:	1 Bag Concrete
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	2
Bottom Depth:	8	Annular Seal:	0.42 Bentonite
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Plugback	Top Depth:	Not Reported
Bottom Depth:	Not Reported	Migrated Sort #:	1
Plugback:	No casing left in Well		
Details Reports For:	Well Plugback	Top Depth:	Not Reported
Bottom Depth:	Not Reported	Migrated Sort #:	2
Plugback:	0-2 Concrete		
Details Reports For:	Well Plugback	Top Depth:	Not Reported
Bottom Depth:	Not Reported	Migrated Sort #:	3
Plugback:	2-15 Bentonite		
Details Reports For:	Well Lithology	Migrated Sort #:	0

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Top Depth:	0	Bottom Depth:	3
Lithology:	Silty sandy clay, dark brown, moist, organic 3-9.2 Silty clay, gray and tan moist, very firm, medium plasticity, iron and manganese nodules		

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	9.2	Bottom Depth:	15
Lithology:	Sand, fine grained, gray saturated, soft, rapid dilatency, nod odor, trace clay modules inter bedded with at 12.5		

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	15	Bottom Depth:	15
Lithology:	Sandy clay, gray and tan, tan, moist, firm, medium plasticity		

Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	1" New SCH 40 PVC .010 15' to 10' Screen		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	1" New SCH 40 PVC 10' to 0 Riser		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

Details Reports For:	Well Casing	Migrated Sort #:	3
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	1" New Top and Bottom Cap		
Casing Status:	Not Reported	Casing Material:	Not Reported
Casing Type:	Not Reported	Schedule:	Not Reported
Gauge:	Not Reported		

**G66
NNW
1/2 - 1 Mile
Higher**

TX WELLS TXMON5000375513

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	380750	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	25
Injurious Water Quality:	Not Reported	Plugging Rpt #:	148455

Submitted Date:	2014-11-10	Owner Name:	Union Pacific Railroad Co
Well #:	SB-3/TMW-2	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2014-10-20	Drill End Date:	2014-10-20
Seal Method:	Other - HAND	Seal Method Desc:	HAND
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Approved by Variance:	Not Reported	Sealed by Driller:	Yes
Sealed by Name:	Not Reported	Surface Completion:	Alternative Procedure Used
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	Vortex Drilling Inc
Driller Name:	William A Clayton	Comments:	Not Reported
Plugged within 48 hrs:	Yes	Plugging Rpt Tracking #:	148455
Driller License #:	53420	Apprentice Reg #:	Not Reported
Details Reports For:	Well Bore Hole	Diameter:	3
Top Depth:	0	Bottom Depth:	25
Details Reports For:	Well Drilling Method	Drill Method:	Driven
Details Reports For:	Well Completion	Borehole Completion:	Filter Packed
Details Reports For:	Well Filter	Filter Material:	Gravel
Top Depth:	13	Bottom Depth:	25
Size:	20/40		
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	2	Annular Seal:	1 Bag Concrete
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	2
Bottom Depth:	13	Annular Seal:	0.77 Bentonite
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Plugback	Top Depth:	Not Reported
Bottom Depth:	Not Reported	Migrated Sort #:	1
Plugback:	No casing left in Well		
Details Reports For:	Well Plugback	Top Depth:	Not Reported
Bottom Depth:	Not Reported	Migrated Sort #:	2
Plugback:	0-2 Concrete		
Details Reports For:	Well Plugback	Top Depth:	Not Reported
Bottom Depth:	Not Reported	Migrated Sort #:	3
Plugback:	2-25 Bentonite		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	3.8
Lithology:	Silty sandy clay, brown, moist, firm organic material , medium plasticity		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	3.8	Bottom Depth:	6.4
Lithology:	Sand tan and yellow, moist, very firm, trace organic material, medium plasticity		
Details Reports For:	Well Lithology	Migrated Sort #:	0

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Top Depth:	6.4	Bottom Depth:	25
Lithology:	Sand, fine to medium grained, trace silt, gray and tan, saturated soft, medium to rapid dilatency, no odor, homegeneous		

Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	1" New SCH 40 PVC .010 25' to 15' Screen		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	1" New SCH 40 PVC 15' to 0 Riser		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

Details Reports For:	Well Casing	Migrated Sort #:	3
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	1" New Top and Bottom Cap		
Casing Status:	Not Reported	Diameter:	Not Reported
Casing Type:	Not Reported	Casing Material:	Not Reported
Gauge:	Not Reported	Schedule:	Not Reported

**G67
NNW
1/2 - 1 Mile
Higher**

TX WELLS TXPLU5000146419

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	148463	Well Type:	Monitor
Borehole Depth (ft):	15	Well Report #:	380794

Details Reports For:	Plug Data	Submitted Date:	2014-11-11
Owner Name:	Union Pacific Railroad Co	Well #:	SB-5/MW-3
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Vortex Drilling Inc	Original Driller:	William A Clayton
Original License #:	53420	Original Well Use:	Monitor
Original Drill Date:	2014-10-20	Plug Method:	Unknown
Plug Date:	2014-10-20	Variance #:	Not Reported
Company Name:	Vortex Drilling Inc	Plugging Name:	William A. Clayton
Driller License:	53420	Apprentice Reg #:	Not Reported
Comments:	Not Reported	Comments:	Not Reported

Details Reports For:	Plug Bore Hole	Diameter:	3
Top Depth:	0	Bottom Depth:	15

Details Reports For:	Plug Range	Top Depth:	Not Reported
Bottom Depth:	Not Reported	Plug Seal:	0-2 Concrete
Amount:	Not Reported	Unit:	Not Reported

Details Reports For:	Plug Range	Top Depth:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Bottom Depth:	Not Reported	Plug Seal:	2-15 Bentonite
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Plug Range	Top Depth:	Not Reported
Bottom Depth:	Not Reported	Plug Seal:	No casing was left in the Well
Amount:	Not Reported	Unit:	Not Reported

G68
NNW
1/2 - 1 Mile
Higher

TX WELLS TXPLU5000146420

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	148464	Well Type:	Monitor
Borehole Depth (ft):	25	Well Report #:	380800
Details Reports For:	Plug Data	Submitted Date:	2014-11-11
Owner Name:	Union Pacific Railroad Co	Well #:	SB-8/TMW-4
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Vortex Drilling Inc	Original Driller:	William A Clayton
Original License #:	53420	Original Well Use:	Monitor
Original Drill Date:	2014-10-20	Plug Method:	Unknown
Plug Date:	2014-10-20	Variance #:	Not Reported
Company Name:	Vortex Drilling Inc	Plugging Name:	William A. Clayton
Driller License:	53420	Apprentice Reg #:	Not Reported
Comments:	Not Reported	Comments:	Not Reported

Details Reports For:	Plug Bore Hole	Diameter:	3
Top Depth:	0	Bottom Depth:	25

Details Reports For:	Plug Range	Top Depth:	Not Reported
Bottom Depth:	Not Reported	Plug Seal:	2-25 Bentonite
Amount:	Not Reported	Unit:	Not Reported

Details Reports For:	Plug Range	Top Depth:	Not Reported
Bottom Depth:	Not Reported	Plug Seal:	0-2 Concrete
Amount:	Not Reported	Unit:	Not Reported

Details Reports For:	Plug Range	Top Depth:	Not Reported
Bottom Depth:	Not Reported	Plug Seal:	No casing was left in the Well
Amount:	Not Reported	Unit:	Not Reported

G69
NNW
1/2 - 1 Mile
Higher

TX WELLS TXPLU5000152887

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	154907	Well Type:	Monitor
Borehole Depth (ft):	16	Well Report #:	391047

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Plug Data	Submitted Date:	2016-01-21
Owner Name:	Union Pacific Railroad	Well #:	MW-1
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Vortex Drilling Inc	Original Driller:	Heriberto Martinez
Original License #:	59554	Original Well Use:	Monitor
Original Drill Date:	2015-03-02		
Plug Method:	Tremmie pipe bentonite from bottom to 2 feet from surface, cement top 2 feet		
Plug Date:	2016-01-12	Variance #:	Not Reported
Company Name:	BEST DRILLING SERVICES, INC.		
Plugging Name:	Calistro Campozano	Driller License:	4997
Apprentice Reg #:	56591	Comments:	Not Reported
Comments:	Not Reported		

Details Reports For:	Plug Bore Hole	Diameter:	6.29999999
Top Depth:	0	Bottom Depth:	16

Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	16	Plug Seal:	CEMENT BENTONITE GROUT
Amount:	1	Unit:	Bags/Sacks

**G70
NNW
1/2 - 1 Mile
Higher**

TX WELLS TXPLU5000146411

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	148455	Well Type:	Monitor
Borehole Depth (ft):	25	Well Report #:	380750

Details Reports For:	Plug Data	Submitted Date:	2014-11-10
Owner Name:	Union Pacific Railroad Co	Well #:	SB-3/TMW-2
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Vortex Drilling Inc	Original Driller:	William A Clayton
Original License #:	53420	Original Well Use:	Monitor
Original Drill Date:	2014-10-20	Plug Method:	Unknown
Plug Date:	2014-10-20	Variance #:	Not Reported
Company Name:	Vortex Drilling Inc	Plugging Name:	William A. Clayton
Driller License:	53420	Apprentice Reg #:	Not Reported
Comments:	Not Reported	Comments:	Not Reported

Details Reports For:	Plug Bore Hole	Diameter:	3
Top Depth:	0	Bottom Depth:	25

Details Reports For:	Plug Range	Top Depth:	Not Reported
Bottom Depth:	Not Reported	Plug Seal:	2-25 Bentonite
Amount:	Not Reported	Unit:	Not Reported

Details Reports For:	Plug Range	Top Depth:	Not Reported
Bottom Depth:	Not Reported	Plug Seal:	No casing left in Well
Amount:	Not Reported	Unit:	Not Reported

Details Reports For:	Plug Range	Top Depth:	Not Reported
Bottom Depth:	Not Reported	Plug Seal:	0-2 Concrete

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Amount: Not Reported Unit: Not Reported

**G71
NNW
1/2 - 1 Mile
Higher**

TX WELLS TXMON5000375563

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	380800	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	25
Injurious Water Quality:	Not Reported	Plugging Rpt #:	148464
Submitted Date:	2014-11-11	Owner Name:	Union Pacific Railroad Co
Well #:	SB-8/TMW-4	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2014-10-20	Drill End Date:	2014-10-20
Seal Method:	Other - HAND	Seal Method Desc:	HAND
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	Yes
Sealed by Name:	Not Reported	Surface Completion:	Alternative Procedure Used
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	Vortex Drilling Inc
Driller Name:	William A Clayton	Comments:	Not Reported
Plugged within 48 hrs:	Yes	Plugging Rpt Tracking #:	148464
Driller License #:	53420	Apprentice Reg #:	Not Reported
Details Reports For:	Well Bore Hole	Diameter:	3
Top Depth:	0	Bottom Depth:	25
Details Reports For:	Well Drilling Method	Drill Method:	Driven
Details Reports For:	Well Completion	Borehole Completion:	Filter Packed
Details Reports For:	Well Filter	Filter Material:	Gravel
Top Depth:	18	Bottom Depth:	25
Size:	20/40		
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	2	Annular Seal:	1 Bag Concrete
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	2
Bottom Depth:	18	Annular Seal:	1.12 Bentonite
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Plugback	Top Depth:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Bottom Depth:	Not Reported	Migrated Sort #:	1
Plugback:	No casing was left in the Well		
Details Reports For:	Well Plugback	Top Depth:	Not Reported
Bottom Depth:	Not Reported	Migrated Sort #:	2
Plugback:	0-2 Concrete		
Details Reports For:	Well Plugback	Top Depth:	Not Reported
Bottom Depth:	Not Reported	Migrated Sort #:	3
Plugback:	2-25 Bentonite		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	2.5
Lithology:	Silty sandy clay, dark gray to dark brown, moist, organic material, cohesive, medium plasticity		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	2.5	Bottom Depth:	11
Lithology:	Silty clay, tan and gray, moist, very fine to hard, medium, calcareous modules at 9		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	11	Bottom Depth:	21
Lithology:	Silty clay, tan and reddish brown, moist, firm to hard, medium plasticity, iron and manganese nodules throughout		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	21	Bottom Depth:	24
Lithology:	Sand, very fine grained, reddish brown and tan, saturated, medium dilatency, no odor		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	24	Bottom Depth:	25
Lithology:	Sandy clay, reddish brown and tan, moist, very firm to hard, medium plasticity		
Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	1" New SCH 40 PVC .010 25' to 20' Screen		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported
Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	1" New SCH 40 PVC 20' to 0 Riser		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported
Details Reports For:	Well Casing	Migrated Sort #:	3
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	1" New Top and Bottom Cap	Diameter:	Not Reported
Casing Status:	Not Reported	Casing Material:	Not Reported
Casing Type:	Not Reported	Schedule:	Not Reported
Gauge:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

G72
NNW
1/2 - 1 Mile
Higher

TX WELLS TXMON5000385472

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	391047	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	16
Injurious Water Quality:	Not Reported	Plugging Rpt #:	154907
Submitted Date:	2015-03-23	Owner Name:	Union Pacific Railroad
Well #:	MW-1	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2015-03-02	Drill End Date:	2015-03-02
Seal Method:	Other - HAND	Seal Method Desc:	HAND
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	Yes
Sealed by Name:	Not Reported	Surface Completion:	Surface Sleeve Installed
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	Vortex Drilling Inc
Driller Name:	Heriberto Martinez	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	154907
Driller License #:	59554	Apprentice Reg #:	Not Reported
Details Reports For:	Well Bore Hole	Diameter:	63
Top Depth:	0	Bottom Depth:	16
Details Reports For:	Well Drilling Method	Drill Method:	Driven
Details Reports For:	Well Completion	Borehole Completion:	Filter Packed
Details Reports For:	Well Filter	Filter Material:	Gravel
Top Depth:	9	Bottom Depth:	16
Size:	20/40		
Details Reports For:	Well Seal Range	Top Depth:	2
Bottom Depth:	9	Annular Seal:	1.96 Bentonite
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	2	Annular Seal:	1 Bag Concrete
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	3
Lithology:	Silty sandy clay, dark brown, moist, organic material, firm, medium plasticity		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	3	Bottom Depth:	9.2
Lithology:	Silty clay, gray and tan, moist, very firm, medium plasticity, iron and manganese nodules		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	9.2	Bottom Depth:	15
Lithology:	Sand, fine grained, gray, saturated, soft, rapid dilatency, no odor, trace clay nodules interbedded with @12.5		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	15	Bottom Depth:	16
Lithology:	Sandy clay, gray and tan, moist, firm, medium plasticity		
Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2" NEW SCH 40 PVC .010 16' to 11' Prepacked Screen		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported
Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2" NEW SCH 40 PVC 11' to 0 Riser		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported
Details Reports For:	Well Casing	Migrated Sort #:	3
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2" NEW Top and Bottom Cap		
Casing Status:	Not Reported	Casing Material:	Not Reported
Casing Type:	Not Reported	Schedule:	Not Reported
Gauge:	Not Reported		

**G73
NNW
1/2 - 1 Mile
Higher**

TX WELLS TXPLU5000146410

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	148454	Well Type:	Monitor
Borehole Depth (ft):	15	Well Report #:	380746
Details Reports For:	Plug Data	Submitted Date:	2014-11-10
Owner Name:	Union Pacific Railroad Co	Well #:	SB-2/TMW-1
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Vortex Drilling Inc	Original Driller:	William A Clayton
Original License #:	53420	Original Well Use:	Monitor
Original Drill Date:	2014-10-20	Plug Method:	Unknown
Plug Date:	2014-10-20	Variance #:	Not Reported
Company Name:	Vortex Drilling Inc	Plugging Name:	William A. Clayton
Driller License:	53420	Apprentice Reg #:	Not Reported
Comments:	Not Reported	Comments:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Plug Bore Hole	Diameter:	3
Top Depth:	0	Bottom Depth:	15
Details Reports For:	Plug Range	Top Depth:	Not Reported
Bottom Depth:	Not Reported	Plug Seal:	0-2 Concrete
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Plug Range	Top Depth:	Not Reported
Bottom Depth:	Not Reported	Plug Seal:	2-15 Bentonite
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Plug Range	Top Depth:	Not Reported
Bottom Depth:	Not Reported	Plug Seal:	No casing left in Well
Amount:	Not Reported	Unit:	Not Reported

**H74
NW
1/2 - 1 Mile
Higher**

TX WELLS TXMON5000001474

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	1653	Well Type:	New Well
Proposed Use:	Domestic	Borehole Depth (ft):	285
Injurious Water Quality:	no	Plugging Rpt #:	Not Reported
Submitted Date:	2001-07-25	Owner Name:	Grabiell Estrada
Well #:	Not Reported	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Domestic	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2001-07-17	Drill End Date:	2001-07-18
Seal Method:	Other - Tremmie	Seal Method Desc:	Tremmie
Dist to Septic/Other Contam:	N/A	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Sewer Not Installed
Approved by Variance:	Not Reported	Sealed by Driller:	Yes
Sealed by Name:	Not Reported	Surface Completion:	Alternative Procedure Used
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Jet	Pump Type Desc:	Not Reported
Pump Depth:	80.00	Chemical Analysis:	Not Reported
Injurious Water:	No	Company Name:	Goolsby Water Well
Driller Name:	George R Goolsby	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	1765	Apprentice Reg #:	Not Reported

Details Reports For:	Well Bore Hole	Diameter:	5
Top Depth:	0	Bottom Depth:	290
Details Reports For:	Well Drilling Method	Drill Method:	Mud (Hydraulic) Rotary
Details Reports For:	Well Completion	Borehole Completion:	Straight Wall

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	100	Annular Seal:	10
Amount:	Not Reported	Unit:	Not Reported

Details Reports For:	Well Levels	Measurement:	41
Measurement Date:	2001-07-16	Artesian Flow:	Not Reported
Measurement Method:	Unknown		

Details Reports For:	Well Packers	Migrated Sort #:	1
Packers:	Rubber Shale 270, 250, 100		
Depth:	Not Reported		

Details Reports For:	Well Packers	Migrated Sort #:	2
Packers:	Wash Valve 280	Depth:	Not Reported

Details Reports For:	Well Test	Test Type:	Jetted
Yield:	30	Drawdown:	N/A
Hours:	N/A		

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	25
Lithology:	Top Soil and Clay Black/Red		

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	25	Bottom Depth:	55
Lithology:	Fine Sand Gray		

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	55	Bottom Depth:	120
Lithology:	Clay Gray		

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	120	Bottom Depth:	140
Lithology:	Fine Sand Red		

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	140	Bottom Depth:	250
Lithology:	Clay Blue		

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	250	Bottom Depth:	280
Lithology:	Good Sand White		

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	280	Bottom Depth:	290
Lithology:	Clay Blue		

Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 New Plastic PVC 0-270 Sch 40		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 New PVC Slotted Screen .006 270-280 Sch 40		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

Details Reports For:	Well Casing	Migrated Sort #:	3
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 New PVC Tail Pipe 280-285 Sch 40		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

75
ENE
1/2 - 1 Mile
Lower

TX WELLS TXMON5000256652

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	260297	Well Type:	Replacement
Proposed Use:	Domestic	Borehole Depth (ft):	285
Injurious Water Quality:	no	Plugging Rpt #:	Not Reported

Submitted Date:	2011-07-21	Owner Name:	TOMMY COOK
Well #:	Not Reported	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	Replacement
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Domestic	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2011-05-22	Drill End Date:	2011-05-23
Seal Method:	Other - TREMMIE	Seal Method Desc:	TREMMIE
Dist to Septic/Other Contam:	100	Distance to Septic Tank:	Not Reported
Dist to Property Line:	10	Distance Verify Meth:	OWNER MEASURE
Approved by Variance:	Not Reported	Sealed by Driller:	Yes
Sealed by Name:	Not Reported	Surface Completion:	Surface Sleeve Installed
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Submersible	Pump Type Desc:	Not Reported
Pump Depth:	120.00	Chemical Analysis:	No
Injurious Water:	No	Company Name:	GOOLSBY W.W.
Driller Name:	George R Goolsby	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	1765	Apprentice Reg #:	Not Reported

Details Reports For:	Well Bore Hole	Diameter:	7
Top Depth:	0	Bottom Depth:	290

Details Reports For:	Well Drilling Method	Drill Method:	Mud (Hydraulic) Rotary

Details Reports For:	Well Completion	Borehole Completion:	Straight Wall

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	100	Annular Seal:	12 P 2 RM
Amount:	Not Reported	Unit:	Not Reported

Details Reports For:	Well Levels	Measurement:	36
Measurement Date:	2011-05-23	Artesian Flow:	Not Reported
Measurement Method:	Unknown		

Details Reports For:	Well Packers	Migrated Sort #:	1
Packers:	SHALE 268 - 248 - 100	Depth:	Not Reported

Details Reports For:	Well Packers	Migrated Sort #:	2
Packers:	WASH VALVE @278	Depth:	Not Reported

Details Reports For:	Well Test	Test Type:	Jetted
Yield:	80	Drawdown:	Not Reported
Hours:	Not Reported		

Details Reports For:	Well Strata	Migrated Strata Depth:	236 TO 280
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Water Type:	GOOD		

Details Reports For:	Well Lithology	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	0-43 CLAY		

Details Reports For:	Well Lithology	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	43-67 SAND		

Details Reports For:	Well Lithology	Migrated Sort #:	3
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	67 -115 CLAY		

Details Reports For:	Well Lithology	Migrated Sort #:	4
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	115 -137 SAND		

Details Reports For:	Well Lithology	Migrated Sort #:	5
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	137-236 CLAY		

Details Reports For:	Well Lithology	Migrated Sort #:	6
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	236-280 SAND		

Details Reports For:	Well Lithology	Migrated Sort #:	7
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	280-285 CLAY T.D.		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	4 N PVC CASING +2 TO 268 SCH. 40		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	4 N PVC SCREEN 268 TO 278 SCH. 40 SLOT .008		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

Details Reports For:	Well Casing	Migrated Sort #:	3
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	4 N PVC BLANK 278 TO 285	Diameter:	Not Reported
Casing Status:	Not Reported	Casing Material:	Not Reported
Casing Type:	Not Reported	Schedule:	Not Reported
Gauge:	Not Reported		

**H76
NW
1/2 - 1 Mile
Higher**

TX WELLS TXDOL2000018253

Database:	Well Report Database	Fid:	18252
Rec id:	18253	Edr site i:	1653
Owner:	Grabiel Estrada	Ownerwell:	No Data
Address:	2600 CR 543, Angleton , TX 77515	Grid:	65-53-8
Waddress:	2600 CR 543, Angleton , TX 77422	Lat:	29 09 23 N
County:	Brazoria	Long:	095 26 06 W
Elevation:	No Data	Gpsused:	Map Tech
Typeofwork:	New Well	Propuse:	Domestic
Sdate:	Not Reported	Completedd:	Not Reported
Diameter:	5 in From Surface To 285 ft	Dmethod:	Mud Rotary
Bcompletio:	Straight Wall	Packedfrom:	Not Reported
Packsize:	Not Reported		
Finterval:	From 0 ft to 100 ft with 10 (#sacks and material)		
Sinterval:	No Data	Tinterval:	No Data
Usedmethod:	Tremmie	Cementedby:	Goolsby Water Well
Contaminat:	N/A ft	Propertyli:	No Data
Verrimetho:	Sewer Not Installed	Varriance:	No Data
Surface:	Alternative Procedure Used	Staticleve:	41 ft. below land surface on 7/16/2001
Flow:	No Data	Packers:	Rubber Shale 270, 250, 100
Cementinwe:	No Data	Typepump:	Jet
Pumpbowl:	80 ft	Welltests:	Jetted
Yield:	30 GPM with N/A ft drawdown after N/A hour		
Watertype:	No Data	Stratadept:	No Data
Chemicalma:	No Data	Undesirabl:	No
Companynam:	Goolsby Water Well	Companyadd:	Rt. 4, 103 Burnett
Ccitystate:	Brazoria , TX 77422	Licensenum:	1765
Wsignature:	Ronnie Goolsby	Dsignature:	No Data
Regnum:	No Data	Comments:	no data
Site id:	TXDOL2000018253		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

I77
South
1/2 - 1 Mile
Lower

TX WELLS TXMON5000230838

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	234071	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	20
Injurious Water Quality:	Not Reported	Plugging Rpt #:	Not Reported
Submitted Date:	2010-10-28	Owner Name:	Groendyke Transport Inc.
Well #:	MW-5	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2010-08-24	Drill End Date:	2010-08-24
Seal Method:	Other - handmix	Seal Method Desc:	handmix
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	No
Sealed by Name:	MEDI	Surface Completion:	Surface Slab Installed
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	Mathers Environmental Drilling Inc.
Driller Name:	Shannon Mathers	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	54933	Apprentice Reg #:	Not Reported
Details Reports For:	Well Bore Hole	Diameter:	8
Top Depth:	0	Bottom Depth:	20
Details Reports For:	Well Drilling Method	Drill Method:	Hollow Stem Auger
Details Reports For:	Well Completion	Borehole Completion:	Other - 20/40 sand
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	1	Annular Seal:	1, concrete
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	1
Bottom Depth:	3	Annular Seal:	1,bent. chips
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	3
Bottom Depth:	20	Annular Seal:	11,sand
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Packers	Migrated Sort #:	1
Packers:	bentonite chips 3 - 1	Depth:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	.5
Lithology:	silt, sandy gray		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	.5	Bottom Depth:	1.5
Lithology:	silt		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	1.5	Bottom Depth:	2
Lithology:	silt clayey brown		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	2	Bottom Depth:	6.5
Lithology:	clay		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	6.5	Bottom Depth:	7
Lithology:	silt, clayey		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	7	Bottom Depth:	20
Lithology:	sand		
Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 new sch. 40 pvc screen 20 - 5 0.010 slot		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported
Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 new sch. 40 pvc riser 5 - 0		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

I78
South
1/2 - 1 Mile
Lower

TX WELLS TXMON5000230840

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	234073	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	20
Injurious Water Quality:	Not Reported	Plugging Rpt #:	Not Reported
Submitted Date:	2010-10-28	Owner Name:	Groendyke Transport Inc.
Well #:	MW-6	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2010-08-24	Drill End Date:	2010-08-24
Seal Method:	Other - handmix	Seal Method Desc:	handmix
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	No
Sealed by Name:	MEDI	Surface Completion:	Surface Slab Installed
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	Mathers Environmental Drilling Inc.
Driller Name:	Shannon Mathers	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	54933	Apprentice Reg #:	Not Reported
Details Reports For:	Well Bore Hole	Diameter:	8
Top Depth:	0	Bottom Depth:	20
Details Reports For:	Well Drilling Method	Drill Method:	Hollow Stem Auger
Details Reports For:	Well Completion	Borehole Completion:	Other - 20/40 sand
Details Reports For:	Well Seal Range	Top Depth:	3
Bottom Depth:	20	Annular Seal:	11,sand
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	1	Annular Seal:	1, concrete
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	1
Bottom Depth:	3	Annular Seal:	1,bent. chips
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Packers	Migrated Sort #:	1
Packers:	bentonite chips 3 - 1	Depth:	Not Reported
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	1.5
Lithology:	black silt		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	1.5	Bottom Depth:	7.5
Lithology:	brown clay		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	7.5	Bottom Depth:	9.5
Lithology:	sand		
Details Reports For:	Well Lithology	Migrated Sort #:	0

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Top Depth:	9.5	Bottom Depth:	9.8
Lithology:	clay		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	9.8	Bottom Depth:	20
Lithology:	sand		
Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 new sch. 40 pvc screen 20 - 5 0.010 slot		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported
Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 new sch. 40 pvc riser 5 - 0		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

J79
SSE
1/2 - 1 Mile
Lower

TX WELLS TXDOL2000016306

Database:	Well Report Database	Fid:	16305
Rec id:	16304	Edr site i:	92060
Owner:	Raul & Brenda Cancino	Ownerwell:	No Data
Address:	1526 Shanks, Angleton , TX 77515	Grid:	65-53-8
Waddress:	1526 Shanks, Angleton , TX 77515	Lat:	29 08 37 N
County:	Brazoria	Long:	095 25 30 W
Elevation:	No Data	Gpsused:	Magellan
Typeofwork:	New Well	Propuse:	Injection
Sdate:	Not Reported	Completedd:	Not Reported
Diameter:	4 in From Surface To 230 ft	Dmethod:	Mud Rotary
Bcompletio:	Straight Wall	Packedfrom:	Not Reported
Packsize:	Not Reported		
Finterval:	From 0 ft to 230 ft with 35 (#sacks and material)		
Sinterval:	No Data	Tinterval:	No Data
Usedmethod:	Pressured Grout Benseal EZ Mud	Cementedby:	William McPike
Contaminat:	No Data	Propertyli:	No Data
Verrimetho:	No Data	Varriance:	No Data
Surface:	No Data	Staticleve:	No Data
Flow:	No Data	Packers:	No Data
Cementinwe:	No Data	Typepump:	No Data
Pumpbowl:	Not Reported	Welltests:	No Data
Yield:	Not Reported	Watertype:	No Data
Stratadept:	No Data	Chemicalma:	No Data
Undesirabl:	No Data	Companynam:	Geothermal Drilling, Inc.
Companyadd:	8840 Highway 75 South	Ccitystate:	Huntsville , TX 77340
Licensenum:	3166	Wsignature:	William McPike
Dsignature:	Jose Lira	Regnum:	00001791
Comments:	no data	Site id:	TXDOL2000016306

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

J80
SSE
1/2 - 1 Mile
Lower

TX WELLS TXMON5000090501

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	92060	Well Type:	New Well
Proposed Use:	Injection	Borehole Depth (ft):	230
Injurious Water Quality:	Not Reported	Plugging Rpt #:	Not Reported
Submitted Date:	2006-09-07	Owner Name:	Raul & Brenda Cancino
Well #:	Not Reported	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Injection	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2006-08-31	Drill End Date:	2006-09-02
Seal Method:	Other - Pressured Grout Benseal EZ Mud		
Seal Method Desc:	Pressured Grout Benseal EZ Mud		
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	Yes
Sealed by Name:	Not Reported	Surface Completion:	Unknown
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	Geothermal Drilling, Inc.
Driller Name:	William Charles McPike	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	3166	Apprentice Reg #:	00001791
Details Reports For:	Well Bore Hole	Diameter:	4
Top Depth:	0	Bottom Depth:	230
Details Reports For:	Well Drilling Method	Drill Method:	Mud (Hydraulic) Rotary
Details Reports For:	Well Completion	Borehole Completion:	Straight Wall
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	230	Annular Seal:	35
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Lithology	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	0-3 Black Land		
Details Reports For:	Well Lithology	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	3-23 Red Clay		
Details Reports For:	Well Lithology	Migrated Sort #:	3
Top Depth:	Not Reported	Bottom Depth:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Lithology: 23-75 Sandy Clay

Details Reports For:	Well Lithology	Migrated Sort #:	4
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	75-100 Red Clay		

Details Reports For:	Well Lithology	Migrated Sort #:	5
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	100-140 Sandy Gray Clay		

Details Reports For:	Well Lithology	Migrated Sort #:	6
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	140-190 Sand		

Details Reports For:	Well Lithology	Migrated Sort #:	7
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	190-230 Gray Clay		

Details Reports For:	Well Lithology	Migrated Sort #:	8
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	7 Bore Holes		

**I81
South
1/2 - 1 Mile
Lower**

TX WELLS TXMON5000214167

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	217245	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	20
Injurious Water Quality:	Not Reported	Plugging Rpt #:	Not Reported

Submitted Date:	2010-05-24	Owner Name:	Groendyke Transport Inc.
Well #:	MW-2	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2010-05-19	Drill End Date:	2010-05-19
Seal Method:	Other - tremie pipe	Seal Method Desc:	tremie pipe
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	No
Sealed by Name:	medi	Surface Completion:	Surface Slab Installed
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	MATHERS ENVIRONMENTAL DRILLING IN
Driller Name:	Patrick L Stephens	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	4850	Apprentice Reg #:	Not Reported

Details Reports For:	Well Bore Hole	Diameter:	8

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Top Depth:	0	Bottom Depth:	20
Details Reports For:	Well Drilling Method	Drill Method:	Hollow Stem Auger
Details Reports For:	Well Completion	Borehole Completion:	Other - 20/40 sand
Details Reports For: Bottom Depth: Amount:	Well Seal Range 1 Not Reported	Top Depth: Annular Seal: Unit:	0 concrete 1 Not Reported
Details Reports For: Bottom Depth: Amount:	Well Seal Range 3 Not Reported	Top Depth: Annular Seal: Unit:	1 bent. chips 1 Not Reported
Details Reports For: Bottom Depth: Amount:	Well Seal Range 20 Not Reported	Top Depth: Annular Seal: Unit:	3 10 20/40 sand Not Reported
Details Reports For: Packers:	Well Packers bentonite chips 1-3	Migrated Sort #: Depth:	1 Not Reported
Details Reports For: Top Depth: Lithology:	Well Lithology Not Reported 0-9" concrete	Migrated Sort #: Bottom Depth:	1 Not Reported
Details Reports For: Top Depth: Lithology:	Well Lithology Not Reported 9"-1 -Stabilized material with gravel and shell	Migrated Sort #: Bottom Depth:	2 Not Reported
Details Reports For: Top Depth: Lithology:	Well Lithology Not Reported 1-9.5 Clay, olive brown to gray	Migrated Sort #: Bottom Depth:	3 Not Reported
Details Reports For: Top Depth: Lithology:	Well Lithology Not Reported 9.5-10 sand, olive brown	Migrated Sort #: Bottom Depth:	4 Not Reported
Details Reports For: Top Depth: Lithology:	Well Lithology Not Reported 10-20 sand yellowish brown	Migrated Sort #: Bottom Depth:	5 Not Reported
Details Reports For: Top Depth: Migrated Casing Info: Diameter: Casing Material: Schedule:	Well Casing Not Reported 2 new sch. 40 pvc screen 15-0 0.010 slot Not Reported Not Reported Not Reported	Migrated Sort #: Bottom Depth: Casing Status: Casing Type: Gauge:	1 Not Reported Not Reported Not Reported Not Reported
Details Reports For:	Well Casing	Migrated Sort #:	2

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 new sch. 40 pvc riser 0-5	Casing Status:	Not Reported
Diameter:	Not Reported	Casing Type:	Not Reported
Casing Material:	Not Reported	Gauge:	Not Reported
Schedule:	Not Reported		

I82
South
1/2 - 1 Mile
Lower

TX WELLS TXMON5000214172

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	217250	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	20
Injurious Water Quality:	Not Reported	Plugging Rpt #:	Not Reported

Submitted Date:	2010-05-24	Owner Name:	Groendyke Transport Inc.
Well #:	MW-3	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2010-05-19	Drill End Date:	2010-05-19
Seal Method:	Other - tremie pipe	Seal Method Desc:	tremie pipe
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	No
Sealed by Name:	medi	Surface Completion:	Surface Slab Installed
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	MATHERS ENVIRONMENTAL DRILLING IN
Driller Name:	Patrick L Stephens	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	4850	Apprentice Reg #:	Not Reported

Details Reports For:	Well Bore Hole	Diameter:	8
Top Depth:	0	Bottom Depth:	20

Details Reports For:	Well Drilling Method	Drill Method:	Hollow Stem Auger

Details Reports For:	Well Completion	Borehole Completion:	Other - 20/40 sand

Details Reports For:	Well Seal Range	Top Depth:	1
Bottom Depth:	3	Annular Seal:	bent. chips 1
Amount:	Not Reported	Unit:	Not Reported

Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	1	Annular Seal:	concrete 1
Amount:	Not Reported	Unit:	Not Reported

Details Reports For:	Well Seal Range	Top Depth:	3
Bottom Depth:	20	Annular Seal:	10 20/40 sand

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Amount:	Not Reported	Unit:	Not Reported
Details Reports For: Packers:	Well Packers bentonite chips 1-3	Migrated Sort #: Depth:	1 Not Reported
Details Reports For: Top Depth: Lithology:	Well Lithology Not Reported 0-7" concrete	Migrated Sort #: Bottom Depth:	1 Not Reported
Details Reports For: Top Depth: Lithology:	Well Lithology Not Reported 7"-1.5 silt, black	Migrated Sort #: Bottom Depth:	2 Not Reported
Details Reports For: Top Depth: Lithology:	Well Lithology Not Reported 1.5-7 Clay very dark gray to gray	Migrated Sort #: Bottom Depth:	3 Not Reported
Details Reports For: Top Depth: Lithology:	Well Lithology Not Reported 7-20 sand, light brownish gray to yellowish brown	Migrated Sort #: Bottom Depth:	4 Not Reported
Details Reports For: Top Depth: Migrated Casing Info: Diameter: Casing Material: Schedule:	Well Casing Not Reported 2 new sch. 40 pvc screen 15-0 0.010 slot Not Reported Not Reported Not Reported	Migrated Sort #: Bottom Depth: Casing Status: Casing Type: Gauge:	1 Not Reported Not Reported Not Reported Not Reported
Details Reports For: Top Depth: Migrated Casing Info: Diameter: Casing Material: Schedule:	Well Casing Not Reported 2 new sch. 40 pvc riser 0-5 Not Reported Not Reported Not Reported	Migrated Sort #: Bottom Depth: Casing Status: Casing Type: Gauge:	2 Not Reported Not Reported Not Reported Not Reported

183
South
1/2 - 1 Mile
Lower

TX WELLS TXMON5000214174

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	217252	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	20
Injurious Water Quality:	Not Reported	Plugging Rpt #:	Not Reported
Submitted Date:	2010-05-24	Owner Name:	Groendyke Transport Inc.
Well #:	MW-4	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2010-05-19	Drill End Date:	2010-05-19

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Seal Method:	Other - tremie pipe	Seal Method Desc:	tremie pipe
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	No
Sealed by Name:	medi	Surface Completion:	Surface Slab Installed
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	MATHERS ENVIRONMENTAL DRILLING INC
Driller Name:	Patrick L Stephens	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	4850	Apprentice Reg #:	Not Reported
Details Reports For:	Well Bore Hole	Diameter:	8
Top Depth:	0	Bottom Depth:	20
Details Reports For:	Well Drilling Method	Drill Method:	Hollow Stem Auger
Details Reports For:	Well Completion	Borehole Completion:	Other - 20/40 sand
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	1	Annular Seal:	concrete 1
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	1
Bottom Depth:	3	Annular Seal:	bent. chips 1
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	3
Bottom Depth:	20	Annular Seal:	10 20/40 sand
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Packers	Migrated Sort #:	1
Packers:	bentonite chips 1-3	Depth:	Not Reported
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	5
Lithology:	Silt very dark gray		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	5	Bottom Depth:	10
Lithology:	clay, light brownish gray		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	10	Bottom Depth:	20
Lithology:	sand, light gray		
Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 new sch. 40 pvc screen 15-0 0.010 slot		
Diameter:	Not Reported	Casing Status:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported
Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 new sch. 40 pvc riser 0-5	Casing Status:	Not Reported
Diameter:	Not Reported	Casing Type:	Not Reported
Casing Material:	Not Reported	Gauge:	Not Reported
Schedule:	Not Reported		

84
NNW
1/2 - 1 Mile
Higher

TX WELLS TXMON5000374063

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	379239	Well Type:	New Well
Proposed Use:	Domestic	Borehole Depth (ft):	285
Injurious Water Quality:	no	Plugging Rpt #:	Not Reported
Submitted Date:	2014-10-28	Owner Name:	MARK WICKER
Well #:	1	# Wells Drilled:	Not Reported
Elevation:	10	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Domestic	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2014-10-24	Drill End Date:	2014-10-27
Seal Method:	Poured	Seal Method Desc:	Not Reported
Dist to Septic/Other Contam:	100+	Distance to Septic Tank:	Not Reported
Dist to Property Line:	50+	Distance Verify Meth:	TAPE
Approved by Variance:	Not Reported	Sealed by Driller:	Yes
Sealed by Name:	Not Reported	Surface Completion:	Surface Sleeve Installed
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Submersible	Pump Type Desc:	Not Reported
Pump Depth:	80.00	Chemical Analysis:	No
Injurious Water:	No	Company Name:	ANCHOR WATER WELL
Driller Name:	Christopher Davis	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	54841	Apprentice Reg #:	Not Reported
Details Reports For:	Well Bore Hole	Diameter:	7
Top Depth:	0	Bottom Depth:	290
Details Reports For:	Well Drilling Method	Drill Method:	Mud (Hydraulic) Rotary
Details Reports For:	Well Completion	Borehole Completion:	Straight Wall
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	10	Annular Seal:	10
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Levels	Measurement:	40
Measurement Date:	2014-10-27	Artesian Flow:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Measurement Method:	Unknown		
Details Reports For: Packers:	Well Packers RUBBER 10	Migrated Sort #: Depth:	1 Not Reported
Details Reports For: Packers:	Well Packers RUBBER 262	Migrated Sort #: Depth:	2 Not Reported
Details Reports For: Yield: Hours:	Well Test 100 Not Reported	Test Type: Drawdown:	Jetted Not Reported
Details Reports For: Top Depth: Lithology:	Well Lithology 0 CLAY	Migrated Sort #: Bottom Depth:	0 250
Details Reports For: Top Depth: Lithology:	Well Lithology 250 SAND	Migrated Sort #: Bottom Depth:	0 280
Details Reports For: Top Depth: Migrated Casing Info: Casing Status: Casing Type: Gauge:	Well Casing Not Reported 4 NEW PVC 262 - 282 008 Not Reported Not Reported Not Reported	Migrated Sort #: Bottom Depth: Diameter: Casing Material: Schedule:	1 Not Reported Not Reported Not Reported Not Reported

**K85
NW
1/2 - 1 Mile
Higher**

TX WELLS TXPLU5000100254

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	3538	Well Type:	Monitor
Borehole Depth (ft):	18	Well Report #:	Not Reported
Details Reports For: Owner Name: # Wells Plugged: Original Company Name: Original License #: Original Drill Date: Plug Method: Plug Date: Company Name: Driller License: Comments:	Plug Data Diamond Shamrock Not Reported Not Reported 3129 1996-10-07 Tremmie pipe cement from bottom to top 2001-05-02 Can-Tex Services 3129 logged by TF	Submitted Date: Well #: Elevation: Original Driller: Original Well Use: Variance #: Plugging Name: Apprentice Reg #: Comments:	2001-10-11 Not Reported Not Reported Can-Tex Monitor Not Reported Ed Gay Not Reported Not Reported
Details Reports For: Top Depth:	Plug Bore Hole Not Reported	Diameter: Bottom Depth:	10 18

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Plug Casing	Top Depth:	0
Bottom Depth:	0	Diameter:	10
Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	18	Plug Seal:	6
Amount:	Not Reported	Unit:	Not Reported

L86
North
1/2 - 1 Mile
Higher

TX WELLS TXMON5000009852

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	10407	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	18
Injurious Water Quality:	no	Plugging Rpt #:	Not Reported
Submitted Date:	2002-08-18	Owner Name:	Texas Department of Public Safety
Well #:	MW-6	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2002-07-30	Drill End Date:	2002-07-30
Seal Method:	Hand Mixed	Seal Method Desc:	Not Reported
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	Yes
Sealed by Name:	Not Reported	Surface Completion:	Surface Slab Installed
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	No		
Company Name:	dba Universal Drilling Services Company		
Driller Name:	Eddie Lee Kenebrew	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	3022	Apprentice Reg #:	Not Reported
Details Reports For:	Well Bore Hole	Diameter:	8.25
Top Depth:	0	Bottom Depth:	18
Details Reports For:	Well Drilling Method	Drill Method:	Hollow Stem Auger
Details Reports For:	Well Completion	Borehole Completion:	Filter Packed
Details Reports For:	Well Filter	Filter Material:	Gravel
Top Depth:	1.5	Bottom Depth:	18
Size:	Not Reported		
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	.5	Annular Seal:	1/2sackcr
Amount:	Not Reported	Unit:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For: Packers: Depth:	Well Packers Hole Plug Benetonite 1.5 to 0.5' Not Reported	Migrated Sort #: Bottom Depth:	1 0 .5
Details Reports For: Top Depth: Lithology:	Well Lithology 0 Grass, soil	Migrated Sort #: Bottom Depth:	0 8
Details Reports For: Top Depth: Lithology:	Well Lithology .5 Clay, gray, plastic, silty, grades to tan to red, sandy below 4	Migrated Sort #: Bottom Depth:	0 8
Details Reports For: Top Depth: Lithology:	Well Lithology 8 Sand, tan, fine grained, well sorted, unconsolidated, wet silty	Migrated Sort #: Bottom Depth:	0 18
Details Reports For: Top Depth: Migrated Casing Info: Diameter: Casing Material: Schedule:	Well Casing Not Reported 2" New PVC 0.010 18' to 2.5' Screen Not Reported Not Reported Not Reported	Migrated Sort #: Bottom Depth: Casing Status: Casing Type: Gauge:	1 Not Reported Not Reported Not Reported Not Reported
Details Reports For: Top Depth: Migrated Casing Info: Diameter: Casing Material: Schedule:	Well Casing Not Reported 2" New PVC Schedule 40 2.5' to 0' Casing Not Reported Not Reported Not Reported	Migrated Sort #: Bottom Depth: Casing Status: Casing Type: Gauge:	2 Not Reported Not Reported Not Reported Not Reported

**L87
North
1/2 - 1 Mile
Higher**

TX WELLS TXMON5000009853

Database: Well Rpt #: Proposed Use: Injurious Water Quality:	Submitted Drillers Reports Database (Monitoring) 10408 Environmental Soil Boring no	Well Type: Borehole Depth (ft): Plugging Rpt #:	Unknown 18 Not Reported
Submitted Date: Well #: Elevation: Work Type Desc: Proposed Use: TCEQ Approved Plans: Drill Start Date: Seal Method: Dist to Septic/Other Contam: Dist to Property Line: Approved by Variance: Sealed by Name: Surf Complete Desc: Pump Type:	2002-08-18 B-7 Not Reported Not Reported Environmental Soil Boring Not Reported 2002-07-30 Not Applicable Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported	Owner Name: # Wells Drilled: Type of Work: Original Well Rpt Track #: Proposed Use Desc: PWS #: Drill End Date: Seal Method Desc: Distance to Septic Tank: Distance Verify Meth: Sealed by Driller: Surface Completion: Completed by Driller: Pump Type Desc:	Texas Department of Public Safety Not Reported Unknown Not Reported Not Reported Not Reported 2002-07-30 Not Reported Not Reported Not Reported No Unknown Not Reported Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	No		
Company Name:	dba Universal Drilling Services Company		
Driller Name:	Eddie Lee Kenebrew	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	3022	Apprentice Reg #:	Not Reported

Details Reports For:	Well Bore Hole	Diameter:	8.25
Top Depth:	0	Bottom Depth:	18

Details Reports For:	Well Drilling Method	Drill Method:	Hollow Stem Auger

Details Reports For:	Well Completion	Borehole Completion:	Filter Packed

Details Reports For:	Well Filter	Filter Material:	Gravel
Top Depth:	0	Bottom Depth:	18
Size:	Not Reported		

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	.5
Lithology:	Grass, soil		

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	.5	Bottom Depth:	7
Lithology:	Clay, gray to tan, plastic, silty, iron coloration		

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	7	Bottom Depth:	18
Lithology:	Sand, tan to gray, fine grained, well sorted, unconsolidated, silty, wet below 8		

L88
North
1/2 - 1 Mile
Higher

TX WELLS TXDOL2000018034

Database:	Well Report Database	Fid:	18033
Rec id:	18021	Edr site i:	10408
Owner:	Texas Department of Public Safety	Ownerwell:	B-7
Address:	P. O. Box 4087, Austin , TX 78773	Grid:	65-53-8
Waddress:	501 Velasco, Angleton , TX	Lat:	29 09 38 N
County:	Brazoria	Long:	095 25 52 W
Elevation:	No Data	Gpsused:	No Data
Typeofwork:	No Data	Propuse:	Environmental Soil Boring
Sdate:	Not Reported	Completedd:	Not Reported
Diameter:	8 1/4 in From Surface To 18 ft	Dmethod:	Hollow Stem Auger
Bcompletio:	Not Reported	Packedfrom:	18 ft to 0.0 ft
Packsize:	Not Reported	Finterval:	No Data
Sinterval:	No Data	Tinterval:	No Data
Usedmethod:	Not Reported	Cementedby:	Not Reported
Contaminat:	Not Reported	Propertyli:	Not Reported
Verrimetho:	Not Reported	Varriance:	Not Reported
Surface:	No Data	Staticleve:	No Data
Flow:	No Data	Packers:	No Data

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Cementinwe:	No Data	Typepump:	No Data
Pumpbowl:	Not Reported	Welltests:	No Data
Yield:	Not Reported	Watertype:	No Data
Stratadept:	No Data	Chemicalma:	No Data
Undesirabl:	No	Companynam:	dba Universal Drilling Services Company
Companyadd:	3532 Maggie Boulevard	Ccitystate:	Orlando , FL 32811
Licensenum:	3022	Wsignature:	Eddie Kenebrew
Dsignature:	No Data	Regnum:	No Data
Comments:	no data	Site id:	TXDOL2000018034

L89
North
1/2 - 1 Mile
Higher

TX WELLS TXDOL2000018035

Database:	Well Report Database	Fid:	18034
Rec id:	18022	Edr site i:	10407
Owner:	Texas Department of Public Safety	Ownerwell:	MW-6
Address:	P. O. Box 4087, Austin , TX 78773	Grid:	65-53-8
Waddress:	501 Velasco, Angleton , TX	Lat:	29 09 38 N
County:	Brazoria	Long:	095 25 52 W
Elevation:	No Data	Gpsused:	No Data
Typeofwork:	New Well	Propuse:	Monitor
Sdate:	Not Reported	Completedd:	Not Reported
Diameter:	8 1/4 in From Surface To 18 ft	Dmethod:	Hollow Stem Auger
Bcompletio:	Not Reported	Packedfrom:	18 ft to 1.5 ft
Packsize:	Not Reported		
Finterval:	From 0.5 ft to 0 ft with 1/2sackcr (#sacks and material)		
Sinterval:	No Data	Tinterval:	No Data
Usedmethod:	Hand Mixed	Cementedby:	Eddie Kenebrew
Contaminat:	No Data	Propertyli:	No Data
Verrimetho:	No Data	Varriance:	No Data
Surface:	Surface Slab Installed	Staticleve:	No Data
Flow:	No Data	Packers:	Hole Plug Benetonite 1.5 to 0.5
Cementinwe:	No Data	Typepump:	No Data
Pumpbowl:	Not Reported	Welltests:	No Data
Yield:	Not Reported	Watertype:	No Data
Stratadept:	No Data	Chemicalma:	No Data
Undesirabl:	No	Companynam:	dba Universal Drilling Services Company
Companyadd:	3532 Maggie Boulevard	Ccitystate:	Orlando , FL 32811
Licensenum:	3022	Wsignature:	Eddie Kenebrew
Dsignature:	No Data	Regnum:	No Data
Comments:	no data	Site id:	TXDOL2000018035

K90
NW
1/2 - 1 Mile
Higher

TX WELLS TXMON5000020445

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	21209	Well Type:	New Well
Proposed Use:	Domestic	Borehole Depth (ft):	460
Injurious Water Quality:	no	Plugging Rpt #:	Not Reported
Submitted Date:	2003-06-05	Owner Name:	PAUL HORTON
Well #:	Not Reported	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Domestic	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2003-06-03	Drill End Date:	2003-06-03
Seal Method:	Tremie	Seal Method Desc:	Not Reported
Dist to Septic/Other Contam:	N/A	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	NO SEPTIC
Approved by Variance:	Not Reported	Sealed by Driller:	Yes
Sealed by Name:	Not Reported	Surface Completion:	Alternative Procedure Used
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Jet	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	No	Company Name:	RONNIE GOOLSBY WATER WELL
Driller Name:	George R Goolsby	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	1765	Apprentice Reg #:	Not Reported
Details Reports For:	Well Bore Hole	Diameter:	5
Top Depth:	0	Bottom Depth:	460
Details Reports For:	Well Drilling Method	Drill Method:	Mud (Hydraulic) Rotary
Details Reports For:	Well Completion	Borehole Completion:	Straight Wall
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	100	Annular Seal:	14
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Levels	Measurement:	56
Measurement Date:	2003-06-03	Artesian Flow:	Not Reported
Measurement Method:	Unknown		
Details Reports For:	Well Packers	Migrated Sort #:	1
Packers:	RUBBER 100	Depth:	Not Reported
Details Reports For:	Well Packers	Migrated Sort #:	2
Packers:	RUBBER 372	Depth:	Not Reported
Details Reports For:	Well Packers	Migrated Sort #:	3
Packers:	RUBBER 392	Depth:	Not Reported
Details Reports For:	Well Packers	Migrated Sort #:	4
Packers:	PVC WASH VALVE 402	Depth:	Not Reported
Details Reports For:	Well Test	Test Type:	Jetted
Yield:	25	Drawdown:	Not Reported
Hours:	Not Reported		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	200
Lithology:	SURFACE SOIL		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	200	Bottom Depth:	230
Lithology:	SAND GOOD		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	230	Bottom Depth:	290
Lithology:	CLAY DARK		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	290	Bottom Depth:	310
Lithology:	SAND GOOD WHITE		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	310	Bottom Depth:	340
Lithology:	CLAY DARK		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	340	Bottom Depth:	350
Lithology:	SAND GOOD		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	350	Bottom Depth:	410
Lithology:	CLAY DARK		
Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 NEW/PVC CASING +2 TO 445 SCH 40		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported
Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 NEW/PVC SCREEN 445 TO 455 .006/REG/SLOT/SCH 40		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported
Details Reports For:	Well Casing	Migrated Sort #:	3
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 NEW/PVC TAILPIPE 455 TO 460 SCH 40		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

**K91
NW
1/2 - 1 Mile
Higher**

TX WELLS TXDOL2000017815

Database:	Well Report Database	Fid:	17814
Rec id:	17808	Edr site i:	21209

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Owner:	PAUL HORTON	Ownerwell:	No Data
Address:	213 JAMISON, ANGLETON , TX 77515	Grid:	65-53-8
Waddress:	213 JAMISON, ANGLETON , TX 77515	Lat:	29 09 25 N
County:	Brazoria	Long:	095 26 19 W
Elevation:	No Data	Gpsused:	MAPTECH
Typeofwork:	New Well	Propuse:	Domestic
Sdate:	Not Reported	Completedd:	Not Reported
Diameter:	5 in From Surface To 460 ft	Dmethod:	Mud Rotary
Bcompletio:	Straight Wall	Packedfrom:	Not Reported
Packsize:	Not Reported		
Finterval:	From 0 ft to 100 ft with 14 (#sacks and material)		
Sinterval:	No Data	Tinterval:	No Data
Usedmethod:	TREMIE	Cementedby:	DRILLER
Contaminat:	N/A ft	Propertyli:	No Data
Verrimetho:	NO SEPTIC	Variance:	No Data
Surface:	Alternative Procedure Used	Staticleve:	56 ft. below land surface on 6/3/2003
Flow:	No Data	Packers:	RUBBER 100
Cementinwe:	No Data	Typepump:	Jet
Pumpbowl:	(No Data) ft	Welltests:	Jetted
Yield:	25 GPM with (No Data) ft drawdown after (No Data) hours		
Watertype:	No Data	Stratadept:	No Data
Chemicalma:	No Data	Undesirabl:	No
Companynam:	RONNIE GOOLSBY WATER WELL	Companyadd:	103 BURNETT ST.
Ccitystate:	BRAZORIA , TX 77422	Licenseum:	1765
Wsignature:	RONNIE GOOLSBY	Dsignature:	No Data
Regnum:	No Data	Comments:	no data
Site id:	TXDOL2000017815		

**K92
NW
1/2 - 1 Mile
Higher**

TX WELLS TXMON5000071135

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	72425	Well Type:	New Well
Proposed Use:	Domestic	Borehole Depth (ft):	455
Injurious Water Quality:	no	Plugging Rpt #:	Not Reported

Submitted Date:	2005-12-16	Owner Name:	MICHAEL BENNETT
Well #:	Not Reported	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Domestic	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2005-10-29	Drill End Date:	2005-10-29
Seal Method:	Other - TREMMIE	Seal Method Desc:	TREMMIE
Dist to Septic/Other Contam:	NO SEWER	Distance to Septic Tank:	Not Reported
Dist to Property Line:	30	Distance Verify Meth:	TAPE
Approved by Variance:	Not Reported	Sealed by Driller:	Yes
Sealed by Name:	Not Reported	Surface Completion:	Surface Sleeve Installed
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Submersible	Pump Type Desc:	Not Reported
Pump Depth:	147.00	Chemical Analysis:	No
Injurious Water:	No	Company Name:	RONNIE GOOLSBY WATER WELL SERVICE
Driller Name:	George R Goolsby	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	1765	Apprentice Reg #:	1509

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For: Top Depth:	Well Bore Hole 0	Diameter: Bottom Depth:	7 200
Details Reports For: Top Depth:	Well Bore Hole 200	Diameter: Bottom Depth:	5 460
Details Reports For:	Well Drilling Method	Drill Method:	Mud (Hydraulic) Rotary
Details Reports For:	Well Completion	Borehole Completion:	Straight Wall
Details Reports For: Bottom Depth: Amount:	Well Seal Range 100 Not Reported	Top Depth: Annular Seal: Unit:	0 11 Not Reported
Details Reports For: Measurement Date: Measurement Method:	Well Levels 2005-10-29 Unknown	Measurement: Artesian Flow:	49 Not Reported
Details Reports For: Packers:	Well Packers RUBBER SHALE 435-415-315	Migrated Sort #: Depth:	1 Not Reported
Details Reports For: Packers:	Well Packers WASH VALVE 445	Migrated Sort #: Depth:	2 Not Reported
Details Reports For: Yield: Hours:	Well Test 60 Not Reported	Test Type: Drawdown:	Jetted Not Reported
Details Reports For: Top Depth: Water Type:	Well Strata Not Reported FRESH	Migrated Strata Depth: Bottom Depth:	417-449 Not Reported
Details Reports For: Top Depth: Lithology:	Well Lithology Not Reported 0-3 SURFACE SOIL	Migrated Sort #: Bottom Depth:	1 Not Reported
Details Reports For: Top Depth: Lithology:	Well Lithology Not Reported 3-65 CLAY	Migrated Sort #: Bottom Depth:	2 Not Reported
Details Reports For: Top Depth: Lithology:	Well Lithology Not Reported 65-90 SAND	Migrated Sort #: Bottom Depth:	3 Not Reported
Details Reports For: Top Depth: Lithology:	Well Lithology Not Reported 90-203 CLAY	Migrated Sort #: Bottom Depth:	4 Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For: Top Depth: Lithology:	Well Lithology Not Reported 203-218 SAND	Migrated Sort #: Bottom Depth:	5 Not Reported
Details Reports For: Top Depth: Lithology:	Well Lithology Not Reported 218-417 CLAY	Migrated Sort #: Bottom Depth:	6 Not Reported
Details Reports For: Top Depth: Lithology:	Well Lithology Not Reported 417-449 SAND	Migrated Sort #: Bottom Depth:	7 Not Reported
Details Reports For: Top Depth: Lithology:	Well Lithology Not Reported 449-455 CLAY	Migrated Sort #: Bottom Depth:	8 Not Reported
Details Reports For: Top Depth: Lithology:	Well Lithology Not Reported 455 TD	Migrated Sort #: Bottom Depth:	9 Not Reported
Details Reports For: Top Depth: Migrated Casing Info: Diameter: Casing Material: Schedule:	Well Casing Not Reported 4 NEW PVC CASING +2 TO 200 SCH 40 Not Reported Not Reported Not Reported	Migrated Sort #: Bottom Depth: Casing Status: Casing Type: Gauge:	1 Not Reported Not Reported Not Reported Not Reported
Details Reports For: Top Depth: Migrated Casing Info: Diameter: Casing Material: Schedule:	Well Casing Not Reported 2 NEW PVC CASING 200 TO 435 SCH 40 Not Reported Not Reported Not Reported	Migrated Sort #: Bottom Depth: Casing Status: Casing Type: Gauge:	2 Not Reported Not Reported Not Reported Not Reported
Details Reports For: Top Depth: Migrated Casing Info: Diameter: Casing Material: Schedule:	Well Casing Not Reported 2 NEW PVC SCREEN 435 TO 445 .006 REG Not Reported Not Reported Not Reported	Migrated Sort #: Bottom Depth: Casing Status: Casing Type: Gauge:	3 Not Reported Not Reported Not Reported Not Reported
Details Reports For: Top Depth: Migrated Casing Info: Diameter: Casing Material: Schedule:	Well Casing Not Reported 2 NEW PVC TAIL PIPE 445 TO 455 SCH 40 Not Reported Not Reported Not Reported	Migrated Sort #: Bottom Depth: Casing Status: Casing Type: Gauge:	4 Not Reported Not Reported Not Reported Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

K93
NW
1/2 - 1 Mile
Higher

TX WELLS TXDOL2000016696

Database:	Well Report Database	Fid:	16695
Rec id:	16692	Edr site i:	72425
Owner:	MICHAEL BENNETT	Ownerwell:	No Data
Address:	203 MADISON AVENUE, CLUTE , TX 77531		
Grid:	65-53-8	Waddress:	BLACK OAK - CR 609, ANGLETON , TX 77515
Lat:	29 09 27 N	County:	Brazoria
Long:	095 26 18 W	Elevation:	No Data
Gpsused:	MAPTECH	Typeofwork:	New Well
Propuse:	Domestic	Sdate:	Not Reported
Completedd:	Not Reported	Diameter:	7 in From Surface To 200 ft
Dmethod:	Mud Rotary	Bcompleteio:	Straight Wall
Packedfrom:	Not Reported	Packsizes:	Not Reported
Finterval:	From 0 ft to 100 ft with 11 (#sacks and material)		
Sinterval:	No Data	Tinterval:	No Data
Usedmethod:	TREMMIE	Cementedby:	DRILLER
Contaminat:	NO SEWER ft	Propertyli:	30 ft
Verrimetho:	TAPE	Varriance:	No Data
Surface:	Surface Sleeve Installed	Staticleve:	49 ft. below land surface on 10/29/2005
Flow:	No Data	Packers:	RUBBER SHALE 435-415-315
Cementinwe:	No Data	Typepump:	Submersible
Pumpbowl:	147 ft	Welltests:	Jetted
Yield:	60 GPM with (No Data) ft drawdown after (No Data) hours		
Watertype:	FRESH	Stratadept:	417-449 ft.
Chemicalma:	No	Undesirabl:	No
Companynam:	RONNIE GOOLSBY WATER WELL SERVICE	Companyadd:	103 BURNETT STREET
Ccitystate:	BRAZORIA , TX 77422	Licensenum:	1765
Wsignature:	GEORGE R. GOOLSBY	Dsignature:	ROBBY GOOLSBY
Regnum:	1509	Comments:	no data
Site id:	TXDOL2000016696		

M94
WNW
1/2 - 1 Mile
Higher

TX WELLS TXPLU5000100252

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	3536	Well Type:	Monitor
Borehole Depth (ft):	18	Well Report #:	Not Reported
Details Reports For:	Plug Data	Submitted Date:	2001-10-11
Owner Name:	Diamond Shamrock	Well #:	Not Reported
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	Can-Tex
Original License #:	3129	Original Well Use:	Monitor
Original Drill Date:	1996-10-07		
Plug Method:	Tremmie pipe cement from bottom to top		
Plug Date:	2001-05-02	Variance #:	Not Reported
Company Name:	Can-Tex Services	Plugging Name:	Ed Gay
Driller License:	3129	Apprentice Reg #:	Not Reported
Comments:	logged by TF	Comments:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Plug Bore Hole	Diameter:	10
Top Depth:	Not Reported	Bottom Depth:	18
Details Reports For:	Plug Casing	Top Depth:	0
Bottom Depth:	0	Diameter:	10
Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	18	Plug Seal:	6
Amount:	Not Reported	Unit:	Not Reported

M95 West 1/2 - 1 Mile Higher

FED USGS USGS40001162291

Organization ID:	USGS-TX	Organization Name:	USGS Texas Water Science Center
Monitor Location:	BH-65-53-806	Type:	Well
Description:	Not Reported	HUC:	12040205
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Coastal lowlands aquifer system	Aquifer Type:	Not Reported
Formation Type:	Chicot Aquifer	Well Depth:	160
Construction Date:	Not Reported	Well Hole Depth:	Not Reported
Well Depth Units:	ft		
Well Hole Depth Units:	Not Reported		

M96 West 1/2 - 1 Mile Higher

TX WELLS TXWDB7000109991

Database:	Groundwater Database	Well #:	6553806
Primary Water Use:	Unused	Elevation:	26
Well Depth:	160	Observation Type:	None
Water Quality Review:	Y	Aquifer:	112CHCTU - Chicot Aquifer, Upper
Well Type:	Withdrawal of Water		

N97 SW 1/2 - 1 Mile Lower

TX WELLS TXMON5000170218

Database:	Submitted Drillers Reports Database (Monitoring)	Well Type:	New Well
Well Rpt #:	172882	Borehole Depth (ft):	265
Proposed Use:	Domestic	Plugging Rpt #:	Not Reported
Injurious Water Quality:	no		
Submitted Date:	2009-03-30	Owner Name:	David Daniels
Well #:	Not Reported	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Domestic	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Drill Start Date: 2004-08-23 Seal Method: Poured Dist to Septic/Other Contam: n/a Dist to Property Line: 50 Approved by Variance: Not Reported Sealed by Name: Not Reported Surf Complete Desc: Not Reported Pump Type: Submersible Pump Depth: 80.00 Injurious Water: No Driller Name: Christopher Davis Plugged within 48 hrs: No Driller License #: 54841	Drill End Date: 2004-08-23 Seal Method Desc: Not Reported Distance to Septic Tank: Not Reported Distance Verify Meth: tape Sealed by Driller: Yes Surface Completion: Surface Sleeve Installed Completed by Driller: Not Reported Pump Type Desc: Not Reported Chemical Analysis: No Company Name: Anchor Water Well Comments: \$scd Plugging Rpt Tracking #: Not Reported Apprentice Reg #: 57143, 1534
Details Reports For: Well Bore Hole Top Depth: 0	Diameter: 7 Bottom Depth: 270
Details Reports For: Well Drilling Method	Drill Method: Mud (Hydraulic) Rotary
Details Reports For: Well Completion	Borehole Completion: Straight Wall
Details Reports For: Well Seal Range Bottom Depth: 10 Amount: Not Reported	Top Depth: 0 Annular Seal: 12 cement Unit: Not Reported
Details Reports For: Well Levels Measurement Date: 2004-08-23 Measurement Method: Unknown	Measurement: 29 Artesian Flow: Not Reported
Details Reports For: Well Packers Packers: Rubber, 10' and 255'	Migrated Sort #: 1 Depth: Not Reported
Details Reports For: Well Test Yield: 100+ Hours: Not Reported	Test Type: Jetted Drawdown: Not Reported
Details Reports For: Well Lithology Top Depth: 0 Lithology: clay	Migrated Sort #: 0 Bottom Depth: 13
Details Reports For: Well Lithology Top Depth: 13 Lithology: sand	Migrated Sort #: 0 Bottom Depth: 55
Details Reports For: Well Lithology Top Depth: 55 Lithology: clay	Migrated Sort #: 0 Bottom Depth: 65
Details Reports For: Well Lithology Top Depth: 65 Lithology: sand	Migrated Sort #: 0 Bottom Depth: 80

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	80	Bottom Depth:	160
Lithology:	clay		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	160	Bottom Depth:	170
Lithology:	sand		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	170	Bottom Depth:	240
Lithology:	clay		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	240	Bottom Depth:	270
Lithology:	sand		
Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	4 N PVC 255-265 010	Diameter:	Not Reported
Casing Status:	Not Reported	Casing Material:	Not Reported
Casing Type:	Not Reported	Schedule:	Not Reported
Gauge:	Not Reported		

**N98
SW
1/2 - 1 Mile
Lower**

TX WELLS TXDOL2000014662

Database:	Well Report Database	Fid:	14661
Rec id:	14661	Edr site i:	172882
Owner:	David Daniels	Ownerwell:	No Data
Address:	P.O. Box 1143, Angleton , TX 77516	Grid:	65-53-8
Waddress:	800 Yancy Rd, Angleton , TX 77515	Lat:	29 08 29 N
County:	Brazoria	Long:	095 26 19 W
Elevation:	No Data	Gpsused:	map
Typeofwork:	New Well	Propuse:	Domestic
Sdate:	Not Reported	Completedd:	Not Reported
Diameter:	7 in From Surface To 265 ft	Dmethod:	Mud Rotary
Bcompleteio:	Straight Wall	Packedfrom:	Not Reported
Packsize:	Not Reported		
Finterval:	From 0 ft to 10 ft with 12 cement (#sacks and material)		
Sinterval:	No Data	Tinterval:	No Data
Usedmethod:	poured	Cementedby:	Christopher Davis
Contaminat:	n/a ft	Propertyli:	50 ft
Verrimetho:	tape	Varriance:	No Data
Surface:	Surface Sleeve Installed	Staticleve:	29 ft. below land surface on 8/23/2004
Flow:	No Data	Packers:	Rubber, 10 and 255
Cementinwe:	No Data	Typepump:	Submersible
Pumpbowl:	80 ft	Welltests:	Jetted
Yield:	100+ GPM with (No Data) ft drawdown after (No Data) hours		
Watertype:	No Data	Stratadept:	No Data
Chemicalma:	No	Undesirabl:	No
Companynam:	Anchor Water Well	Companyadd:	P.O. Box 450
Ccitystate:	Angleton , TX 77516	Licenseum:	54841
Wsignature:	Christopher Davis	Dsignature:	Justin Ryan Walters
Regnum:	57143, 1534	Comments:	\$scd

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Site id: TXDOL2000014662

M99 West 1/2 - 1 Mile Higher

TX WELLS TXWDB7000109992

Database:	Groundwater Database	Well #:	6553807
Primary Water Use:	Domestic	Elevation:	26
Well Depth:	42	Observation Type:	None
Water Quality Review:	Y	Aquifer:	112CHCT - Chicot Aquifer
Well Type:	Withdrawal of Water		

100 North 1/2 - 1 Mile Higher

FRDS PWS TX0200018

Epa region:	06	State:	TX
Pwsid:	TX0200018	Pwsname:	TOWN OF HOLIDAY LAKES
Cityserved:	Not Reported	Stateserved:	TX
Ziperved:	Not Reported	Fipscounty:	48039
Status:	Active	Retpopsrvd:	957
Pwssvconn:	319	Psource longname:	Groundwater
Pwstype:	CWS	Owner:	Local_Govt
Contact:	SCHROEDER, NORMAN, C	Contactorgname:	SCHROEDER, NORMAN, C
Contactphone:	979-849-1136	Contactaddress1:	RR 4 BOX 747
Contactaddress2:	Not Reported	Contactcity:	ANGLETON
Contactstate:	TX	Contactzip:	77515-8412
Pwsactivitycode:	A		
Pwsid:	TX0200018	Facid:	1202
Facname:	PLANT - ALASKA / TEXAS	Factype:	Treatment_plant
Facactivitycode:	A	Trtobjective:	disinfection
Trtprocess:	gaseous chlorination, pre	Factypecode:	TP
Pwsid:	TX0200018	Facid:	1202
Facname:	PLANT - ALASKA / TEXAS	Factype:	Treatment_plant
Facactivitycode:	A	Trtobjective:	corrosion control
Trtprocess:	inhibitor, orthophosphate	Factypecode:	TP
PWS ID:	TX0200018	PWS name:	THE CITY OF HOLIDAY LAKE
Address:	RT 4 BOX 747	Care of:	C/O M A BERG
City:	ANGLETON	State:	TX
Zip:	77515	Owner:	THE CITY OF HOLIDAY LAKE
Source code:	Ground water	Population:	858
PWS ID:	TX0200018	PWS type:	System Owner/Responsible Party
PWS name:	O J PURSLEY	PWS address:	Not Reported
PWS city:	Not Reported	PWS state:	Not Reported
PWS zip:	Not Reported	PWS ID:	TX0200018
Activity status:	Active	Date system activated:	Not Reported
Date system deactivated:	Not Reported	Retail population:	00000900
System name:	LAKESIDE WATER WORKS	System address:	C/O O J PURSLEY - OWNER
System address:	ROUTE 4 BOX 203	System city:	ANGLETON
System state:	TX	System zip:	77515
Population served:	501 - 1,000 Persons	Treatment:	Treated

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Latitude:	290948	Longitude:	0952548
Violation id:	90059313	Orig code:	S
State:	TX	Violation Year:	2008
Contamination code:	0999	Contamination Name:	Chlorine
Violation code:	27	Violation name:	Monitoring and Reporting (DBP)
Rule code:	210	Rule name:	St1 DBP
Violation measur:	Not Reported	Unit of measure:	Not Reported
State mcl:	Not Reported	Cmp bdt:	10/01/2008
Cmp edt:	12/31/2008		
Violation id:	90059316	Orig code:	S
State:	TX	Violation Year:	2013
Contamination code:	3100	Contamination Name:	Coliform (TCR)
Violation code:	23	Violation name:	Monitoring, Routine Major (TCR)
Rule code:	110	Rule name:	TCR
Violation measur:	Not Reported	Unit of measure:	Not Reported
State mcl:	Not Reported	Cmp bdt:	02/01/2013
Cmp edt:	02/28/2013		
PWS currently has or had major violation(s) or enforcement:Yes			
Violation ID:	9410054	Violation source ID:	Not Reported
PWS telephone:	Not Reported	Contaminant:	COLIFORM (TCR)
Violation type:	Max Contaminant Level, Monthly (TCR)		
Violation start date:	100193	Violation end date:	103193
Violation period (months):	001	Violation awareness date:	Not Reported
Major violator:	Not Reported	Maximum contaminant level:	Not Reported
Number of required samples:	Not Reported	Number of samples taken:	Not Reported
Analysis method:	Not Reported	Analysis result:	Not Reported
PWS currently has or had major violation(s) or enforcement:Yes			
Violation ID:	9410056	Violation source ID:	Not Reported
PWS telephone:	Not Reported	Contaminant:	COLIFORM (TCR)
Violation type:	Monitoring, Repeat Minor (TCR)		
Violation start date:	100193	Violation end date:	103193
Violation period (months):	001	Violation awareness date:	Not Reported
Major violator:	No	Maximum contaminant level:	Not Reported
Number of required samples:	Not Reported	Number of samples taken:	Not Reported
Analysis method:	Not Reported	Analysis result:	Not Reported
PWS currently has or had major violation(s) or enforcement:Yes			
Violation ID:	9410057	Violation source ID:	Not Reported
PWS telephone:	Not Reported	Contaminant:	COLIFORM (TCR)
Violation type:	Notification, Public	Violation start date:	100193
Violation end date:	103193	Violation period (months):	001
Violation awareness date:	Not Reported	Major violator:	Not Reported
Maximum contaminant level:	Not Reported	Number of required samples:	Not Reported
Number of samples taken:	Not Reported	Analysis method:	Not Reported
Analysis result:	Not Reported		
PWS currently has or had major violation(s) or enforcement:Yes			
Violation ID:	9410058	Violation source ID:	Not Reported
PWS telephone:	Not Reported	Contaminant:	COLIFORM (TCR)
Violation type:	Monitoring, Routine Major (TCR)		
Violation start date:	110193	Violation end date:	113093
Violation period (months):	001	Violation awareness date:	Not Reported
Major violator:	Yes	Maximum contaminant level:	Not Reported
Number of required samples:	Not Reported	Number of samples taken:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Analysis method:	Not Reported	Analysis result:	Not Reported
PWS currently has or had major violation(s) or enforcement:Yes			
Violation ID:	9410059	Violation source ID:	Not Reported
PWS telephone:	Not Reported	Contaminant:	COLIFORM (TCR)
Violation type:	Notification, Public	Violation start date:	110193
Violation end date:	113093	Violation period (months):	001
Violation awareness date:	Not Reported	Major violator:	Not Reported
Maximum contaminant level:	Not Reported	Number of required samples:	Not Reported
Number of samples taken:	Not Reported	Analysis method:	Not Reported
Analysis result:	Not Reported		
Violation ID:	90059313	Orig Code:	S
Enforcemnt FY:	2009	Enforcement Action:	04/30/2009
Enforcement Detail:	St Public Notif received	Enforcement Category:	Informal
Violation ID:	90059313	Orig Code:	S
Enforcemnt FY:	2009	Enforcement Action:	03/27/2009
Enforcement Detail:	St Public Notif requested	Enforcement Category:	Informal
Violation ID:	90059313	Orig Code:	S
Enforcemnt FY:	2009	Enforcement Action:	03/27/2009
Enforcement Detail:	St Violation/Reminder Notice		
Enforcement Category:	Informal		
Violation ID:	90059313	Orig Code:	S
Enforcemnt FY:	2009	Enforcement Action:	08/04/2009
Enforcement Detail:	St Compliance achieved	Enforcement Category:	Resolving
Violation ID:	90059316	Orig Code:	S
Enforcemnt FY:	2013	Enforcement Action:	04/01/2013
Enforcement Detail:	St Violation/Reminder Notice		
Enforcement Category:	Informal		
Violation ID:	90059316	Orig Code:	S
Enforcemnt FY:	2013	Enforcement Action:	05/30/2013
Enforcement Detail:	St Public Notif received	Enforcement Category:	Informal
Violation ID:	90059316	Orig Code:	S
Enforcemnt FY:	2013	Enforcement Action:	04/01/2013
Enforcement Detail:	St Public Notif requested	Enforcement Category:	Informal

**101
NE
1/2 - 1 Mile
Higher**

TX WELLS TXMON5000256743

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	260390	Well Type:	New Well
Proposed Use:	Domestic	Borehole Depth (ft):	280
Injurious Water Quality:	no	Plugging Rpt #:	Not Reported
Submitted Date:	2011-07-22	Owner Name:	DON RAYMOND
Well #:	Not Reported	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Domestic	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2011-06-25	Drill End Date:	2011-06-25

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Seal Method:	Other - TREMMIE	Seal Method Desc:	TREMMIE
Dist to Septic/Other Contam:	100	Distance to Septic Tank:	Not Reported
Dist to Property Line:	50	Distance Verify Meth:	OWNER
Approved by Variance:	Not Reported	Sealed by Driller:	Yes
Sealed by Name:	Not Reported	Surface Completion:	Surface Sleeve Installed
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Jet	Pump Type Desc:	Not Reported
Pump Depth:	100.00	Chemical Analysis:	No
Injurious Water:	No	Company Name:	GOOLSBY W.W.
Driller Name:	George R Goolsby	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	1765	Apprentice Reg #:	Not Reported
Details Reports For:	Well Bore Hole	Diameter:	5
Top Depth:	0	Bottom Depth:	280
Details Reports For:	Well Drilling Method	Drill Method:	Mud (Hydraulic) Rotary
Details Reports For:	Well Completion	Borehole Completion:	Straight Wall
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	100	Annular Seal:	8 P. 5 RM
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Levels	Measurement:	43
Measurement Date:	2011-06-25	Artesian Flow:	Not Reported
Measurement Method:	Unknown		
Details Reports For:	Well Packers	Migrated Sort #:	1
Packers:	SHALE 263 - 243 - 100	Depth:	Not Reported
Details Reports For:	Well Packers	Migrated Sort #:	2
Packers:	WASH VALVE 273	Depth:	Not Reported
Details Reports For:	Well Test	Test Type:	Jetted
Yield:	30	Drawdown:	Not Reported
Hours:	Not Reported		
Details Reports For:	Well Strata	Migrated Strata Depth:	245 TO 274
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Water Type:	GOOD		
Details Reports For:	Well Lithology	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	0 TO 41 CLAY41		
Details Reports For:	Well Lithology	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	41 TO 53 SAND		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For: Top Depth: Lithology:	Well Lithology Not Reported 53 TO 119 CLAY	Migrated Sort #: Bottom Depth:	3 Not Reported
Details Reports For: Top Depth: Lithology:	Well Lithology Not Reported 119 TO 128 SAND	Migrated Sort #: Bottom Depth:	4 Not Reported
Details Reports For: Top Depth: Lithology:	Well Lithology Not Reported 128 TO 245 CLAY	Migrated Sort #: Bottom Depth:	5 Not Reported
Details Reports For: Top Depth: Lithology:	Well Lithology Not Reported 245 TO 274 SAND	Migrated Sort #: Bottom Depth:	6 Not Reported
Details Reports For: Top Depth: Lithology:	Well Lithology Not Reported 274 TO 280 CLAY t.d.	Migrated Sort #: Bottom Depth:	7 Not Reported
Details Reports For: Top Depth: Migrated Casing Info: Casing Status: Casing Type: Gauge:	Well Casing Not Reported 2 N PVC CASING +2 TO 263 Not Reported Not Reported Not Reported	Migrated Sort #: Bottom Depth: Diameter: Casing Material: Schedule:	1 Not Reported Not Reported Not Reported Not Reported
Details Reports For: Top Depth: Migrated Casing Info: Diameter: Casing Material: Schedule:	Well Casing Not Reported 2 N PVC SCREEN 263 TO 273 SLOT .006 Not Reported Not Reported Not Reported	Migrated Sort #: Bottom Depth: Casing Status: Casing Type: Gauge:	2 Not Reported Not Reported Not Reported Not Reported
Details Reports For: Top Depth: Migrated Casing Info: Casing Status: Casing Type: Gauge:	Well Casing Not Reported 2 N PVC BLANK 273 TO 280 Not Reported Not Reported Not Reported	Migrated Sort #: Bottom Depth: Diameter: Casing Material: Schedule:	3 Not Reported Not Reported Not Reported Not Reported

**102
SW
1/2 - 1 Mile
Lower**

TX WELLS TXMON5000314463

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	318793	Well Type:	New Well
Proposed Use:	Domestic	Borehole Depth (ft):	250
Injurious Water Quality:	no	Plugging Rpt #:	Not Reported
Submitted Date:	2013-05-15	Owner Name:	Stormy Wolf

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Well #:	Not Reported	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Domestic	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2013-05-09	Drill End Date:	2013-05-11
Seal Method:	Other - 100% Halliburton Method		
Seal Method Desc:	100% Halliburton Method	Dist to Septic/Other Contam:	Not Reported
Distance to Septic Tank:	Not Reported	Dist to Property Line:	Not Reported
Distance Verify Meth:	Not Reported	Approved by Variance:	Not Reported
Sealed by Driller:	Yes	Sealed by Name:	Not Reported
Surface Completion:	Surface Sleeve Installed	Surf Complete Desc:	Not Reported
Completed by Driller:	Not Reported	Pump Type:	Submersible
Pump Type Desc:	Not Reported	Pump Depth:	Not Reported
Chemical Analysis:	No	Injurious Water:	No
Company Name:	Felder Water Well	Driller Name:	David Eric Branch
Comments:	license 56029 wi	Plugged within 48 hrs:	No
Plugging Rpt Tracking #:	Not Reported	Driller License #:	56029
Apprentice Reg #:	Not Reported		

Details Reports For:	Well Bore Hole	Diameter:	7
Top Depth:	0	Bottom Depth:	230

Details Reports For:	Well Bore Hole	Diameter:	3.75
Top Depth:	230	Bottom Depth:	250

Details Reports For:	Well Drilling Method	Drill Method:	Mud (Hydraulic) Rotary

Details Reports For:	Well Completion	Borehole Completion:	Straight Wall

Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	230	Annular Seal:	25
Amount:	Not Reported	Unit:	Not Reported

Details Reports For:	Well Levels	Measurement:	38
Measurement Date:	2013-05-11	Artesian Flow:	Not Reported
Measurement Method:	Unknown		

Details Reports For:	Well Packers	Migrated Sort #:	1
Packers:	K Packers 2-1/2 220'-230'	Depth:	Not Reported

Details Reports For:	Well Test	Test Type:	Jetted
Yield:	150	Drawdown:	Not Reported
Hours:	Not Reported		

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	2
Lithology:	Soil		

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	2	Bottom Depth:	8
Lithology:	Gumbo		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	8	Bottom Depth:	16
Lithology:	Calichi		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	16	Bottom Depth:	60
Lithology:	Sand .006-.012		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	60	Bottom Depth:	77
Lithology:	Clay Tan		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	77	Bottom Depth:	86
Lithology:	Sand Tan .005		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	86	Bottom Depth:	89
Lithology:	Clay		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	89	Bottom Depth:	95
Lithology:	Sand Tan .006		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	95	Bottom Depth:	110
Lithology:	Clay		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	110	Bottom Depth:	110
Lithology:	Sand Tan Fine		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	110	Bottom Depth:	150
Lithology:	Clay Tan & Grey		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	150	Bottom Depth:	170
Lithology:	Sand Tan .006		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	170	Bottom Depth:	220
Lithology:	Clay		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	220	Bottom Depth:	260
Lithology:	Sand & Gravel		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	260	Bottom Depth:	270

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Lithology: Clay

Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	4 N PVC Casing 0-230 C	Diameter:	Not Reported
Casing Status:	Not Reported	Casing Material:	Not Reported
Casing Type:	Not Reported	Schedule:	Not Reported
Gauge:	Not Reported		

Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2.5 N PVC Liner 220-230 L	Diameter:	Not Reported
Casing Status:	Not Reported	Casing Material:	Not Reported
Casing Type:	Not Reported	Schedule:	Not Reported
Gauge:	Not Reported		

Details Reports For:	Well Casing	Migrated Sort #:	3
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2.5 N PVC Slotted 230-250 S		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

O103
North
1/2 - 1 Mile
Higher

TX WELLS TXMON5000108058

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	109795	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	17
Injurious Water Quality:	Not Reported	Plugging Rpt #:	Not Reported

Submitted Date:	2007-04-22	Owner Name:	Former Harris Gulf Station
Well #:	MW-11	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2007-03-27	Drill End Date:	2007-03-27
Seal Method:	Other - handmix	Seal Method Desc:	handmix
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	No
Sealed by Name:	MEDI	Surface Completion:	Surface Slab Installed
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	Mathers Environmental Drilling Inc.
Driller Name:	Shawn Thomas Mathers	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	54308	Apprentice Reg #:	Not Reported

Details Reports For:	Well Bore Hole	Diameter:	10
Top Depth:	0	Bottom Depth:	17

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Drilling Method	Drill Method:	Hollow Stem Auger
Details Reports For:	Well Completion	Borehole Completion:	Other - 20/40 sand
Details Reports For: Bottom Depth: Amount:	Well Seal Range .5 Not Reported	Top Depth: Annular Seal: Unit:	0 1,concrete Not Reported
Details Reports For: Bottom Depth: Amount:	Well Seal Range 1.5 Not Reported	Top Depth: Annular Seal: Unit:	.5 1,bentonite Not Reported
Details Reports For: Bottom Depth: Amount:	Well Seal Range 17 Not Reported	Top Depth: Annular Seal: Unit:	1.5 14,sand Not Reported
Details Reports For: Packers: Depth:	Well Packers bentonite chips 1.5' - .5' Not Reported	Migrated Sort #:	1
Details Reports For: Top Depth: Lithology:	Well Lithology 0 concrete	Migrated Sort #: Bottom Depth:	0 .5
Details Reports For: Top Depth: Lithology:	Well Lithology .5 dark gray silt	Migrated Sort #: Bottom Depth:	0 3
Details Reports For: Top Depth: Lithology:	Well Lithology 3 dark gray clay	Migrated Sort #: Bottom Depth:	0 4
Details Reports For: Top Depth: Lithology:	Well Lithology 4 greenish gray and dark gray silt	Migrated Sort #: Bottom Depth:	0 5
Details Reports For: Top Depth: Lithology:	Well Lithology 5 bluish gray fine grained sand	Migrated Sort #: Bottom Depth:	0 11
Details Reports For: Top Depth: Lithology:	Well Lithology 11 light gray fine grained sand	Migrated Sort #: Bottom Depth:	0 17
Details Reports For: Top Depth: Migrated Casing Info: Diameter: Casing Material: Schedule:	Well Casing Not Reported 4 new sch. 40 pvc screen 17 - 2 0.010 slot Not Reported Not Reported Not Reported	Migrated Sort #: Bottom Depth: Casing Status: Casing Type: Gauge:	1 Not Reported Not Reported Not Reported Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	4 new sch. 40 pvc riser 2 - 0		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

O104
North
1/2 - 1 Mile
Higher

TX WELLS TXMON5000234806

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	238135	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	20
Injurious Water Quality:	no	Plugging Rpt #:	Not Reported

Submitted Date:	2010-12-16	Owner Name:	STEWART ROBERT
Well #:	MW-17	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2010-11-30	Drill End Date:	2010-11-30
Seal Method:	Other - mix by hand	Seal Method Desc:	mix by hand
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	Yes
Sealed by Name:	Not Reported	Surface Completion:	Alternative Procedure Used
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	No
Injurious Water:	No	Company Name:	Talon/LPE
Driller Name:	William A Clayton	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	53420	Apprentice Reg #:	Not Reported

Details Reports For:	Well Bore Hole	Diameter:	10.25
Top Depth:	0	Bottom Depth:	20

Details Reports For:	Well Drilling Method	Drill Method:	Hollow Stem Auger

Details Reports For:	Well Completion	Borehole Completion:	Filter Packed

Details Reports For:	Well Filter	Filter Material:	Gravel
Top Depth:	2	Bottom Depth:	20
Size:	8/16		

Details Reports For:	Well Seal Range	Top Depth:	1
Bottom Depth:	2	Annular Seal:	1/2: 3/8 benton
Amount:	Not Reported	Unit:	Not Reported

Details Reports For:	Well Seal Range	Top Depth:	0

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Bottom Depth:	1	Annular Seal:	1/2: concrete
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Lithology	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	Surface-4" Asphalt surface		
Details Reports For:	Well Lithology	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	4"-1 fill sandy gravel		
Details Reports For:	Well Lithology	Migrated Sort #:	3
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	1-4 silt w/sand-fine grain-dark grey-moist		
Details Reports For:	Well Lithology	Migrated Sort #:	4
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	4-7 silt sand to sandy clay moist grey to olive brown		
Details Reports For:	Well Lithology	Migrated Sort #:	5
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	7-12 sandy clay to silty sand / lit brwn fine grain		
Details Reports For:	Well Lithology	Migrated Sort #:	6
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	12-20 same as above		
Details Reports For:	Well Lithology	Migrated Sort #:	7
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	20 bottom of hole		
Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	4" new PVC screen 20'-2.5 screen=0.010		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported
Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	4" new PVC riser 2.5'-0 Riser=sch.40 PVC		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

O105
North
1/2 - 1 Mile
Higher

TX WELLS TXDOL2000016064

Database:	Well Report Database	Fid:	16063
Rec id:	16055	Edr site i:	109795
Owner:	Former Harris Gulf Station	Ownerwell:	MW-11
Address:	101 North Velasco St., Angleton , TX		
Grid:	65-53-8	Waddress:	101 North Velasco St., Angleton , TX
Lat:	29 09 51 N	County:	Brazoria
Long:	095 25 54 W	Elevation:	No Data
Gpsused:	Magellan Blazer GPS	Typeofwork:	New Well
Propuse:	Monitor	Sdate:	Not Reported
Completedd:	Not Reported	Diameter:	10 in From Surface To 17 ft
Dmethod:	Hollow Stem Auger	Bcompleteio:	Not Reported
Packedfrom:	Not Reported	Packsizes:	Not Reported
Finterval:	From 17 ft to 1.5 ft with 14,sand (#sacks and material)		
Sinterval:	From 1.5 ft to .5 ft with 1,bentonite (#sacks and material)		
Tinterval:	From .5 ft to 0 ft with 1,concrete (#sacks and material)		
Usedmethod:	handmix	Cementedby:	MEDI
Contaminat:	No Data	Propertyli:	No Data
Verrimetho:	No Data	Varriance:	No Data
Surface:	Surface Slab Installed	Staticleve:	No Data
Flow:	No Data	Packers:	bentonite chips 1.5 - .5
Cementinwe:	No Data	Typepump:	No Data
Pumpbowl:	Not Reported	Welltests:	No Data
Yield:	Not Reported	Watertype:	No Data
Stratadept:	No Data	Chemicalma:	No Data
Undesirabl:	No Data	Companynam:	Mathers Environmental Drilling Inc.
Companyadd:	12245 E. FM 529	Ccitystate:	Houston , TX 77041
Licensenum:	54308	Wsignature:	Shawn T. Mathers
Dsignature:	No Data	Regnum:	No Data
Comments:	no data	Site id:	TXDOL2000016064

O106
North
1/2 - 1 Mile
Higher

TX WELLS TXMON5000120007

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	121901	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	20
Injurious Water Quality:	no	Plugging Rpt #:	Not Reported
Submitted Date:	2007-09-11	Owner Name:	Robert B. Stewart
Well #:	MW-14	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2007-08-28	Drill End Date:	2007-08-28
Seal Method:	Other - Grout	Seal Method Desc:	Grout
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	Yes
Sealed by Name:	Not Reported	Surface Completion:	Alternative Procedure Used

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	No
Injurious Water:	No	Company Name:	Advanced Drilling Systems, Inc.
Driller Name:	Mario Palacios Moya	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	4990	Apprentice Reg #:	Not Reported
Details Reports For:	Well Bore Hole	Diameter:	8
Top Depth:	0	Bottom Depth:	20
Details Reports For:	Well Drilling Method	Drill Method:	Hollow Stem Auger
Details Reports For:	Well Completion	Borehole Completion:	Filter Packed
Details Reports For:	Well Filter	Filter Material:	Gravel
Top Depth:	2	Bottom Depth:	20
Size:	20/40		
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	1	Annular Seal:	2, Concrete
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	1
Bottom Depth:	2	Annular Seal:	1, Bentonite
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	2
Bottom Depth:	20	Annular Seal:	11, Sand
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Levels	Measurement:	10
Measurement Date:	2007-08-28	Artesian Flow:	Not Reported
Measurement Method:	Unknown		
Details Reports For:	Well Lithology	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	0-0.5: Asphalt/Concrete		
Details Reports For:	Well Lithology	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	0.5-4: Sand, clayey, Brown, damp, loose		
Details Reports For:	Well Lithology	Migrated Sort #:	3
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	- lighter brown, minor orange mottles		
Details Reports For:	Well Lithology	Migrated Sort #:	4
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	4-8: Clay, sandy/silty, light brown, moist, low plasticity		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Lithology	Migrated Sort #:	5
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	- orangish brown w/light brown smear, inc. in moisture		

Details Reports For:	Well Lithology	Migrated Sort #:	6
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	8-10: Silt, sandy, orangish brown, moist, low plasticity		

Details Reports For:	Well Lithology	Migrated Sort #:	7
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	10-20: Sand, silty, brown, wet, loose		

Details Reports For:	Well Lithology	Migrated Sort #:	8
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	- inc. clay content, gray, decr. moisture		

Details Reports For:	Well Lithology	Migrated Sort #:	9
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	-clayey/silty, light brown, decr. moisture to TD		

Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 New PVC Casing 0-2.5 sch-40		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 New PVC Slotted 2.5-20 0.01		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

O107
North
1/2 - 1 Mile
Higher

TX WELLS TXMON5000151702

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	154178	Well Type:	New Well
Proposed Use:	Environmental Soil Boring	Borehole Depth (ft):	60
Injurious Water Quality:	Not Reported	Plugging Rpt #:	121865

Submitted Date:	2008-09-24	Owner Name:	STEWART ROBERT
Well #:	SB-1	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Environmental Soil Boring	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2008-07-31	Drill End Date:	2008-07-31
Seal Method:	Poured	Seal Method Desc:	Not Reported
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	No
Sealed by Name:	Talon	Surface Completion:	Surface Sleeve Installed
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	Talon Drilling, LP
Driller Name:	Shane Currie	Comments:	Not Reported
Plugged within 48 hrs:	Yes	Plugging Rpt Tracking #:	121865
Driller License #:	54499	Apprentice Reg #:	57601

Details Reports For:	Well Bore Hole	Diameter:	2.25
Top Depth:	0	Bottom Depth:	60

Details Reports For:	Well Drilling Method	Drill Method:	Hollow Stem Auger

Details Reports For:	Well Completion	Borehole Completion:	Open Hole

Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	2	Annular Seal:	1 Cement
Amount:	Not Reported	Unit:	Not Reported

Details Reports For:	Well Seal Range	Top Depth:	2
Bottom Depth:	60	Annular Seal:	5 bentonite
Amount:	Not Reported	Unit:	Not Reported

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	1	Bottom Depth:	3
Lithology:	silty sandy clay, brown		

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	3	Bottom Depth:	60
Lithology:	sand, tan		

O108
North
1/2 - 1 Mile
Higher

TX WELLS

TXPLU5000119902

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	121865	Well Type:	Environmental Soil Boring
Borehole Depth (ft):	60	Well Report #:	154178

Details Reports For:	Plug Data	Submitted Date:	2008-09-24
Owner Name:	STEWART ROBERT	Well #:	SB-1
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Talon Drilling, LP	Original Driller:	Shane Currie
Original License #:	54499	Original Well Use:	Environmental Soil Boring
Original Drill Date:	2008-07-31	Plug Method:	Unknown
Plug Date:	2008-07-31	Variance #:	Not Reported
Company Name:	Talon Drilling, LP	Plugging Name:	Shane Currie
Driller License:	54499	Apprentice Reg #:	57601

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Comments:	Not Reported	Comments:	Not Reported
Details Reports For:	Plug Bore Hole	Diameter:	2.25
Top Depth:	0	Bottom Depth:	60
Details Reports For:	Plug Range	Top Depth:	Not Reported
Bottom Depth:	Not Reported	Plug Seal:	Not Provided
Amount:	Not Reported	Unit:	Not Reported

O109
North
1/2 - 1 Mile
Higher

TX WELLS TXDOL2000015819

Database:	Well Report Database	Fid:	15818
Rec id:	15816	Edr site i:	121901
Owner:	Robert B. Stewart	Ownerwell:	MW-14
Address:	104 East Bronco Bend Dr., Angleton , TX 77515		
Grid:	65-53-8	Waddress:	101 S. Velasco St., Angleton , TX 77515
Lat:	29 09 52 N	County:	Brazoria
Long:	095 25 53 W	Elevation:	No Data
Gpsused:	Magellan-315	Typeofwork:	New Well
Propuse:	Monitor	Sdate:	Not Reported
Completedd:	Not Reported	Diameter:	8 in From Surface To 20 ft
Dmethod:	Hollow Stem Auger	Bcompleteio:	Not Reported
Packedfrom:	2 ft to 20 ft	Packsizes:	20/40
Finterval:	From 2 ft to 20 ft with 11, Sand (#sacks and material)		
Sinterval:	From 1 ft to 2 ft with 1, Bentonite (#sacks and material)		
Tinterval:	From 0 ft to 1 ft with 2, Concrete (#sacks and material)		
Usedmethod:	Grout	Cementedby:	Advanced Drilling Systems, Inc.
Contaminat:	No Data	Propertyli:	No Data
Verrimetho:	No Data	Varriance:	No Data
Surface:	Alternative Procedure Used	Staticleve:	10 ft. below land surface on 8/28/2007
Flow:	No Data	Packers:	No Data
Cementinwe:	No Data	Typepump:	No Data
Pumpbowl:	Not Reported	Welltests:	No Data
Yield:	Not Reported	Watertype:	No Data
Stratadept:	No Data	Chemicalma:	No
Undesirabl:	No	Companynam:	Advanced Drilling Systems, Inc.
Companyadd:	904 W. Tidwell	Ccitystate:	Houston , TX 77091
Licensenum:	4990	Wsignature:	Mario Moya
Dsignature:	No Data	Regnum:	No Data
Comments:	no data	Site id:	TXDOL2000015819

O110
North
1/2 - 1 Mile
Higher

TX WELLS TXDOL2000015261

Database:	Well Report Database	Fid:	15260
Rec id:	15258	Edr site i:	154178
Owner:	STEWART ROBERT	Ownerwell:	SB-1
Address:	104 E BRONCO BEND DR, ANGLETON , TX 77515		
Grid:	65-53-8	Waddress:	101 S VELASCO ST, ANGLETON , TX 77515
Lat:	29 09 52 N	County:	Brazoria
Long:	095 25 53 W	Elevation:	No Data

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Gpsused:	Garmin etrex	Typeofwork:	New Well
Propuse:	Environmental Soil Boring	Sdate:	Not Reported
Completedd:	Not Reported	Diameter:	2 1/4 in From Surface To 60 ft
Dmethod:	Hollow Stem Auger	Bcompleto:	Open Hole
Packedfrom:	Not Reported	Packsizes:	Not Reported
Finterval:	From 0 ft to 2 ft with 1 Cement (#sacks and material)		
Sinterval:	From 2 ft to 60 ft with 5 bentonite (#sacks and material)		
Tinterval:	No Data	Usedmethod:	poured
Cementedby:	Talon	Contaminat:	No Data
Propertyli:	No Data	Verrimetho:	No Data
Varriance:	No Data	Surface:	Surface Sleeve Installed
Staticleve:	No Data	Flow:	No Data
Packers:	No Data	Cementinwe:	No Data
Typepump:	No Data	Pumpbowl:	Not Reported
Welltests:	No Data	Yield:	Not Reported
Watertype:	No Data	Stratadept:	No Data
Chemicalma:	No Data	Undesirabl:	No Data
Companynam:	Talon Drilling, LP	Companyadd:	921 N Bivins
Ccitystate:	Amarillo , TX 79107	Licenseum:	54499
Wsignature:	Shane Currie	Dsignature:	Ronnie Rodriguez
Regnum:	57601	Comments:	no data
Site id:	TXDOL2000015261		

O111
North
1/2 - 1 Mile
Higher

TX WELLS TXMON5000144157

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	146531	Well Type:	New Well
Proposed Use:	Environmental Soil Boring	Borehole Depth (ft):	12
Injurious Water Quality:	Not Reported	Plugging Rpt #:	Not Reported

Submitted Date:	2008-07-15	Owner Name:	Harris Gulf Station
Well #:	B-2	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Environmental Soil Boring	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2008-06-10	Drill End Date:	2008-06-10
Seal Method:	Other - hand mix	Seal Method Desc:	hand mix
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	No
Sealed by Name:	MEDI	Surface Completion:	Unknown
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	Mathers Environmental Drilling Inc.
Driller Name:	Shannon Mathers	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	54933	Apprentice Reg #:	Not Reported

Details Reports For:	Well Bore Hole	Diameter:	2
Top Depth:	0	Bottom Depth:	12

Details Reports For:	Well Drilling Method	Drill Method:	Direct Push

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Completion	Borehole Completion:	Open Hole
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	1	Annular Seal:	.5,concrete
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	1
Bottom Depth:	12	Annular Seal:	2,bentonite
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	.5
Lithology:	concrete		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	.5	Bottom Depth:	5
Lithology:	black to dark gray clay		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	5	Bottom Depth:	8
Lithology:	olive green silty clay		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	8	Bottom Depth:	12
Lithology:	light gray sand		

O112
North
1/2 - 1 Mile
Higher

TX WELLS TXMON5000144156

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	146530	Well Type:	New Well
Proposed Use:	Environmental Soil Boring	Borehole Depth (ft):	12
Injurious Water Quality:	Not Reported	Plugging Rpt #:	Not Reported
Submitted Date:	2008-07-15	Owner Name:	Harris Gulf Station
Well #:	B-1	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Environmental Soil Boring	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2008-06-10	Drill End Date:	2008-06-10
Seal Method:	Other - hand mix	Seal Method Desc:	hand mix
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	No
Sealed by Name:	MEDI	Surface Completion:	Unknown
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	Mathers Environmental Drilling Inc.
Driller Name:	Shannon Mathers	Comments:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	54933	Apprentice Reg #:	Not Reported
Details Reports For:	Well Bore Hole	Diameter:	2
Top Depth:	0	Bottom Depth:	12
Details Reports For:	Well Drilling Method	Drill Method:	Direct Push
Details Reports For:	Well Completion	Borehole Completion:	Open Hole
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	1	Annular Seal:	.5,concrete
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	1
Bottom Depth:	12	Annular Seal:	2,bentonite
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	.5
Lithology:	concrete		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	.5	Bottom Depth:	5
Lithology:	black to dark gray clay		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	5	Bottom Depth:	8
Lithology:	olive green silty clay		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	8	Bottom Depth:	12
Lithology:	light gray sand		

O113
North
1/2 - 1 Mile
Higher

TX WELLS TXMON5000120002

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	121896	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	20
Injurious Water Quality:	no	Plugging Rpt #:	Not Reported
Submitted Date:	2007-09-11	Owner Name:	Robert B. Stewart
Well #:	MW-12	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Drill Start Date:	2007-08-28	Drill End Date:	2007-08-28
Seal Method:	Other - Grout	Seal Method Desc:	Grout
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	Yes
Sealed by Name:	Not Reported	Surface Completion:	Alternative Procedure Used
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	No
Injurious Water:	No	Company Name:	Advanced Drilling Systems, Inc.
Driller Name:	Mario Palacios Moya	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	4990	Apprentice Reg #:	Not Reported
Details Reports For:	Well Bore Hole	Diameter:	8
Top Depth:	0	Bottom Depth:	20
Details Reports For:	Well Drilling Method	Drill Method:	Hollow Stem Auger
Details Reports For:	Well Completion	Borehole Completion:	Filter Packed
Details Reports For:	Well Filter	Filter Material:	Gravel
Top Depth:	2	Bottom Depth:	20
Size:	20/40		
Details Reports For:	Well Seal Range	Top Depth:	1
Bottom Depth:	2	Annular Seal:	1, Bentonite
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	1	Annular Seal:	2, Concrete
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	2
Bottom Depth:	20	Annular Seal:	11, Sand
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Levels	Measurement:	11
Measurement Date:	2007-08-28	Artesian Flow:	Not Reported
Measurement Method:	Unknown		
Details Reports For:	Well Lithology	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	0-1: Concrete/rebar		
Details Reports For:	Well Lithology	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	1-6: Sand, clayey, dark gray, moist, loose		
Details Reports For:	Well Lithology	Migrated Sort #:	3
Top Depth:	Not Reported	Bottom Depth:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Lithology: - inc. in fines, dec. in moisture, minor orange mottles

Details Reports For:	Well Lithology	Migrated Sort #:	4
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	6-11: Clay, sandy/silty, gray, moist, low plasticity, minor orange mottles		

Details Reports For:	Well Lithology	Migrated Sort #:	5
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	- inc. in clay content, inc. in moisture		

Details Reports For:	Well Lithology	Migrated Sort #:	6
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	- inc. in sand content		

Details Reports For:	Well Lithology	Migrated Sort #:	7
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	11-20: Sand, silty, brown, wet, loose		

Details Reports For:	Well Lithology	Migrated Sort #:	8
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	- inc. clay content, decr. moisture to TD		

Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 New PVC Casing 0-2.5 sch-40		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 New PVC Slotted 2.5-20 0.01		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

O114
North
1/2 - 1 Mile
Higher

TX WELLS TXMON5000144158

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	146532	Well Type:	New Well
Proposed Use:	Environmental Soil Boring	Borehole Depth (ft):	12
Injurious Water Quality:	Not Reported	Plugging Rpt #:	Not Reported

Submitted Date:	2008-07-15	Owner Name:	Harris Gulf Station
Well #:	B-3	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Environmental Soil Boring	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Drill Start Date: Seal Method: Dist to Septic/Other Contam: Dist to Property Line: Approved by Variance: Sealed by Name: Surf Complete Desc: Pump Type: Pump Depth: Injurious Water: Driller Name: Plugged within 48 hrs: Driller License #:	2008-06-10 Other - hand mix Not Reported Not Reported Not Reported MEDI Not Reported Not Reported Not Reported Not Reported Shannon Mathers No 54933	Drill End Date: Seal Method Desc: Distance to Septic Tank: Distance Verify Meth: Sealed by Driller: Surface Completion: Completed by Driller: Pump Type Desc: Chemical Analysis: Company Name: Comments: Plugging Rpt Tracking #: Apprentice Reg #:	2008-06-10 hand mix Not Reported Not Reported No Unknown Not Reported Not Reported Not Reported Mathers Environmental Drilling Inc. Not Reported Not Reported Not Reported
Details Reports For: Top Depth:	Well Bore Hole 0	Diameter: Bottom Depth:	2 12
Details Reports For:	Well Drilling Method	Drill Method:	Direct Push
Details Reports For:	Well Completion	Borehole Completion:	Open Hole
Details Reports For: Bottom Depth: Amount:	Well Seal Range 12 Not Reported	Top Depth: Annular Seal: Unit:	1 2,bentonite Not Reported
Details Reports For: Bottom Depth: Amount:	Well Seal Range 1 Not Reported	Top Depth: Annular Seal: Unit:	0 .5,concrete Not Reported
Details Reports For: Top Depth: Lithology:	Well Lithology 0 concrete	Migrated Sort #: Bottom Depth:	0 .5
Details Reports For: Top Depth: Lithology:	Well Lithology .5 black to dark gray clay	Migrated Sort #: Bottom Depth:	0 5
Details Reports For: Top Depth: Lithology:	Well Lithology 5 olive green silty clay	Migrated Sort #: Bottom Depth:	0 8
Details Reports For: Top Depth: Lithology:	Well Lithology 8 light gray sand	Migrated Sort #: Bottom Depth:	0 12

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

O115
North
1/2 - 1 Mile
Higher

TX WELLS TXMON5000161901

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	164499	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	20
Injurious Water Quality:	Not Reported	Plugging Rpt #:	Not Reported
Submitted Date:	2009-01-07		
Owner Name:	Former Thomas Texaco, Robert B Stewart		
Well #:	MW-16	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2008-12-22	Drill End Date:	2008-12-22
Seal Method:	Unknown	Seal Method Desc:	Not Reported
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	No
Sealed by Name:	Not Reported	Surface Completion:	Surface Slab Installed
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported		
Company Name:	Universal Drilling Services of Texas, LLC.		
Driller Name:	Keith Arlin Barge	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	4786	Apprentice Reg #:	Not Reported
Details Reports For:	Well Bore Hole	Diameter:	10.5
Top Depth:	0	Bottom Depth:	20
Details Reports For:	Well Drilling Method	Drill Method:	Hollow Stem Auger
Details Reports For:	Well Completion	Borehole Completion:	Filter Packed
Details Reports For:	Well Filter	Filter Material:	Gravel
Top Depth:	3	Bottom Depth:	20
Size:	20/40		
Details Reports For:	Well Seal Range	Top Depth:	1
Bottom Depth:	3	Annular Seal:	1.5 bentonite
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	1	Annular Seal:	1 concrete
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Lithology	Migrated Sort #:	1

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	0-2" Asphalt and shell base.		
Details Reports For:	Well Lithology	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	2-6" Fill, gravely tan sand.		
Details Reports For:	Well Lithology	Migrated Sort #:	3
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	6"-5 sandy clay, very fine-grained poorly graded sand grades from approx 10% at 6" to 50% at 5, high plasticity, soft moist clay, dark greenish gray, sand also occurs as small tan (2.5Y-6/4) seams, weak odor.		
Details Reports For:	Well Lithology	Migrated Sort #:	4
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	5-10 clayey sand, high plasticity clay grades from approx 50% at 5 to 10% at 10. very fine-grained, poorly graded, loose sand, moist, lighter in color mottled greenish-gray and orange-tan (2.5Y-6/4), weak odor.		
Details Reports For:	Well Lithology	Migrated Sort #:	5
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	10-20 -sand, very fine-grained, poorly graded, loose sand, saturated, color same as above (5-10), very weak odor. 15-20 poor recovery, no odor.		
Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	4" N PVC Slotted 20-5'	Diameter:	Not Reported
Casing Status:	Not Reported	Casing Material:	Not Reported
Casing Type:	Not Reported	Schedule:	Not Reported
Gauge:	Not Reported		
Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	4" N PVC Blank 5-0'	Diameter:	Not Reported
Casing Status:	Not Reported	Casing Material:	Not Reported
Casing Type:	Not Reported	Schedule:	Not Reported
Gauge:	Not Reported		

O116
North
1/2 - 1 Mile
Higher

TX WELLS TXMON5000161899

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	164497	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	20
Injurious Water Quality:	Not Reported	Plugging Rpt #:	Not Reported
Submitted Date:	2009-01-07		
Owner Name:	Former Thomas Texaco, Robert B Stewart		
Well #:	MW-15	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Proposed Use: TCEQ Approved Plans: Drill Start Date: Seal Method: Dist to Septic/Other Contam: Dist to Property Line: Approved by Variance: Sealed by Name: Surf Complete Desc: Pump Type: Pump Depth: Injurious Water: Company Name: Driller Name: Plugged within 48 hrs: Driller License #:	Monitor Not Reported 2008-12-22 Unknown Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Universal Drilling Services of Texas, LLC. Keith Arlin Barge No 4786	Proposed Use Desc: PWS #: Drill End Date: Seal Method Desc: Distance to Septic Tank: Distance Verify Meth: Sealed by Driller: Surface Completion: Completed by Driller: Pump Type Desc: Chemical Analysis: Comments: Plugging Rpt Tracking #: Apprentice Reg #:	Not Reported Not Reported 2008-12-22 Not Reported Not Reported Not Reported No Surface Slab Installed Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported
Details Reports For: Top Depth:	Well Bore Hole 0	Diameter: Bottom Depth:	10.5 20
Details Reports For:	Well Drilling Method	Drill Method:	Hollow Stem Auger
Details Reports For:	Well Completion	Borehole Completion:	Filter Packed
Details Reports For: Top Depth: Size:	Well Filter 3 20/40	Filter Material: Bottom Depth:	Gravel 20
Details Reports For: Bottom Depth: Amount:	Well Seal Range 1 Not Reported	Top Depth: Annular Seal: Unit:	0 1 concrete Not Reported
Details Reports For: Bottom Depth: Amount:	Well Seal Range 3 Not Reported	Top Depth: Annular Seal: Unit:	1 1.5 bentonite Not Reported
Details Reports For: Top Depth: Lithology:	Well Lithology Not Reported 0-2" Asphalt.	Migrated Sort #: Bottom Depth:	1 Not Reported
Details Reports For: Top Depth: Lithology:	Well Lithology Not Reported 2-6" Fill, gravely tan sand.	Migrated Sort #: Bottom Depth:	2 Not Reported
Details Reports For: Top Depth: Lithology:	Well Lithology Not Reported 6"-7 sand grades from approx 10% at 6" to 50% at 7.5, high plasticity, soft moist clay, dark greenish gray, sand also occurs as small tan (2.5Y-6/4) seams. Very strong odor.	Migrated Sort #: Bottom Depth:	3 Not Reported
Details Reports For: Top Depth: Lithology:	Well Lithology Not Reported 7-11 clayey sand, high plasticity clay grades from approx 50% at 7 to 10% at 11. very fine-grained, poorly graded, loose sand, moist, saturated below 10, lighter in color mottled greenish-gray and orange-tan (2.5Y-6/4).	Migrated Sort #: Bottom Depth:	4 Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Lithology	Migrated Sort #:	5
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	11-17 -sand, very fine-grained, poorly graded, loose sand, saturated, color same as above (7-11).		

Details Reports For:	Well Lithology	Migrated Sort #:	6
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	No recovery at 17-20 likely sand.		

Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	4" N PVC Slotted 20-5'	Diameter:	Not Reported
Casing Status:	Not Reported	Casing Material:	Not Reported
Casing Type:	Not Reported	Schedule:	Not Reported
Gauge:	Not Reported		

Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	4" N PVC Blank 5-0'	Diameter:	Not Reported
Casing Status:	Not Reported	Casing Material:	Not Reported
Casing Type:	Not Reported	Schedule:	Not Reported
Gauge:	Not Reported		

O117
North
1/2 - 1 Mile
Higher

TX WELLS TXMON5000144159

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	146533	Well Type:	New Well
Proposed Use:	Environmental Soil Boring	Borehole Depth (ft):	12
Injurious Water Quality:	Not Reported	Plugging Rpt #:	Not Reported

Submitted Date:	2008-07-15	Owner Name:	Harris Gulf Station
Well #:	B-4	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Environmental Soil Boring	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2008-06-10	Drill End Date:	2008-06-10
Seal Method:	Other - hand mix	Seal Method Desc:	hand mix
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	No
Sealed by Name:	MEDI	Surface Completion:	Unknown
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	Mathers Environmental Drilling Inc.
Driller Name:	Shannon Mathers	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	54933	Apprentice Reg #:	Not Reported

Details Reports For:	Well Bore Hole	Diameter:	2
Top Depth:	0	Bottom Depth:	12

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Drilling Method	Drill Method:	Direct Push
Details Reports For:	Well Completion	Borehole Completion:	Open Hole
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	1	Annular Seal:	.5,concrete
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	1
Bottom Depth:	12	Annular Seal:	2,bentonite
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	.5
Lithology:	concrete		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	.5	Bottom Depth:	5
Lithology:	black to dark gray clay		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	5	Bottom Depth:	8
Lithology:	olive green silty clay		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	8	Bottom Depth:	12
Lithology:	light gray sand		

O118
North
1/2 - 1 Mile
Higher

TX WELLS TXDOL2000015387

Database:	Well Report Database	Fid:	15386
Rec id:	15414	Edr site i:	146533
Owner:	Harris Gulf Station	Ownerwell:	B-4
Address:	101 North Velasco St., Angleton , TX	Waddress:	101 N. Velasco St., Angleton , TX
Grid:	65-53-8	County:	Brazoria
Lat:	29 09 52 N	Elevation:	No Data
Long:	095 25 54 W	Typeofwork:	New Well
Gpsused:	Magellan GPS	Sdate:	Not Reported
Propuse:	Environmental Soil Boring	Diameter:	2 in From Surface To 12 ft
Completedd:	Not Reported	Bcompletio:	Open Hole
Dmethod:	Not Reported	Packsizes:	Not Reported
Packedfrom:	Not Reported		
Finterval:	From 12 ft to 1 ft with 2,bentonite (#sacks and material)		
Sinterval:	From 1 ft to 0 ft with .5,concrete (#sacks and material)		
Tinterval:	No Data	Usedmethod:	hand mix
Cementedby:	MEDI	Contaminat:	No Data
Propertyli:	No Data	Verrimetho:	No Data
Varriance:	No Data	Surface:	No Data
Staticleve:	No Data	Flow:	No Data
Packers:	No Data	Cementinwe:	No Data

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Typepump:	No Data	Pumpbowl:	Not Reported
Welltests:	No Data	Yield:	Not Reported
Watertype:	No Data	Stratadept:	No Data
Chemicalma:	No Data	Undesirabl:	No Data
Companynam:	Mathers Environmental Drilling Inc.	Companyadd:	12245 E. FM 529
Ccitystate:	Houston , TX 77041	Licenseum:	54933
Wsignature:	Shannon Mathers	Dsignature:	No Data
Regnum:	No Data	Comments:	no data
Site id:	TXDOL2000015387		

O119
North
1/2 - 1 Mile
Higher

TX WELLS TXDOL2000015391

Database:	Well Report Database	Fid:	15390
Rec id:	15415	Edr site i:	146532
Owner:	Harris Gulf Station	Ownerwell:	B-3
Address:	101 North Velasco St., Angleton , TX		
Grid:	65-53-8	Waddress:	101 N. Velasco St., Angleton , TX
Lat:	29 09 52 N	County:	Brazoria
Long:	095 25 54 W	Elevation:	No Data
Gpsused:	Magellan GPS	Typeofwork:	New Well
Propuse:	Environmental Soil Boring	Sdate:	Not Reported
Completedd:	Not Reported	Diameter:	2 in From Surface To 12 ft
Dmethod:	Not Reported	Bcompletio:	Open Hole
Packedfrom:	Not Reported	Packsizes:	Not Reported
Finterval:	From 12 ft to 1 ft with 2,bentonite (#sacks and material)		
Sinterval:	From 1 ft to 0 ft with .5,concrete (#sacks and material)		
Tinterval:	No Data	Usedmethod:	hand mix
Cementedby:	MEDI	Contaminat:	No Data
Propertyli:	No Data	Verrimetho:	No Data
Varriance:	No Data	Surface:	No Data
Staticleve:	No Data	Flow:	No Data
Packers:	No Data	Cementinwe:	No Data
Typepump:	No Data	Pumpbowl:	Not Reported
Welltests:	No Data	Yield:	Not Reported
Watertype:	No Data	Stratadept:	No Data
Chemicalma:	No Data	Undesirabl:	No Data
Companynam:	Mathers Environmental Drilling Inc.	Companyadd:	12245 E. FM 529
Ccitystate:	Houston , TX 77041	Licenseum:	54933
Wsignature:	Shannon Mathers	Dsignature:	No Data
Regnum:	No Data	Comments:	no data
Site id:	TXDOL2000015391		

O120
North
1/2 - 1 Mile
Higher

TX WELLS TXDOL2000015077

Database:	Well Report Database	Fid:	15076
Rec id:	15066	Edr site i:	164499
Owner:	Former Thomas Texaco, Robert B Stewart		
Ownerwell:	MW-16	Address:	104 E. Bronco Road, Angleton , TX 77515
Grid:	65-53-8	Waddress:	101 S Velasco, Angleton , TX 77515
Lat:	29 09 52 N	County:	Brazoria
Long:	095 25 54 W	Elevation:	No Data
Gpsused:	No Data	Typeofwork:	New Well

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Propuse:	Monitor	Sdate:	Not Reported
Completedd:	Not Reported	Diameter:	10.5 in From Surface To 20 ft
Dmethod:	Hollow Stem Auger	Bcompleto:	Not Reported
Packedfrom:	20 ft to 3 ft	Packsize:	20/40
Finterval:	From 3 ft to 1 ft with 1.5 bentonite (#sacks and material)		
Sinterval:	From 1 ft to 0 ft with 1 concrete (#sacks and material)		
Tinterval:	No Data	Usedmethod:	No Data
Cementedby:	No Data	Contaminat:	No Data
Propertyli:	No Data	Verrimetho:	No Data
Varriance:	No Data	Surface:	Surface Slab Installed
Staticleve:	No Data	Flow:	No Data
Packers:	No Data	Cementinwe:	No Data
Typepump:	No Data	Pumpbowl:	Not Reported
Welltests:	No Data	Yield:	Not Reported
Watertype:	No Data	Stratadept:	No Data
Chemicalma:	No Data	Undesirabl:	No Data
Companynam:	Universal Drilling Services of Texas, LLC.		
Companyadd:	3233 W 11th Street, Suite 800	Ccitystate:	Houston , TX 77008
Licensenum:	4786	Wsignature:	Keith Barge
Dsignature:	No Data	Regnum:	No Data
Comments:	no data	Site id:	TXDOL2000015077

O121
North
1/2 - 1 Mile
Higher

TX WELLS TXDOL2000015078

Database:	Well Report Database	Fid:	15077
Rec id:	15067	Edr site i:	164497
Owner:	Former Thomas Texaco, Robert B Stewart		
Ownerwell:	MW-15	Address:	104 E. Bronco Road, Angleton , TX 77515
Grid:	65-53-8	Waddress:	101 S Velasco, Angleton , TX 77515
Lat:	29 09 52 N	County:	Brazoria
Long:	095 25 54 W	Elevation:	No Data
Gpsused:	No Data	Typeofwork:	New Well
Propuse:	Monitor	Sdate:	Not Reported
Completedd:	Not Reported	Diameter:	10.5 in From Surface To 20 ft
Dmethod:	Hollow Stem Auger	Bcompleto:	Not Reported
Packedfrom:	20 ft to 3 ft	Packsize:	20/40
Finterval:	From 3 ft to 1 ft with 1.5 bentonite (#sacks and material)		
Sinterval:	From 1 ft to 0 ft with 1 concrete (#sacks and material)		
Tinterval:	No Data	Usedmethod:	No Data
Cementedby:	No Data	Contaminat:	No Data
Propertyli:	No Data	Verrimetho:	No Data
Varriance:	No Data	Surface:	Surface Slab Installed
Staticleve:	No Data	Flow:	No Data
Packers:	No Data	Cementinwe:	No Data
Typepump:	No Data	Pumpbowl:	Not Reported
Welltests:	No Data	Yield:	Not Reported
Watertype:	No Data	Stratadept:	No Data
Chemicalma:	No Data	Undesirabl:	No Data
Companynam:	Universal Drilling Services of Texas, LLC.		
Companyadd:	3233 W 11th Street, Suite 800	Ccitystate:	Houston , TX 77008
Licensenum:	4786	Wsignature:	Keith Barge
Dsignature:	No Data	Regnum:	No Data
Comments:	no data	Site id:	TXDOL2000015078

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

O122
North
1/2 - 1 Mile
Higher

TX WELLS TXDOL2000015392

Database:	Well Report Database	Fid:	15391
Rec id:	15416	Edr site i:	146531
Owner:	Harris Gulf Station	Ownerwell:	B-2
Address:	101 North Velasco St., Angleton , TX		
Grid:	65-53-8	Waddress:	101 N. Velasco St., Angleton , TX
Lat:	29 09 52 N	County:	Brazoria
Long:	095 25 54 W	Elevation:	No Data
Gpsused:	Magellan GPS	Typeofwork:	New Well
Propuse:	Environmental Soil Boring	Sdate:	Not Reported
Completedd:	Not Reported	Diameter:	2 in From Surface To 12 ft
Dmethod:	Not Reported	Bcompletio:	Open Hole
Packedfrom:	Not Reported	Packsizes:	Not Reported
Finterval:	From 12 ft to 1 ft with 2,bentonite (#sacks and material)		
Sinterval:	From 1 ft to 0 ft with .5,concrete (#sacks and material)		
Tinterval:	No Data	Usedmethod:	hand mix
Cementedby:	MEDI	Contaminat:	No Data
Propertyli:	No Data	Verrimetho:	No Data
Varriance:	No Data	Surface:	No Data
Staticleve:	No Data	Flow:	No Data
Packers:	No Data	Cementinwe:	No Data
Typepump:	No Data	Pumpbowl:	Not Reported
Welltests:	No Data	Yield:	Not Reported
Watertype:	No Data	Stratadept:	No Data
Chemicalma:	No Data	Undesirabl:	No Data
Companynam:	Mathers Environmental Drilling Inc.	Companyadd:	12245 E. FM 529
Ccitystate:	Houston , TX 77041	Licenseum:	54933
Wsignature:	Shannon Mathers	Dsignature:	No Data
Regnum:	No Data	Comments:	no data
Site id:	TXDOL2000015392		

O123
North
1/2 - 1 Mile
Higher

TX WELLS TXDOL2000015821

Database:	Well Report Database	Fid:	15820
Rec id:	15818	Edr site i:	121896
Owner:	Robert B. Stewart	Ownerwell:	MW-12
Address:	104 East Bronco Bend Dr., Angleton , TX 77515		
Grid:	65-53-8	Waddress:	101 S. Velasco St., Angleton , TX 77515
Lat:	29 09 52 N	County:	Brazoria
Long:	095 25 54 W	Elevation:	No Data
Gpsused:	Magellan-315	Typeofwork:	New Well
Propuse:	Monitor	Sdate:	Not Reported
Completedd:	Not Reported	Diameter:	8 in From Surface To 20 ft
Dmethod:	Hollow Stem Auger	Bcompletio:	Not Reported
Packedfrom:	2 ft to 20 ft	Packsizes:	20/40
Finterval:	From 2 ft to 20 ft with 11, Sand (#sacks and material)		
Sinterval:	From 1 ft to 2 ft with 1, Bentonite (#sacks and material)		
Tinterval:	From 0 ft to 1 ft with 2, Concrete (#sacks and material)		
Usedmethod:	Grout	Cementedby:	Advanced Drilling Systems, Inc.
Contaminat:	No Data	Propertyli:	No Data
Verrimetho:	No Data	Varriance:	No Data

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Surface:	Alternative Procedure Used	Staticleve:	11 ft. below land surface on 8/28/2007
Flow:	No Data	Packers:	No Data
Cementinwe:	No Data	Typepump:	No Data
Pumpbowl:	Not Reported	Welltests:	No Data
Yield:	Not Reported	Watertype:	No Data
Stratadept:	No Data	Chemicalma:	No
Undesirabl:	No	Companynam:	Advanced Drilling Systems, Inc.
Companyadd:	904 W. Tidwell	Ccitystate:	Houston , TX 77091
Licensenum:	4990	Wsignature:	Mario Moya
Dsignature:	No Data	Regnum:	No Data
Comments:	no data	Site id:	TXDOL2000015821

O124 North 1/2 - 1 Mile Higher

TX WELLS TXDOL2000015425

Database:	Well Report Database	Fid:	15424
Rec id:	15417	Edr site i:	146530
Owner:	Harris Gulf Station	Ownerwell:	B-1
Address:	101 North Velasco St., Angleton , TX	Waddress:	101 N. Velasco St., Angleton , TX
Grid:	65-53-8	County:	Brazoria
Lat:	29 09 52 N	Elevation:	No Data
Long:	095 25 54 W	Typeofwork:	New Well
Gpsused:	Magellan GPS	Sdate:	Not Reported
Propuse:	Environmental Soil Boring	Diameter:	2 in From Surface To 12 ft
Completedd:	Not Reported	Bcompletio:	Open Hole
Dmethod:	Not Reported	Packsiz:	Not Reported
Packedfrom:	Not Reported	Usedmethod:	hand mix
Finterval:	From 12 ft to 1 ft with 2,bentonite (#sacks and material)	Contaminat:	No Data
Sinterval:	From 1 ft to 0 ft with .5,concrete (#sacks and material)	Verrimetho:	No Data
Tinterval:	No Data	Surface:	No Data
Cementedby:	MEDI	Flow:	No Data
Propertyli:	No Data	Cementinwe:	No Data
Varriance:	No Data	Pumpbowl:	Not Reported
Staticleve:	No Data	Yield:	Not Reported
Packers:	No Data	Stratadept:	No Data
Typepump:	No Data	Undesirabl:	No Data
Welltests:	No Data	Companyadd:	12245 E. FM 529
Watertype:	No Data	Licensenum:	54933
Chemicalma:	No Data	Dsignature:	No Data
Companynam:	Mathers Environmental Drilling Inc.	Comments:	no data
Ccitystate:	Houston , TX 77041		
Wsignature:	Shannon Mathers		
Regnum:	No Data		
Site id:	TXDOL2000015425		

125 West 1/2 - 1 Mile Higher

TX WELLS TXPLU5000100256

Database:	Submitted Drillers Reports Database (Plugged)	Well Type:	Monitor
Plugging Rpt #:	3540	Well Report #:	Not Reported
Borehole Depth (ft):	18		
Details Reports For:	Plug Data	Submitted Date:	2001-10-11

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Owner Name:	Diamond Shamrock	Well #:	Not Reported
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	Can-Tex
Original License #:	3129	Original Well Use:	Monitor
Original Drill Date:	1996-10-07		
Plug Method:	Tremmie pipe cement from bottom to top		
Plug Date:	2001-05-02	Variance #:	Not Reported
Company Name:	Can-Tex Services	Plugging Name:	Ed Gay
Driller License:	3129	Apprentice Reg #:	Not Reported
Comments:	logged by TF	Comments:	Not Reported

Details Reports For:	Plug Bore Hole	Diameter:	10
Top Depth:	Not Reported	Bottom Depth:	18

Details Reports For:	Plug Casing	Top Depth:	0
Bottom Depth:	0	Diameter:	10

Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	18	Plug Seal:	6
Amount:	Not Reported	Unit:	Not Reported

126
SE
1/2 - 1 Mile
Lower

TX WELLS TXMON5000317929

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	322297	Well Type:	New Well
Proposed Use:	Domestic	Borehole Depth (ft):	270
Injurious Water Quality:	no	Plugging Rpt #:	Not Reported

Submitted Date:	2013-06-21	Owner Name:	MARIA PENA
Well #:	1	# Wells Drilled:	Not Reported
Elevation:	9	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Domestic	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2013-06-14	Drill End Date:	2013-06-20
Seal Method:	Other - PRESSURED	Seal Method Desc:	PRESSURED
Dist to Septic/Other Contam:	100+	Distance to Septic Tank:	Not Reported
Dist to Property Line:	7	Distance Verify Meth:	TAPE
Approved by Variance:	Not Reported	Sealed by Driller:	Yes
Sealed by Name:	Not Reported	Surface Completion:	Surface Sleeve Installed
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Submersible	Pump Type Desc:	Not Reported
Pump Depth:	80.00	Chemical Analysis:	No
Injurious Water:	No	Company Name:	ANCHOR WATER WELL
Driller Name:	Christopher Davis	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	54841	Apprentice Reg #:	Not Reported

Details Reports For:	Well Bore Hole	Diameter:	7
Top Depth:	0	Bottom Depth:	270

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Drilling Method	Drill Method:	Mud (Hydraulic) Rotary
Details Reports For:	Well Completion	Borehole Completion:	Straight Wall
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	100	Annular Seal:	17
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Levels	Measurement:	37
Measurement Date:	2013-06-20	Artesian Flow:	Not Reported
Measurement Method:	Unknown		
Details Reports For:	Well Packers	Migrated Sort #:	1
Packers:	RUBBER 100	Depth:	Not Reported
Details Reports For:	Well Packers	Migrated Sort #:	2
Packers:	RUBBER 247	Depth:	Not Reported
Details Reports For:	Well Test	Test Type:	Jetted
Yield:	80	Drawdown:	Not Reported
Hours:	Not Reported		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	37
Lithology:	CLAY		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	37	Bottom Depth:	53
Lithology:	SAND		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	53	Bottom Depth:	100
Lithology:	CLAY		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	100	Bottom Depth:	130
Lithology:	SAND		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	130	Bottom Depth:	240
Lithology:	CLAY		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	240	Bottom Depth:	270
Lithology:	SAND		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	270	Bottom Depth:	270
Lithology:	CLAY		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	4 NEW PVC 247 - 267 008	Diameter:	Not Reported
Casing Status:	Not Reported	Casing Material:	Not Reported
Casing Type:	Not Reported	Schedule:	Not Reported
Gauge:	Not Reported		

P127
NNW
1/2 - 1 Mile
Higher

TX WELLS TXMON5000390221

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	395932	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	16
Injurious Water Quality:	Not Reported	Plugging Rpt #:	103549
Submitted Date:	2015-05-27	Owner Name:	Flexco Asphalt
Well #:	MW-3	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2015-03-03	Drill End Date:	2015-03-03
Seal Method:	Other - hand mix	Seal Method Desc:	hand mix
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	No
Sealed by Name:	MEDI	Surface Completion:	Surface Slab Installed
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	Shawn Mathers
Driller Name:	Shawn Thomas Mathers	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	103549
Driller License #:	54308	Apprentice Reg #:	Not Reported

Details Reports For:	Well Bore Hole	Diameter:	8
Top Depth:	0	Bottom Depth:	16

Details Reports For:	Well Drilling Method	Drill Method:	Hollow Stem Auger

Details Reports For:	Well Completion	Borehole Completion:	Other - 20/40 sand

Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	1	Annular Seal:	1,concrete
Amount:	Not Reported	Unit:	Not Reported

Details Reports For:	Well Seal Range	Top Depth:	1
Bottom Depth:	3	Annular Seal:	1,bent. chips
Amount:	Not Reported	Unit:	Not Reported

Details Reports For:	Well Seal Range	Top Depth:	3

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Bottom Depth:	15	Annular Seal:	7,sand
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	1
Lithology:	concrete		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	1	Bottom Depth:	4
Lithology:	silty clay, dark gray		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	4	Bottom Depth:	8
Lithology:	sandy clay, gray		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	8	Bottom Depth:	15
Lithology:	sand, brown, red		
Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 new sch. 40 pvc screen 15 - 5 0.0101 slot		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported
Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 new sch. 40 pvc riser 5 - 0		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

P128
NNW
1/2 - 1 Mile
Higher

TX WELLS TXMON5000390220

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	395931	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	16
Injurious Water Quality:	Not Reported	Plugging Rpt #:	103548
Submitted Date:	2015-05-27	Owner Name:	Flexco Asphalt
Well #:	MW-2	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2015-03-03	Drill End Date:	2015-03-03
Seal Method:	Other - hand mix	Seal Method Desc:	hand mix
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Approved by Variance:	Not Reported	Sealed by Driller:	No
Sealed by Name:	MEDI	Surface Completion:	Surface Slab Installed
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	Shawn Mathers
Driller Name:	Shawn Thomas Mathers	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	103548
Driller License #:	54308	Apprentice Reg #:	Not Reported
Details Reports For:	Well Bore Hole	Diameter:	8
Top Depth:	0	Bottom Depth:	16
Details Reports For:	Well Drilling Method	Drill Method:	Hollow Stem Auger
Details Reports For:	Well Completion	Borehole Completion:	Other - 20/40 sand
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	1	Annular Seal:	1,concrete
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	3
Bottom Depth:	15	Annular Seal:	7,sand
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	1
Bottom Depth:	3	Annular Seal:	1,bent. chips
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	1
Lithology:	concrete		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	1	Bottom Depth:	4
Lithology:	silty clay, dark gray		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	4	Bottom Depth:	8
Lithology:	sandy clay, gray		
Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	8	Bottom Depth:	15
Lithology:	sand gray		
Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 new sch. 40 pvc screen 15 - 5 0.0101 slot	Casing Status:	Not Reported
Diameter:	Not Reported	Casing Type:	Not Reported
Casing Material:	Not Reported	Gauge:	Not Reported
Schedule:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 new sch. 40 pvc riser 5 - 0		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

P129
NNW
1/2 - 1 Mile
Higher

TX WELLS TXMON5000390219

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	395930	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	16
Injurious Water Quality:	Not Reported	Plugging Rpt #:	103547
Submitted Date:	2015-05-27	Owner Name:	Flexco Asphalt
Well #:	MW-1	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2015-03-03	Drill End Date:	2015-03-03
Seal Method:	Other - hand mix	Seal Method Desc:	hand mix
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported
Approved by Variance:	Not Reported	Sealed by Driller:	No
Sealed by Name:	MEDI	Surface Completion:	Surface Slab Installed
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	Not Reported
Injurious Water:	Not Reported	Company Name:	Shawn Mathers
Driller Name:	Shawn Thomas Mathers	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	103547
Driller License #:	54308	Apprentice Reg #:	Not Reported

Details Reports For:	Well Bore Hole	Diameter:	8
Top Depth:	0	Bottom Depth:	16
Details Reports For:	Well Drilling Method	Drill Method:	Hollow Stem Auger
Details Reports For:	Well Completion	Borehole Completion:	Other - 20/40 sand
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	2	Annular Seal:	1,concrete
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	4
Bottom Depth:	16	Annular Seal:	7,sand
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	2

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Bottom Depth:	4	Annular Seal:	1,bent. chips
Amount:	Not Reported	Unit:	Not Reported

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	0	Bottom Depth:	4
Lithology:	fill, gravel and sand		

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	4	Bottom Depth:	10
Lithology:	sandy clay, gray med. stiff		

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	10	Bottom Depth:	15
Lithology:	sand, gray, saturated, fine		

Details Reports For:	Well Lithology	Migrated Sort #:	0
Top Depth:	15	Bottom Depth:	16
Lithology:	clayey sand, brown		

Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 new sch. 40 pvc screen 16 - 6 0.0101 slot		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 new sch. 40 pvc riser 6 - 0		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

**P130
NNW
1/2 - 1 Mile
Higher**

TX WELLS TXPLU5000048007

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	103549	Well Type:	Monitor
Borehole Depth (ft):	16	Well Report #:	395932

Details Reports For:	Plug Data	Submitted Date:	2015-07-31
Owner Name:	FLEXCO ASPHALT	Well #:	MW-3
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	SHAWN MATHERS
Original License #:	54308	Original Well Use:	Monitor
Original Drill Date:	2015-03-03		
Plug Method:	Pour in 3/8 bentonite chips when standing water in well is less than 100 feet depth, cement top 2 feet		

Plug Date:	2015-07-29	Variance #:	Not Reported
Company Name:	MATHERS ENVIRONMENTAL DRILLING, INC.		
Plugging Name:	THOMAS E MATHERS	Driller License:	3096

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Apprentice Reg #:	Not Reported	Comments:	No Data
Comments:	Not Reported		
Details Reports For:	Plug Bore Hole	Diameter:	8
Top Depth:	Not Reported	Bottom Depth:	16
Details Reports For:	Plug Casing	Top Depth:	3
Bottom Depth:	15	Diameter:	2
Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	15	Plug Seal:	3 BENT.CHIPS
Amount:	Not Reported	Unit:	Not Reported

P131
NNW
1/2 - 1 Mile
Higher

TX WELLS TXPLU5000048006

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	103547	Well Type:	Monitor
Borehole Depth (ft):	16	Well Report #:	395930
Details Reports For:	Plug Data	Submitted Date:	2015-07-31
Owner Name:	FLEXCO ASPHALT	Well #:	MW-1
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	SHAWN MATHERS
Original License #:	54308	Original Well Use:	Monitor
Original Drill Date:	2015-03-03		
Plug Method:	Pour in 3/8 bentonite chips when standing water in well is less than 100 feet depth, cement top 2 feet		
Plug Date:	2015-07-29	Variance #:	Not Reported
Company Name:	MATHERS ENVIRONMENTAL DRILLING, INC.		
Plugging Name:	THOMAS E MATHERS	Driller License:	3096
Apprentice Reg #:	Not Reported	Comments:	No Data
Comments:	Not Reported		
Details Reports For:	Plug Bore Hole	Diameter:	8
Top Depth:	Not Reported	Bottom Depth:	16
Details Reports For:	Plug Casing	Top Depth:	0
Bottom Depth:	0	Diameter:	0
Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	16	Plug Seal:	3 BENT.CHIPS
Amount:	Not Reported	Unit:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

P132
NNW
1/2 - 1 Mile
Higher

TX WELLS TXPLU5000048005

Database:	Submitted Drillers Reports Database (Plugged)		
Plugging Rpt #:	103548	Well Type:	Monitor
Borehole Depth (ft):	16	Well Report #:	395931
Details Reports For:	Plug Data	Submitted Date:	2015-07-31
Owner Name:	FLEXCO ASPHALT	Well #:	MW-2
# Wells Plugged:	Not Reported	Elevation:	Not Reported
Original Company Name:	Not Reported	Original Driller:	SHAWN MATHERS
Original License #:	54308	Original Well Use:	Monitor
Original Drill Date:	2015-03-03		
Plug Method:	Pour in 3/8 bentonite chips when standing water in well is less than 100 feet depth, cement top 2 feet		
Plug Date:	2015-07-29	Variance #:	Not Reported
Company Name:	MATHERS ENVIRONMENTAL DRILLING, INC.		
Plugging Name:	THOMAS E MATHERS	Driller License:	3096
Apprentice Reg #:	Not Reported	Comments:	No Data
Comments:	Not Reported		
Details Reports For:	Plug Bore Hole	Diameter:	8
Top Depth:	Not Reported	Bottom Depth:	16
Details Reports For:	Plug Casing	Top Depth:	3
Bottom Depth:	15	Diameter:	2
Details Reports For:	Plug Range	Top Depth:	0
Bottom Depth:	15	Plug Seal:	3 BENT.CHIPS
Amount:	Not Reported	Unit:	Not Reported

O133
North
1/2 - 1 Mile
Higher

TX WELLS TXMON5000120004

Database:	Submitted Drillers Reports Database (Monitoring)		
Well Rpt #:	121898	Well Type:	New Well
Proposed Use:	Monitor	Borehole Depth (ft):	20
Injurious Water Quality:	no	Plugging Rpt #:	Not Reported
Submitted Date:	2007-09-11	Owner Name:	Robert B. Stewart
Well #:	MW-13	# Wells Drilled:	Not Reported
Elevation:	Not Reported	Type of Work:	New Well
Work Type Desc:	Not Reported	Original Well Rpt Track #:	Not Reported
Proposed Use:	Monitor	Proposed Use Desc:	Not Reported
TCEQ Approved Plans:	Not Reported	PWS #:	Not Reported
Drill Start Date:	2007-08-28	Drill End Date:	2007-08-28
Seal Method:	Other - Grout	Seal Method Desc:	Grout
Dist to Septic/Other Contam:	Not Reported	Distance to Septic Tank:	Not Reported
Dist to Property Line:	Not Reported	Distance Verify Meth:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Approved by Variance:	Not Reported	Sealed by Driller:	Yes
Sealed by Name:	Not Reported	Surface Completion:	Alternative Procedure Used
Surf Complete Desc:	Not Reported	Completed by Driller:	Not Reported
Pump Type:	Not Reported	Pump Type Desc:	Not Reported
Pump Depth:	Not Reported	Chemical Analysis:	No
Injurious Water:	No	Company Name:	Advanced Drilling Systems, Inc.
Driller Name:	Mario Palacios Moya	Comments:	Not Reported
Plugged within 48 hrs:	No	Plugging Rpt Tracking #:	Not Reported
Driller License #:	4990	Apprentice Reg #:	Not Reported
Details Reports For:	Well Bore Hole	Diameter:	8
Top Depth:	0	Bottom Depth:	20
Details Reports For:	Well Drilling Method	Drill Method:	Hollow Stem Auger
Details Reports For:	Well Completion	Borehole Completion:	Filter Packed
Details Reports For:	Well Filter	Filter Material:	Gravel
Top Depth:	2	Bottom Depth:	20
Size:	20/40		
Details Reports For:	Well Seal Range	Top Depth:	0
Bottom Depth:	1	Annular Seal:	2, Concrete
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	1
Bottom Depth:	2	Annular Seal:	1, Bentonite
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Seal Range	Top Depth:	2
Bottom Depth:	20	Annular Seal:	11, Sand
Amount:	Not Reported	Unit:	Not Reported
Details Reports For:	Well Levels	Measurement:	11
Measurement Date:	2007-08-28	Artesian Flow:	Not Reported
Measurement Method:	Unknown		
Details Reports For:	Well Lithology	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	0-1: Asphalt/Concrete		
Details Reports For:	Well Lithology	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	1-6: Sand, clayey, Brown, dry, loose		
Details Reports For:	Well Lithology	Migrated Sort #:	3
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	- inc. in fines, minor orange mottles		
Details Reports For:	Well Lithology	Migrated Sort #:	4

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	6-11: Clay, sandy/silty, gray, moist, low plasticity, minor orange mottles.		

Details Reports For:	Well Lithology	Migrated Sort #:	5
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	- inc. in sand content, inc. in moisture		

Details Reports For:	Well Lithology	Migrated Sort #:	6
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	11-20: Sand, silty, brown, wet, loose		

Details Reports For:	Well Lithology	Migrated Sort #:	7
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Lithology:	- inc. clay content, decr. moisture to TD		

Details Reports For:	Well Casing	Migrated Sort #:	1
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 New PVC Casing 0-2.5 sch-40		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

Details Reports For:	Well Casing	Migrated Sort #:	2
Top Depth:	Not Reported	Bottom Depth:	Not Reported
Migrated Casing Info:	2 New PVC Slotted 2.5-20 0.01		
Diameter:	Not Reported	Casing Status:	Not Reported
Casing Material:	Not Reported	Casing Type:	Not Reported
Schedule:	Not Reported	Gauge:	Not Reported

O134 North 1/2 - 1 Mile Higher

TX WELLS TXDOL2000015820

Database:	Well Report Database	Fid:	15819
Rec id:	15817	Edr site i:	121898
Owner:	Robert B. Stewart	Ownerwell:	MW-13
Address:	104 East Bronco Bend Dr., Angleton , TX 77515		
Grid:	65-53-8	Waddress:	101 S. Velasco St., Angleton , TX 77515
Lat:	29 09 53 N	County:	Brazoria
Long:	095 25 54 W	Elevation:	No Data
Gpsused:	Magellan-315	Typeofwork:	New Well
Propuse:	Monitor	Sdate:	Not Reported
Completedd:	Not Reported	Diameter:	8 in From Surface To 20 ft
Dmethod:	Hollow Stem Auger	Bcompleto:	Not Reported
Packedfrom:	2 ft to 20 ft	Packsizes:	20/40
Finterval:	From 2 ft to 20 ft with 11, Sand (#sacks and material)		
Sinterval:	From 1 ft to 2 ft with 1, Bentonite (#sacks and material)		
Tinterval:	From 0 ft to 1 ft with 2, Concrete (#sacks and material)		
Usedmethod:	Grout	Cementedby:	Advanced Drilling Systems, Inc.
Contaminat:	No Data	Propertyli:	No Data
Verrimetho:	No Data	Varriance:	No Data
Surface:	Alternative Procedure Used	Staticleve:	11 ft. below land surface on 8/28/2007
Flow:	No Data	Packers:	No Data
Cementinwe:	No Data	Typepump:	No Data

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Pumpbowl:	Not Reported	Welltests:	No Data
Yield:	Not Reported	Watertype:	No Data
Stratadept:	No Data	Chemicalma:	No
Undesirabl:	No	Companynam:	Advanced Drilling Systems, Inc.
Companyadd:	904 W. Tidwell	Ccitystate:	Houston , TX 77091
Licensenum:	4990	Wsignature:	Mario Moya
Dsignature:	No Data	Regnum:	No Data
Comments:	no data	Site id:	TXDOL2000015820

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

1
South
1/2 - 1 Mile

OIL_GAS TXOG70001167911

Surface ID: 165198
Current Well #: Not Reported
Radioactive: Not Reported
Well Type: Dry Hole

Well ID: Not Reported
API #: 42039
Side Track: Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS RADON

AREA RADON INFORMATION

State Database: TX Radon

Radon Test Results

County	Mean	Total Sites	%>4 pCi/L	%>20 pCi/L	Min pCi/L	Max pCi/L
BRAZORIA	<.5	29	.0	.0	<.5	3.3

Federal EPA Radon Zone for BRAZORIA County: 3

Note: Zone 1 indoor average level > 4 pCi/L.
: Zone 2 indoor average level >= 2 pCi/L and <= 4 pCi/L.
: Zone 3 indoor average level < 2 pCi/L.

Federal Area Radon Information for Zip Code: 77515

Number of sites tested: 3

Area	Average Activity	% <4 pCi/L	% 4-20 pCi/L	% >20 pCi/L
Living Area - 1st Floor	0.200 pCi/L	100%	0%	0%
Living Area - 2nd Floor	Not Reported	Not Reported	Not Reported	Not Reported
Basement	Not Reported	Not Reported	Not Reported	Not Reported

PHYSICAL SETTING SOURCE RECORDS SEARCHED

TOPOGRAPHIC INFORMATION

USGS 7.5' Digital Elevation Model (DEM)

Source: United States Geologic Survey

EDR acquired the USGS 7.5' Digital Elevation Model in 2002 and updated it in 2006. The 7.5 minute DEM corresponds to the USGS 1:24,000- and 1:25,000-scale topographic quadrangle maps. The DEM provides elevation data with consistent elevation units and projection.

Current USGS 7.5 Minute Topographic Map

Source: U.S. Geological Survey

HYDROLOGIC INFORMATION

Flood Zone Data: This data was obtained from the Federal Emergency Management Agency (FEMA). It depicts 100-year and 500-year flood zones as defined by FEMA. It includes the National Flood Hazard Layer (NFHL) which incorporates Flood Insurance Rate Map (FIRM) data and Q3 data from FEMA in areas not covered by NFHL.

Source: FEMA

Telephone: 877-336-2627

Date of Government Version: 2003, 2015

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002, 2005 and 2010 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Wetland Inventory

Source: Texas General Land Office

Telephone: 512-463-0745

HYDROGEOLOGIC INFORMATION

AQUIFLOW^R Information System

Source: EDR proprietary database of groundwater flow information

EDR has developed the AQUIFLOW Information System (AIS) to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted to regulatory authorities at select sites and has extracted the date of the report, hydrogeologically determined groundwater flow direction and depth to water table information.

GEOLOGIC INFORMATION

Geologic Age and Rock Stratigraphic Unit

Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - A digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

STATSGO: State Soil Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Service (NRCS)

The U.S. Department of Agriculture's (USDA) Natural Resources Conservation Service (NRCS) leads the national Conservation Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps.

SSURGO: Soil Survey Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Service (NRCS)

Telephone: 800-672-5559

SSURGO is the most detailed level of mapping done by the Natural Resources Conservation Service, mapping scales generally range from 1:12,000 to 1:63,360. Field mapping methods using national standards are used to construct the soil maps in the Soil Survey Geographic (SSURGO) database. SSURGO digitizing duplicates the original soil survey maps. This level of mapping is designed for use by landowners, townships and county natural resource planning and management.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

LOCAL / REGIONAL WATER AGENCY RECORDS

FEDERAL WATER WELLS

PWS: Public Water Systems

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Public Water System data from the Federal Reporting Data System. A PWS is any water system which provides water to at least 25 people for at least 60 days annually. PWSs provide water from wells, rivers and other sources.

PWS ENF: Public Water Systems Violation and Enforcement Data

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Violation and Enforcement data for Public Water Systems from the Safe Drinking Water Information System (SDWIS) after August 1995. Prior to August 1995, the data came from the Federal Reporting Data System (FRDS).

USGS Water Wells: USGS National Water Inventory System (NWIS)

This database contains descriptive information on sites where the USGS collects or has collected data on surface water and/or groundwater. The groundwater data includes information on wells, springs, and other sources of groundwater.

STATE RECORDS

Public Water Supply Sources Databases

Source: Texas Commission on Environmental Quality

Telephone: 512-239-6199

Locations of public drinking water sources maintained by the TCEQ.

Groundwater Database

Source: Texas Water Development Board

Telephone: 512-936-0837

Well Report Database

Source: Department of Licensing and Regulation

Telephone: 512-936-0833

Water Well Database

Source: Harris-Galveston Coastal Subsidence District

Telephone: 281-486-1105

Brackish Resources Aquifer Characterization System Database

Source: Texas Water Development Board

WDB's Brackish Resources Aquifer Characterization System (BRACS) was designed to map and characterize the brackish aquifers of Texas in greater detail than previous studies. The information is contained in the BRACS Database and project data are summarized in a project report with companion geographic information system data files.

Submitted Driller's Reports Database

Source: Texas Water Development Board

Telephone: 512-936-0833

The Submitted Driller's Report Database is populated from the online Texas Well Report Submission and Retrieval System which is a cooperative Texas Department of Licensing and Regulation (TDLR) and Texas Water Development Board (TWDB) application that registered water-well drillers use to submit their required reports.

OTHER STATE DATABASE INFORMATION

Texas Oil and Gas Wells

Source: Texas Railroad Commission

Telephone: 512-463-6882

Oil and gas well locations.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

RADON

State Database: TX Radon

Source: Department of Health

Telephone: 512-834-6688

Rinal Report of the Texas Indoor Radon Survey

Area Radon Information

Source: USGS

Telephone: 703-356-4020

The National Radon Database has been developed by the U.S. Environmental Protection Agency

(USEPA) and is a compilation of the EPA/State Residential Radon Survey and the National Residential Radon Survey.

The study covers the years 1986 - 1992. Where necessary data has been supplemented by information collected at private sources such as universities and research institutions.

EPA Radon Zones

Source: EPA

Telephone: 703-356-4020

Sections 307 & 309 of IRAA directed EPA to list and identify areas of U.S. with the potential for elevated indoor radon levels.

OTHER

Airport Landing Facilities: Private and public use landing facilities

Source: Federal Aviation Administration, 800-457-6656

Epicenters: World earthquake epicenters, Richter 5 or greater

Source: Department of Commerce, National Oceanic and Atmospheric Administration

Earthquake Fault Lines: The fault lines displayed on EDR's Topographic map are digitized quaternary faultlines, prepared in 1975 by the United State Geological Survey

STREET AND ADDRESS INFORMATION

© 2015 TomTom North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

APPENDIX D: QUALIFICATIONS

Education

B.S. Geology, Texas A&M University

Highlights

3.5 year internship in the environmental consulting industry
Phase I Environmental Site Assessments

Experience Summary

Ms. Kelley currently holds the role of a Staff Assessor and her responsibilities include thorough site assessment and technical report writing in line with the American Society of Testing and Materials (ASTM) standard and US Environmental Protection Agency's All Appropriate Inquiry (AAI) as well as customized client formats. In addition, Ms. Kelley performs limited visual asbestos surveys, lead-based paint surveys and radon testing as required per scope of work.

Ms. Kelley will be performing Phase I Environmental Site Assessments, Phase II Environmental Site Assessments, and other related environmental assessments for multi-family residential, commercial office buildings, shopping centers, multi-tenant commercial complexes, industrial warehouses, gas stations, dry cleaners, and manufacturing facilities.

Contact

hkelley@partneresi.com

Education

B.S. Civil Engineering, University of North Carolina at Charlotte

Training

40-Hour HAZWOPER

8-Hour HAZWOPER Supervisor

Highlights

Over 20 years performing Phase I Environmental Site Assessments, Transaction Screen Assessments and Environmental Desktop Reports on residential, commercial and industrial properties

Over 20 years performing Phase II soil and groundwater assessments

Design and installation of numerous soil/groundwater remediation systems including pump and treat/air stripping, bioremediation, vapor extraction and carbon absorption

5 years conducting asbestos inspections and abatement on residential, commercial and industrial facilities

Experience Summary

Mr. Little has significant experience in due diligence assessments for numerous commercial, industrial and residential properties and satisfying the ASTM and EPA's All Appropriate Inquiry (AAI) standards. He has managed multiple projects from the Phase I environmental site assessment process through Phase II, abatement and remediation.

During the past 20 years, Mr. Little has managed and removed hundreds of USTs at locations throughout the southeast United States. Mr. Little has extensive experience managing and performing Phase II soil and groundwater subsurface investigations and has significant experience with various types of soil/groundwater remediation design and installation. Mr. Little has also conducted numerous asbestos inspections on commercial, industrial and residential properties.

Project Experience

Client Manager, Nationwide Telecommunications Company, Charlotte, North Carolina. Mr. Little was the UST Program Manager in North Carolina for a large telecommunications company. He managed all aspects with regards to regulatory closure of USTs and managed the assessment, remediation and permitting of up to 30 UST sites. In addition, Mr. Little completed Phase I ESAs and transaction screens for various communications properties including commercial and cell tower sites.

Program Manager, Southeast US Convenience Store/Gas Station Portfolio, Charlotte, North Carolina. Mr. Little was the UST Program Manager in North and South Carolina for a large Midwest petroleum company. He managed the UST program for up to 65 sites that had been dormant and was able to enlist most sites in state trust fund programs. Mr. Little managed the UST removals, assessment, remediation and permitting of dissolved and free product plumes.

Project Manager, Chlorinated Solvent and Heavy Metal Groundwater Plume, Active Saw Blade Manufacturing Facility, Boone, North Carolina. Results of a Phase I that Mr. Little did indicated the potential for hazardous waste in the soil and groundwater at this facility. Following a lengthy and difficult soil and groundwater investigation in the southern Appalachian Mountains, a chlorinated solvent and heavy metal groundwater

plume was delineated at this saw blade manufacturing facility. Mr. Little managed all phases of this project from the Phase I, Phase II, regulatory permitting, remediation system pilot testing, design and installation. The pump and treat technology included air stripping for the VOCs coupled with carbon absorption for the heavy metals.

Project Manager, Free Product Plume Removal, Orangeburg, South Carolina. Mr. Little was the Project Manager for a gas station in Orangeburg with a significant free product plume. Following the installation of a couple of monitor wells containing free product, a total of approximately 12 recovery/monitor wells were installed to delineate a free product plume. Free product thicknesses ranged from a few inches to up to over 11-feet thick and the total free product volume was estimated at 400,000-gallons. Mr. Little managed all phases of the extremely difficult free product recovery process and permitting.

Project Manager/Air Monitor, WR Grace Asbestos Superfund Site, Libby, Montana. Mr. Little spent over six months over a three-year time period supporting cleanup activities at this Superfund site. Activities included managing site perimeter and personnel air sampling at sites being abated.

Contact

glittle@partneresi.com

Education

A.S., Science and Math, San Jacinto College, Pasadena, TX
B.S., Zoology, The University of Texas, Austin, TX
M.S., Environmental Science, Texas A&M University, College Station, TX

Registrations

Texas-Licensed Asbestos Inspector (No. 601805)
Texas-Licensed Lead-Based Paint Inspector (No. 2060633)
EPA Accredited Asbestos Inspector

Training

OSHA 40-Hour HAZWOPER
OSHA 8-Hour Annual Refresher

Highlights

23 years of experience in the real estate due diligence industry
Environmental due diligence for debt and equity transactions and foreclosures
Extensive portfolio management experience throughout the United States
Phase I Environmental Site Assessments
Phase II subsurface investigations
Soil and groundwater remediation

Experience Summary

Mr. Polasek currently serves as a National Client Manager and the Houston Regional Manager for Partner Engineering and Science, Inc. (Partner) providing solutions to clients' due diligence needs. He is responsible for ensuring consistency, quality, and on-time delivery of due diligence and engineering services provided by Partner. Current day-to-day responsibilities include project oversight, staff supervision, report review, and client marketing and management.

Mr. Polasek has been personally involved in the details of thousands of real estate transactions for various client types and therefore understands the specific needs and scopes of work required for the different parties involved in the transaction. Mr. Polasek has served as an environmental scientist, project manager, or senior author for projects associated with over 5,000 real estate transactions. Mr. Polasek is familiar with the due diligence requirements of a varied number of reporting standards, including ASTM, EPA's All Appropriate Inquiry (AAI), and U.S. Small Business Administration's (SBA) SOP 50 10. He also has experience with fulfilling numerous customized client scopes of work. Additionally, Mr. Polasek has working experience in the environmental permitting process, which has included the completion and implementation of Storm Water Pollution Prevention Plans (SWPPP); Spill Prevention, Control, and Countermeasure Plans (SPCC); and landfarm permits for various clients.

Previously, Mr. Polasek was a Senior Project Manager for an environmental consulting company and was responsible for due diligence business development, accounting, and technical leadership of staff scientists; for coordination with federal, state, and local regulatory agencies to complete due diligence, subsurface investigations, and remediation at petroleum- and chlorinated solvent-impacted facilities; for supervision

of long term remedial action fieldwork and roadway construction of County Road 126 at the Turtle Bayou Superfund Site (a project supervised by Region 6 Environmental Protection Agency, and the Tulsa District Corps of Engineers); and for negotiation of contractor and consultant contracts.

Project Experience

Seven gas stations and three future gas stations in Houston, Texas. Independently marketed and provided project management and technical oversight of Environmental Site Assessments (ESAs) and Limited Subsurface Investigations (LSIs).

Three oilfield chemical blending plants in Midland, Odessa, and Snyder, Texas. Independently marketed and provided project management and technical oversight of ESAs and LSIs.

Eight water well drilling companies in Texas, Colorado, Nevada, and Kansas. Independently marketed and provided project management and technical oversight of ESAs and LSIs.

Five marine terminal facilities in Texas and Louisiana. Managed and completed ESAs.

Microchip manufacturing plant in Austin, Texas. Managed and completed an ESA.

County Road 126 at the Turtle Bayou Superfund Site. Supervised long term remedial action fieldwork and roadway construction. Remedial action included both chemical injections and landfarming of contaminated soils. Roadway construction activities included the removal of the existing County Road 126 and its replacement with a wider asphalt-paved roadway.

Terminal in Beaumont, Texas. Provided on-site supervision of a subsurface jet fuel release at a leaking pipeline valve. Actions included impacted soil removal and landfarming of contaminated soils.

Terminal in Merkle, Texas. Provided on-site supervision of a subsurface crude fuel release at a leaking pipeline. Actions included impacted soil removal, landfarming and treatment of contaminated soils, and landfarm deconstruction and soil replacement back into the excavation.

West Texas and Southern New Mexico. Conducted 50+ SPCC Plans. Tasks included collecting site specific information, mapping, and compiling reports for review by the staff engineer.

Many Diversified Interests (MDI) Superfund Site in Houston, Texas. Conducted asbestos sampling and radioactive material testing. The MDI Site was formerly a foundry in a residential neighborhood. Responsibilities included sampling and providing results/reports to the EPA lead consulting company for the MDI Site.

Affiliations

Member of the Environmental Bankers Association, Risk Managers Association, the Commercial Real Estate Network Gulf Coast, and Houston Association of Government Guaranteed Lenders.

Speaking

Panelist on Development in Houston 2014, RealShare, Houston, TX. Discussed state of development in Houston.

Moderator on Impact of Oil and Gas Prices on Commercial Real Estate 2015, Bisnow, Houston, TX. Discussed with the panel how the drop in oil prices have affected the different commercial real estate markets.

Guest Speaker on Due Diligence 101 to two Real Estate Brokerage Firms in Houston, TX 2015 and Fort Worth, TX 2016, and to an Appraisal and Title Company Luncheon in Fort Worth, TX 2016. Discussed what a Phase I ESA is, why ESAs are important, and typical environmental concerns and issues uncovered during the ESA process.

Panelist on Environmental Due Diligence 2017 and 2018, Mid America Lenders Association, Austin, TX. Discussed Phase I ESA issues.

Presentation on Environmental Due Diligence at Chief Appraisal's Conference in Houston 2017 and 2018, Houston, TX. Discussed due diligence issues in Houston.

Contact

jpolasek@partneresi.com